

(08/11/13) Wef

ASS. REC. BY:

REF: CS/CT12440557/Rnh3

2004

ASSIGNMENT

From:

Date:

Estimated Cost:

OD ☒ TP ☒ WS ☒ TP RES ☒ OD RES ☒ EVA ☒ INV ☒ MV

To Inspect Vehicle No: SLQ 1172Z

at Workshop m/s BORNH

of PANDAN CRESCENT

Insured:

CTI

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

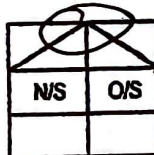

Bal. or Market Value:

41K

IDAC Accident Report:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SLQ 1172Z

Yr Regn: 2017 JUN

Type: ☒ M.Car / ☒ M.Cycle / ☒ Bus / ☒ Van / ☒ Lorry / ☒ Taxi / ☒ Prime Mover /

Truck / Trailer or

Make:

TOYOTA PRIUS HYBRID 1.8 c.c 1798

Colour:

GR6Y

A/C: Insured / Std / NI / NA

Sp. Reading:

571029

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB3FU103561319

Gen. Cond: Good ☒ Fair ☒ Poor ☒ BurntSteering: Inorder ☒ Jammed ☒ Leaked ☒ Burnt orBrake: Inorder ☒ Jammed ☒ Leaked ☒ Burnt orModi: ☒ Nil / ☒ S/Rim / ☒ STD A/Rim or

Tyre Size:

F:

195/65R15

R:

BS ☒ DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal.

6 mm

R/Bal.

6 mm

L/Bal.

6 mm

L/Bal.

6 mm

D.O.A.

D.O.I.

26/11/24

Survey held at

PANDAN C

Des. of Damages: ☒ Frt / ☒ Rear / ☒ O/S / ☒ N/S / ☒ UIC / ☒ Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

REPAIR LIMA 24K

Date/Time, File Pass to?



Preli. Report



Final Report

1)

Date/Time, File Return to?

2)

Days of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:



Site Insp (\$

S+RS \$



Interview (\$

Photos



Tech. Invs (\$

Others



Weekend (\$

TOTAL

Report Format:

Lump Sum / I.B.I: (\$



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details	Account No.	Customer Details
China Taiping Insurance (S) Pte Ltd 3 Anson Road #16-00 Springleaf Tower Singapore 079909 Attn: Motor Claims Dept	S1000003 / ICC11	M/S Grab Rentals Pte. Ltd 3 Media Close #01-03/06 Singapore 138498 Work: 65703925
	Document No. 0	
	Document Date 25/11/2024	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2017	ZVW50R	AHXEBW Q3	28/06/2017	SLQ1172Z	0	34952	67/DS/SLQ1172Z
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDKB3FU103561319	2ZRS056117	60	Sam San Joi	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
1	Z	BP-GRAB-DS SUNDRIES - FLASH ARRIVE: DD/MM/YY 0000HR TP-XE9029Z ACC DATE:24/11/2024 TOW IN:24/11/2024 DATE-IN: DATE SURVEY: NO OF REPAIR DAYS: BY: AUTHORISED ON:				50 100.00
2	B	BP-LAB2 CHECK LIGHTING & WIRING SYSTEM				? 198.00
3	B	BP-MECH2 REMOVE & INSTALL AIRCON CONDENSER ASSY A ND CHARGE UP GAS				? 198.00
4	Z	BP-SLANT SUPPLY SEALANT (NETT)				? 200.00
5	B	BP-ECU2 TO RESET ECU AND REPROGRAMME				? 198.00
6	B	BP-LAB2 REPLACE FRT ACCIDENT DAMAGED PARTS STRAIGHTEN & ALIGN FRT ACCIDENT AFFECTED AREAS				1584 3960.00
7	B	BP-RES2 RESPRAY JOB ON FRT ACCIDENT AFFECTED ARE AS				1312 3280.00
8	1	U52119-47962 COVER, FR BUMPER	1.00	799.30		799.30
9	2	U53395-47040 SEAL, HOOD TO FR END	1.00	71.50		71.50
10	3	U52116-47050 SUPPORT, FR BUMPER	1.00	121.30		121.30
11	4	U52115-47050 SUPPORT, FR BUMPER	1.00	121.30		121.30
12	5	K52161-0K040 PIECE, RR BUMPER	10.00	5.80		58.00

For & on behalf of	Customer's Signature	Charge Summary	Total
Borneo Motors (Singapore) Pte Ltd			
	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	Less Amount Due



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details		Account No. S1000003 / ICCI1		Customer Details				
China Taiping Insurance (S) Pte Ltd 3 Anson Road #16-00 Springleaf Tower Singapore 079909 Attn: Motor Claims Dept		Document No. 0		M/S Grab Rentals Pte. Ltd 3 Media Close #01-03/06 Singapore 138498 Work: 65703925				
		Document Date 25/11/2024						
		Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.
2017	ZVW50R	AHXEBW Q3	28/06/2017	SLQ1172Z	0	34952	67/DS/SLQ1172Z	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
JTDKB3FU103561319		2ZRS056117	60	Sam San Joi	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
13	6	U52611-47140 ABSORBER, FR BUMPER ?			1.00	110.20		110.20
14	7	U52021-47110 REINFORCEMENT			1.00	1105.80		1105.80
15	8	U53101-47081 GRILLE SUB-ASSY			1.00	484.10		484.10
16	9	U53301-47110 HOOD SUB-ASSY			1.00	1380.00		1380.00
17	0	U53802-47100 FENDER SUB-ASSY, FR			1.00	1488.90		1488.90
18	1	U75310-47060 EMBLEM ASSY, X			1.00	126.10		126.10
19	2	U75374-47150 EMBLEM, SIDE PANEL			1.00	75.70		75.70
20	3	U53510-47140 LOCK ASSY, HOOD			1.00	187.20		187.20
21	4	U53217-47030 BRACE, HOOD LOCK			1.00	107.80		107.80
22	5	U53205-47900 SUPPORT S/A,			1.00	522.80		522.80
23	6	U53214-47050 SUPPORT, RADIATOR,			1.00	109.40		109.40
24	7	U53213-47050 SUPPORT, RADIATOR,			1.00	109.40		109.40
25	8	U81185-47691 UNIT, HEADLAMP			1.00	4063.00		4063.00
26	9	U81145-47691 UNIT, HEADLAMP			1.00	4063.00		4063.00
27	0	U88460-10320 CONDENSER ASSY			1.00	2462.90		2462.90
28	1	U16400-37311 RADIATOR ASSY			1.00	3067.40		3067.40
29	2	U16711-37160 SHROUD, FAN			1.00	366.90		366.90
30	3	S08889-80102 COOLANT, SLLC&&& ?			1.00	108.00		108.00

From
Hp 90010018
4 days
26/11/24
Res 68
paint

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer _____

Signature: _____

Date: _____

For & on behalf of the Repairer of the following: Borneo Motors (Singapore) Pte Ltd		Customer's Signature		Charge Summary		Total 29,244.00	
I hereby acknowledge receipt of vehicle				Parts	21,110.00	GST 9.00% 2,631.96	Less 0.00
				Labour	8,134.00		
				Sublet	0.00		
				Lubrication/Fluid	0.00		
				Others	0.00		
				Amount Due		31,875.96	

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	200G
Vehicle Details	
Vehicle No.:	SLQ1172Z
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Nov 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Silver
Manufacturing Year:	2017
Engine No.:	2ZRS056117
Chassis No.:	JTDKB3FU103561319
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	28 Jun 2017
First Registration Date:	28 Jun 2017
Transfer Count:	1
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jun 2027
PARF Rebate Amount:	\$3,000.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jun 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$53,106.00
COE Rebate Amount:	\$13,719.00
Total Rebate Amount:	\$16,719.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 27 Nov 2024

OK



Toyota Prius Hybrid 1.8A S

\$62,800 Instalment \$1,138/mth

PREMIUM AD

Shortlist

Get Warranty

Loan Calculator



Overview Financial Leasing Photo Research

Depreciation	\$16,420 / year
Reg. Date	29-Jun-2018 (3yrs 7mths 1day COE left)
Manufactured	2018
Mileage	93,000 km (14.5k / year)
Transmission	Auto
Engine Cap	1,797 cc
Road Tax	\$974 / year
Power	90.0 kW (120 bhp)
Curb Weight	1,360 kg
Fuel Type	Petrol-Electric
COE	\$37,605
OMV	\$25,590
ARF	\$7,826
Dereg Value	\$18,573 as of today
No. of Owners	3