

REF:

ASSIGNMENT

From: _____ Date: _____

Estn: _____

OD / TP / TP RES / CD RES / EVA / INV / MVTo in Vehicle NO: _____at W/O _____

of _____

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Vehicle: _____

(Policy Condition)

Remark: The vehicle had commenced its repair at the time of inspection.

N/S O/S

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLX6756UYr Regn: 2018 AprilType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai ElantraCD 1591Colour: Grey

A/C: Insured / Std / NI / NA

Sp. Reading: 151619

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KMH D841CM Ju660359Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 225/40R18R: 225/40R18BS / DUN / EXNOVA / GY / FS / LIZA / MIG / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal. 06 mmR/Bal. 06 mmL/Bal. 06 mmL/Bal. 06 mm

D.O.A. _____

D.O.A. 20/11/24Survey held at HD PerfectDes. of Damages: Fnt / Rear / O/S N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

TP ChurnCOE ExpiryEstimate given during : Yes (✓)
1st Survey : No ()MV : 47KPV : 20.4KNett: 26.6K372 D

Date/Time, File Pass to?



: Preli. Report

Days Of Repair: _____

1)



: Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee:



: Site Insp (\$ _____)



: Interview (\$ _____)



: Tech. Inve (\$ _____)

Survey Fee:

Transportation:

3 + RS. 81

Photos

Others

Report Format:

Report 24 HRS / 48 HRS / 72 HRS


HD Perfect Autowork Pte Ltd

Company Reg No: 202136904Z

8 Kaki Bukit Ave 4, #08-09 Premier@Kaki Bukit
Singapore 415875

Tel : 6341 6789 Fax: 6341 6778

E-mail: hdperfectautowork@gmail.com

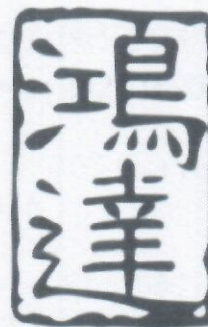

HD PERFECT
AUTOWORK PTE LTD

DATE 20.11.2024

TO
VEHICLE NO
MODEL
DATE OF ACCIDENT
TIME OF ACCIDENT

CHINA TAIPING MOTOR CLAIMS DEPTS
SLX6756U
HYUNDAI ELANTRA
07.11.2024
06:47 HOURS

WE APPEND HEREUNDER THE ESTIMATED COST OF REPAIRS TO BE CARRIED OUT TO THE ABOVE VEHICLE.

CLAIM DETAIL : PARTS

S/N	DESCRIPTION	QTY	UNIT LIST PRICE	TOTAL LIST PRICE
1	REAR BUMPER <i>torn</i>	1	\$ 670.40	\$ 670.40 <i>475</i>
2	REAR BUMPER REFLECTOR LH <i>cracked</i>	1	\$ 35.20	\$ 35.20
3	REAR BUMPER LOWER LIP <i>new</i>	1	\$ 250.10	\$ 250.10 <i>+</i>
4	REAR BUMPER RETAINER <i>cracked LH</i>	2	\$ 44.30	\$ 88.60 <i>44.30</i>
5	REAR BUMPER INNER GRANISH LH <i>new</i>	1	\$ 137.50	\$ 137.50 <i>+</i>
6	TAILLAMP LH <i>cracked</i>	1	\$ 876.80	\$ <u>876.80</u> <i>+</i>
7	REAR FENDER LH <i>Repair</i>	1	\$ 1,890.50	\$ 1,890.50 <i>+</i>
8	REAR FENDER AIR VENT LH <i>del</i>	1	\$ 107.40	\$ 107.40 <i>✓</i>
9	REAR FENDER COWLING LH <i>torn</i>	1	\$ 146.80	\$ 146.80 <i>✓</i>
10	REAR WINDSCREEN MOULDING <i>new</i>	1	\$ 186.30	\$ 186.30 <i>+</i>
11	REAR AXLE <i>2 set</i>	1	\$ 2,140.00	\$ 2,140.00 <i>+</i>
12	REAR SHOCK ABSORBER RH <i>new</i>	1	\$ 475.00	\$ 475.00 <i>+</i>
13	REAR WHEEL HUP WITH BEARING RH <i>new</i>	1	\$ 525.00	\$ 525.00 <i>+</i>

TOTAL PRICE \$ 7,529.60
LESS 20% \$ 1,505.92
SUB TOTAL PRICE \$ 6,023.68

SPECIAL NETT ITEMS

S/N	DESCRIPTION	QTY	UNIT S/NETT	TOTAL S/NETT
1	REAR BUMPER CLIP (SET) <i>new</i>	1	\$ 50.00	\$ 50.00 <i>30</i>

TO
VEHICLE NO
MODEL
DATE OF ACCIDENT
TIME OF ACCIDENT

CHINA TAIPING MOTOR CLAIMS DEPTS
SLX6756U
HYUNDAI ELANTRA
07.11.2024
06:47 HOURS

2	REAR BUMPER INNER GRANISH CLIP RH (SET) <i>new</i>	1	\$ 50.00	\$ 50.00	+
3	REAR BUMPER DIFFUSER (SPECAIL TYPE) <i>new</i>	1	\$ 1,200.00	\$ 1,200.00	700
4	TAIL LAMP CLIP (SET) <i>new</i>	1	\$ 30.00	\$ 30.00	+
5	REAR FENDER RH SEALANT <i>new</i>	1	\$ 80.00	\$ 80.00	+
6	REAR FENDER INNER COWLING RH CLIP (SET) <i>new</i>	1	\$ 50.00	\$ 50.00	30
7	REAR FENDER INNER TRIM RH CLIPS (SET) <i>new</i>	1	\$ 50.00	\$ 50.00	+
8	REAR WINDSCREEN SEALANT <i>new</i>	1	\$ 80.00	\$ 80.00	+
9	REAR WINDSCREEN INNER SEAL <i>new</i>	1	\$ 60.00	\$ 60.00	+
10	REAR SPORT RIM <i>new</i>	1	\$ 1,000.00	\$ 4,000.00	400
11	REAR TYRE <i>new</i>	1	\$ 480.00	\$ 480.00	+
12	BRAKE OIL <i>new</i>	1	\$ 80.00	\$ 80.00	+

TOTAL \$ 1,650.00

CLAIM DETAILS: LABOUR AND SPRAY PAINTING (FRONT)

S/N	JOB DESCRIPTION	PRICE	ADJUSTED COST
1	PANEL BEATING, REMOVING AND REPLACING PARTS	\$ 2,000.00	300
2	SPRAY PAINTING TO AFFECTED AREA	\$ 1,800.00	800
3	TUFF COAT	\$ 250.00	40
4	WIRING CHECK	\$ 250.00	30
5	REMOVE AND REFIX UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR	\$ 350.00	x
6	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING	\$ 80.00	50
7	CONDUCT WATER LEAKAGE TEST	\$ 80.00	+
8	REMOVE AND REFIX FUEL TANK TO FACILITATE FENDER REPLACEMENT	\$ 120.00	+
9	REMOVE AND REFIX REAR WINDSCREEN	\$ 120.00	+
10	REMOVE AND REFIX REAR UNDERCARRIAGE	\$ 650.00	+

TO
VEHICLE NO
MODEL
DATE OF ACCIDENT
TIME OF ACCIDENT

CHINA TAIPING MOTOR CLAIMS DEPTS
SLX6756U
HYUNDAI ELANTRA
07.11.2024
06:47 HOURS

11	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.	\$	350.00	x
----	---	----	--------	---

TOTAL \$ 6,050.00

ESTIMATE REPORT

TOTAL PARTS COST \$ 7,673.68
TOTAL LABOUR COST \$ 6,050.00
TOTAL REPAIR COST \$ 13,723.68

*Adrian King
h/s 20/11/24
04 Days*

NB: THIS IS ONLY AN ESTIMATE AND SHOULD ADDITIONAL WORK BE FOUND NECESSARY TO BE
CARRIED OUT IN THE COURSE OF REPAIRS, EXTRA MATERIALS AND LABOUR COST WILL BE CHARGED
ACCORDINGLY WHICH HOWEVER, YOU WILL BE INFORMED PRIOR TO ACTION TAKEN.

PARTS PRICES ARE SUBJECT TO CHANGES.

YOURS FAITHFULLY,

IRENE

SERVICE ADVISOR
IRENE
HP : 8297 9787

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: