

CS/MSG 24120095/DVH³


ASSIGNMENT

COB 17 Sept 2022
12 Sept 2024

From: _____ Date: _____
 Estimated Cost: _____
 OB / TP / NS / TP RES / OD RES / EVA / NV / MV
 To inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

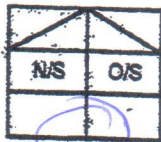

Est. or Market Value: _____
 DAC Accident Report: _____ Consistent?: Yes or No
 GSA / PR Spec: _____ Consistent?: Yes or No
 Est. Repair: 6 days Res: Yes or No
 Lump Sum: 912 % 3 Val: Yes or No

CA / REV / REP. / 24HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHD3050U
 Yr Regr: 12 Sept 2024
 Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Hyundai Kona CC 1580
 Colour: Blue A/C: Insured / Std / Nil / NA
 Sp. Reading: 36165 T/Radio: Insured / Std / Nil / NA
 Eng No: G4LLRU450026
 C/No: KMHHB811V SU086664
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/65 R16
 R: 11

BS / DUN / EXOVA / GY / FS / LZA / MIC / OHTSU / PR / SUMI /
 TOYO / YOKO or Kumho

Front Rear
 R/Bal: 5 mm R/Bal: 5 mm
 L/Bal: 5 mm L/Bal: 5 mm
 D.O.A: 06/12/2024 D.O.I: 09/12/2024

Survey held at Rightmost Logong

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooflap or
 Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MSG SHJ 4636X

Date / Time, File Name (P)

☐: Prel. Report
☐: Final Report

Date / Time, File Name (P)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transporter:

Photos

Other

TOTAL

Add Fee: ☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech. Invs (\$)
☐ Weekend (\$)

Report Format: _____

Lump Sum / L.B. (\$)

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	821R

Vehicle Details

Vehicle No.:	SHD3050U
Vehicle to be Exported:	No
Intended Deregistration Date:	31 Dec 2024
Vehicle Make:	HYUNDAI
Vehicle Model:	SX2 KONA 1.6 GDI HEV
Primary Colour:	Blue
Manufacturing Year:	2024
Engine No.:	G4LLRU450026
Chassis No.:	KMH8B811VSU086664
Maximum Power Output:	96.0 kW (128 bhp)
Open Market Value:	\$24,945.00
Original Registration Date:	12 Sep 2024
First Registration Date:	12 Sep 2024
Transfer Count:	0
Actual ARF Paid:	\$19,423.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	11 Sep 2032
PARF Rebate Amount:	\$14,567.00

Intended COE Rebate Details

COE Expiry Date:	11 Sep 2032
COE Category:	A - Car-Details at OneMotoring
COE Period(Years):	8
PQP Paid:	\$73,358.00
COE Rebate Amount:	\$70,581.00
Total Rebate Amount:	\$85,148.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 06 Dec 2024

OK

MSIG

VEHICLE NO.: SHD 3050 U

DESCRIPTION	QTY	LIST PRICE	AMOUNT
REAR BUMPER <i>Demol</i>	1	\$ 1,015.00	\$ 1,015.00
BEAM-REAR BUMPER <i>Demol</i>	1	\$ 582.00	\$ 582.00
STAY-RR BUMPER,(LH/RH) <i>one</i>	2	\$ 55.00	\$ 110.00
BRACKET ASSY-RR BUMPER LWR,(LH/RH) <i>one</i>	2	\$ 32.00	\$ 64.00
CAP-RR HOOK <i>one</i>	1	\$ 11.00	\$ 11.00
DIFFUSER ASSY-RR BUMPER <i>Demol</i>	1	\$ 856.70	\$ 856.70
PARKING SENSOR <i>one</i>	2	\$ 262.00	\$ 524.00
PARKING SENSOR WIRE <i>one</i>	1	585.35	\$ 585.35
REAR END PANEL <i>Demol</i>	1	\$ 729.00	\$ 729.00
REAR END PANEL GARNISH <i>broken</i>	1	\$ 190.00	\$ 190.00
PANEL ASSY-TAIL GATE <i>Demol</i>	1	\$ 2,164.00	\$ 2,164.00
HINGE ASSY-TAIL GATE (LH/RH) <i>one</i>	2	\$ 28.00	\$ 56.00
TRIM ASSY-TAIL GATE LWR <i>broken</i>	1	\$ 378.00	\$ 378.00
TRIM ASSY-TAIL GATE UPR <i>one</i>	1	\$ 63.00	\$ 63.00
TRIM ASSY-TAIL GATE FRAME SIDE (LH/RH) <i>one</i>	2	\$ 39.00	\$ 78.00
W/STRIP-TAIL GATE OPNG <i>broken</i>	1	\$ 137.00	\$ 137.00
LATCH ASSY-TAIL GATE <i>1st / Demol</i>	1	\$ 278.00	\$ 278.00
STRIKER ASSY-T/GATE <i>one</i>	1	\$ 25.00	\$ 25.00
HANDLE ASSY-TAIL GATE O/S <i>one</i>	1	\$ 125.00	\$ 125.00
LIFTER ASSY-TAIL GATE,(LH/RH) <i>one</i>	2	\$ 111.00	\$ 222.00
BOOT TOP COVER CTR <i>one</i>	1	\$ 455.00	\$ 455.00
BOOT EMBLEM-SYMBOL MARK <i>1st</i>	1	\$ 72.00	\$ 72.00
EMBLEM-KONA <i>1st</i>	1	\$ 97.00	\$ 97.00
EMBLEM-HYBRID <i>one</i>	1	\$ 47.00	\$ 47.00
SPOILER-RR <i>one</i>	1	\$ 1,347.00	\$ 1,347.00
GARNISH ASSY-TAIL GATE <i>one</i>	1	\$ 375.00	\$ 375.00
REAR NUMBER PLATE LAMP <i>broken</i>	2	\$ 231.00	\$ 462.00
3RD BRAKE LAMP ASSY-CENTER POSITION <i>broken</i>	1	\$ 6,604.00	\$ 6,604.00
LAMP ASSY-REAR COMB OUTSIDE,LH <i>one</i>	2	\$ 717.00	\$ 1,434.00
LAMP ASSY-REAR COMB LH,LWR <i>one</i>	2	\$ 953.00	\$ 1,906.00
LAMP ASSY-REAR FOG <i>one</i>	1	\$ 163.00	\$ 163.00
3RD BRAKE LAMP ASSY-HMS <i>one</i>	1	\$ 220.00	\$ 220.00
UNIT ASSY-REAR VIEW CAMERA <i>one</i>	1	\$ 1,088.00	\$ 1,088.00
REAR MUFFLER <i>one</i>	1	\$ 1,341.00	\$ 1,341.00
REAR MUFFLER HEAT SHIELD <i>one</i>	1	\$ 235.00	\$ 235.00
REAR MUFFLER MOUNTING <i>one</i>	2	\$ 22.00	\$ 44.00
SUB TOTAL			\$ 24,083.05

1306.00

$$\begin{array}{r} 8476.70 \\ 6.781.36 \\ \hline \end{array}$$

LESS 20%				\$ 4,816.61
DISCOUNTED TOTAL				\$ 19,266.44
REAR NUMNER PLATE <i>broken</i>	SN	1	\$ 45.00	\$ 45.00
COMFORT LOGO <i>hec</i>	SN	1	\$ 80.00	\$ 80.00
REAR WINDSCREEN SEALANT <i>hec</i>	SN	1	\$ 46.00	\$ 46.00
SUB TOTAL				\$ 171.00
Labour Charge				
Panel Beating	1	\$2,000.00	\$ 2,000.00	
Spray Painting Charge	1	\$1,600.00	\$ 1,600.00	
Wiring Charge	1	\$100.00	\$ 100.00	
Tuff Kote	1	\$100.00	\$ 100.00	
Towing Charge	1	\$80.00	\$ 80.00	
Remove/Refix Cushion & Upholstery Rear	1	\$150.00	\$ 150.00	
Remove/Refix Rear Windscreen Glass	1	\$120.00	\$ 120.00	
Diagnostic & Resetting To Erase Fault Code	1	\$550.00	\$ 550.00	
TOTAL LABOUR				\$ 4,700.00
ESTIMATE TOTAL				\$ 24,137.44
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.				

✓
✓
✓

171.00

600/-
400/-
30/-
20/-
4/-
80/-
80/-
4/-

1210.00

09/12/2024 @ 1300m

P/P 8,162-36

N/A Actual

Part by Part

5 days

[Signature]

Photo after

LKK Auto

sign

with damage

Part.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: