

ASS. REC. BY:

REF:

LIP / CS / 4p 24 120133 / knh3

Kenneth

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

05 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

11/25

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMH 1691C

Yr Regn:

01, 11

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Volkswagen Touran c.c.

1390

Colour

N. Brown

A/C: Insured / Std / NI / NA

Sp. Reading

292005

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WVG 7771 T ZBW 043224

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

225/45 R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or

Front

R/Bal.

7

mm

Rear

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

2/4/24

D.O.I.

16/12/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

17/12/24 Submit lump sum \$ 3500

(Red. \$ 2450, 41%)

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

5

Resurvey No. of Trlp:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

) S + RS. \$

☐

: Interview (\$

) F. \$

☐

: Tech Invs (\$

) Others

☐

: Weekend (\$

TOTAL

Report Format:

Lump Sum / I.B.I. (\$



# ABSOLUTE APPRAISAL SERVICES PTE LTD

## Loss Adjusters & Motor Appraisers

160 Sin Ming Drive, #05-11 Sin Ming AutoCity (S) 575 722

Email: absolute.app.svcs@gmail.com Mobile: 9688 0413

### Vehicle Inspection Report

To: Ang Nguang Seng  
C/o: 160 Sin Ming Drive, #02-09  
Sin Ming AutoCity (S) 575722

Date of report: 28.04.2024  
Date of request: 09.04.2024  
Date of inspection: 09.04.2024  
Date of accident: 02.04.2024  
Claim type: Third Party Claim

Report No: AAS/2024/079

### Particulars of affected vehicle:

Registration no: SMH1691C  
Make/Model: Volkswagen Touran 1.4 (A)  
Year of registration: 2010/11  
Colour: Metallic Brown

Odometer: 280154 km  
Engine Capacity: 1390 cc  
Engine no: CAV245542  
Chassis no: WVGZZZ1TZW043224

### Condition of tires:

Front Left: 5mm  
Make: Pirelli  
Rear Left: 5mm  
Make: Pirelli

Front Right: 5mm  
Make: Pirelli  
Rear Right: 5mm  
Make: Pirelli

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

### Pre-accident condition (Static tests only)

General Bodywork : Good  
Paintwork : Good  
Handbrake : In order  
Footbrake : In order  
Steering : In order  
Apparent engine modification : Nil

### The Assignment


The inspection was conducted at M/s. 833 Motorsports Pte Ltd  
160 Sin Ming Drive, #02-09  
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

### Assessment

Repairer's estimate: \$ 10,434.07  
Revised estimate: \$ 7,449.42  
Recommended reserve: \$ 5,950.00 (Lump sum)

Estimated normal duration of repairs : 5 Working days

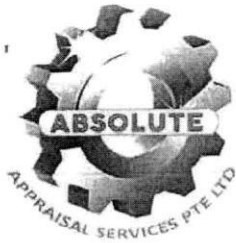

# ABSOLUTE APPRAISAL SERVICES PTE LTD

## Loss Adjusters & Motor Appraisers

160 Sin Ming Drive, #05-11 Sin Ming AutoCity (S) 575 722

Email: absolute.app.svcs@gmail.com Mobile: 9688 0413

Vehicle No: SMH1691C

Report No: AAS/2024/079

### W/O PREJUDICE

#### Point of impact

At the RHS rear portion.

#### General description of damages

The RHR door, RHR quarter panel, RHR road wheel, etc.

Other parts were also found damaged. (See schedule for details)

#### Recommendation

The estimate cost of repair submitted by M/s 833 Motorsports Pte Ltd as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$7,449.42

#### Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$5,950.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 6 working days.


We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 40 photographs.

Your Faithfully  
Absolute Appraisal Services Pte Ltd



Nicky Sean  
Automobile Appraiser  
MSAAA / MSMCTA

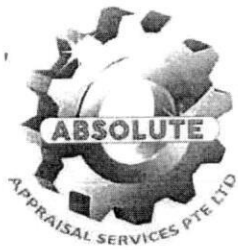

# ABSOLUTE APPRAISAL SERVICES PTE LTD

## Loss Adjusters & Motor Appraisers

160 Sin Ming Drive, #05-11 Sin Ming AutoCity (S) 575 722

Email: absolute.app.svcs@gmail.com Mobile: 9688 0413

Vehicle No: SMH1691C

Report No: AAS/2024/079

### Appraisal Schedule

S/N	Parts Description	Qty	Condition	Repairer's Est	Revised Est
1	RHR door	1	Dented <i>2061.87</i>	\$ 2,444.04	\$ 2,444.04
2	RHR door outer handle	1	Grazed	\$ 233.15	<i>Nil</i> \$ 233.15 <i>X</i>
3	RHR door protector	1	Grazed	\$ 140.71	\$ 140.71
4	RHR door weather seal	1	Necessary	\$ 280.12	\$ 280.12
5	RHR door sound absorber	1	Necessary	\$ 43.65	\$ 43.65
6	RHR door lock	1	Distorted	\$ 388.53	\$ 388.53
7	RHR door glass regulator	1	Serviceable	\$ 553.67	-
8	RHR door glass regulator motor	1	Serviceable	\$ 650.15	-
9	RHR quarter panel	1	Dented	<i>L.N</i> \$ 1,780.27	\$ 1,780.27 <i>400.00</i>
10	RHR quarter glass w moulding	1	Not Necessary	\$ 534.68	-
Total:				\$ 7,048.97	\$ 5,310.47
-10%				\$ 704.90	\$ 531.05
List total:				\$ 6,344.07	\$ 4,779.42
1	RHR quarter glass sealant	1	Not Necessary	\$ 60.00	-
2	RHR sport rim	1	Grazed/Chipped	<i>L.N</i> \$ 850.00	\$ 600.00 <i>400.00</i>
Special nett total:				\$ 910.00	\$ 600.00
Parts Total:				\$ 7,254.07	\$ 5,379.42



# ABSOLUTE APPRAISAL SERVICES PTE LTD

## Loss Adjusters & Motor Appraisers

160 Sin Ming Drive, #05-11 Sin Ming AutoCity (S) 575 722

Email: absolute.app.svcs@gmail.com Mobile: 9688 0413

Vehicle No: SMH1691C

Report No: AAS/2024/079

S/N Labour Description

Repairer's Est

Revised Est

1 Renew RHR sport rim.

\$ 50.00

\$ 20.00

2 Conduct wheel alignment.

\$ 100.00

\$ 60.00

3 Remove & transfer RHR door fittings.

\$ 150.00

\$ 100.00 *60%*

4 Renew RHR quarter glass.

\$ 180.00

-

5 Remove & refit fuel tank to make way for replacement.

\$ 150.00

-

6 Remove & refit rear luggage trim, rear seats, etc to make way for replacement/repairs.

\$ 200.00

\$ 100.00

7 Anti rust on affected panels.

\$ 100.00

\$ 40.00

8 To renew damaged parts, conduct straightening & panel beating on affected area. Re-align affected area.

\$ 1,250.00

\$ 750.00 *50%*

9 Spray painting on replaced & affected parts/areas.

\$ 1,000.00

\$ 1,000.00 *50%*

Labour Total:

\$ 3,180.00

\$ 2,070.00

Grand Total:

\$ 10,434.07

\$ 7,449.42

The final adjusted lump sum amount is \$5,950.00

Under normal circumstances, the repair should be completed within a reasonable period of ~~6~~ *5* working days.

40 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.