

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51 Ubi
Avenue 1
408933

Insurer Reference: DMHCSNA00003412400-SNR3320X
Repairer Reference: 74874
Date calculated: 06/01/2025 10:43 AM

Full Report
Registration: SNR3320X
Printed: 06/01/2025 10:43 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:	DMHCSNA00003412400-SNR3320X	Date of Incident:	05/12/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	HONDA		
Model:	FIT (GK)		
Sub Model:	BASE MODEL		
Model Sheet Number:	35 EF 01		
Registration:	SNR3320X		
VIN number:			
Odometer:	19641		
Model Specs			
AIR CONDITIONING	STARTER BUTTON	FOG LAMPS	REAR PARKING SYSTEM
1498CCM 86KW FLEX	CVT AUTOMATIC	TYRES 185/60 R15..H	GRILLE TRIM CHROMED
PREPARE OFF VEHICLE	THREE COAT PEARL		

Insurer Reference: DMHCSNA00003412400-SNR3320X
 Repairer Reference: 74874
 Date calculated: 06/01/2025 10:43 AM

Full Report
 Registration: SNR3320X
 Printed: 06/01/2025 10:43 AM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
 Date of Inspection:

Damage Areas

All ☐
 Underbody ☐

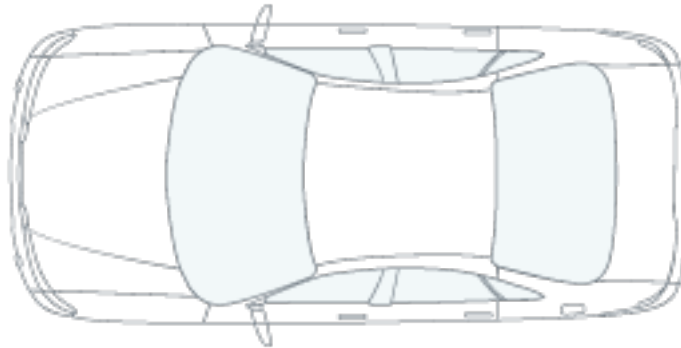

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	RUST PROOFING BODY SHELL PART	2.0	8.40	
NO NUMBER	FRONT BUMPER CARRIER RUST PROTECT PROOF	2.0	8.40	
8101A2 ZAX	RENEW FRONT BUMPER	10.0	42.00	
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS			
NO NUMBER	R + R FRONT BUMPER SUPPORT	3.0	12.60	
NO NUMBER	RENEW RADIATOR GRILLE	2.0	8.40	
NO NUMBER	R + R HEADLAMPS (BUMPER REMOVED)	4.0	16.80	
	INCLUDES: ADJUST HEADLAMPS			
812100 ZAX	RENEW BONNET	6.0	25.20	
	INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE			
7421B0 ZAX	R + R WASHER TANK	4.0	16.80	
NO NUMBER	R + R FILLER NECK	1.0	4.20	
NO NUMBER	R + R LEFT FRONT WING (BUMPER AND HEADLAMP REMOVED)	3.0	12.60	
	INCLUDES: R + R LF WHEELHOUSE SHELL			
NO NUMBER	R + R RIGHT FRONT WING (BUMPER AND HEADLAMP REMOVED)	3.0	12.60	
	INCLUDES: R + R R/F WHEELHOUSE SHELL			
NO NUMBER	R + R FRONT PANEL CPL	15.0	63.00	
812105 ZAX	R + R WINDOW FRAME GRILLE	3.0	12.60	
114100 ZAX	R + R RADIATOR CPL WITH ATTACHED PARTS	4.0	16.80	
NO NUMBER	R + R AIR FILTER HOUSING	4.0	16.80	
616100 ZAX	R + R AIR CONDITIONING CONDENSER	8.0	33.60	
NO NUMBER	REFILL + VENT AIR CONDITIONING	10.0	42.00	
0340	FRT BUMPER SUPPORT CAVITY PROTECTION			

Insurer Reference: DMHCSNA00003412400-SNR3320X
 Repairer Reference: 74874
 Date calculated: 06/01/2025 10:43 AM

Full Report
 Registration: SNR3320X
 Printed: 06/01/2025 10:43 AM

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	8.00	80.0	336.00
Total of Labour			336.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - THREE COAT PEARL	WU Price SGD
	BONNET NEW PART PAINTING	19.7
	L/F WING NEW PART PAINTING	12.6
	R/F WING NEW PART PAINTING	12.6
	FRONT PANEL CPL SURFACE PAINT	6.0
	FRONT BUMPER NEW PART PAINT K1R	16.2
	FRT TOWING EYE COVER NEW PART PAINT K1R	4.5
	LEFT FRONT DOOR REPAIR PAINTING <50%	20.7
	RIGHT FRONT DOOR REPAIR PAINTING <50%	20.7
	L/WINDSCREEN SIDE MOULDING	10.0*
	R/WINDSCREEN SIDE MOULDING	10.0*

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	54.96
0741	L/F WING NEW PART PAINTING	22.35
0742	R/F WING NEW PART PAINTING	22.35
1009	FRONT PANEL CPL SURFACE PAINT	12.70
0283	FRONT BUMPER NEW PART PAINT K1R	70.97
0293	FRT TOWING EYE COVER NEW PART PAINT K1R	0.62
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	36.17
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	36.17

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		133.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Preparation Multi-Coat	0.50	5.0	21.00
Total	10 WU/h	16.80	168.0

Material Cost - Paint	Price SGD
New Part Painting	99.66
New Part Painting - Plastic K1R	71.59
Repair Painting	72.34
Surface-/Blend Paint	12.70
Material-constant Metal Preparation	28.60
Material-constant Multi-Coat	9.30
Material-constant Plastic	9.00
Total	303.19

Spare Parts

prices as at 2015-06-01/01

Insurer Reference: DMHCSNA00003412400-SNR3320X
 Repairer Reference: 74874
 Date calculated: 06/01/2025 10:43 AM

Full Report
 Registration: SNR3320X
 Printed: 06/01/2025 10:43 AM

Code	Description	Part Number	Part Source	Price SGD
8403	AIR FILTER DUCT	172525V5M00	Original	40.00
0471	BONNET	60100T5LT00ZZ	Original	450.00
0492	BONNET LOCK	74120T5A003	Original	65.00
4465	CONDENSER	80100T5SK01	Original	450.00
9987	COOLANT/ANTIFREEZE	NO NUMBER	Original	35.00
1395	COWL TRIM GRILLE	74200T5NM00	Original	120.00
1435	FILLER NECK	76805T5HH01	Original	20.00
0283	FRONT BUMPER	71101T5NM00ZZ	Original	680.00
1004	FRONT BUMPER CENTRE	UPPER BEAM	Original	35.00
0257	FRONT NUMBER PLATE	KNPL3	Original	0.00
1009	FRONT PANEL CPL	60400T5NM01ZZ	Original	320.00
0340	FRT BUMPER SUPPORT	71130T5NM00ZZ	Original	280.00
0351	FRT LWR BUMP GRILLE	71102T5NM00	Original	200.00
0410	GRILLE	08F21T5A300	Original	260.00
0431	GRILLE BADGE	75700T5NM00	Original	20.00
0475	L/BONNET HINGE	60170T5A000ZZ	Original	35.00
1005	L/BONNET HINGE	COVER	Original	15.00
1007	L/F AIRCON	AIR GUIDE	Original	20.00
0319	L/F HEADLAMP BRACKET	71190T5RA00	Original	30.00
0741	L/F WING	60261T5HH10ZZ	Original	250.00
0476	R/BONNET HINGE	60120T5A000ZZ	Original	35.00
1006	R/BONNET HINGE	COVER	Original	15.00
0320	R/F HEADLAMP BRACKET	71140T5RA00	Original	30.00
0742	R/F WING	60211T5HH10ZZ	Original	250.00
7761	RADIATOR	190105V3Z51	Original	800.00
0562	RIGHT HEADLAMP ASSY	33100T5AP01	Original	400.00
0411	UP/CVR RADIAT GRILLE	71105T5NM50	Original	20.00
1436	WASHER RESERVOIR	76841T5HH01	Original	45.00

f: OEM Parts
 n: Non-OEM Parts
 u: Used parts

Savings	0.00
Subtotal	4,920.00
Fixed Sundry Parts Price	100.00
Total	5,020.00

Extras

Code	Description	Price SGD
1000	AIRCON GAS	50.00*
1003	FRONT NUMBER PLATE	40.00*
Total Extras		90.00

Insurer Reference: DMHCSNA00003412400-SNR3320X
Repairer Reference: 74874
Date calculated: 06/01/2025 10:43 AM

Full Report
Registration: SNR3320X
Printed: 06/01/2025 10:43 AM

Final Calculation

	SGD	SGD
Parts	4,920.00	
Fixed Sundry Parts Price	100.00	
Total Parts		5,020.00
Labour Time Base 10 WU/h		
Total 80.0 WU X 42.00 SGD/h	336.00	
Total of Labour		336.00
Additional Costs		
Rustproofing		
Rate 4.0 WU X 42.00 SGD/h	16.80	
Total Of Additional Costs		16.80
Total Of Extras		90.00
Paint Work Time Base 10 WU/h		
Labour Cost 168.0 WU X 42.00 SGD/h	705.60	
Material Cost	303.19	
Total Paint Including Material		1,008.79
Repair Cost Excludes GST		6,471.59
GST (+9.00%)		582.44
Repair Cost Included GST		7,054.03
Deductions (Excludes GST)		
Deduction For Excess	-2,000.00	
Total Of Deductions (Excludes GST)		-2,000.00
Grand Total Excludes GST		4,471.59
GST (+9.00%)		402.44
Grand Total Included GST		4,874.03

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.