

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

STRIDES PREMIER AUTOMOTIVE SERVICES PL INV No. AC2500367

60 WOODLANDS INDUSTRIAL PARK E4 INV

SINGAPORE 757705

ATTN: HUA YEN

INV Date 16/01/2025

Reference CS/SMR24120198/Enh3e2

(NT)

Code SMR

PROFESSIONAL SERVICE FEE

Vehicle No. SMT 4053L

Insured Veh. SHB 1289Y

Claim No. TAX/12/24/2027

Policy No.

Accident Date 11/12/2024

Inspection Date 16/12/2024

Description	Total
Survey Inspection	128.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	128.00
GST (9%)	11.52
Grand Total	139.52

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

KHM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

		Affiliated to Federation Internation	nale Des Experts Er	n Automo	bile
	STRIDES PREMIE	R AUTOMOTIVE SERVICES PL		Ref:	CS/SMR24120198/Enh3e2(N)
	60 WOODLANDS I SINGAPORE 7577	NDUSTRIAL PARK E4 05		Date:	16/01/2025
	ATTN: HUA YEN			Code:	SMR
1.		Policy Particulars :	- THIRD PART	CLAIN	1
	Insured Veh.	SHB 1289Y	Veh. Inspected	k	SMT 4053L
	Policy No.		Coverage (\$)		0.00
	Claim No.	TAX/12/24/2027	Excess (\$)		0.00
	Assign From	HUA YEN	Assign Date		13/12/2024
2.		Vehicle Partic	ulars & Condit	ion	
	Make & Model	HYUNDAI QX VENUE	c.c		1598
	Engine No.	HIDDEN	Year of Reg.		2020
	Chassis No.	KMHRC813TLU052718	Colour		ORANGE
	Odometer	93034 KM	Steering		IN ORDER
	Brakes	IN ORDER	Modification		SPORTS RIM
	General	FAIR			
3.		Condition	ons of Tyres		
		Size	Make		Balance
	R/H Front Tyre	215/55 R17	YOKOHAMA		6 mm
	L/H Front Tyre	215/55 R17	YOKOHAMA		6 mm
	R/H Rear Tyre	215/55 R17	YOKOHAMA		6 mm
	L/H Rear Tyre	215/55 R17	YOKOHAMA		6 mm
4.		Description	on of Damages		
	THE VEHICLE SUS	STAINED DAMAGES AT THE REA	AR PORTION.		
	DAMAGES SEE DI	ETAILS.			
5.		General	Information		
	Accident Date	11/12/2024	Inspection Dat	e	16/12/2024
	Survey held at	BIFROST AUTO PTE LTD	-		
		8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKI SINGAPORE 415875	Г		
5a.		Re	emarks		
		N WAS CONDUCTED ON A"WIT E TO YOUR INSTRUCTIONS, W			
5b.		Estimate I	Days of Repair		
	ESTIMATED NORM	MAL PERIOD FOR REPAIR:		7 Worki	ng Days



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMT 4053L

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	TAILGATE	DENTED	1,708.00	1,708.00
1	TAILGATE WINDSCREEN GLASS RUBBER MOULDING	NOT NECESSARY	98.00	-
1	TAILGATE "VENUE" EMBLEM	NECESSARY	76.00	76.00
1	TAILGATE CENTRE LOGO	NECESSARY	56.00	56.00
1	TAILGATE "S" EMBLEM	NECESSARY	23.00	23.00
1	TAILGATE "1.6" EMBLEM	NECESSARY	27.00	27.00
1	TAILGATE LOCK	BENT	162.00	162.00
1	TAILGATE LOCK CATCH	NOT NECESSARY	55.00	-
1	TAILGATE INNER TRIM BOARD	BROKEN	198.00	198.00
1	SET TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	70.00	20.00
1	TAILGATE RH ABSORBER STAY	NOT NECESSARY	322.00	-
1	TAILGATE LH ABSORBER STAY	NOT NECESSARY	322.00	-
1	TAILGATE RH HINGE	NOT NECESSARY	98.00	-
1	TAILGATE LH HINGE	NOT NECESSARY	98.00	-
1	TAILGATE WIPER MOTOR	NOT NECESSARY	566.00	-
1	TAILGATE WEATHERSTRIP	CRUSHED	203.00	203.00
1	TAILGATE OPENER BUTTON SWITCH	CUT	178.00	178.00
1	REAR BUMPER	BROKEN	578.00	578.00
1	SET REAR BUMPER CLIPS	NECESSARY	70.00	30.00
1	REAR BUMPER RH SIDE RETAINER	BROKEN	58.00	58.00
1	REAR BUMPER LH SIDE RETAINER	BROKEN	58.00	58.00
1	REAR BUMPER REVERSE CAMERA	CUT	785.00	785.00
1	REAR BUMPER NUMBER PLATE RH LAMP	NOT NECESSARY	89.00	-
1	REAR BUMPER NUMBER PLATE LH LAMP	NOT NECESSARY	89.00	-
1	REAR BUMPER LOWER GARNISH	CRUSHED / CUT	387.00	387.00
1	REAR BUMPER LOWER GARNISH CENTRE COVER	BROKEN	233.00	233.00
1	REAR BUMPER RH SIDE REVERSE SENSOR	NOT NECESSARY	199.00	-
1	REAR BUMPER RH REVERSE SENSOR	SHORTED	199.00	199.00
1	REAR BUMPER LH REVERSE SENSOR	SHORTED	199.00	199.00
1	REAR BUMPER LH SIDE REVERSE SENSOR	NOT NECESSARY	199.00	-
1	REAR BUMPER REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	289.00	-

Report Ref No. CS/SMR24120198/Enh3e2(N)



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	REAR BUMPER REINFORCEMENT	BROKEN	288.00	288.00
1	REAR BUMPER RH LAMP	NOT NECESSARY	145.00	-
1	REAR BUMPER LH LAMP	NOT NECESSARY	145.00	-
1	RH TAILLAMP	NOT NECESSARY	1,066.00	-
1	RH TAILLAMP LOWER BRACKET	NOT NECESSARY	67.00	-
1	RH TAILLAMP PANEL	NOT NECESSARY	187.00	-
1	RH TAILLAMP LOCK CLIPS	NOT NECESSARY	28.00	-
1	LH TAILLAMP	NOT NECESSARY	1,066.00	-
1	LH TAILLAMP LOWER BRACKET	NOT NECESSARY	67.00	-
1	LH TAILLAMP PANEL	NOT NECESSARY	187.00	-
1	LH TAILLAMP LOCK CLIPS	NOT NECESSARY	28.00	-
1	END PANEL	DENTED	875.00	875.00
1	END PANEL GARNISH	NECESSARY	156.00	156.00
1	SET END PANEL GARNISH CLIPS	NOT NECESSARY	28.00	-
1	REAR RH FENDER INNER TRIM BOARD	BROKEN	335.00	335.00
1	SET REAR RH FENDER INNER TRIM BOARD CLIPS	NECESSARY	60.00	20.00
1	REAR LH FENDER INNER TRIM BOARD	BROKEN	335.00	335.00
1	SET REAR LH FENDER INNER TRIM BOARD CLIPS	NECESSARY	60.00	20.00
1	SPARE TYRE TOP COVER BOARD	NOT NECESSARY	569.00	-
1	EXHAUST SILENCER	NOT NECESSARY	837.00	-
1	EXHAUST SILENCER GASKET	NOT NECESSARY	54.00	-
	LESS 20% DISCOUNT		-2,855.00	-1,441.40
			11,420.00	5,765.60
	SPECIAL NETT ITEMS			
1	TAILGATE WINDSCREEN GLASS SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN GLASS INNER SEAL (SN)	NECESSARY	60.00	20.00
1	END PANEL JOINT SEALANT (SN)	NECESSARY	70.00	30.00
1	REAR NUMBER PLATE (SN)	BROKEN	70.00	50.00
			280.00	140.00

Report Ref No. CS/SMR24120198/Enh3e2(N)



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>LABOUR</u>			
	LABOUR CHARGE TO REMOVE, CHECK, REPLACE AND REINSTALL DAMAGES BODYPARTS. TO PANEL BEATING, CUT/WELD AND REALIGN ALL AFFECTED PANELS AND AREAS.		1,600.00	900.00
	SPRAY PAINTING ON AFFECTED AREAS AND PANELS.		1,500.00	600.00
	CHECK WIRING AND LIGHTING SYSTEM ON AFFECTED AREAS.		70.00	30.00
	APPLY RUST COATING CHEMICAL ON AFFECTED AREAS AND PANELS.		80.00	30.00
	REMOVE AND REINSTALL TAILGATE WINDSCREEN GLASS TO ASSIST REPAIR.		220.00	50.00
	REMOVE AND REPLACE TAILGATE INNER MECHANISM TO NEW TAILGATE.		200.00	120.00
	REMOVE AND REPLACE REAR BUMPER REVERSE SENSORS AND WIRE HARNESS (4 SENSORS).		120.00	30.00
	REMOVE AND REPLACE REAR INNER TRIMS, GARNISH AND BOARDS TO ASSIST REPAIR.		400.00	80.00
	MOUNT VEHICLE ON CHASSIS ALIGNMENT BENCH TO REPAIR CHASSIS FRAMES.	NOT NECESSARY	500.00	-
			4,690.00	1,840.00
	GRAND TOTAL		16,390.00	7,745.60

RECOMMENDED COST OF LUMP SUM REPAIRS	6,200.00
(TO ITS PRE-ACCIDENT CONDITION)	

Report Ref No. CS/SMR24120198/Enh3e2(N)



Automotive Assessor

P

ANG BRYAN TANI

Automotive Assessor / Investigator

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Actual Driver
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy liability.

 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.

- 4. The issue and acceptance of this is form by instrained companies.
 5. Any false reporting may be referred to the Police for investigation.
 6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission 11/12/2024 15:54 (SGT) Reported by Both Policyholder and Actual Driver Date of Accident 11/12/2024 08:45 (SGT) Exact Location of Accident Singapore Additional Location Information ALONG AYE Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMT4053L

INSURED/POLICYHOLDER

Is company? No Name Of Registered Owner **CHEN SIQI** NRIC No SXXXX706F Fmail Address Mobile Phone No Alternative Phone No

VEHICLE PARTICULARS

Manufacturer Hyundai Model QX VENUE 1.6 CVT S Variant HYUNDAI / QX VENUE 1.6 CVT S

Exact purpose for which vehicle was being used at time of accident Private use

Are you claiming under your own insurance policy for repair to your vehicle?

No - Claiming third party Vehicle Category Private car Transmission Auto CC 1598 Vehicle Fuel Petrol

First Regisration Date 09/06/2020 Chassis no

KMHRC813TLU052718 Effective Date/Time of Ownership 09/06/2020 09:06 (SGT)

INSURANCE COMPANY

Name of Insurance Company Direct Asia Insurance (Singapore) Pte Ltd Policy Number / Cover Note Number MT/00933325/03

DRIVER

Name of Driver	CHEN SIQI
NRIC No	SXXXX706F
Date Of Birth	
Occupation	Indoor
Driving Pass Date	05/05/2009
Driving License Pass Class	3
Driving License Validity	Valid
Driving experience	15 YEARS AND 7 MONTHS
Gender	Female
Mobile Number	
Alt. Phone Number	-
Email Address	
Address	
Address complement	
Address complement Postcode	- -
Is the driver the policyholder?	Vaa
If No, Relationship of the Driver with the Insured	Yes
Does Driver Own Other Vehicles?	- No
Vehicle Registration Number of Other Vehicle Owned by Driver	No
Verlicle Negistration Number of Other Verlicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-
, ,	
GENERAL INFORMATION OF THE ACCIDENT	
Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry
OTHER INFORMATION	
Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s)	
soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	
Translator's email	-
Original language used in the statement	-
DETAILS OF POLICE ACTION	
Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-
CIRCUMSTANCES OF ACCIDENT	
REFER TO SKETCH PLAN	
ATTACHMENT(S)	
Are accident photos available for attachment?	Voc
Was there any video captured by Car Camera?	Yes No
Trac alore any video captured by Car Carrera:	INU
- DETAIL O OF OTHER	VEHICLE PROPERTY 1
DETAILS OF OTHER	VEHICLE PROPERTY 1

SHB1289Y

Vehicle Registration Number

Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	_
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	_
Contact Number	-
Address	_
Address complement	_
Postcode	_
Insurance Company Name	_
Nature Of Damage	_
Details of property damaged in accident	_
No. Of Passenger (Including Driver)	_
- , ,	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	
Vehicle Manufacturer	
Vehicle Model	-
Vehicle Variant	
Vehicle Colour	
Vehicle Category	Private hire
Name of Driver	
Contact Number	
Address	
Address complement	
Postcode	<u>-</u>
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Actual Driver
- Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Traffic Police Department for investigation.
- This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims:

(ii) investigating the accident and/or my claims;

1.

- (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
- (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages), and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

olicyholder's ketch Plan	Signature / Date & Time	Actual Driver's Signature (if driver is not the policyholder) / Date & Time	Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)
Mong	AYE		A18MT4053L
			6:SHB 1289Y C. SMX8622Y
		TANGE OF THE PROPERTY OF THE P	
vJun2022			

0	n tre	Ctaru	time o	and do	tt, 1	was driving
Perice 1	+, SMT40	53L and	1 slan	g dom	ue s	udda.19
venice s	SHBIZE	59Y 001	inded ne	fon	te tear	White
C, 54x862	er weigh	involve	in t	e secuid	ent as	ber
	· ·					
Declaration We declare the fore	going particulars	are true in every re	Hspect.			
1						7
p		Actual Driver's S		wie out the outer	holder) Witness	ed by Reporting Centre P



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 1 of 24)













Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 2 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 3 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 4 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 5 of 24)













Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 6 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 7 of 24)













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 8 of 24)













Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 9 of 24)







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 10 of 24)














Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 11 of 24)

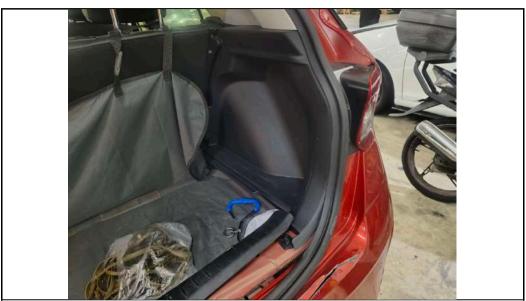











Reg. No: 199607198R GST Reg. No. 19-9607198-R INSPECTION PHOTOS (Page 12 of 24)














Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 13 of 24)



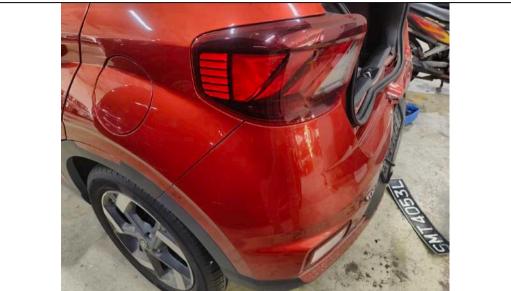









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 14 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 15 of 24)













Reg. No: 199607198R GST Reg. No. 19-9607198-R **INSPECTION PHOTOS (Page 16 of 24)**













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 17 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 18 of 24)













Reg. No: 199607198R GST Reg. No. 19-9607198-R **INSPECTION PHOTOS (Page 19 of 24)**













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 20 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 21 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 22 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 23 of 24)













Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 24 of 24)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)







