

ASS. REC. BY:

REF:

C721

Kenneth

## ASSIGNMENT

From:

Date:

Estimated Cost:

DD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

14

days

Res.:

Yes or No

Lum Sum:

113.1

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMQ 96921

Yr Regn:

12 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mw E200 Amb G.C

Colour:

M.D. Blue

A/C: Insured / Std / NI / NA

Sp. Reading:

65214

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WDP 2130422A 586109

Gen. Cohd: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

245/35ZR20

R:

275/30ZR20

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental

Front

Rear

R/Bal.

8

mm

R/Bal.

3

mm

L/Bal.

8

mm

L/Bal.

3

mm

D.O.A.

7/12/24

D.O.I.

17/12/2024

Survey held at

Des. of Damages: Frit / Rear / O/S / N/S / U/C / Rooftop or

Frt N/S &amp; o/s body

The U/C / Chassis frame / Body structure affected due to collision. ✓

Date / Time

Action / Instruction

1 Midnight case, no modification.

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

Fuel

Others

Add Fee:

☐

: Site Insp (\$)

☐

: Interview (\$)

☐

: Tech Invs (\$)

☐

: Weekend (\$)

TOTAL

Report Format:

Lump Sum / I.B.I: (\$)

Lai Huat (Meng Kee) Motor Pte Ltd  
160 Sin Ming Drive, #04-01, #04-02 & #07-03,  
Sin Ming Autocity  
575722

Insurer Reference: DMPCSNW00167082303  
Repairer Reference: 74880  
Date calculated: 17/12/2024 10:16 AM

Full Report  
Registration: SMQ9692A  
Printed: 17/12/2024 10:16 AM

### Summary Information

|                        |                    |                   |                                             |
|------------------------|--------------------|-------------------|---------------------------------------------|
| Claim Location:        | Singapore (SG)     | Work Provider:    | China Taiping Insurance (Singapore) Pte Ltd |
| Printed by:            | Jenny Lim          | Currency:         | SGD                                         |
| Claim Reference:       | DMPCSNW00167082303 | Date of Incident: | 07/12/24                                    |
| Estimated Repair Time: |                    | Hire Car Start:   |                                             |
| Actual Repair Days:    |                    | Hire Car End:     |                                             |

### Vehicle Details

|                       |                   |
|-----------------------|-------------------|
| Vehicle Manufacturer: | MERCEDES-BENZ     |
| Model:                | E-CLASS (W213)    |
| Sub Model:            | E 200             |
| Model Sheet Number:   | 03 FE 42          |
| Registration:         | SMQ9692A          |
| VIN number:           | WDD2130422A586109 |
| Odometer:             |                   |

#### Model Specs

FROM A449969/L016369  
HEADUNIT ECE/ROW  
GARMIN MAP PILOT  
ACTIVE BRAKE ASSIST  
MEDIA DISPLAY 12,3"  
HEATED FRONT SEATS  
STORAGE PACKAGE  
KEYLESS GO  
CENTRE CONSOLE WOOD  
AUTOMATIC 9-SPEED  
8/9J X 20 ALU  
INCR ANTI THEFT DEV  
AMG STYLING  
CLEAR COAT HARD

265/35-295/30 ZR20  
AMG LINE  
MODEL 2019  
OUT/IN MIRR AUTO DIM  
LED HEADLAMP  
MULT FUNC ST/WHL LTH  
ASH WOOD TRIM  
ELECTRIC BOOTLID  
PASS AIRBAG INTERRUPT  
TYRE PRESSURE SENSOR  
TYRE W/FLAT RUNNING  
EMERGENCY CALL SYS  
BODY SHELL LOAD LVL2

INSTR PANEL LEATHER  
MOBILE COM-MODUL LTE  
HEAT ABS GLAZING CPL  
ELEC FOLD DR MIRRORS  
ANTI-THEFT ALARM  
MEMORY PACKAGE  
PARK PILOT SYSTEM  
ELECTRIC BOOTLID  
SHIFT PADDLE ON STRG  
AGILITY CONTR SUSPEN  
EXTENDED FUEL TANK  
PANORAMIC ROOF  
TWO COAT METALLIC

AMG LINE  
PREP MAP PILOT  
MIRROR PACKAGE  
REARVIEW CAMERA  
PAD ARTICO MICROFIBR  
INTERIOR PROTECTION  
ANALOG CLOCK  
RADIATOR SHROUD  
DYNAMIC SELECT  
PART-FILT WITH SENSR  
PEDESTRIAN PROTECT  
DAB TUNER  
PREPARE OFF VEHICLE

*Not Authorized*  
*Repair By pain*  
*£2 @ 1250k*  
*14 days*

### Labour

| Code       | Description                                                                                           | Time Base 10 WU/h | Price = 42.00 SGD/h |           |
|------------|-------------------------------------------------------------------------------------------------------|-------------------|---------------------|-----------|
|            |                                                                                                       |                   | WU                  | Price SGD |
| 54-1011 01 | SHORT TEST<br>INCLUDES: CONNECT + DISCONNECT STAR<br>DIAGNOSIS,<br>PRINT DATA,<br>DELETE ERROR MEMORY |                   | 3.0                 | 12.60     |

LKK Auto Consultants hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Page 1 of 7  
Approved by Repairer  
Signature:  
Date:

PRINT DATE 17/12/2024

Insurer Reference: DMPCSNW00167082303

Repairer Reference: 74880

Date calculated: 17/12/2024 10:16 AM

Full Report

Registration: SMQ9692A

Printed: 17/12/2024 10:16 AM

| Code        | Description                                                                                                                                                         | WU   | Price SGD |
|-------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------|------|-----------|
| 54-7989 01  | R + R BATTERY EARTH CABLE<br>(WHEN DISCONNECTING ELECTRIC PLUG AND<br>SOCKET CONNECTIONS)                                                                           | 3.0  | 12.60     |
| 54-0650 01  | MAIN BOARD MAINTAINED<br>(FOR CHECK AND DIAGNOSIS WORK)                                                                                                             | 1.0  | 4.20      |
| 61-1087 01  | R + R CENTRE AND REAR ENGINE<br>COMPARTMENT COVERING                                                                                                                | 3.0  | 12.60     |
| 61-1088 01  | R + R FRONT AND CENTRE ENGINE<br>COMPARTMENT COVERING                                                                                                               | 4.0  | 16.80     |
| 61-1116 01  | R + R L/UNDERFLOOR COVER                                                                                                                                            | 3.0  | 12.60     |
| 88-2532 01  | REPAIR OF FRONT-END DAMAGE<br>INCLUDES: RENEW BUMPER, BONNET, RADIATOR<br>COVER, FRONT WINGS AND FRONT LAMP UNITS,<br>CONVERT ATTACHED PARTS, RENEW IF<br>NECESSARY | 44.0 | 184.80    |
| 88-1164 01  | ADDITION FOR RENEW FRONT BUMPER<br>(VEHICLE WITH ACTIVE BRAKE ASSIST)                                                                                               | 1.0  | 4.20      |
| 88-1375 01  | ADDITION TO RENEW FRONT BUMPER<br>(VEHICLE WITH PEDESTRIAN PROTECT)                                                                                                 | 1.0  | 4.20      |
| 88-1376 01  | ADD TO RENEW FRONT BUMPER<br>(VEHICLE WITH PARK ASSISTENT)                                                                                                          | 3.0  | 12.60     |
| 82-4886 01  | ADDITIONAL TO RENEW HEADLAMP<br>(VEHICLE WITH LED HEADLAMP)                                                                                                         | 3.0  | 12.60     |
| 88-4668 01  | R + R L/F WHEELARCH SHELL                                                                                                                                           | 4.0  | 16.80     |
| 88-4693 01  | R + R R/F WHEELARCH SHELL                                                                                                                                           | 4.0  | 16.80     |
| 88-2657 01  | R + R BOTH BONNET HINGE                                                                                                                                             | 4.0  | 16.80     |
| 91-2173 01  | R + R L/BONNET STAY                                                                                                                                                 | 3.0  | 12.60     |
| 91-2174 01  | R + R R/BONNET STAY                                                                                                                                                 | 3.0  | 12.60     |
| 60-1331 01  | R + R ATTACHED PARTS OF THE ENGINE<br>COMPARTMENT FOR RENEWAL OF THE FRONT<br>MODULE<br>INCLUDES: R + R ALL ATTACHED PARTS IN<br>THE REPAIR SECTION                 | 15.0 | 63.00     |
| 62-1266 01  | R + R OR RENEW FRONT CROSSMEMBER AND<br>COMPLETE TRUSSING BETWEEN WHEELHOUSES<br>INCLUDES: R + R CENTRE TRUSSING, RENEW<br>IF NECESSARY                             | 15.0 | 63.00     |
| 88-8802 01  | REMOVE + REFIT REAR BUMPER<br>INCLUDES: R + R CENTRE REAR PANEL TRIM<br>AND TAILLAMP                                                                                | 13.0 | 54.60     |
| 88-8805 01  | DIS + ASS REAR BUMPER (REMOVED)                                                                                                                                     | 7.0  | 29.40     |
| 88-8887 01  | ADDITIONAL FOR DISS/ASS REAR BUMPER<br>(VEHICLE WITH PARK ASSISTENT)                                                                                                | 2.0  | 8.40      |
| 88-8890 01  | ADDITION TO REAR BUMPER DIS + ASS<br>(VEHICLE WITH TAILGATE OPENER)                                                                                                 | 1.0  | 4.20      |
| 20-3865 01) | R + R RADIATOR                                                                                                                                                      | 7.0  | 29.40     |
| 09-6935 03) | R + R LOW-TEMPERATURE COOLER (ADD)                                                                                                                                  | 3.0  | 12.60     |
| 83-6543 01  | R + R AIR CONDITIONING CONDENSER                                                                                                                                    | 14.0 | 58.80     |
| 27-7031 01  | R + R OIL PAN AUTOMATIC GEARBOX                                                                                                                                     | 5.0  | 21.00     |
| 40-1590 01  | R + R FRONT WHEELS                                                                                                                                                  | 3.0  | 12.60     |
| 40-1470 01  | ADD TO L/F WHEEL REMOVE AND REFIT<br>(ASSEMBLY ON WHEELS FROM 17 INCH)                                                                                              | 1.0  | 4.20      |
| 40-1470 01  | ADD TO R/F WHEEL REMOVE AND REFIT<br>(ASSEMBLY ON WHEELS FROM 17 INCH)                                                                                              | 1.0  | 4.20      |
| 33-3620 01  | R + R FRONT STEERING KNUCKLE                                                                                                                                        | 30.0 | 126.00    |

Surer Reference: DMPCSNW00167082303

Repairer Reference: 74880

Date calculated: 17/12/2024 10:16 AM

Full Report

Registration: SMQ9692A

Printed: 17/12/2024 10:16 AM

| Code                             | Description                              | WU           | Price SGD       |
|----------------------------------|------------------------------------------|--------------|-----------------|
| 33-1438 01)                      | DETACH + REFIT L/F TENSION ROD           | 4.0          | 16.80           |
| 33-1440 01)                      | DETACH + REFIT R/F TENSION ROD           | 4.0          | 16.80           |
| 33-1438 01)                      | R + R LEFT FRONT TORSION BAR             | 4.0          | 16.80           |
| 33-1440 01)                      | R + R RIGHT FRONT TORSION BAR            | 4.0          | 16.80           |
| 32-1955 01)                      | R + R L/F STRUT                          | 6.0          | 25.20           |
| 32-1960 01)                      | R + R R/F STRUT                          | 6.0          | 25.20           |
| 32-1965 01)                      | R + R FRONT SUSPENSION STRUT (ADD/WORK)  | 3.0          | 12.60           |
| 32-1908 01)                      | DISS/ASS L/F SUSPENSION STRUT REMOVED    | 3.0          | 12.60           |
| 32-1914 01)                      | DISS/ASS R/F SUSPENSION STRUT            | 3.0          | 12.60           |
| 32-1920 01)                      | DIS + ASS FRONT SPRING STRUT/S (REMOVED) | 2.0          | 8.40            |
| 42-2724 01)                      | R + R L/F BRAKE CALIPER                  | 3.0          | 12.60           |
| 42-2725 01)                      | R + R FRONT BRAKE CALIPER ASS WORK       | 3.0          | 12.60           |
| 33-1412 01)                      | R+R F/SPRING HANDLEBAR                   | 2.0          | 8.40            |
| 40-2410 01                       | R + R LEFT FRONT TYRE                    | 3.0          | 12.60           |
| 40-2410 01                       | R + R RIGHT FRONT TYRE                   | 3.0          | 12.60           |
| 40-2410 01                       | R + R RIGHT REAR TYRE                    | 3.0          | 12.60           |
| 40-2055 01                       | L/FRONT WHEEL BALANCE                    | 2.0          | 8.40            |
| 40-2055 01                       | R/FRONT WHEEL BALANCE                    | 2.0          | 8.40            |
| 40-2055 01                       | BALANCE R/R WHEEL                        | 2.0          | 8.40            |
| 40-1580 01)                      | R + R REAR WHEEL ADD                     | 1.0          | 4.20            |
| 40-2713 01                       | ADD TO WHEEL RENEW                       | 3.0          | 12.60           |
|                                  | (VEHICLE WITH TYRE PRESSURE CHECK)       |              |                 |
| 40-1470 01                       | ADD TO R/R WHEEL REMOVE AND REFIT        | 1.0          | 4.20            |
|                                  | (ASSEMBLY ON WHEELS FROM 17 INCH         |              |                 |
| 49-5507 02                       | R + R CATALYST                           | 11.0         | 46.20           |
| 49-5500 02)                      | RENEW CATALYST                           | 3.0          | 12.60           |
| 42-1350 01                       | BLEED BRAKE SYSTEM                       | 11.0         | 46.20           |
| 20-1190 01                       | ADDITION TO COOLING SYSTEM DRAIN /REFILL | 3.0          | 12.60           |
|                                  | (VEHICLE WITH SEPARATE LOW TEMPERATURE-  |              |                 |
|                                  | WATER CYCLE)                             |              |                 |
| 83-1762 01                       | AIR-CONDITIONING SYSTEM DRAIN FLUID,     | 6.0          | 25.20           |
|                                  | EXHAUST, REFILL, PRESSURE TEST           |              |                 |
|                                  | (FOR ALL WORK ON THE SYSTEM)             |              |                 |
| 83-0640 01                       | CHECK AIR COND                           | 1.0          | 4.20            |
| 82-1120 01                       | ADJUST HEADLAMPS                         | 7.0          | 29.40           |
|                                  | (VEHICLE WITH LED HEADLAMP)              |              |                 |
|                                  | INCLUDES: ZERO POSITION FOR LED HEADLAMP |              |                 |
|                                  | WITH STAR-DIAGNOSIS ADJUST               |              |                 |
| 40-6500 01                       | ALIGN VEHICLE                            | 8.0          | 33.60           |
|                                  | INCLUDES: ALIGN FRONT AND REAR TOE AND   |              |                 |
|                                  | CAMBER,                                  |              |                 |
|                                  | CHECK FRONT AND REAR VEHICLE LEVEL       |              |                 |
| 1482                             | RIGHT FRONT DOOR REPAIR                  | 15 20.0* ✓   | 84.00           |
| 1782                             | R/R DOOR REPAIR                          | 15 20.0* ✓   | 84.00           |
| 2086                             | RIGHT DOOR FRAME REPAIR                  | 25 30.0*     | 126.00          |
| 3482                             | R/R WING REPAIR                          | 15 20.0*     | 84.00           |
| <b>Labour Cost</b>               |                                          | <b>Hrs</b>   | <b>WU</b>       |
| <b>Panel / Mechanical Labour</b> |                                          | <b>40.30</b> | <b>403.0</b>    |
| <b>Alignment</b>                 |                                          |              |                 |
| <b>Measuring Work</b>            |                                          | <b>0.80</b>  | <b>8.0</b>      |
| <b>Total of Labour</b>           |                                          |              | <b>1,726.20</b> |

Surfer Reference: DMPCSNW00167082303  
Repairer Reference: 74880  
Date calculated: 17/12/2024 10:16 AM

Full Report  
Registration: SMQ9692A  
Printed: 17/12/2024 10:16 AM

## Paint

| Paint Work | SYSTEM AZT                            | Time Basis 10 WU/h |
|------------|---------------------------------------|--------------------|
| Code       | Description - TWO COAT METALLIC       | WU Price SGD       |
|            | BONNET NEW PART PAINTING              | 31.0               |
|            | L/BONNET HINGE SURFACE PAINT          | 4.0                |
|            | R/BONNET HINGE SURFACE PAINT          | 4.0                |
|            | L/F WING NEW PART PAINTING            | 11.0               |
|            | R/F WING NEW PART PAINTING            | 11.0               |
|            | FRONT BUMPER TRIM NEW PART PAINT K1R  | 10.0               |
|            | R/SILL PANELLING NEW PART PAINT K1R   | 7.0                |
|            | REAR BUMPER COVER NEW PART PAINT K1R  | 12.0               |
|            | RIGHT FRONT DOOR REPAIR PAINTING <50% | 17.0               |
|            | R/R DOOR REPAIR PAINTING <50%         | 15.0               |
|            | RIGHT DOOR FRAME REPAIR PAINTING <50% | 7.0                |
|            | R/F SILL REPAIR PAINTING <50%         | 10.0               |
|            | R/LWR A-PILLAR REPAIR PAINTING <50%   | 8.0                |
|            | RIGHT B-PILLAR REPAIR PAINTING <50%   | 10.0               |
|            | R/R WING REPAIR PAINTING <50%         | 15.0               |

## Paint Material Per Part

| Code | Description                           | Price SGD |
|------|---------------------------------------|-----------|
|      |                                       | 107.33    |
| 0471 | BONNET NEW PART PAINTING              | 0.25      |
| 0475 | L/BONNET HINGE SURFACE PAINT          | 0.25      |
| 0476 | R/BONNET HINGE SURFACE PAINT          | 22.70     |
| 0741 | L/F WING NEW PART PAINTING            | 22.70     |
| 0742 | R/F WING NEW PART PAINTING            | 47.23     |
| 0283 | FRONT BUMPER TRIM NEW PART PAINT K1R  | 28.04     |
| 2208 | R/SILL PANELLING NEW PART PAINT K1R   | 60.02     |
| 2583 | REAR BUMPER COVER NEW PART PAINT K1R  | 30.04     |
| 1482 | RIGHT FRONT DOOR REPAIR PAINTING <50% | 25.19     |
| 1782 | R/R DOOR REPAIR PAINTING <50%         | 2.91      |
| 2086 | RIGHT DOOR FRAME REPAIR PAINTING <50% | 11.31     |
| 2112 | R/F SILL REPAIR PAINTING <50%         | 4.52      |
| 2240 | R/LWR A-PILLAR REPAIR PAINTING <50%   | 11.31     |
| 2292 | RIGHT B-PILLAR REPAIR PAINTING <50%   | 24.55     |
| 3482 | R/R WING REPAIR PAINTING <50%         |           |

## Labour Cost - Paint

|                                | Hrs     | WU    | Price SGD |
|--------------------------------|---------|-------|-----------|
| Factor                         |         | 172.0 |           |
| Time Paint                     | 2.50    | 25.0  | 105.00    |
| Preparation Main Work Metal    | 0.50    | 5.0   | 21.00     |
| Preparation Comp. Work Plastic |         |       |           |
| Total                          | 10 WU/h | 202.0 | 848.40    |

Insurer Reference: DMPCSNW00167082303  
 Repairer Reference: 74880  
 Date calculated: 17/12/2024 10:16 AM

Full Report  
 Registration: SMQ9692A  
 Printed: 17/12/2024 10:16 AM

### Material Cost - Paint

New Part Painting  
 New Part Painting - Plastic K1R  
 Repair Painting  
 Surface-/Blend Paint  
 Material-constant Metal Preparation  
 Material-constant Plastic  
**Total**

Price SGD  
 152.73  
 135.29  
 109.83  
 0.50  
 28.60  
 9.00  
 435.95

### Spare Parts

prices as at 2015-06-01  
 Price SGD

| Code | Description          | Part Number       | Part Source |                |
|------|----------------------|-------------------|-------------|----------------|
| 4465 | AIR CON CONDENSER    | 099 500 0454      | Original    | Br/Pu ✓ 816.00 |
| 1007 | ATF                  | 6 LITRESG         | Original    | M ✓ 120.00     |
| 0471 | BONNET               | 213 880 0357      | Original    | Br ✓ 1,295.00  |
| 8819 | CATALYST             | 274 140 1708      | Original    | ? 1,657.00     |
| 9987 | COOLANT/ANTIFREEZE   | NO NUMBER         | Original    | M ✓ 19.00      |
| 0390 | CTR FRT BUMPER MLDG  | 213 885 7000      | Original    | Dr ✓ 260.00    |
| 8780 | CTR LWR ENGINE CVR   | 213 524 2700      | Original    | CM ✓ 120.00    |
| 7789 | FAN UNIT             | 099 906 1800      | Original    | ? 950.00       |
| 0283 | FRONT BUMPER TRIM    | 213 885           | Original    | Ta ✓ 1,220.00  |
|      |                      | 2700649999        |             |                |
| 0930 | FRONT MODULE CPL     | 213 620 6300      | Original    | mi ✓ 568.00    |
| 0257 | FRONT NUMBER PLATE   | KNPL3             | Original    | R ✓ 0.00       |
| 0349 | FRT/CTR IMPACT DAMP  | 213 885 0103      | Original    | mi ✓ 105.00    |
| 1006 | FRT BUMPER TRI-GRIP  | RIVETX20          | Original    | mi ✓ 100.00    |
| 0377 | FRT BUMPER W/        | 213 540 5403      | Original    | ? 283.00       |
|      | HARNESS              |                   |             |                |
| 0305 | FRT CT BUMP GRILLE   | 213 885 6900      | Original    | mi ✓ 120.00    |
| 0335 | FRT CTR BUMPER CARR  | 213 885 2500      | Original    | R ✓ 100.00     |
| 8779 | FRT ENGINE COVER     | 213 520 0900      | Original    | Bo ✓ 173.00    |
| 1001 | FRT LWR CROSSMEMBER  | 213 620 0130      | Original    | Br ✓ 305.00    |
| 0260 | FRT NO PLATE BRKT    | 213 880 2400      | Original    | mi ✓ 89.00     |
| 0491 | FRT PRESSURE SENSOR  | 213 905 0914      | Original    | ? 108.00       |
| 8896 | GEARBOX OIL TUBE     | 725 271 2101      |             | ? 0.00         |
| 8891 | GEARBOX SUMP         | 725 270 3707      | Original    | ? 255.00       |
| 8897 | GEARBOX WATER PIPE   | 725 271 6100      |             | ? 0.00         |
| 0405 | GRILLE               | 213 888 0123 64   | Original    | CM ✓ 120.00    |
| 0477 | L/BONNET ACTUATOR    | 213 906 2201      | Original    | Act ✓ 120.00   |
| 0475 | L/BONNET HINGE       | 213 880 0128      | Original    | Dr ✓ 148.00    |
| 2621 | L/BUMPER MNTG REINF  | 213 885 4905      | Original    | M ✓ 20.00      |
| 7155 | L/F BRAKE CALIPER    | 011 421 9798      | Original    | ? 1,083.00     |
| 0343 | L/F BUMPER CARRIER   | 213 885 2300      | Original    | R ✓ 64.00      |
| 0303 | L/F BUMP LWR GRILLE  | 213 885 6700      | Original    | CM ✓ 66.00     |
| 7071 | L/F CONTROL ARM      | 205 330 6510      | Original    | R ✓ 353.00     |
| 0365 | L/F INNER SENSOR     | 000 905 5504 9999 | Original    | ? 100.00       |
| 0359 | L/F INN SPACER RING  | 000 542 1251      | Original    | M ✓ 6.00       |
| 4283 | L/FLOOR COVER        | 213 680 6307      | Original    | CM ✓ 168.00    |
| 0355 | L/F OUT SPACER RING  | 000 542 1251      | Original    | M ✓ 6.00       |
| 7087 | L/FR SHOCK ABSORBER  | 213 320 3630      | Original    | R ✓ 490.00     |
| 7201 | L/FR WHEEL           | 213 401 2200 7X21 | Original    | Dr ✓ 1,395.00  |
| 7081 | L/F STEERING KNUCKLE | 213 332 4700      | Original    | Br ✓ 1,030.00  |
| 1189 | L/F STRUT            | 253 620 1600      | Original    | R ✓ 45.00      |
| 7091 | L/F STRUT BEARING    | 253 323 0020      | Original    | M ✓ 190.00     |
| 7047 | L/F TENSION ROD      | 205 330 1305      | Original    | ? 328.00       |
| 7061 | L/F TRACK CONT ARM   | 205 330 5501      | Original    | Br ✓ 438.00    |

Insurer Reference: DMPCSNW00167082303  
 Repairer Reference: 74880  
 Date calculated: 17/12/2024 10:16 AM

Full Report  
 Registration: SMQ9692A  
 Printed: 17/12/2024 10:16 AM

| Code | Description          | Part Number       | Part Source | Price SGD |
|------|----------------------|-------------------|-------------|-----------|
| 1191 | L/F UPP BUMP FRT ABS | 213 620 1500      | Original    | 155.00    |
| 7131 | L/F WHEEL HUB        | 205 334 0400      | Original    | 315.00    |
| 0839 | L/F W-HOUSE FRT CVR  | 238 690 1503      | Original    | 90.00     |
| 0841 | L/F W-HOUSE RR COVER | 238 691 1700      | Original    | 155.00    |
| 0741 | L/F WING             | 213 880 0118      | Original    | 575.00    |
| 9649 | L/H-LAMP LVL C-UNIT  | 213 900 2616      | Original    | 415.00    |
| 9645 | L/HORN               | 213 542 4400      | Original    | 120.00    |
| 8767 | L/LWR COVER BRACKET  | 213 524 0340      | Original    | 24.00     |
| 0413 | L/LWR GRILLE MLDG    | 213 888 0373 64   | Original    | 48.00     |
| 7099 | L/UPPER DAMPER RING  | 205 322 0184      | Original    | 48.00     |
| 0411 | L/UPP GRILLE MLDG    | 213 888 0173 64   | Original    | 1,900.00  |
| 0561 | LEFT HEADLAMP ASSY   | 213 906 6701      | Original    | 545.00    |
| 7762 | LOW TEMP RADIATOR    | 099 500 2003      | Original    | 120.00    |
| 0478 | R/BONNET ACTUATOR    | 213 906 2201      | Original    | 148.00    |
| 0476 | R/BONNET HINGE       | 213 880 0228      | Original    | 20.00     |
| 2622 | R/BUMPER MNTG REINF  | 213 885 5005      | Original    | 64.00     |
| 0344 | R/F BUMPER CARRIER   | 213 885 2400      | Original    | 74.00     |
| 0304 | R/F BUMP LWR GRILLE  | 213 885 6800      | Original    | 353.00    |
| 7072 | R/F CONTROL ARM      | 205 330 6610      | Original    | 100.00    |
| 0366 | R/F INNER SENSOR     | 000 905 5504 9999 | Original    | 6.00      |
| 0360 | R/F INN SPACER RING  | 000 542 1251      | Original    | 6.00      |
| 0356 | R/F OUT SPACER RING  | 000 542 1251      | Original    | 490.00    |
| 7088 | R/FR SHOCK ABSORBER  | 213 320 3630      | Original    | 1,395.00  |
| 7202 | R/FR WHEEL           | 213 401 2200 7X21 | Original    | 950.00    |
| 7082 | R/F STEERING KNUCKLE | 213 332 4800      | Original    | 190.00    |
| 7092 | R/F STRUT BEARING    | 253 323 0020      | Original    | 328.00    |
| 7048 | R/F TENSION ROD      | 205 330 1405      | Original    | 470.00    |
| 7062 | R/F TRACK CONT ARM   | 205 330 5601      | Original    | 315.00    |
| 7132 | R/F WHEEL HUB        | 205 334 0400      | Original    | 90.00     |
| 0840 | R/F W-HOUSE FRT CVR  | 238 690 1603      | Original    | 110.00    |
| 0842 | R/F W-HOUSE RR COVER | 238 691 1000      | Original    | 575.00    |
| 0742 | R/F WING             | 213 880 0018      | Original    | 24.00     |
| 8768 | R/LWR COVER BRACKET  | 213 524 0440      | Original    | 1,483.00  |
| 9552 | R/RR WHEEL           | 213 401 2300 7X21 | Original    | 765.00    |
| 2208 | R/SILL PANELLING     | 213 698 0600 9999 | Original    | 48.00     |
| 7100 | R/UPPER DAMPER RING  | 205 322 0184      | Original    | 160.00    |
| 0437 | RAD GRILLE COVER     | 213 888 0160 9982 | Original    | 145.00    |
| 0407 | RAD GRILLE FRAME     | 213 885 0200 64   | Original    | 648.00    |
| 7761 | RADIATOR             | 099 500 7303      | Original    | 983.00    |
| 2583 | REAR BUMPER COVER    | 213 885           | Original    |           |
|      |                      | 0801649999        |             |           |
| 0562 | RIGHT HEADLAMP ASSY  | 213 906 6801      | Original    | 1,900.00  |
| 2627 | RR LWR BUMPER COVER  | 213 885 1801      | Original    | 248.00    |
| 0791 | SCREW                | 001 990 6736      | Original    | 50.00     |
| 0935 | UPP FRT PANEL COVER  | 213 620 1701      | Original    | 165.00    |

f: OEM Parts  
 n: Non-OEM Parts  
 u: Used parts

Savings  
 Subtotal  
 Fixed Sundry Parts Price

Total

0.00  
 31,694.00  
 100.00

31,794.00

## Extras

| Code | Description | Price SGD |
|------|-------------|-----------|
| 1000 | AIRCON GAS  | 50.00*    |

Insurer Reference: DMPCSNW00167082303  
Repairer Reference: 74880  
Date calculated: 17/12/2024 10:16 AM

Full Report  
Registration: SMQ9692A  
Printed: 17/12/2024 10:16 AM

| Code                | Description                        | Price SGD     |
|---------------------|------------------------------------|---------------|
| 1001                | COMPUTERISED WHEEL ALIGNMENT       | ✓ 60.00*      |
| 1002                | CHK/ERASE FAULT CODE AFTER REPAIR  | ✓ 120.00*     |
| 1003                | REPROGRAM SRS CONTROL UNIT         | ? 350.00*     |
| 1004                | REPROGRAM L/HEADLAMP LIGHT CONTROL | 250 350.00*   |
| 1005                | FRONT NUMBER PLATE                 | ✓ 40.00*      |
| <b>Total Extras</b> |                                    | <b>970.00</b> |

### Final Calculation

|                                       | SGD       | SGD              |
|---------------------------------------|-----------|------------------|
| <b>Parts</b>                          | 31,694.00 |                  |
| Fixed Sundry Parts Price              | 100.00    |                  |
| <b>Total Parts</b>                    |           | <b>31,794.00</b> |
| <b>Labour Time Base 10 WU/h</b>       | 1,692.60  |                  |
| Total 403.0 WU X 42.00 SGD/h          |           |                  |
| Alignment                             | 33.60     |                  |
| Measuring Work                        |           |                  |
| <b>Total of Labour</b>                |           | <b>1,726.20</b>  |
| <b>Total Of Extras</b>                |           | <b>970.00</b>    |
| <b>Paint Work Time Base 10 WU/h</b>   | 848.40    |                  |
| Labour Cost 202.0 WU X 42.00 SGD/h    | 435.95    |                  |
| Material Cost                         |           |                  |
| <b>Total Paint Including Material</b> |           | <b>1,284.35</b>  |
| <b>Repair Cost Excludes GST</b>       |           | <b>35,774.55</b> |
| GST (+9.00%)                          |           | <b>3,219.71</b>  |
| <b>Repair Cost Included GST</b>       |           | <b>38,994.26</b> |

### Comments

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

Your NCD will be affected due to late reporting

SLOM24CC0003-01 / Lai Huat (Meng Kee) Motor Pte Ltd  
ENTRY DATE & TIME: 12/12/2024 16:43 (SGT)  
SUBMITTED BY: Jenny Lim  
VERSION: 2 (13/12/2024 14:10 (SGT))

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

|                                 |                        |
|---------------------------------|------------------------|
| Date of First Submission        | 12/12/2024 16:43 (SGT) |
| Reported by                     | Actual Driver          |
| Date of Accident                | 07/12/2024 05:30 (SGT) |
| Exact Location of Accident      | Temasek Ave, Singapore |
| Additional Location Information | -                      |
| Country/State of Loss           | Singapore              |

### DETAILS OF OWN VEHICLE

|                             |                        |
|-----------------------------|------------------------|
| Vehicle Registration Number | SMQ9692A               |
| INSURED/POLICYHOLDER        |                        |
| Is company?                 | No                     |
| Name Of Registered Owner    | Tan Thiam Heng         |
| NRIC No                     | SXXXX627A              |
| Email Address               | kingsley.tkr@gmail.com |
| Mobile Phone No             | (Phone) +65-96230655   |
| Alternative Phone No        | -                      |

### VEHICLE PARTICULARS

|                                                                              |             |
|------------------------------------------------------------------------------|-------------|
| Manufacturer                                                                 | Mercedes    |
| Model                                                                        | E200        |
| Variant                                                                      | -           |
| Exact purpose for which vehicle was being used at time of accident           | Private use |
| Are you claiming under your own insurance policy for repair to your vehicle? | Yes         |
| Vehicle Category                                                             | Private car |
| Transmission                                                                 | Auto        |
| CC                                                                           | 1991        |
| Vehicle Fuel                                                                 | -           |
| First Registration Date                                                      | -           |
| Chassis no                                                                   | -           |
| Effective Date/Time of Ownership                                             | -           |

### INSURANCE COMPANY

|                                   |                                               |
|-----------------------------------|-----------------------------------------------|
| Name of Insurance Company         | China Taiping Insurance (Singapore) Pte. Ltd. |
| Policy Number / Cover Note Number | DMPCSNW00167082303                            |

DRIVER

SKETCH PLAN

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Actual Driver.
- 3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Traffic Police Department for investigation.
- 6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)


I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

*[Signature]*  
Policyholder's Signature / Date & Time  
13 DEC 2024

*[Signature]*  
Driver's Signature (if driver is not the policyholder) / Date & Time

*[Signature]*  
Witnessed by Reporting Centre Personnel  
(Name as in NRIC card) **Jenny Lim**

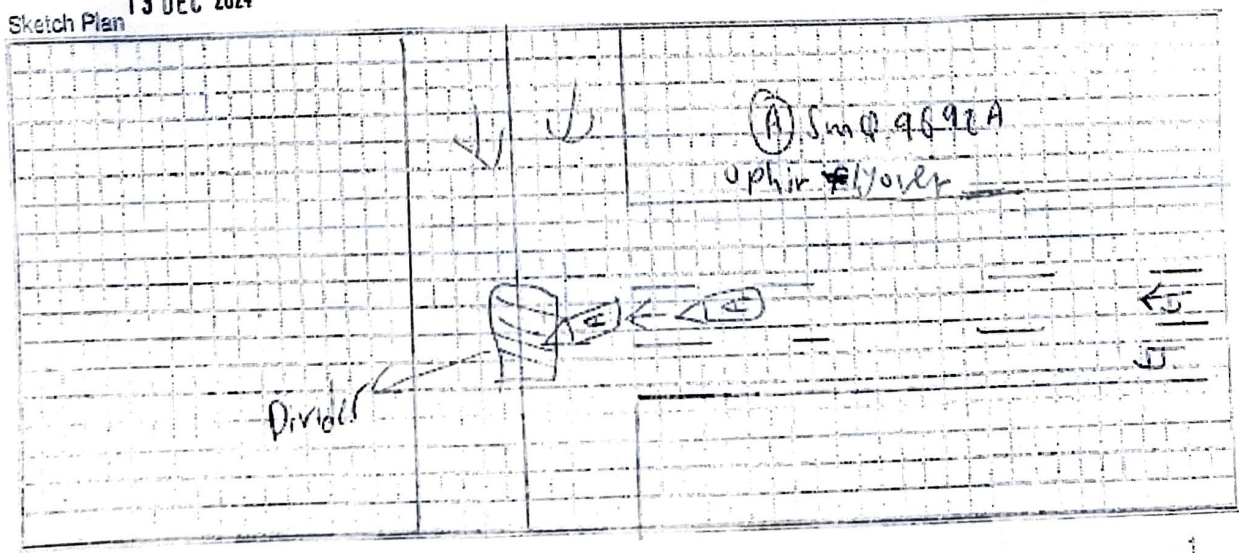

*Back to OneMotoring*

## Enquire PARF/COE Rebate for Registered Vehicle Vehicle Owner Particulars

Owner ID Type:

Owner ID:

### Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

### Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

### Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

QP Paid:

COE Rebate Amount:

Total Rebate Amount:

### Message

You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.

The information contained herein is correct as at 12 Dec 2024

Singapore NRIC

627A

SMQ9692A

Yes

12 Dec 2024

MERCEDES BENZ

E200 AMG LINE AUTO

Blue

2018

27492031716475

WDD2130422A586109

135.0 kW (181 bhp)

\$56,449.00

12 Dec 2019

12 Dec 2019

0

\$73,609.00

Yes

11 Dec 2029

\$51,526.00

11 Dec 2029

B - Car above 1600cc or 97kW (130bhp)

10

\$40,009.00

\$19,989.00

\$71,515.00

OK