



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2503723

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 16/06/2025
Reference CD/CTI24120377/Aua3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SNN 3747U
Insured Veh. SNU 4262H
Claim No. SNM24D206879
Policy No. DMPCSNW00137762400
Accident Date 05/12/2024
Inspection Date 06/12/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24120377/Aua3q2(N)	
			Date: 16/06/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SNU 4262H	Veh. Inspected	SNN 3747U
	Policy No.	DMPCSNW00137762400	Coverage (\$)	0.00
	Claim No.	SNM24D206879	Excess (\$)	0.00
	Assign From		Assign Date	06/12/2024
2. Vehicle Particulars & Condition				
	Make & Model	VOLKSWAGEN JETTA	c.c	1390
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	WVWZZZ16ZGM010993	Colour	WHITE
	Odometer	176297 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/40 R18	MICHELIN	6 mm
	L/H Front Tyre	225/40 R18	MICHELIN	6 mm
	R/H Rear Tyre	225/40 R18	MICHELIN	6 mm
	L/H Rear Tyre	225/40 R18	MICHELIN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION AND UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	05/12/2024	Inspection Date	06/12/2024
	Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNN 3747U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DEFORMED	1,387.50	1,387.50
2	FRONT BUMPER SIDE RETAINER @\$124.20	CRACKED	248.40	248.40
1	FRONT BUMPER NOZZLER LH	NOT NECESSARY	285.30	-
1	FRONT BUMPER NOZZLER COVER LH	NOT NECESSARY	78.60	-
1	FRONT BUMPER PARKING SENSOR LH	NOT NECESSARY	451.20	-
1	FRONT BUMPER PARKING SENSOR HOLDER @\$78.00	NOT NECESSARY	156.00	-
1	FRONT BUMPER FOG LAMP LH	CRACKED	385.00	385.00
1	FRONT BUMPER FOG LAMP COVER LH	CUT	188.00	188.00
1	FRONT BUMPER FOG LAMP LOWER GARNISH LH	CUT	196.00	196.00
1	FRONT BUMPER SPONGE	CRACKED	198.20	198.20
1	FRONT GRILLE C/W CHROME	NOT NECESSARY	2,473.77	-
1	FRONT GRILLE LOGO	NOT NECESSARY	169.81	-
1	HEADLAMP LH	CRACKED	2,864.30	2,864.30
1	HEADLAMP BRACKET LH	NOT NECESSARY	58.69	-
1	FRONT FENDER LH	DENTED	695.77	695.77
1	FRONT FENDER SUPPORT BRACKET LH	BENT	185.20	185.20
1	FRONT FENDER INNER COWLING LH	TORN	233.97	233.97
1	FRONT ABS SENSOR LH	NOT NECESSARY	195.33	-
1	FRONT STEERING RACK AND PINION	NOT NECESSARY	4,380.89	-
1	FRONT KNUCKLE ARM LH	DAMAGED	870.99	870.99
1	FRONT KNUCKLE ARM BEARING LH	DAMAGED	531.60	340.00
1	FRONT LOWER ARM LH	BENT	560.70	560.70
1	FRONT STABILIZER BAR LINKAGE LH	NOT NECESSARY	138.70	-
1	DRIVE SHAFT LH	NOT NECESSARY	2,400.71	-
1	FRONT SHOCK ABSORBER LH	NOT NECESSARY	764.80	-
	LESS 10% DISCOUNT		-2,009.94	-835.40
			18,089.49	7,518.63
1	FRONT WHEEL RIM LH (SN)	CUT	1,680.00	680.00

Report Ref No. CD/CTI24120377/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-168.00	-
			1,512.00	680.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET FRONT BUMPER UNDER COVER CLIP (SN)	NOT NECESSARY	50.00	-
1	SET FRONT GRILLE (UPPER) CLIP (SN)	NOT NECESSARY	50.00	-
1	SET FRONT FENDER INNER COWLING CLIP RH (SN)	NECESSARY	80.00	30.00
1	FRONT WHEEL TYRE RH (SN)	NOT NECESSARY	480.00	-
1	SET WHEEL CAP (SN)	NOT NECESSARY	100.00	-
1	BRAKE OIL (SN)	NOT NECESSARY	30.00	-
			870.00	60.00
	<u>LABOUR</u>			
	PANEL BEATING ,REMOVING AND REPLACING PARTS .		1,200.00	500.00
	SPRAY PAINTING TO AFFECTED AREA.		1,000.00	400.00
	TUFF COAT.	NOT NECESSARY	250.00	-
	WIRING CHECK.		80.00	30.00
	REFOCUS HEADLAMP BEAM.	NOT NECESSARY	80.00	-
	REMOVE AND REFIX FRONT UNDERCARRIAGE.		650.00	200.00
	FOUR WHEEL ALIGNMENT.		120.00	80.00
	REMOVE AND REFIX FRONT BUMPER SENSOR AND DISTANCE SETTING.		180.00	50.00
	RESET ABS LIGHT.	NOT NECESSARY	350.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	650.00	-
			4,560.00	1,260.00
GRAND TOTAL			25,031.49	9,518.63

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,600.00
---	--	--	-----------------

Report Ref No. CD/CTI24120377/Aua3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 1 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 5 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 8 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U




PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U

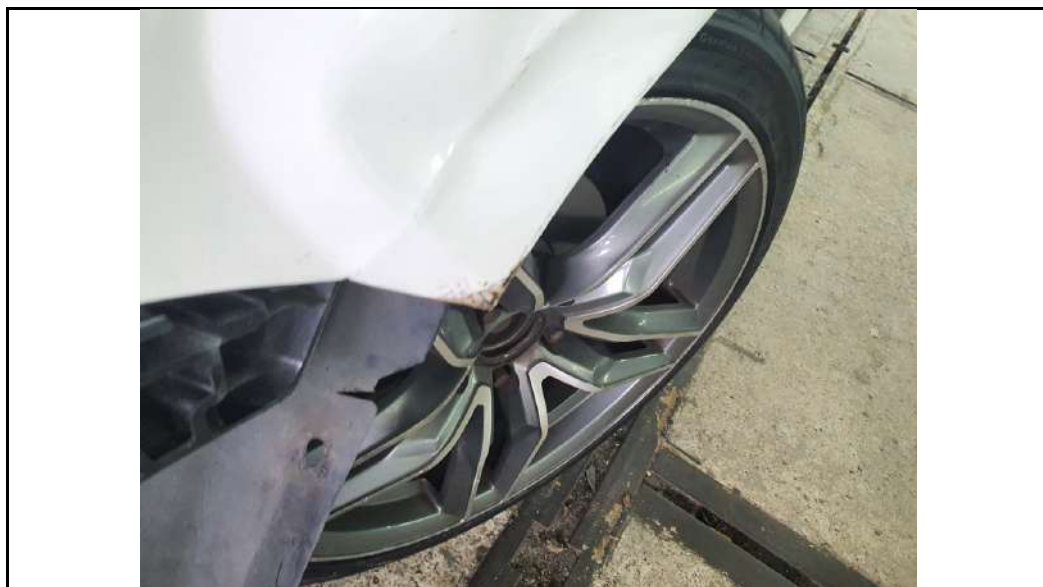



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 6 of 6)

PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U



PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.

19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SNN 3747U

