

KY AUTO PTE. LTD
25 KAKI BUKIT ROAD 4
#05-23 SYNERGY@KB

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
Repairer Reference: 074732
Date calculated: 09/01/2025 5:03 PM

Full Report
Registration: SNT1640A
Printed: 09/01/2025 5:03 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KY AUTO	Currency:	SGD
Claim Reference:	SNM24D206572/ SNT1640A/C01/TAYHP	Date of Incident:	20/11/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	AVANTE (CN7)
Sub Model:	AVANTE
Model Sheet Number:	30 1L 15
Registration:	SNT1640A

VIN number:
Odometer:

Model Specs

1.6 LTR 66 KW	6-SPEED DCT	TWO COAT METALLIC	PREPARE OFF VEHICLE
---------------	-------------	-------------------	---------------------

Steve (LKK) 27/12/24, 11.00am

DD- N21 BUL

Excess - ?

P/P

by Bef spy

Repr limit \$60K

20 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
Repairer Reference: 074732
Date calculated: 09/01/2025 5:03 PM

Full Report
Registration: SNT1640A
Printed: 09/01/2025 5:03 PM

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

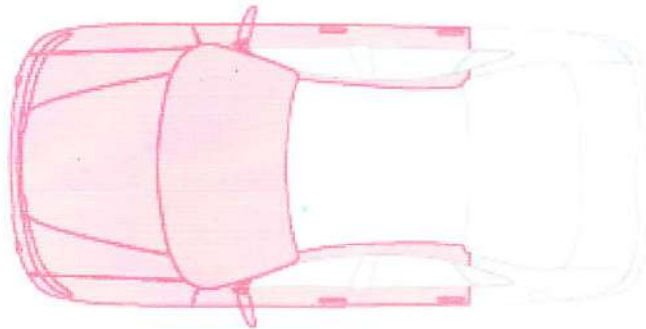

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
52904A00	ALIGNMENT CPL BEFORE REPAIR		7.0	31.50
52902A00	ALIGN FRONT AND REAR (W/O ADJUSTMENTS)		10.0	45.00
52902A00	ALIGN COMPL VEHICLE (INCL FRT ADJUSTM)		10.0	45.00
18600A00	ADD WORK FOR H-LAMP LEVEL CONTROL		3.0	13.50
NO NUMBER	R + R L/F AXLE HALF		16.0	72.00
NO NUMBER	R + R R/F AXLE HALF		16.0	72.00
NO NUMBER	R + R FRONT PANEL		16.0	72.00
NO NUMBER	RENEW L/F S-MEMBER REINF FRONT SECTION		5.0	22.50
NO NUMBER	RENEW R/F S-MEMBER REINF FRONT SECTION		5.0	22.50
NO NUMBER	RENEW LEFT FRONT WHEEL HOUSE BRACKET		17.0	76.50
NO NUMBER	RENEW RIGHT FRONT WHEEL HOUSE BRACKET		17.0	76.50
NO NUMBER	ADD/WORK FOR SEALING BONNET		3.0	13.50
79110R0B)	R + R BOTH BONNET HINGES		5.0	22.50
66400R00	RENEW BONNET		8.0	36.00
	INCLUDES: R + R AND ADJUST BONNET			
86111R00	R + R FRONT SCREEN		25.0	112.50
	INCLUDES: INNER MIRROR, BOTH A-PILLAR TRIMS, COWL GRILLE			

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
 Repairer Reference: 074732
 Date calculated: 09/01/2025 5:03 PM

Full Report
 Registration: SNT1640A
 Printed: 09/01/2025 5:03 PM

Code	Description	WU	Price SGD
	AND WIPER ARM REMOVE AND REFIT		
81170R00	R + R BONNET STAY	2.0	9.00
98120R00	R + R WIPER LINKAGE	3.0	13.50
92000R0B)	R + R BOTH HEADLAMPS CPL	2.0	9.00
66300R0B	RENEW BOTH FRONT WINGS (BUMPER REMOVED) INCLUDES: BOTH FRONT WINGS R + R AND REQUIRED ATTACHED PARTS ASSEMBLE	17.0	76.50
85310R00)	R + R HEADLINING	29.0	130.50
88810R00	R + R LEFT FRONT SEAT BELT	4.0	18.00
82300R00	R + R PARTS OF THE L/F DOOR TRIM	3.0	13.50
82411R00)	R + R LEFT FRONT DOOR WINDOW	1.0	4.50
81310R00)	R + R L/F DOOR LOCK	2.0	9.00
82000A00	R + R L/FR WINDOW LIFT ASS-WORK	3.0	13.50
88810R0R	R + R RIGHT FRONT SEAT BELT	4.0	18.00
82300R0R	R + R RIGHT FRONT DOOR TRIM	3.0	13.50
82411R0R)	R + R R/F DOOR WINDOW	1.0	4.50
81310R0R)	R + R R/F DOOR LOCK	2.0	9.00
82000A0R	R + R R/FR WDW LIFT ASS-WORK	3.0	13.50
84710R00)	RENEW DASHBOARD	20.0	90.00
66540R00)	R + R INSTRUMENT PANEL SUPPORT	21.0	94.50
95910R00	R + R AIRBAG CONTROL UNIT	4.0	18.00
28100R00	R + R AIR CLEANER CPL	3.0	13.50
28310R1H)	R + R AIR INTAKE MANIFOLD	6.0	27.00
NO NUMBER	R + R ENGINE COVER	1.0	4.50
35002A00	R + R ADD/WORK THROTTLE BODY UNIT	4.0	18.00
41066R00	R + R COOLANT EXPANSION TANK	7.0	31.50
41066A00	CLUTCH FLUID FILL	5.0	22.50
36910R00	R + R ELECTRIC WATER PUMP	9.0	40.50
NO NUMBER	DRAIN + REFILL ENGINE OIL	5.0	22.50
43760R00)	R + R GEAR SHIFT CABLE	9.0	40.50
25300R1H)	R + R RADIATOR	21.0	94.50
25411R00	R + R WATER PIPE	4.0	18.00
97701R00)	R + R AIR CONDITIONING COMPRESSOR ADD	2.0	9.00
97763R00)	R + R COMPRESSOR-EVAPORATOR	2.0	9.00
97762R00	R + R COMPRESSOR-/CONDENSER HOSE	5.0	22.50
25431R00	R + R REFRIGERANT CONTAINER	2.0	9.00
23001A00	DRAIN/REFILL COOLING SYSTEM	5.0	22.50
NO NUMBER	DETACH + REFIT EXHAUST SYSTEM	1.0	4.50
58700A00ZAX	VENT FRONT BRAKE SYSTEM	3.0	13.50
NO NUMBER	R + R FRONT AXLE MEMBER	7.0	31.50
79300A00	ADJUST FRONT DOOR LOCK	2.0	9.00
98000A00	R + R WIPER BLADE/ARM ASS-WORK	2.0	9.00
88810RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
94002RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
56910RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
93490RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
96600R0A	R + R HORN (ADD/WORK)	2.0	9.00
95910RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
95930RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
56920RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
97701RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
28310RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
35100RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
 Repairer Reference: 074732
 Date calculated: 09/01/2025 5:03 PM

Full Report
 Registration: SNT1640A
 Printed: 09/01/2025 5:03 PM

Code	Description	WU	Price SGD
36910RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	13.50
NN	FRONT BUMPER R&R / NEW PARTS	X 980.0*	4,410.00
1013	L/UPPER FRONT PANEL REPAIR	X 30.0*	135.00
1014	R/UPPER FRONT PANEL REPAIR	X 30.0*	135.00
1117	L/F WHEELHOUSE REPAIR	20 30.0*	135.00
1118	R/F WHEELHOUSE REPAIR	20 30.0*	135.00
1122	R/F W-HOUSE REINF REPAIR	10 30.0*	135.00
1201	L/F SIDE MEMBER REPAIR	20 30.0*	135.00
1202	R/F SIDE MEMBER REPAIR	20 30.0*	135.00
1481	LEFT FRONT DOOR REPAIR	X 20.0*	90.00
1482	RIGHT FRONT DOOR REPAIR	X 20.0*	90.00
2227	L/F OUTER DOOR FRAME REPAIR	X 50.0*	225.00
2228	R/F OUTER DOOR FRAME REPAIR	X 50.0*	225.00
2351	ROOF REPAIR	X 40.0*	180.00
4429	L/LWR HEATER HOUSING CHECK		
4430	R/LWR HEATER HOUSING CHECK		
4455	AIR CON COMPRESSOR CHECK		
8863	GEARBOX HOUSING CHECK		
8884	CLUTCH HOUSING CHECK		
8903	DIFFERENTIAL HOUSING CHECK		
8915	UPPER GEARBOX BRKT CHECK		

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	177.00	1,770.0	7,965.00
Alignment			
Measuring Work	2.70	27.0	121.50
Total of Labour			8,086.50

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT CTR BUMPER BRKT SURFACE PAINT	4.0
	L/HEADLAMP SUPPORT SURFACE PAINT	4.0
	R/HEADLAMP SUPPORT SURFACE PAINT	4.0
	L/W-HOUSE SUPPORT SURFACE PAINT	4.0
	R/W-HOUSE SUPPORT SURFACE PAINT	4.0
	L/F SIDE MEMBER FRT SURFACE PAINT	4.0
	R/F SIDE MEMBER FRT SURFACE PAINT	4.0
	FRONT BUMPER NEW PART PAINT K1R	12.0
	FRT BUMPER PROT CVR NEW PART PAINT K1R	4.0
	L/F OUTER DOOR FRAME REPAIR PAINTING <50%	15.0
	BONNET REPAIR PAINTING >50%	41.0
	L/F WING REPAIR PAINTING >50%	13.0
	R/F WING REPAIR PAINTING >50%	13.0
	LEFT FRONT DOOR REPAIR PAINTING >50%	25.0
	L/R DOOR REPAIR PAINTING >50%	23.0
	L/R OUT QTR PANEL REPAIR PAINTING >50%	21.0
	RIGHT FRONT DOOR REPAIR PAINTING >50%	25.0
	R/R DOOR REPAIR PAINTING >50%	23.0
	R/R OUT QTR PANEL REPAIR PAINTING >50%	21.0
	L/UPPER FRONT PANEL SURFACE PAINT	4.0
	R/UPPER FRONT PANEL SURFACE PAINT	4.0
	L/F WHEELHOUSE SURFACE PAINT	6.0

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
 Repairer Reference: 074732
 Date calculated: 09/01/2025 5:03 PM

Full Report
 Registration: SNT1640A
 Printed: 09/01/2025 5:03 PM

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	R/F WHEELHOUSE SURFACE PAINT	6.0
	R/F W-HOUSE REINF SURFACE PAINT	5.0
	L/F SIDE MEMBER SURFACE PAINT	6.0
	R/F SIDE MEMBER SURFACE PAINT	6.0
	R/F OUTER DOOR FRAME SURFACE PAINT	7.0
	ROOF SURFACE PAINT	13.0
	UPP BUMPER MOULDING SPOT PAINTING	9.0

Paint Material Per Part

Code	Description	Price SGD
0341	FRT CTR BUMPER BRKT SURFACE PAINT	3.74
1011	L/HEADLAMP SUPPORT SURFACE PAINT	1.25
1012	R/HEADLAMP SUPPORT SURFACE PAINT	1.25
1119	L/W-HOUSE SUPPORT SURFACE PAINT	1.99
1120	R/W-HOUSE SUPPORT SURFACE PAINT	1.99
1203	L/F SIDE MEMBER FRT SURFACE PAINT	1.25
1204	R/F SIDE MEMBER FRT SURFACE PAINT	1.25
0283	FRONT BUMPER NEW PART PAINT K1R	55.10
0295	FRT BUMPER PROT CVR NEW PART PAINT K1R	4.92
2227	L/F OUTER DOOR FRAME REPAIR PAINTING <50%	22.61
0471	BONNET REPAIR PAINTING >50%	67.15
0741	L/F WING REPAIR PAINTING >50%	9.48
0742	R/F WING REPAIR PAINTING >50%	9.48
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	34.76
1781	L/R DOOR REPAIR PAINTING >50%	29.63
3485	L/R OUT QTR PANEL REPAIR PAINTING >50%	25.68
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	34.76
1782	R/R DOOR REPAIR PAINTING >50%	29.63
3486	R/R OUT QTR PANEL REPAIR PAINTING >50%	25.68
1013	L/UPPER FRONT PANEL SURFACE PAINT	3.74
1014	R/UPPER FRONT PANEL SURFACE PAINT	3.74
1117	L/F WHEELHOUSE SURFACE PAINT	13.45
1118	R/F WHEELHOUSE SURFACE PAINT	13.45
1122	R/F W-HOUSE REINF SURFACE PAINT	4.98
1201	L/F SIDE MEMBER SURFACE PAINT	11.95
1202	R/F SIDE MEMBER SURFACE PAINT	11.95
2228	R/F OUTER DOOR FRAME SURFACE PAINT	17.43
2351	ROOF SURFACE PAINT	44.82
0313	UPP BUMPER MOULDING SPOT PAINTING	2.55

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	45.00 SGD/h		
Time Paint		330.0	
Preparation Main Work Metal	2.50	25.0	112.50
Preparation Comp. Work Plastic	0.50	5.0	22.50
Total	10 WU/h	36.00	360.0
			1,620.00

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
 Repairer Reference: 074732
 Date calculated: 09/01/2025 5:03 PM

Full Report
 Registration: SNT1640A
 Printed: 09/01/2025 5:03 PM

Material Cost - Paint

New Part Painting - Plastic K1R	60.02
Repair Painting	288.86
Surface-/Blend Paint	138.23
Spot Painting	2.55
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	527.26

Spare Parts

					prices as at 2001-01-01
Code	Description	Part Number	Part Source		Price SGD
6909	A/C REFRIGERANT (gas)	KNAC01	Original	✓ DR	120.00
7762	ADD COOLER (condenser)	25310BY100	Original	✓ DR	850.00
7440	AIRBAG CONTROL UNIT	95910AA350	Original	✓ DR	1,200.00
4465	AIR CON CONDENSER	97606AA010	Original	✓ DR	650.00
9986	AIR CON COOLANT	NO NUMBER	Original	X	100.00
8391	AIR FILTER ASSY	28110BY150	Original	✓ BR	680.00
0471	BONNET	66400AA000	Original	✓ DR	1,200.00
0499	BONNET CABLE	81190AA800	Original	X	360.00
0513	BONNET CABLE	64158J3000	Original	✓ TN	45.00
	BRACKET				
0481	BONNET INSULATION	81125AA000	Original	✓ TN	480.00
0492	BONNET LOCK	81130AA900	Original	✓ ST	480.00
0495	BONNET STAY	81170AA000	Original	✓ BR	220.00
0731	BULBS	NO NUMBER	Original	✓ BR	100.00
4484	COMPR/CONDENSER	97762BY110	Original	?	240.00
	HOSE				
4483	COMPR/EVAP HOSE	97777BY210	Original	?	340.00
6903	COOLANT/ANTIFREEZE	KNCW01	Original	X	140.00
9987	COOLANT/ANTIFREEZE	NO NUMBER	Original	X	120.00
6989	COOLANT DILUTED	KNCW01	Original	X	150.00
8408	COOLANT TANK	254R0BY700	Original	✓ BR	350.00
1393	COWL PANEL COVER	86150AA900	Original	✓ BR	850.00
7445	DRIVER AIRBAG	80100AA600NNB	Original	✓ BR	2,300.00
7950	ELEC WATER PUMP MOT	369102BKB0	Original	?	220.00
7940	ENGINE COVER	292402J000	Original	X	380.00
1000	ENGINE MOUNTING LH	ENGINE MOUNTING	Original	?	400.00
1001	ENGINE MOUNTING RH	ENGINE MOUNTING	Original	✓ BR	400.00
6900	ENGINE OIL	KNEO06	Original	X	120.00
7787	EXPANSION TANK	25430BY000	Original	✓ BR	280.00
7795	FAN MOTOR CPL	25380BY100	Original	✓ BR	580.00
0283	FRONT BUMPER	86511AAAA0	Original	✓ BR	0.00
0315	FRONT IMPACT DAMPER	86520AAAA0	Original	✓ BR	280.00
0431	FRONT MANUFACT	86311AAAA0	Original	✓ DR	85.00
	BADGE				
0257	FRONT NUMBER PLATE	KNPL3	Original	✓ BR	25.00
0295	FRT BUMPER PROT CVR	86512AAAA0	Original	X	850.00
0340	FRT BUMPER SUPPORT	64900AA500	Original	✓ BR	880.00
0341	FRT CTR BUMPER BRKT	86571AAAA0	Original	✓ BR	680.00
0258	FRT NO PLATE REINF	KNPL0	Original	✓ BR	65.00
1003	FRT SEAT AIRBAG LH	FRT SEAT AIRBAG	Original	✓ BR	1,100.00
1004	FRT SEAT AIRBAG RH	FRT SEAT AIRBAG	Original	✓ BR	1,100.00
8991	GEAR CHANGE CABLE	46790BY100	Original	?	1,200.00
0410	GRILLE	86350AAAB0CA	Original	✓ BR	680.00
4957	HEADLINING	85310AA170TVN	Original	✓ TN	1,400.00

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
 Repairer Reference: 074732
 Date calculated: 09/01/2025 5:03 PM

Full Report
 Registration: SNT1640A
 Printed: 09/01/2025 5:03 PM

Code	Description	Part Number	Part Source	Price SGD
9645	HIGH TONE HORN	96611AA500	Original	140.00
1002	HYBRID CONTROL MODUL	HYBRID CONTROL	Original / OR	4,500.00
4331	INSTRUMENT PANEL	84710AA900NNB	Original / OR	1,480.00
8221	INTAKE MANIFOLD	2831003HB0	Original / OR	2,100.00
0475	L/BONNET HINGE	66910AA000	Original / ST	105.00
0653	L/BUMPER AIR PIPE	86545AAAA0	Original / ?	220.00
0289	L/BUMPER MOULDING	86595AAAA0	Original / ?	260.00
7437	L/F AIRBAG SENSOR	95920M6000	Original / PC	380.00
0321	L/F BUMPER BRACKET	86551AAAA0	Original / BK	85.00
0299	L/F BUMPER COVER	86563AACD0	Original / ?	120.00
0297	L/F BUMPER PANEL	86565AAAA0	Original / ?	120.00
0285	L/F BUMPER SUPPORT	865E3AAAA0	Original / ?	85.00
1453	L/FR WIPER ARM	98311AA900	Original X	160.00
4661	L/F SEAT BELT	88810AA200TVN	Original / Jammed	850.00
1203	L/F SIDE MEMBER FRT	64575AA000	Original X R	160.00
0355	L/F UPP BUMPER BRKT	865E1AAAA0	Original X R	85.00
0841	L/F WHEELHOUSE COVER	86811AAAA0	Original X R / OR	145.00
0741	L/F WING	66310AA500	Original / DO	720.00
1457	L/F WIPER BLADE	98360AA900	Original X	35.00
1011	L/HEADLAMP SUPPORT	64117AA000	Original / OR	120.00
7771	L/LWR RAD RUBB MOUNT	25336AA000	Original / PC	20.00
7755	L/RADIATOR AIR GUIDE	29136BY500	Original / OR	75.00
4941	L/UPP A-PILLAR TRIM	85810AA000TVN	Original X	420.00
7769	L/UPP RADIATOR BRKT	253S3AA100	Original / OR	30.00
1119	L/W-HOUSE SUPPORT	64577AA500	Original X R	65.00
1423	L/WINDSCREEN MLDG	86130AA000	Original / PC	95.00
0561	LEFT HEADLAMP ASSY	92101AA620	Original / OR	2,850.00
8783	LOWER ENGINE COVER	29110AA000	Original / ?	480.00
7773	LOWER RADIATOR HOSE	25415G2000	Original / ?	90.00
0292	LWR BUMPER GRILLE	86531AAAA0CA	Original / ?	1,150.00
4325	PASSENGER AIRBAG	80300AA000	Original / OR	1,800.00
7951	PUMP INTAKE PIPE	369202BKB3	Original / ?	45.00
0476	R/BONNET HINGE	66920AA000	Original / ?	105.00
0654	R/BUMPER AIR PIPE	86546AAAA0	Original / ?	220.00
0290	R/BUMPER MOULDING	86596AAAA0	Original / ?	260.00
7438	R/F AIRBAG SENSOR	95920M6000	Original / PC	380.00
0322	R/F BUMPER BRACKET	86552AAAA0	Original / OR	85.00
0298	R/F BUMPER PANEL	86566AAAA0	Original / OR	120.00
0286	R/F BUMPER SUPPORT	865E4AAAA0	Original / OR	85.00
1454	R/FR WIPER ARM	98321AA900	Original X	160.00
4662	R/F SEAT BELT	88820AA700TVN	Original / Jammed	850.00
1204	R/F SIDE MEMBER FRT	64585AA000	Original X R	160.00
0356	R/F UPP BUMPER BRKT	865E2AAAA0	Original X R	85.00
0842	R/F WHEELHOUSE COVER	86812AAAA0	Original X R / OR	145.00
0742	R/F WING	66320AA500	Original / DO	720.00
1458	R/F WIPER BLADE	983502T900	Original X	35.00
1012	R/HEADLAMP SUPPORT	64127AA000	Original / OR	120.00
7772	R/LWR RAD RUBB MOUNT	25336AA000	Original / PC	20.00
7756	R/RADIATOR AIR GUIDE	29134BY500	Original / OR	75.00
4942	R/UPP A-PILLAR TRIM	85820AA000TVN	Original X	420.00
7770	R/UPP RADIATOR BRKT	253S3AA100	Original / OR	30.00

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
 Repairer Reference: 074732
 Date calculated: 09/01/2025 5:03 PM

Full Report
 Registration: SNT1640A
 Printed: 09/01/2025 5:03 PM

Code	Description	Part Number	Part Source	Price SGD
1120	R/W-HOUSE SUPPORT	64587AA500	Original <i>X R</i>	65.00
7761 <i>N/A 2</i>	RADIATOR <i>OD</i>	253E0BY100	Original <i>- M</i>	800.00
0500	REAR BOWDEN CABLE	81185AA900	Original <i>X</i>	220.00
8404	RESONATOR TUBE	28212BY600	Original <i>X</i>	0.00
0562	RIGHT HEADLAMP ASSY	92102AA620	Original <i>- BR</i>	2,850.00
1005	ROOF SIDE AIRBAG LH	ROOF AIRBAG RH	Original <i>- BR</i>	1,500.00
1006	ROOF SIDE AIRBAG RH	ROOF AIRBAG RH	Original <i>- BR</i>	1,500.00
7775	RR UPP RADIATOR HOSE	25414BY000	Original <i>- ?</i>	60.00
6963	SPRINGS/HINGES	NO NUMBER	Original <i>- ?</i>	100.00
7409	S-WHEEL CONTACT RING	93490AA130	Original <i>- ?</i>	650.00
7791	TANK WATER HOSE	25450BY000	Original <i>- ?</i>	60.00
7792	TANK WATER HOSE	25450S7700	Original <i>- ?</i>	60.00
8149	THROTTLE BODY	3510003HA0	Original <i>- BR</i>	3,800.00
0409	UP/CVR RADIAT GRILLE	86391AAAA0	Original <i>- BR</i>	380.00
0313	UPPER BUMPER MOULDING	86599AAAA0	Original <i>- BR</i>	380.00
1009	UPPER FRONT PANEL	64101AA500	Original <i>- BR</i>	680.00
0413	UPPER GRILLE TRIM	86370AAAA0	Original <i>- BR</i>	560.00
1436	WASHER CONTAINER	98611AA500	Original <i>- BR</i>	220.00
1401	WINDSCREEN	86111BY070	Original <i>- BR</i>	1,300.00
1411	WINDSCREEN BOND KIT	ZK20063001A	Original <i>- BR</i>	100.00
1421	WINDSCREEN MOULDING	86121AA000	Original <i>- BR</i>	95.00
1437	W-SCREEN WASHER PUMP	985103T500	Original <i>- ?</i>	110.00
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 60,255.00
u: Used parts				Fixed Sundry Parts Price 200.00
				Addition(+10.00%) 6,025.50
Total				66,480.50

Insurer Reference: SNM24D206572/SNT1640A/C01/TAYHP
Repairer Reference: 074732
Date calculated: 09/01/2025 5:03 PM

Full Report
Registration: SNT1640A
Printed: 09/01/2025 5:03 PM

Final Calculation

	SGD	SGD
Parts	60,255.00	
Fixed Sundry Parts Price	200.00	
Addition(+10.00%)	6,025.50	
Total Parts		66,480.50
Labour Time Base 10 WU/h		
Total 1,770.0 WU X 45.00 SGD/h	7,965.00	
Alignment		
Measuring Work	121.50	
Total of Labour		8,086.50
Paint Work Time Base 10 WU/h		
Labour Cost 360.0 WU X 45.00 SGD/h	1,620.00	
Material Cost	527.26	
Total Paint Including Material		2,147.26
Repair Cost Excludes GST		76,714.26
GST (+9.00%)		6,904.28
Repair Cost Included GST		83,618.54

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.