

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk 10, #01-20
575645



Insurer Reference:
Repairer Reference: 074695
Date calculated: 23/12/2024 9:51 PM

Full Report
Registration: SNL7992L
Printed: 23/12/2024 9:51 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	15/12/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	BMW
Model:	3-SERIES F30N
Sub Model:	330I
Model Sheet Number:	01 AF 06
Registration:	SNL7992L
VIN number:	WBA8A76040NU06833
Odometer:	109856

Model Specs
FROM 03.2016
AIR CON AUTO 2-ZONES
COMFORT ACCESS SYST
LED HEADLAMP
HANDS FREE CONV SYST
SHELF PACKAGE
DIP REAR VIEW MIRROR
SPORT S-WHEEL LEATH
WHEELS 8/8.5JX18 ALU
TYRE W/FLAT RUNNING

LED FOG LAMPS
WINDSCREEN RAIN SENS
DIP REAR VIEW MIRROR
LIGHT PACKAGE
ELEC/SEAT ADJ MEMORY
FRT SLIDING ARMREST
FRT/RR PARK DIST CON
8-SPEED AUTOMATIC
WINDOW FRAME BLACK

SPORT LINE
COMPRESSION MODEL
NAVIG SYST BUSINESS
DAKOTA LEATHER TRIM
INSTR CLUSTER EXTEND
CRUISE CONTROL
REARVIEW CAMERA
SERVOTRONIC
INT MOULDINGS ALUMIN

THROUGH LOAD SYSTEM
O2 VOLUME
HI-FI SPEAKER SYSTEM
FRT SPORT SEATS
ALARM SWITCH
HEAD-UP DISPLAY
1998CCM 185KW
225/45-/255/40 R18 Y
TWO COAT METALLIC

Not Authorized
1/1 Rmp &
Repairing After Rain
5 days *Ex 850h*

Insurer Reference:
Repairer Reference: 074695
Date calculated: 23/12/2024 9:51 PM


Full Report
Registration: SNL7992L
Printed: 23/12/2024 9:51 PM

Vehicle Condition

Vehicle Status
Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

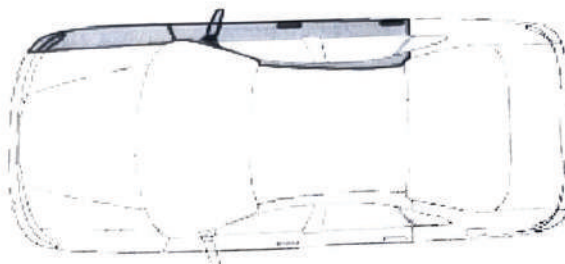

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK		2.0	7.00
41 35 555)	RENEW R/F WING		9.0	31.50
	INCLUDES: R + R WHEELHOUSE COVER			
	DOES NOT INCLUDE: R + R SILL MOULDING			
51 71 947	R + R R/SILL MOULDING		4.0	14.00
41 51 580	R + R RIGHT FRONT DOOR		3.0	10.50
67 62 505	R + R R/F WINDOW REGULATOR MOTOR		1.0	3.50
	(WINDOW REGULATOR REMOVED)			
41 52 580	R + R RIGHT REAR DOOR		3.0	10.50
41 51 563	ADJUST BOTH R/DOORS		4.0	14.00
41 51 562	RENEW BOTH R/DOORS (REMOVED)		72.0	252.00
51 22 830)	R + R R/R INNER WINDOW CHANNEL MOULDING		1.0	3.50
	DOES NOT INCLUDE: R + R DOOR TRIM			
67 62 525	R + R R/R WINDOW REGULATOR MOTOR		1.0	3.50
	(WINDOW REGULATOR REMOVED)			

Insurer Reference:
Repairer Reference: 074695
Date calculated: 23/12/2024 9:51 PM

Full Report
Registration: SNL7992L
Printed: 23/12/2024 9:51 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

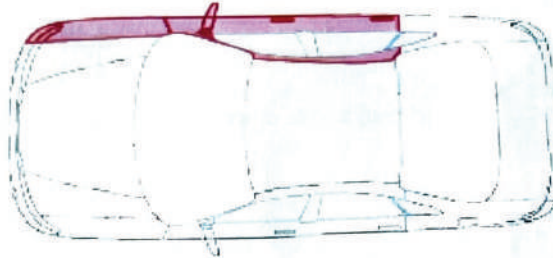

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK		2.0	7.00
41 35 555)	RENEW R/F WING		9.0	31.50
	INCLUDES: R + R WHEELHOUSE COVER			
	DOES NOT INCLUDE: R + R SILL MOULDING			
51 71 947	R + R R/SILL MOULDING		4.0	14.00
41 51 580	R + R RIGHT FRONT DOOR		3.0	10.50
67 62 505	R + R R/F WINDOW REGULATOR MOTOR (WINDOW REGULATOR REMOVED)		1.0	3.50
41 52 580	R + R RIGHT REAR DOOR		3.0	10.50
41 51 563	ADJUST BOTH R/DOORS		4.0	14.00
41 51 562	RENEW BOTH R/DOORS (REMOVED)		72.0	252.00
51 22 830)	R + R R/R INNER WINDOW CHANNEL MOULDING		1.0	3.50
	DOES NOT INCLUDE: R + R DOOR TRIM			
67 62 525	R + R R/R WINDOW REGULATOR MOTOR (WINDOW REGULATOR REMOVED)		1.0	3.50

Insurer Reference:
Repairer Reference: 074695
Date calculated: 23/12/2024 9:51 PM

Full Report
Registration: SNL7992L
Printed: 23/12/2024 9:51 PM

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	8.30	100.0	350.00
Total of Labour			350.00

Paint

Paint Work

Code	Description - TWO COAT METALLIC	Time Basis 12 WU/h	WU	Price SGD
99 35 519	R/F WING PAINTING STAGE 2		7.0	24.50
99 51 548	RIGHT FRONT DOOR PAINTING STAGE 2		17.0	59.50
99 52 548	R/R DOOR PAINTING STAGE 2		14.0	49.00
99 99 000	ADDITIONAL TIME FOR ONE MAIN WORK INCLUDES: MIX COLOUR AND SPRAY COLOUR SAMPLE		21.0	73.50

	Hrs	WU	Price SGD
Total Paint	4.90	59.0	206.50

Material Cost - Paint

New Part Painting

Material-constant Metal

Total

Price SGD
140.00
13.47
153.47

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2024-05-17	Price SGD
1839	CLEANER R1	83 19 2 211 217			26.15 ?
1837	QTR WINDOW SEAL KIT	83 19 2 289 285			131.55 ✓
1510	R/F DOOR SEAL	51 33 7 258 329	Original		180.00 ?
0846	R/F LIP	51 71 7 260 740	Original		95.00 ?
0842	R/F WHEELHOUSE COVER	51 71 7 260 726	Original		155.00 ✓
0844	R/F W-HOUSE RR COVER	51 71 4 529 628	Original		125.00 ?
1552	R/F WINDOW MOTOR	67 62 7 406 624	Original		350.00 ?
1548	R/F WINDOW REGULATOR	51 33 7 281 886	Original		302.70 ?
0742	R/F WING	41 00 9 621 598	Original		820.00 ✓
1782	R/R DOOR	41 00 7 298 514	Original		1,530.00 ✓
1810	R/R DOOR SEAL	51 35 7 258 330	Original		230.00 ✓
1852	R/R WINDOW MOTOR	67 62 7 341 564	Original		350.00 x
1848	R/R WINDOW REGULATOR	51 35 7 281 888	Original		242.15 ✓
1482	RIGHT FRONT DOOR	41 00 7 298 566	Original		1,530.00 ✓

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings

Subtotal

Total

0.00
6,067.55
6,067.55

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Audatex System Using Manufacturer Times

Acknowledged by Repairer

Signature:

Date:

PRINT DATE 23/12/2024

Insurer Reference:
Repairer Reference: 074695
Date calculated: 23/12/2024 9:51 PM

Full Report
Registration: SNL7992L
Printed: 23/12/2024 9:51 PM

Final Calculation

	SGD	SGD
Parts	6,067.55	6,067.55
Total Parts		
Labour Time Base 12 WU/h	350.00	350.00
Total 100.0 WU X 42.00 SGD/h		
Total of Labour		
Paint Work Time Base 12 WU/h	206.50	
Labour Cost 59.0 WU X 42.00 SGD/h	153.47	
Material Cost		359.97
Total Paint Including Material		6,777.52
Repair Cost Excludes GST		609.98
GST (+9.00%)		7,387.50
Repair Cost Included GST		
Deductions (Excludes GST)	-1,050.00	-1,050.00
Deduction For Excess		
Total Of Deductions (Excludes GST)		5,727.52
Grand Total Excludes GST		515.48
GST (+9.00%)		6,243.00
Grand Total Included GST		

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.