

(08/11/13) wef
ASS. REC. BY:

REF: CS/SMR24070072/Rvp3


787A

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / (P) / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: SNL 6080A
at Workshop m/s VANTAGE
of ALEXANDRA RD
Insured: SMR
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

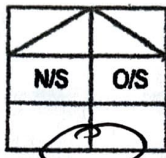

Bal. or Market Value: 146k
IDAC Accident Report: Consistent?: Yes or No
GIA / PR Seen: Consistent?: Yes or No
Est. Repairs: _____ days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SNL 6080A Yr Regn: 2023 July
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or

Make: BYD ATTO 3 100KW SR c.c. _____
Colour: GRGY AC: Insured / Std / NI / NA
Sp. Reading: 20524 T/Radio: Insured / Std / NI / NA
Eng/No: _____

C/No: LHXC4CB6P2145662

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / 2/Rim / STD A/Rim or

Tyre Size: F: 215/55R18
R: 1.

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or ATLAS

Front		Rear	
R/Bal.	<u>6</u> mm	R/Bal.	<u>6</u> mm
L/Bal.	<u>6</u> mm	L/Bal.	<u>6</u> mm
D.O.A.	<u>28/02/24</u>	D.O.I.	<u>22/08/24</u>
Survey held at	<u>ALEXANDRA</u>		

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REGAM LIMIT - 60K

Date/Time, File Pass to?

☐
☐

: Preli. Report

: Final Report

1) _____
Date/Time, File Return to?

2) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Tech. Invs (\$ _____)

☐ : Weekend (\$ _____)

) S + RS \$ _____

) Photos

) Others

TOTAL

Report Format : _____

Lump Sum / I.B.I: (\$ _____)

305 Alexandra Road
159942 Singapore

Tel : 6376 8833
Fax : 6477 7398

GST Registration No. M2-0000551-1

ESTIMATE



Estimate No.

BY 6806

Date Estimated

20/08/2024

Page No. 1 of 2

Prepared By

Muhammad Danial Bin Ishak

ESTIMATE REPAIR FOR

Wee Sung Seng

29 Pennefather Road

Singapore 424449

ACCOUNT 14356

MS First Capital Insurance Limited

36 Robinson Road

#16-01 City House

Singapore 068877

REGN. NO.

SNL6080A

CHASSIS NO.

LGXCE4CB6P2145662

REGN. DATE

21/07/2023

MODEL

ATTO 3 100KW SR

MILEAGE

11416

DESCRIPTION

TO CONDUCT THIRD PARTY CLAIM AGAINST MS FIRST CAPITAL(SHF387H) DOA.25.02.24

TO REMOVE & REPLACE REAR BUMPER, REAR TAILGATE, REAR END PANEL, REAR REINFORCEMENT BEAM.

TO REPAIR/PANEL BEAT REAR FLOOR PANEL.

TO REMOVE & INSTALL REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.

TO SUPPLY & INSTALL 3M SOLAR FILM FOR REAR GLASS.

TO SUPPLY & INSTALL REAR PLATE NUMBER WITH FRAME. *de?*

TO SPRAY PAINT REAR BUMPER, REAR TAILGATE, REAR END PANEL, REAR FLOOR PANEL, REAR REINFORCEMENT BEAM. *?*

TO CONDUCT BODY CAVITY PRESERVATIONS.

TO CONDUCT ECU RE-PROGRAMMING AND CLEAR OF FAULT CODES TO ENSURE PROPER FUNCTION.

SUNDRIES.

VALUE

0.00

1200 2,450.00

? 650.00

600.00

350.00

70.00

1200 3,250.00

150 200.00

600.00

20 100.00

Total Labour 1:

8,270.00

PART NUMBER

DESCRIPTION

QTY

PRICE

DISC

VALUE

13186487-00	BRACKET - LH REAR LOWER BUMPER <i>?</i>	1	32.00	10.00	28.80
13186483-00	BRACKET - FRT LH REAR BUMPER <i>?</i>	1	31.00	10.00	27.90
13186486-00	REAR BUMPER LR BRACKET ASSY <i>?</i>	1	18.00	10.00	16.20
13161557-00	TRIM COVER OUTER LH - REAR BUMPER <i>X</i>	1	18.00	10.00	16.20
13161637-00	TRIM COVER INNER LH - REAR BUMPER <i>?</i>	1	145.00	10.00	130.50
13161517-00	TRIM OF REAR BUMPER <i>CR</i>	1	174.00	10.00	156.60
13220424-00	TRIM - LOWER SURROUND REAR BUMPER <i>cm</i>	1	250.00	10.00	225.00
13814520-00	BUMPER BODY ASSY., REAR <i>de</i>	1	1,330.00	10.00	1,197.00
10995230-00	PLATE CLIP <i>?</i>	2	3.00	10.00	5.40
11551518-00	CLIPS FOR BOARDS <i>?</i>	2	3.00	10.00	5.40
10215282-00	THROUGH-HOLE EMBEDDED PLASTIC NUT <i>?</i>	1	1.50	10.00	1.35
13186501-00	TRIM - LH REAR FENDER <i>?</i>	1	380.00	10.00	342.00
13276895-00	BUILDYOURDREAM WORD MARK ASSY <i>new</i>	1	80.00	10.00	72.00
13688366-00	ATTO WORD MARK ASSY <i>new</i>	1	23.00	10.00	20.70
13778327-00	REAR PANEL ASSEMBLY <i>?</i>	1	1,100.00	10.00	990.00
13777448-00	IMPACT BEAM., REAR <i>?</i>	1	650.00	10.00	585.00

305 Alexandra Road
159942 Singapore

Tel : 6376 8833

Fax : 6477 7398

BYD

GST Registration No. M2-0000551-1
ESTIMATE



Estimate No.

BY 6806

Date Estimated

20/08/2024

Page No. 2 of 2

Prepared By

Muhammad Danial Bin Ishak

REGN. NO.

SNL6080A

CHASSIS NO.

LGXCE4CB6P2145662

REGN. DATE

21/07/2023

MODEL

ATTO 3 100kW SR

MILEAGE

11416

PART NUMBER	DESCRIPTION	QTY	PRICE	DISC	VALUE
13777456-00	BACK DOOR ASSEMBLY <i>h/</i>	1	3,480.00	10.00	3,132.00
13171273-00	WINDSCREEN ASSY - REAR <i>m - phdu</i>	1	1,200.00	10.00	1,080.00
13195405-00	SMALL PROBE (STANDARD BLACK) ?	1	45.00	10.00	40.50
13195405-00	SMALL PROBE (STANDARD BLACK) ?	1	45.00	10.00	40.50
13401407-00	REAR BUMPER WIRE ?	1	250.00	10.00	225.00
13184243-00	LEFT REAR REFLEX REFLECTOR <i>cm/</i>	1	21.00	10.00	18.90

Total Parts : 8,356.95

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Rasul
4p 90010068
4 days
22/08/24
Rey by paint

Customer Name & Signature / Company Stamp

Date

Labour 1	S\$	8,270.00
Parts	S\$	8,356.95
Labour 2	S\$	0.00
Excess	S\$	0.00
Total GST @ 9%	S\$	1,496.43
Grand Total	S\$	18,123.38

The above estimates are base on visual inspection and it is possible that further materials and labour may be required upon dismantling. Should this occur, we will submit supplementary quotation for further approval. This estimate is valid for a period of 30 days.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	787A
Vehicle Details	
Vehicle No.:	SNL6080A
Vehicle to be Exported:	No
Intended Deregistration Date:	23 Aug 2024
Vehicle Make:	BYD
Vehicle Model:	ATTO 3 100KW SR
Primary Colour:	White
Manufacturing Year:	2023
Engine No.:	-
Chassis No.:	LGXCE4CB6P2145662
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$34,000.00
Original Registration Date:	21 Jul 2023
First Registration Date:	21 Jul 2023
Transfer Count:	0
Actual ARF Paid:	\$0.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	20 Jul 2033
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	20 Jul 2033
COE Category:	A - Car-Details at OneMotoring
COE Period(Years):	10
QP Paid:	\$96,206.00
COE Rebate Amount:	\$85,686.00
Total Rebate Amount:	\$85,686.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 23 Aug 2024

OK



BYD Atto 3 Electric Sunroof

\$146,800 Instalment \$1,231/mth

PREMIUM AD

💰 Apply for 2.48% loan

♡ Shortlist

📄 Loan Calculator

LATEST PROMO

mycarforum

Keep Heat Under Control!
Block up to 99.6% of...

Overview Financial Photo Research

Depreciation	📘 \$16,460 / year
Reg. Date	24-Jul-2023 (8yrs 11mths COE left)
Manufactured	📘 2023
Mileage	16,860 km (15.5k / year)
Transmission	Auto
Road Tax	📘 \$1,502 / year
Power	100.0 kW (134 bhp) View specs of the BYD Atto 3 Electric (2022)
Curb Weight	📘 1,750 kg
Fuel Type	Electric
Drive Range	-
COE	📘 \$96,206
OMV	📘 \$34,000
Dereg Value	📘 \$76,965 as of today