



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

STRIDES PREMIER AUTOMOTIVE SERVICES PL	INV No.	AC2503029
60 WOODLANDS INDUSTRIAL PARK E4	INV Date	19/05/2025
SINGAPORE 757705	Reference	CS/SMR24070172/Uqp3e2
ATTN: HUA YEN	Code	SMR

PROFESSIONAL SERVICE FEE

Vehicle No.	FBP 8897T
Insured Veh.	SHB 157B
Claim No.	TAX/06/24/2098
Policy No.	
Accident Date	30/06/2024
Inspection Date	09/07/2024

Description	Total
Survey Inspection	128.00
Digital Photographs	
Transportation	
Subtotal	128.00
GST (9%)	11.52
Grand Total	139.52

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
STRIDES PREMIER AUTOMOTIVE SERVICES PL 60 WOODLANDS INDUSTRIAL PARK E4SINGAPORE 757705 ATTN: HUA YEN			Ref: CS/SMR24070172/Uqp3e2(N) Date: 19/05/2025 Code: SMR	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHB 157B	Veh. Inspected	FBP 8897T
	Policy No.		Coverage (\$)	0.00
	Claim No.	TAX/06/24/2098	Excess (\$)	0.00
	Assign From	HUA YEN	Assign Date	09/07/2024
2. Vehicle Particulars & Condition				
	Make & Model	YAMAHA YZF-R155	c.c	155
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	MH3RG4710JK051214	Colour	RED
	Odometer	-	Steering	AFFECTED
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	100-80-17	MICHELIN	7 mm
	L/H Front Tyre			mm
	R/H Rear Tyre	140/70-17	MICHELIN	7 mm
	L/H Rear Tyre			mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION AND O/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	30/06/2024	Inspection Date	09/07/2024
	Survey held at	BAN HOCK HIN CO.PTE LTD BLK 8 DEFU SOUTH STREET 1, #04-28 JTC DEFU INDUSTRIAL CITY, SINGAPORE 533758		
5a. Remarks				
	A)THE VEHICLE HAS NOT SEND IN FOR REPAIRS. B)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. C)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBP 8897T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	AXLE RIM FRONT	CUT	23.00	23.00
1	BALANCER HANDLE (AFTERMARKET) HEAVY	CUT	63.00	63.00
1	BAR HANDLE LH	* CHECK	82.00	-
1	BAR HANDLE RH	* CHECK	82.00	-
2	BEARING @\$13.00	NECESSARY	26.00	26.00
1	BEARING STEERING CONE LOWER	NECESSARY	14.00	14.00
1	BEARING STEERING CONE UPPER	NECESSARY	23.00	23.00
1	BOLT FOOTREST	CUT	10.00	10.00
1	BRACKET UNDER FORK	CRACKED	324.00	324.00
1	BRACKET, POUCH	DAMAGED	38.00	38.00
1	CABLE CLUTCH	* CHECK	21.00	-
1	COMPLETER AFTERMARKET STICKERS	* CHECK	341.00	-
1	COOLANT (MOBIL) ANTIFREEZE	NECESSARY	21.00	21.00
1	COVER 7	CUT	34.00	34.00
1	COVER HANDLE LEVER CLUTCH	TORN	6.00	6.00
1	COVER INNER FRONT RH	CRACKED	47.00	47.00
1	COVER RADIATOR	* CHECK	17.00	-
1	COVER SIDE LOWER LH	CRACKED	90.00	90.00
1	COVER SIDE LOWER RH	CRACKED	97.00	97.00
1	COVER TAIL RH	CUT	54.00	54.00
1	COVER TANK CENTER	* CHECK	74.00	-
1	COVER TANK SIDE LH	* CHECK	57.00	-
1	COVER TANK SIDE RH	* CHECK	57.00	-
1	COWLING FRONT LOWER	CRACKED	55.00	55.00
1	COWLING FRONT UPPER	CRACKED	51.00	51.00
1	COWLING SIDE LH	CRACKED	81.00	81.00
1	COWLING SIDE RH	CRACKED	81.00	81.00
1	CROWN HANDLE	TWISTED	91.00	91.00
2	DAMPER COWLING 1 @\$3.00	NECESSARY	6.00	6.00
2	DAMPER COWLING 2 @\$3.00	NECESSARY	6.00	6.00
2	EMBLEM (YAMAHA) LOGO @\$21.00	NECESSARY	42.00	42.00

Report Ref No. CS/SMR24070172/Uqp3e2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	EMBLEM YAMAHA @\$5.00	NECESSARY	10.00	10.00
1	FOOTREST FRONT RH	CUT	23.00	23.00
1	FORK FRONT ASSY LH	BENT / TWISTED	850.00	850.00
1	FORK FRONT ASSY RH	BENT / TWISTED	850.00	850.00
1	GASKET WATER PUMP	* CHECK	8.00	-
1	GRILL AIR OULET LH	TORN	8.00	8.00
1	GROMMET POLE REAR	* CHECK	7.00	-
1	GROMMET RADIATOR	* CHECK	3.00	-
1	HEADLIGHT ASSY	CRACKED	530.00	530.00
1	HOSE RADIATOR 2	* CHECK	13.00	-
1	LABEL WARNING	* CHECK	3.00	-
1	LEVER BRAKE	BENT	23.00	23.00
1	LEVER CLUTCH	TWISTED	28.00	28.00
1	LICENCE LIGHT ASSY	* CHECK	28.00	-
1	METER ASSY	* CHECK	240.00	-
1	MID GROMMET	* CHECK	6.00	-
1	SET MIRROR RECTANGLE	CUT	78.00	78.00
1	MUDGUARD FRONT	CUT	60.00	60.00
4	NUT @\$12.00	NECESSARY	48.00	48.00
5	NUT SPRING @\$4.00	NECESSARY	20.00	20.00
2	NUT STEERING CONE @\$13.00	NECESSARY	26.00	26.00
1	PAD CAP TANK	NOT NECESSARY	71.00	-
1	PANEL CONSOLE LH	CUT	14.00	14.00
1	PANEL CONSOLE RH	CUT	16.00	16.00
1	PANEL INNER FRONT LOWER	CUT	51.00	51.00
1	PANEL INNER LH	CUT	11.00	11.00
1	PANEL INNER RH	CRACKED	11.00	11.00
1	PANEL SIDE LH	CRACKED	22.00	22.00
1	PANEL SIDE RH	CRACKED	22.00	22.00
1	PEDAL BRAKE	CUT	28.00	28.00
1	PIPE TANK COOLANT	* CHECK	19.00	-
1	PLATE	* CHECK	5.00	-
1	PLATE	* CHECK	5.00	-

Report Ref No. CS/SMR24070172/Uqp3e2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PLATE NUMBER FRONT (STRAIGHT)	DAMAGED	22.00	22.00
1	PLATE NUMBER REAR (6.5 INCH X 9 INCH)	BENT	30.00	30.00
1	PROTECTOR MUFFLER	CUT	46.00	46.00
1	RACE BALL 1	* CHECK	14.00	-
1	RACE BALL UPPER 2	* CHECK	14.00	-
1	RADIATOR ASSY	SERVICEABLE	282.00	-
1	RETAINER BALL BEARING	* CHECK	13.00	-
1	RIM SPORT FRONT	WARPED	353.00	353.00
10	RIVET @\$3.00	NECESSARY	30.00	30.00
1	SEAL	NECESSARY	5.00	5.00
1	SEAL 2	NECESSARY	5.00	5.00
1	SEAL 2	NECESSARY	5.00	5.00
1	SEAL DUST STEERING CONE	NECESSARY	10.00	10.00
2	SEAL WHEEL FRONT @\$5.00	NECESSARY	10.00	10.00
1	SHAFT ROCKER 2	NECESSARY	11.00	11.00
1	SIGNAL FRONT LH ASSY	DAMAGED	31.00	31.00
1	SIGNAL FRONT RH ASSY	DAMAGED	31.00	31.00
1	STAY HEADLAMP	BENT	94.00	94.00
1	STAY WATERPUMP	* CHECK	13.00	-
1	STICKER COVER TAIL LH	NECESSARY	5.00	5.00
1	STICKER COWLING FRONT UPPER LH	NECESSARY	3.00	3.00
1	STICKER COWLING FRONT UPPER RH	NECESSARY	3.00	3.00
1	STICKER COWLING SIDE LH	NECESSARY	3.00	3.00
1	STICKER COWLING SIDE LH 2	NECESSARY	13.00	13.00
1	STICKER COWLING SIDE RH	NECESSARY	3.00	3.00
1	STICKER COWLING SIDE RH 2	NECESSARY	13.00	13.00
1	SWITCH HANDLE LH	* CHECK	61.00	-
1	TANK COOLANT	* CHECK	17.00	-
1	VALVE RIM	* CHECK	14.00	-
1	WASHER CROWN HANDLE	NECESSARY	6.00	6.00
1	WASHER PLATE	NECESSARY	5.00	5.00
1	WASHER STEERING CONE	NECESSARY	5.00	5.00
1	WINDSHIELD FRONT	BROKEN	81.00	81.00

Report Ref No. CS/SMR24070172/Uqp3e2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-	-483.50
			6,402.00	4,351.50
	LABOUR			
	ALIGNMENT BODY.	* CHECK	711.00	-
	LABOUR - LABOUR QUOTED FOR DISMANTLING AND INSTALLATION OF PARTS.		2,040.00	700.00
	TRANSPORT CHARGES.		63.00	35.00
			2,814.00	735.00
	GRAND TOTAL		9,216.00	5,086.50
RECOMMENDED COST OF REPAIRS (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$1,803.60 NETT)				5,086.50

Report Ref No. CS/SMR24070172/Uqp3e2(N)

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	01/07/2024 18:20 (SGT)
Reported by	Both Policyholder and Actual Driver
Date of Accident	30/06/2024 02:55 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	JLN BUKIT MERAH
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	FBP8897T
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	RIZQY HAZRI BIN IDRIS
NRIC No	T0222478F
Email Address	RIZQYHAZRI@GMAIL.COM
Mobile Phone No	(Phone) +65-91296477
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Yamaha
Model	R15
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Motorcycle
Transmission	Manual
CC	155

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5131876148-01

DRIVER

Name of Driver	RIZQY HAZRI BIN IDRIS
NRIC No	T0222478F
Date Of Birth	03/08/2002
Occupation	Indoor

Driving Pass Date	08/03/2022
Driving experience	2 YEARS AND 3 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91296477
Alt. Phone Number	-
Email Address	RIZQYHAZRI@GMAIL.COM
Address	BLK 9 JALAN RUMAH TINGGI
Address complement	#11-453
Postcode	150009
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Major/Minor Rd
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Traffic Police
Police Station Phone No	(Phone) +65-65470000
Alt. Police Station Phone No	(Fax) +65-65474900
Police Station Address	10 Ubi Avenue 3 Singapore 408865
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER AS POLICE REPORT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHB157B
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-

Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	Na
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	1

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	RIZQY HAZRI BIN IDRIS
Gender	Male
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	21
Injuries Sustained	Swollen right big toe, abrasion left leg, left hand . Strain on shoulder and right thigh
Injured person in which vehicle?	FBP8897T
Were seat belts worn?	No
Was this injured conveyed to hospital by ambulance?	Yes

WITNESS DETAILS

WITNESS 1

Name	Nasser
Phone	(Phone) +65-90298292
Email	-

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Policyholder's Signature / Date & Time
01/07/2024

Driver's Signature (if driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)
Muhammad Sumardi Bin Mohd Affandi
S995530

Sketch Plan 17:50hrs

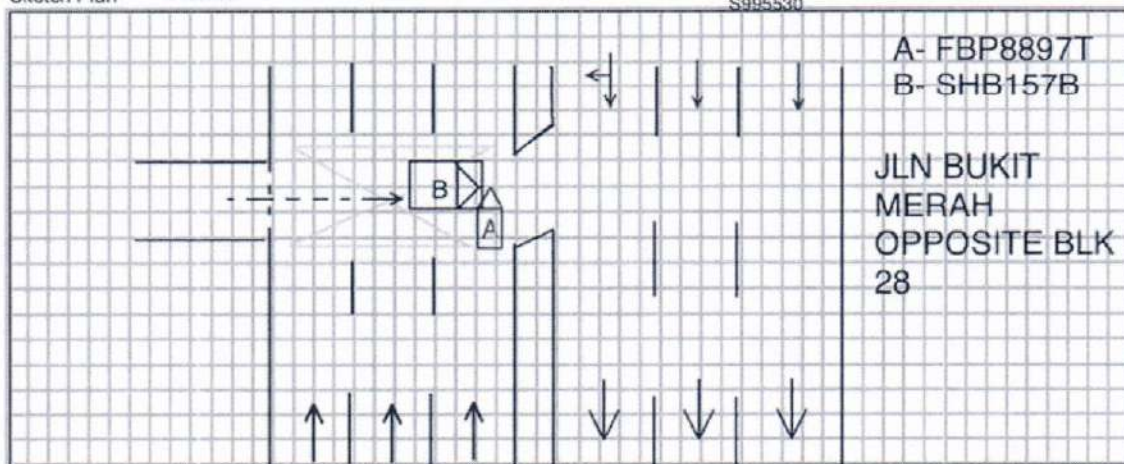

Describe Circumstance of the Accident

REFER TO GEARS

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time
01/07/2024
17:50hrs

Driver's Signature (if driver is not the policyholder) / Date
& Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)
Muhammad Sumardi Bin Mohd Affandi₂
S995530



**SINGAPORE
POLICE FORCE**



T/20240701/7071

1 of 3

Report No. T/20240701/7071

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No. 65470000

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 01/07/2024 15:09		Vide Report No.:		Station Diary No.:	
Informant's Particulars					
Name of Informant: RIZQY HAZRI BIN IDRIS			Address: 9 JALAN RUMAH TINGGI #11-453 SINGAPORE 150009		
ID Type / ID No.: NRIC NO / T0222478F			Contact No.: Home/Office: Mobile: 91296477		
Nationality: SINGAPORE CITIZEN			Email: rizqyhazri@gmail.com		
Sex: Male	Age: 21	Date of Birth: 03/08/2002	Type of Informant: Rider		
Race: Malay			Language: English		
Occupation: National Service Full Time			Driving Licence Information: Class: 2B Date of Expiry:		

General Information of the Accident				
Type of Accident:	Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 30/06/2024 02:55	Type of Location: Straight Road
Location: JALAN BUKIT MERAH				
Weather: Clear		Road Surface: Dry		
Traffic Flow: Two Way		Traffic Control: Not Controlled		Traffic Volume: No Traffic
Type of Collision: Between Moving Vehicles - Head To Side				Anyone conveyed by ambulance: Yes

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
FBP8897T	Motorcycle	YAMAHA	YZF-R155	Red		0

Details of Vehicle Insurance				
Vehicle No.	Insurance Company	Insurance No	Effective Date	Expiry Date
FBP8897T	NTUC Income Insurance Co-Operative Limited	5131876148-01	19/11/2023	18/11/2024



**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000



T/20240701/7071

2 of 3

Report No. T/20240701/7071

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Rider			
Name	RIZQY HAZRI BIN IDRIS	ID No.	T0222478F
Related Vehicle	FBP8897T (Motorcycle)	Contact No.	91296477
Hospital/Clinic	SINGAPORE GENERAL HOSPITAL	Class of Driving Licence & Expiry Date	Class: 2B Date of Expiry: NIL
Date Treatment	30/06/2024	Date Discharge	30/06/2024
No. of Days granted Medical Leave (MC)	07	Degree of Injury	Slight

Brief Details.

On 30/06/24 at about 2:55am I was riding along Jalan Bukit Merah road towards Kampong Bahru Road in lane 1. Before the T junction of Hoy Fatt road a taxi (SHB157B) dashed out the carpark (BMBM1) and tried to make an illegal right turn. With no time to react, I collided with the front right side of the taxi. I was not able to get up and required assistance after being flung about 1 meter away. I was then conveyed to SGH. I have someone that is willing to be the witness.



**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000



T/20240701/7071

3 of 3

Report No. T/20240701/7071

CONTINUATION OF REPORT

Signature Of Officer Recording The Report:
Not applicable

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / TPIB /
Ahmad Syafiq Bin Harris
Contact No.: 65476201

Signature Of Informant:
The identity of the person making this report has been
authenticated by Singpass. No signature is required.

Date/Time:
01/07/2024 15:09

Classification Of Case:

NP168

PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T




PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T

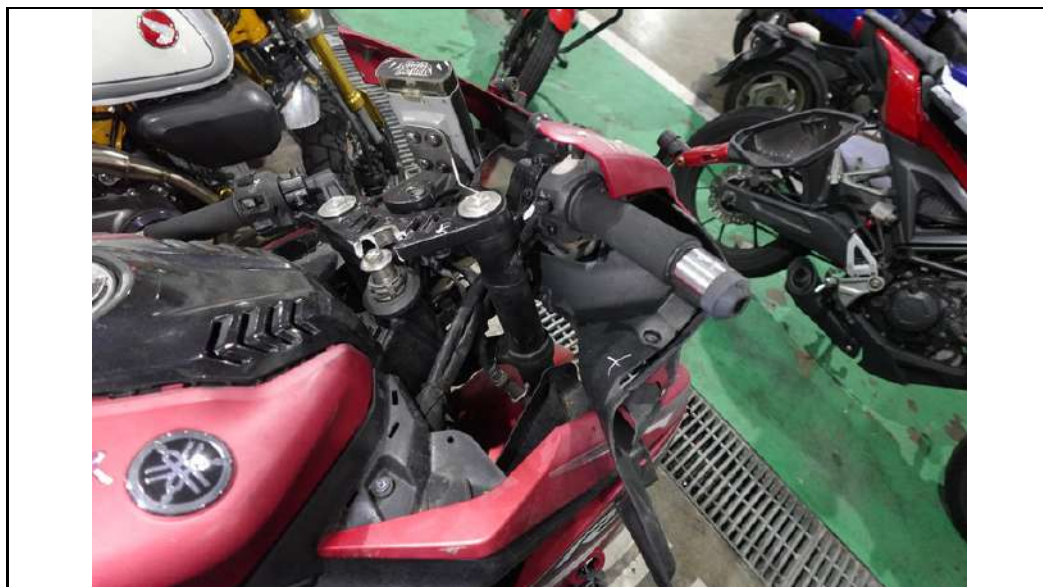

PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T




PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T




PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T

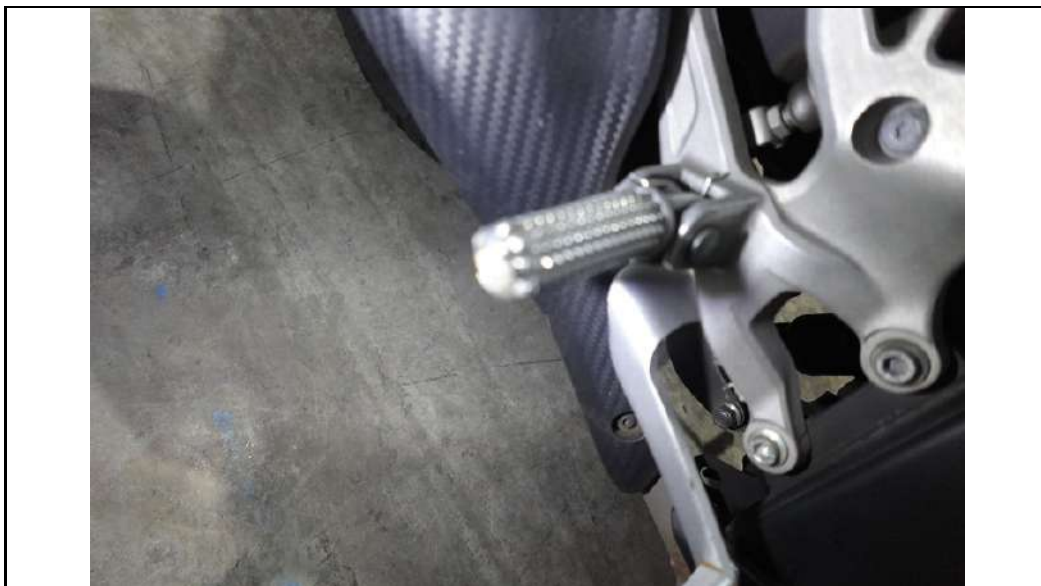

PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T

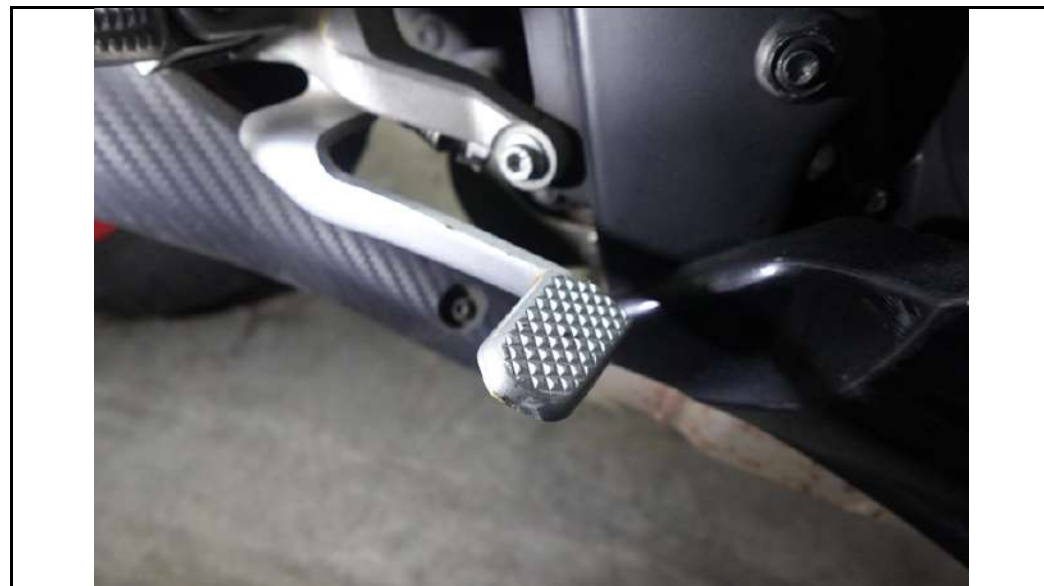

PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T



PHOTOGRAPHS FOR VEHICLE NO. : FBP 8897T

