

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/SMO 24070218/U993

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHB 5217D

at Workshop m/s SMRT Changi South

of _____

Insured: SJV1243A

Policy No. _____

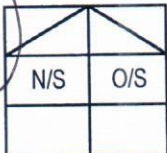
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 3 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

C369K

Vehicle: IN / OUT

Date: _____ Person Contacted: 174826875

Veh No: SHB 5217D Yr Regn: 30/11/20

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CA /

Make: Toyota Prius SDR c.c 1794

Colour: maroon A/C: Insured / Std / NI / NA

Sp. Reading: 412693 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTDKB3FU403091674

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 175/65-R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or green trac

Front: 5 mm Rear: 5 mm

R/Bal. 5 mm R/Bal. 5 mm

L/Bal. 5 mm L/Bal. 5 mm

D.O.A. 10/07/24 D.O.I. 12/7/24

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

MS def.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
7/8/24	4/5 @ 1450 inbound polsuen. (Net @ 11831.88, 89%) Tony have invoice

Date/Time, File Pass to?

1) 07/8/24

Date/Time, File Return to?

2) _____

☐ : Preli. Report☐ : Final Report

Days Of Repair: 3

Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS, \$ _____

Photos _____

Others _____

TOTAL

Report Format: 71

Lump Sum / I.B.I. (\$) 1450

TP
44 ADV-L-1

SMRT Accident Vehicle Repair Estimates

SMRT Auto
60 Woodlar
FAX Number
Estimator T
Accident Re

Date Gener

User ID

Sompo

Section A - Accident Details	
Registration Number	SHB5217D
Case Reference Number	TAX/07/24/2035
Registration Date	30/11/2020
Company Type	Strides Premier Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS4EL
Name of Driver	LEE KWANG HANN
Type of Accident	Side Swipe
Accident Date and Time	10/7/2024 4:05 PM
Accident Reported Date and Time	11/7/2024 10:52 AM
Is Surveyor Required?	No
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24121809
Special Instruction to ARC, if any	TP/TOWED/LEFT FRONT PORTION
Prepared Date and Time	11/7/2024 1:05 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates		
Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$0.00
Total Spray Cost	\$976.00	\$0.00
Total Spare Part Cost	\$5,799.98	\$0.00
Total Other Cost	\$1,114.44	\$0.00
TOTAL COST	\$8,735.42	\$0.00
Lump Sum Total	\$8,750.00	\$0.00
Number of Repair Days	6.0	
Prepared / Adjusted By	Boon Chew Tay	
ARC / Surveyor Sign Off Date		
Signature		x
Remarks		

Section C - Quotation and Accident Invoice Details			
Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	

STRIDES

AUTOMOTIVE

Who Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SMRT Accident Vehicle Repair Estimates

SMRT Autor

60 Woodland

FAX Number

Estimator Te

Accident Rep

Date Generated

User ID

NOT Authorised
11/7/24 @ 11am
to be paid after repair
1/5 15/450
3 days

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR LH FRONT PORTION	\$845.00	200
Total Labour	\$845.00	200

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT BUMPER	\$378.00	200
TO RESPRAY FRONT FENDER LH	\$378.00	200
TO RESPRAY RIM	\$220.00	100
Total Spray Painting & Panel Beating	\$976.00	

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$56.00	311 ✓
TO CHECK WIRING AND SYSTEM FUNCTION	\$120.00	11X
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	11X
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	60
TO REMOVE AND REFIT TYRE	\$120.00	11X
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER (NET)	\$148.44	11X ✓
TO REMOVE AND REFIX UNDERCARRIAGE	\$350.00	11X
TO REPLACE SUNDRY PARTS	\$100.00	11X
Total Other Costs	\$1,114.44	

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Ap
		52119-47980	COVER, FR BUMPER	1.00	\$565.60	25.00	\$424.20	Replace	DD ✓
		52116-47050	SUPPORT, FR BUMPER LH	1.00	\$86.20	25.00	\$64.65	Replace	CR ✓
	Tow cover	52128-47910	COVER, FR BUMPER LH	1.00	\$32.70	25.00	\$24.53	Replace	MIS ✓
		53112-47310	GRILLE, RADIATOR	1.00	\$192.80	25.00	\$144.60	Replace	11X
		53101-47100	GRILLE SUB-ASSY	1.00	\$457.10	25.00	\$342.83	Replace	11X
		53111-47140	GRILLE, SUB -ASSY, 2	1.00	\$170.20	25.00	\$127.65	Replace	11X
		51451-12120	COVER ASSY, ENGINE	1.00	\$261.60	25.00	\$196.20	Replace	11X
		52161-16010	CLIPS PIECE, FRT BUMPER	10.00	\$4.80	25.00	\$36.00	Replace	11X
		52535-50060	RETAINER, FR BUMPER, LH & RH	1.00	\$9.50	25.00	\$7.13	Replace	11X
		52421-47030	PAD, FRONT BUMPER (NO.1)	1.00	\$44.10	25.00	\$33.08	Replace	11X
		52421-47040	PAD, FRONT BUMPER (NO.2)	1.00	\$38.90	25.00	\$29.17	Replace	11X
		52713-47040	MOULDING, FRONT BUMPER SIDE, LH	1.00	\$103.70	25.00	\$77.78	Replace	11X
		52618-47130	ABSORBER, FR BUMPER LOWER	1.00	\$143.60	25.00	\$107.70	Replace	11X
		52611-47210	ABSORBER, FR BUMPER	1.00	\$86.60	25.00	\$64.95	Replace	11X
		81185-47890	UNIT, HEADLAMP, LH	1.00	\$2,852.40	25.00	\$2,139.30	Replace	11X
		81220-12240	LAMP ASSY, FOG, LH	1.00	\$256.50	25.00	\$192.38	Replace	11X
		51444-12080	COVER, ENGINE UNDER SIDE LH	1.00	\$86.20	25.00	\$64.65	Replace	11X
		51410-47021	COVER ASSY, ENGINE UNDER CENTER SET	1.00	\$511.20	25.00	\$383.40	Replace	11X

SMRT Accident Vehicle Repair Estimates

SMRT Autor
60 Woodland
FAX Number
Estimator Te
Accident Rep

Date Genera

User ID

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Ap
		53802-47100	FENDER SUB-ASSY, FR LH	1.00	\$1,060.70	25.00	\$795.53	Replace	R X
		75374-47140	EMBLEM, SIDE PANEL (HYBRID)	1.00	\$59.10	25.00	\$44.33	Replace	11 X
		53876-47060	LINER, FR FENDER, LH	1.00	\$227.80	25.00	\$170.85	Replace	700 X
		53828-47070	PROTECTOR, FR FENDER LH	1.00	\$101.80	25.00	\$76.35	Replace	11 X
		53852-47041	PAD, FR WHEEL LH	1.00	\$65.00	25.00	\$48.75	Replace	11 X
		42611-47450	WHEEL, DISC FRONT	1.00	\$2,036.30	25.00	\$1,527.23	Replace	R X
			TYRE	1.00	\$126.74	0.00	\$126.74	Replace	11 X
		43550-47020	HUB & BEARING ASSY, RH & LH	1.00	\$722.10	25.00	\$541.58	Replace	11 X
Total					\$10,303.24		\$7,791.56		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Ch
Total									

8-1147
252
860.25

less 202
dry Sur
688.20
200
764.44
1652.64

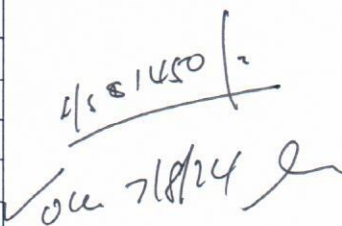
2-860.25
1-964.44
1824.69
202
1459.

Section A - Accident Details

Registration Number	SHB5217D
Case Reference Number	TAX/07/24/2035
Registration Date	30/Nov/2020
Company Type	Strides Premier Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS4FL
Name of Driver	LEE KWANG HANN
Type of Accident	Side Swipe
Accident Date and Time	10/Jul/2024 4:05 PM
Accident Reported Date and Time	11/Jul/2024 10:52 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24121809
Special Instruction to ARC, if any	TP/TOWED/LEFT FRONT PORTION
Prepared Date and Time	11/Jul/2024 1:05 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$200.00
Total Spray Cost	\$976.00	\$500.00
Total Spare Part Cost	\$6,233.25	\$860.26
Total Other Cost	\$1,114.44	(\$110.26)
TOTAL COST	\$9,168.69	\$1,450.00 (L/S)
Lump Sum Total	\$9,150.00	\$0.00
Number of Repair Days	6.0	3.0
Prepared / Adjusted By	Boon Chew Tay	MARCUS CHUA (LKK) / Somp
ARC / Surveyor Sign Off Date	12/07/2024 4:10 PM	12/07/2024 2:17 PM
Signature		Marcus Chua
Remarks	REQ TOWING INVOICE REQ WHEEL ALIGNMENT REPORT L/S REPAIR / AFTER PAINT PHOTO, FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR MARCUS CHUA (LKK) / HP : 9009 6608 / Email : marcuschua@lkkauto.com	


 1/18/2024

Section A - Accident Details	
Registration Number	SHB5217D
Case Reference Number	TAX/07/24/2035
Registration Date	30/Nov/2020
Company Type	Strides Premier Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS4FL
Name of Driver	LEE KWANG HANN
Type of Accident	Side Swipe
Accident Date and Time	10/Jul/2024 4:05 PM
Accident Reported Date and Time	11/Jul/2024 10:52 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24121809
Special Instruction to ARC, if any	TP/TOWED/LEFT FRONT PORTION
Prepared Date and Time	11/Jul/2024 1:05 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates		
Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$200.00
Total Spray Cost	\$976.00	\$500.00
Total Spare Part Cost	\$6,233.25	\$688.21
Total Other Cost	\$1,114.44	\$264.44
TOTAL COST	\$9,168.69	\$1,652.65
Lump Sum Total	\$9,150.00	\$1,650.00 (L/S) 4/581450
Number of Repair Days	6.0	3.0
Prepared / Adjusted By	Boon Chew Tay	MARCUS CHUA (LKK) / Sompo
ARC / Surveyor Sign Off Date	12/07/2024 4:10 PM	12/07/2024 2:17 PM
Signature		Marcus Chua
Remarks	REQ TOWING INVOICE REQ WHEEL ALIGNMENT REPORT L/S REPAIR / AFTER PAINT PHOTO, FOR CHECK ITEM and REPLACE ITEM. PLEASE CALL SURVEYOR MARCUS CHUA (LKK) / HP: 9009 6608 / Email: marcuschua@lkkauto.com	

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-2407-0222	Invoice Number	
Quotation Date	18.07.2024	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR LH FRONT PORTION	\$845.00	\$200.00
Total Labour	\$845.00	\$200.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT BUMPER	\$378.00	\$200.00
TO RESPRAY FRONT FENDER LH	\$378.00	\$200.00
TO RESPRAY RIM	\$220.00	\$100.00
Total Spray Painting & Panel Beating	\$976.00	\$500.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$56.00	\$56.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$120.00	\$0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$60.00
TO REMOVE AND REFIT TYRE	\$120.00	\$0.00
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	\$148.44	\$148.44
TO REMOVE AND REFIX UNDERCARRIAGE	\$350.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
Total Other Costs	\$1,114.44	\$264.44

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved	
		52119-47980	COVER, FR BUMPER	1.00	\$565.60	25.00	\$424.20	Replace	Replace	√
		52116-47050	SUPPORT, FR BUMPER LH	1.00	\$86.20	25.00	\$64.65	Replace	Replace	√
		52128-47910	COVER, FR BUMPER LH	1.00	\$32.70	25.00	\$24.53	Replace	Replace	√
		53112-47310	GRILLE, RADIATOR	0.00	\$192.80	0.00	\$0.00	Replace	Not Given	X
		53101-47100	GRILLE SUB-ASSY	0.00	\$457.10	0.00	\$0.00	Replace	Not Given	X
		53111-47140	GRILLE, SUB -ASSY , 2	0.00	\$170.20	0.00	\$0.00	Replace	Not Given	X
		51451-12120	COVER ASSY, ENGINE	0.00	\$261.60	0.00	\$0.00	Replace	Not Given	X
		52161-16010	CLIPS PIECE, FRT BUMPER	10.00	\$4.80	25.00	\$36.00	Replace	Replace	√
		52535-50060	RETAINER, FR BUMPER, LH & RH	0.00	\$9.50	0.00	\$0.00	Replace	Not Given	X

Strides Premier Accident Vehicle Repair Estimates

Strides Premier Automotive Services Pte Ltd	
60 Woodlands Industrial Park E4, Singapore 757705	
FAX Number : 63685592	
Estimator Telephone Number : 68662623	
Accident Reporting Number : 68662672	

Date Generated : 18/07/2024

User ID : PohSuan

	52421-47030	PAD, FRONT BUMPER (NO.1)	1.00	\$44.10	25.00	\$33.08	Replace	Replace	✓
	52421-47040	PAD, FRONT BUMPER (NO.2)	1.00	\$38.90	25.00	\$29.17	Replace	Replace	✓
	52713-47040	MOULDING, FRONT BUMPER SIDE, LH	1.00	\$103.70	25.00	\$77.78	Replace	Replace	✓
	52618-47130	ABSORBER, FR BUMPER LOWER	0.00	\$143.60	0.00	\$0.00	Replace	Not Given	X
	52611-47210	ABSORBER, FR BUMPER	0.00	\$86.60	0.00	\$0.00	Replace	Not Given	X
	81185-47890	UNIT, HEADLAMP, LH	0.00	\$2,852.40	0.00	\$0.00	Replace	Not Given	X
	81220-12240	LAMP ASSY, FOG, LH	0.00	\$256.50	0.00	\$0.00	Replace	Not Given	X
	51444-12080	COVER, ENGINE UNDER SIDE LH	0.00	\$86.20	0.00	\$0.00	Replace	Not Given	X
	51410-47021	COVER ASSY, ENGINE UNDER CENTER SET	0.00	\$511.20	0.00	\$0.00	Replace	Not Given	X
	53802-47100	FENDER SUB-ASSY, FR, LH	1.00	\$1,060.70	100.00	\$0.00	Replace	Repair	R
	75374-47140	EMBLEM, SIDE PANEL (HYBRID)	0.00	\$59.10	0.00	\$0.00	Replace	Not Given	X
	53876-47060	LINER, FR FENDER, LH	1.00	\$227.80	25.00	\$170.85	Replace	Replace	✓
	53828-47070	PROTECTOR, FR FENDER LH	0.00	\$101.80	0.00	\$0.00	Replace	Not Given	X
	53852-47041	PAD, FR WHEEL LH	0.00	\$65.00	0.00	\$0.00	Replace	Not Given	X
	42611-47450	WHEEL, DISC FRONT	1.00	\$2,036.30	100.00	\$0.00	Replace	Repair	R
		TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given	X
	43550-47020	HUB & BEARING ASSY, RH & LH	0.00	\$722.10	0.00	\$0.00	Replace	Not Given	X
Total				\$10,303.24		\$860.26			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

860.26
 -20%
 688.21 L/S \$1,650/-
 + 200.00
 + 764.44
 1,652.65

P-860.26

+ 200

+ 764.44

1824.70

1652.65

11459.76 = L/S \$1450



YISHUN TOWING PTE LTD

Blk 4015 Ang Mo Kio Industrial Park 1, #01-502, Singapore 569631

Tel: 6458 8480 HP: 9628 8480 Fax: 6288 8480

Website: www.yishuntowing.com

Reg. No. 200106908W GST No. 200106908W

M/s Greaves Premier Auto

WORK ORDER

No. 0001005

Order By: 97 427722

A/T 07:52 D/T. 08:27

Date: 10/07/24

車牌
Vehicle No. SAB 5217 D

車型
Model

From: 408 Serangoon Ave

To: 23 Chandi' Gours Ave

Remarks:

Day/Night Night

Customer Signature & Company Stamp

Authorised Signature

Tow Truck No.: 4L 73138

All business transactions with Yishun Towing Pte Ltd are subject to its Standard Conditions in so far as these Conditions are applicable. Copies of these conditions may be obtained upon request. Note: Please see terms & conditions on the reverse side.



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	369K
Vehicle Details	
Vehicle No.:	SHB5217D
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Jul 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Maroon
Manufacturing Year:	2020
Engine No.:	2ZR2G84474
Chassis No.:	JTDKB3FU403091674
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,807.00
Original Registration Date:	30 Nov 2020
First Registration Date:	30 Nov 2020
Transfer Count:	0
Actual ARF Paid:	\$14,530.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Nov 2028
PARF Rebate Amount:	\$10,897.00
Intended COE Rebate Details	
COE Expiry Date:	29 Nov 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$29,180.00
COE Rebate Amount:	\$15,978.00
Total Rebate Amount:	\$26,875.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 12 Jul 2024

OK