

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645



Insurer Reference:
Repairer Reference: 070863
Date calculated: 11/06/2024 6:09 PM

Full Report
Registration: SLT1730Y
Printed: 11/06/2024 6:09 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	06/06/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	E-CLASS (W213)
Sub Model:	E 200
Model Sheet Number:	03 FE 42
Registration:	SLT1730Y
VIN number:	
Odometer:	189160

Not Notified
1/1/24 @
Return After Repair
Ex \$2000
14 days

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

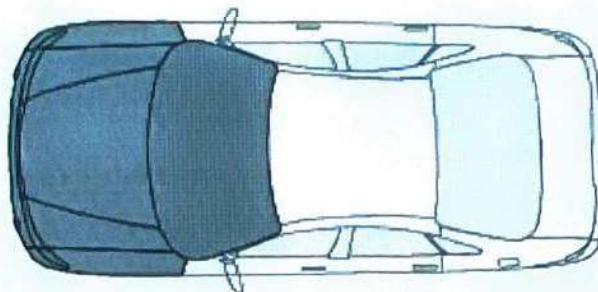

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		3.0	12.60
54-0650 01	MAIN BOARD MAINTAINED (FOR CHECK AND DIAGNOSIS WORK)		1.0	4.20
61-1069 01	R + R COMPL LWR ENGINE COMPARTMENT COVER		3.0	12.60
88-2532 01	REPAIR OF FRONT-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WINGS AND FRONT LAMP UNITS, CONVERT ATTACHED PARTS, RENEW IF NECESSARY		44.0	184.80
88-2657 01	R + R BOTH BONNET HINGE		4.0	16.80
88-2620 01	R + R FRONT BONNET CABLE		3.0	12.60

Code	Description	WU	Price SGD
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	15.0	63.00
62-1266 01	R + R OR RENEW FRONT CROSSMEMBER AND COMPLETE TRUSSING BETWEEN WHEELHOUSES INCLUDES: R + R CENTRE TRUSSING, RENEW IF NECESSARY	15.0	63.00
62-1440 01	RENEW L/F SIDE MEMBER END SECTION	21.0	88.20
62-1441 01	RENEW R/F SIDE MEMBER END SECTION	21.0	88.20
67-1700 01	RENEW FRONT SCREEN INCLUDES: INTERIOR MIRROR, RAIN SENSOR, BOTH WIPER ARMS, COVER WATER BOX, COVER MOULDINGS AND ALL TRIMS REMOVE AND REFIT	26.0	109.20
68-4605 01	R + R INSTRUMENT PANEL	27.0	113.40
68-4635 01	RENEW INSTRUMENT PANEL (REMOVED)	4.0	16.80
7681 01	R + R INDICATOR SWITCH	7.0	29.40
15-5070 02	RENEW ALTERNATOR	15.0	63.00
20-3865 01)	R + R RADIATOR	7.0	29.40
20-5410 02	R + R OVERFLOW TANK	8.0	33.60
09-6935 03)	R + R LOW-TEMPERATURE COOLER (ADD)	3.0	12.60
83-6543 01	R + R AIR CONDITIONING CONDENSER	14.0	58.80
83-7351 04)	R + R AIR CONDITIONING COMPRESSOR	4.0	16.80
83-7383 01	RENEW COMPRESSOR AIR CONDITION REMOVED	3.0	12.60
83-7805 ZAX	REMOVE AND REFIT WATER PIPE A	4.0	16.80
83-7810 ZAX	REMOVE AND REFIT WATER PIPE B	4.0	16.80
83-7820 ZAX	REMOVE AND REFIT WATER PIPE D	4.0	16.80
33-1050 01	R + R FRONT AXLE CARRIER	40.0	168.00
33-1252 ZAX	RENEW FRONT AXLE SUPPORT (REMOVED)	1.0	4.20
33-1427 02	R + R LEFT FRONT CONTROL ARM	7.0	29.40
33-1428 02	R + R RIGHT FRONT CONTROL ARM	7.0	29.40
33-1411 01)	REMOVE AND REFIT L/F CONTROL ARM	5.0	21.00
33-1411 01)	REMOVE AND REFIT R/F CONTROL ARM	5.0	21.00
20-1190 01	ADDITION TO COOLING SYSTEM DRAIN /REFILL (VEHICLE WITH SEPARATE LOW TEMPERATURE-WATER CYCLE)	3.0	12.60
1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	6.0	25.20
83-0640 01	CHECK AIR COND	1.0	4.20
82-1110 01	ADJUST HEADLAMPS	3.0	12.60
40-6500 01	ALIGN VEHICLE INCLUDES: ALIGN FRONT AND REAR TOE AND CAMBER, CHECK FRONT AND REAR VEHICLE LEVEL	8.0	33.60

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	34.10	341.0	1,432.20
Alignment			
Measuring Work	0.80	8.0	33.60
Total of Labour			1,465.80

Paint

Paint Work

Time Basis 10 WU/h

Code	Description - MF	WU	Price SGD
98-1731 01	FRONT BUMPER TRIM PAINTING	8.0	33.60
98-2805 01	BONNET PAINTING STAGE I-M	26.0	109.20
98-2005 ZAX	L/BONNET HINGE PAINTING STAGE I-J	3.0	12.60
98-2005 ZAX	R/BONNET HINGE PAINTING STAGE I-J	3.0	12.60
98-2415 01	L/F WING PAINTING STAGE I-M	7.0	29.40
98-2615 01	R/F WING PAINTING STAGE I-M	7.0	29.40
LE 1211	L/F SIDE MEMBER END PAINTING STAGE I-J	6.0	25.20
LE 1212	R/F SIDE MEMBER END PAINTING STAGE I-J	6.0	25.20
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY PARTS	14.0	58.80

Total Paint

Hrs 8.00 WU 80.0 Price SGD 336.00

Material Cost - Paint

Inner Part Painting

Price SGD

7.48

New Part Painting (Bold)

171.57

Material-constant Metal

13.47

Total**192.52****Spare Parts**

prices as at 2015-06-01

Code	Description	Part Number	Part Source	Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	mi 30.00 ✓
0260	FRT NO PLATE BRKT	213 880 0044	Original	mi 110.00 ✓
0283	FRONT BUMPER TRIM	213 885	Original	Br 1,650.00 ✓
		0038649999		
0291	FRT UPP BUMPER SEAL	205 628 1300	Original	mi 75.00 ✓
0299	TOWING EYE COVER	213 885 0222 9999	Original	mi 140.00 ✓
0303	L/F BUMP LWR GRILLE	213 885 0922	Original	CM 145.00 ✓
0304	R/F BUMP LWR GRILLE	213 885 1022	Original	CM 145.00 ✓
0305	FRT CT BUMP GRILLE	213 885 0622	Original	Br 180.00 ✓
0317	FRT LWR BUMPER MLDG	213 885 0100	Original	Br 175.00 ✓
0335	FRT CTR BUMPER CARR	213 885 1265	Original	Br 185.00 ✓
0343	L/F BUMPER CARRIER	213 885 0865	Original	Br 185.00 ✓
0344	R/F BUMPER CARRIER	213 885 1065	Original	Br 185.00 ✓
0349	FRT/CTR IMPACT DAMP	213 885 0237	Original	Br 280.00 ✓
0381	OUTER TEMP SENSOR	007 542 1318	Original	mi 180.00 ✓
0390	CTR FRT BUMPER MLDG	213 885 7401	Original	Br 160.00 ✓
0405	GRILLE	213 880 8602	Original	Br 1,050.00 ✓
0415	L/F AIR GUIDE GRILLE	213 505 1130	Original	mi 120.00 ✓
0416	R/F AIR GUIDE GRILLE	213 505 1230	Original	mi 120.00 ✓
0432	FRONT MANUFACT	221 880 0086	Original	mi 120.00 ✓
	BADGE			
0471	BONNET	213 880 0357	Original	Br 2,450.00 ✓
0475	L/BONNET HINGE	213 880 0128	Original	320.00 7
0476	R/BONNET HINGE	213 880 0228	Original	320.00 7

Code	Description	Part Number	Part Source	Price SGD	
0481	CTR BONNET INSULAT	213 682 0026	Original	Reborn 480.00	✓
0485	L/F SUSPN BUFFER	000 998 7340	Original	20.00	?
0486	R/F SUSPN BUFFER	000 998 7340	Original	20.00	?
0494	BONNET CATCH	218 880 0064	Original	Ry 120.00	✓
0495	L/ACCELERATION SENS	213 905 1300	Original	180.00	?
0496	R/ACCELERATION SENS	213 905 1300	Original	180.00	?
0497	L/F BONNET STRUT	213 980 0164	Original	Sm 145.00	X
0498	R/F BONNET STRUT	213 980 0264	Original	Ln 145.00	X
0500	BONNET CABLE	257 880 2304	Original	95.00	?
0503	L/UPP LOCK	213 880 0060	Original	Ry 115.00	✓
0504	R/UPPER LOCK	213 880 0060	Original	Ry 115.00	✓
0507	L/SPRING ELEMENT	205 880 0027	Original	55.00	?
0508	R/SPRING ELEMENT	205 880 0027	Original	55.00	?
0515	L/LID LOCKING	204 880 0260	Original	nit 55.00	✓
0516	R/LID LOCKING	204 880 0260	Original	nit 55.00	✓
0521	L/LWR HEADLAMP BRKT	213 620 2800	Original	Ry 45.00	✓
0522	R/LWR HEADLAMP BRKT	213 620 2900	Original	Ry 45.00	✓
0561	LEFT HEADLAMP ASSY	213 820 2361	Original	Ry 3,600.00	✓
0562	RIGHT HEADLAMP ASSY	213 820 2461	Original	Ry 3,600.00	✓
Ad41	L/F WING	213 880 0118	Original	Ry 1,150.00	✓
5/42	R/F WING	213 880 0018	Original	Ln 1,150.00	X
0839	L/F W-HOUSE FRT CVR	238 690 1303	Original	CM 170.00	✓
0840	R/F W-HOUSE FRT CVR	238 690 1403	Original	CM 170.00	✓
0841	L/F W-HOUSE RR COVER	238 691 1700	Original	Ln 295.00	X
0842	R/F W-HOUSE RR COVER	238 691 1000	Original	295.00	?
0930	FRONT MODULE CPL	213 620 6300	Original	1,150.00	?
0935	UPP FRT PANEL COVER	213 620 1701	Original	CM 290.00	✓
0955	L/F C-MEMBER STRUT	213 620 2700	Original	Ry 85.00	✓
0956	R/F C-MEMBER STRUT	213 620 2700	Original	Ry 85.00	✓
0989	FRONT CTR RETAINER	213 898 0100	Original	CM 110.00	✓
1001	FRT LWR CROSSMEMBER	213 620 0130	Original	580.00	?
1187	L/F LWR BUMP FRT ABS	213 620 0400	Original	140.00	?
1188	R/F LWR BUMP FRT ABS	213 620 0400	Original	140.00	?
1189	L/F STRUT	253 620 1600	Original	85.00	?
1190	R/F STRUT	253 620 0700	Original	85.00	?
1191	L/F UPP BUMP FRT ABS	213 620 0195	Original	Ry 210.00	✓
1192	R/F UPP BUMP FRT ABS	213 620 0295	Original	Ry 240.00	✓
1211	L/F SIDE MEMBER END	213 620 8900	Original	1,750.00	?
1212	R/F SIDE MEMBER END	213 620 9000	Original	1,750.00	?
101	WINDSCREEN	213 670 8002	Original	CM 1,050.00	✓
1411	WINDSCREEN REP KIT	000 989 4905 11		0.00	
1413	FRT SCREEN MNTG KIT	USE SINGLE PARTS			
1416	WINDSCREEN SEAL	000 987 4866	Original	Ry 120.00	✓
1441	WASHER JET COVERS	205 869 0007	Original	nit 450.00	✓
4325	PASSENGER AIRBAG	213 860 0202	Original	Ry 1,980.00	✓
4331	INSTRUMENT PANEL	213 680 9504	Original	Ta 5,500.00	✓
		9K00			
4455	AIR CON COMPRESSOR	000 830 3002	Original	3,350.00	?
4465	AIR CON CONDENSER	099 500 0454	Original	Ry 1,780.00	✓
4469	L/RADIATOR SUPP FRAM	099 504 1800	Original	Ry 120.00	✓
4470	R/RADIATOR SUPP FRAM	099 504 2000	Original	Ry 120.00	✓
4481	PUMP/DRYER PIPE	213 830 1502	Original	135.00	?
4482	CONT/EXP VALVE PIPE	213 830 5100	Original	220.00	?
4483	COMPRESSOR PIPE	205 830 6201	Original	150.00	?
7011	FRONT AXLE SUPPORT	205 628 0057	Original	2,850.00	?
7047	L/F TENSION ROD	205 330 1305	Original	Sm 390.00	X

Code	Description	Part Number	Part Source	Price SGD
7048	R/F TENSION ROD	205 330 1405	Original	390.00 X
7071	L/F CONTROL ARM	205 330 6510	Original	680.00 X
7072	R/F CONTROL ARM	205 330 6610	Original	680.00 X
7261	FRONT STABILIZER	205 323 2700	Original	380.00 X
7415	COMBI SWITCH MODULE	213 900 7010 9051	Original	350.00 ?
7445	DRIVER AIRBAG	000 860 1002 9116	Original	2,900.00 ?
7751	FRONT INTAKE CHANNEL	213 500 0055	Original	195.00 ?
7752	LOWER AIR GUIDE	213 505 0130	Original	205.00 ?
7753	RADIATOR AIR GUIDE	213 505 0030	Original	195.00 ?
7761	RADIATOR	099 500 2203	Original	1,450.00 ?
7762	LOW TEMP RADIATOR	099 500 2003	Original	1,350.00 ?
7765	L/LWR RADIATOR BRKT	213 501 0620	Original	150.00 ?
7766	R/LWR RADIATOR BRKT	213 501 0720	Original	150.00 ?
7773	R/RADIATOR HOSE	253 501 9382	Original	85.00 ?
7776	L/RADIATOR HOSE	253 501 9182	Original	85.00 ?
7787	EXPANSION TANK	205 500 0049	Original	215.00 X
7789	FAN UNIT	099 906 1800	Original	1,950.00 ?
8249	WASHER BOTTLE	274 200 0385	Original	185.00 X
8383	AIR SUCTION TUBE	274 090 0029	Original	225.00 ?
Ac85	AIR INTAKE HOSE	274 090 1800	Original	165.00 ?
8391	AIR FILTER	274 090 1701 64	Original	550.00 X
8411	ALTERNATOR	000 906 0922	Original	3,350.00 X
8775	L/F LOWER COVER	213 520 5600	Original	105.00 ?
8776	R/F LOWER COVER	213 520 5800	Original	105.00 ?
8779	FRT ENGINE COVER	213 520 0000	Original	350.00 ?
8780	CTR LWR ENGINE CVR	213 524 2700	Original	850.00 ?
9645	L/HORN	213 542 4400	Original	200.00 ?
9646	R/HORN	213 542 4300	Original	200.00 ?
9684	L/F CONTACT SWITCH	204 870 3158	Original	80.00 ?
9685	R/F CONTACT SWITCH	204 870 4458	Original	80.00 ?
1000	BONNET ACTUATOR RH	ACTUATOR	Original	250.00 X
1001	BONNET ACTUATOR LH	ACTUATOR	Original	250.00 X
1002	FRT PARKING SENSOR	SENSOR(X4)	Original	760.00 ?
1003	PARKING SENSOR SIDE	SENSOR(X2)	Original	380.00 ?
1004	F/SENSOR HARNESS	SENSOR HARNESS	Original	590.00 ?
1005	FRT RADAR SENSOR	RADAR	Original	1,650.00 ?
1006	RADAR SENSOR	RADAR	Original	55.00 ?
1007	FRT GRILLE CAMERA	CAMERA	Original	1,800.00 ?
1008	KNEE AIRBAG RH	AIRBAG	Original	1,350.00 ?
1009	KNEE AIRBAG COVER RH	COVER	Original	250.00 ?
1010	AIRBAG ECU CPL	ECU	Original	1,150.00 ?
1011	SEAT BELT FRT RH	SEAT BELT	Original	1,590.00 ?
1012	SEAT BELT FRT LH	SEAT BELT	Original	1,590.00 ?
1013	SEAT BELT BUCKLE RH	BUCKLE FRONT	Original	180.00 ?
1014	SEAT BELT BUCKLE LH	BUCKLE FRONT	Original	180.00 ?
1015	SEAT BELT REAR RH	SEAT BELT	Original	590.00 ?
1016	SEAT BELT REAR LH	SEAT BELT	Original	590.00 ?
1017	SEAT BELT BUCKLE RH	BUCKLE REAR	Original	220.00 ?
1018	SEAT BELT BUCKLE LH	BUCKLE REAR	Original	220.00 ?

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal

Total

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey

- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

0.00

77,095.00

77,095.00

Final Calculation

	SGD	SGD
Parts	77,095.00	
Total Parts		77,095.00
Labour Time Base 10 WU/h		
Total 341.0 WU X 42.00 SGD/h	1,432.20	
Alignment		
Measuring Work	33.60	
Total of Labour		1,465.80
Paint Work Time Base 10 WU/h		
Labour Cost 80.0 WU X 42.00 SGD/h	336.00	
Material Cost	192.52	
Total Paint Including Material		528.52
Repair Cost Excludes GST		79,089.32
GST (+9.00%)		7,118.04
Repair Cost Included GST		86,207.36

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.