



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

MS FIRST CAPITAL INSURANCE LTD
16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING

SINGAPORE 048581

INV No. : SAC2400969
INV Date : 14-10-2024

Reference CD/FCI24060099/Upa3
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLL 3767X
Insured Veh. SHC 3720A
Claim No. D24005261MFCT/CTPL/TPD 2
Policy No. D-24101861MFCT
Accident Date 11/06/2024
Inspection Date 19/06/2024

Description	Amount
Third Party Express Settlement	300.00
Sub-Total	300.00
GST (9%)	27.00
Grand Total	327.00

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDING SINGAPORE 048581		Ref: CD/FCI24060099/Upa3 Date: 14/10/2024 Code: FCI2		
1. Policy Particulars :- DIRECT SETTLEMENT				
Insured Veh.	SHC 3720A	Veh. Inspected	SLL 3767X	
Policy No.	D-24101861MFCT	Coverage	0	
Claim No.	D24005261MFCT/CTPL/TPD 2	Excess	\$0.00	
Assign From	SERENE LER	Assign Date	14/06/2024	
2. Vehicle Details				
Make & Model	HONDA JAZZ 1.5 (A)	C.C	1498	
Engine No.	L15B31190902	Year of Reg.	22/02/2017	
Chassis No.	JHMGK5850HX201245	Colour	SILVER	
Odometer	105749 KM	Steering	IN ORDER	
Brakes	IN ORDER	General	GOOD	
Modification(s)	RIMS: SPORTS RIM			
3. Conditions of Tyres				
	Size	Make	Balance (mm)	
R/H Front Tyre	185/55R16	YOKOHAMA	6	
L/H Front Tyre	185/55R16	YOKOHAMA	6	
R/H Rear Tyre	185/55R16	YOKOHAMA	6	
L/H Rear Tyre	185/55R16	YOKOHAMA	6	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/06/2024	Inspection Date	19/06/2024	
Survey held at	HOCK WAH MOTOR WORKSHOP PTE LTD 3011 BEDOK INDUSTRIAL PARK E #01-2008 SINGAPORE 489977			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR: 2 Working Days				



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SLL 3767X

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRONT FENDER RH	TO REPAIR SEE LABOUR	\$509.40	\$0.00
1	FRONT BUMPER	TORN	\$587.50	\$587.50
1	FRONT BUMPER RETAINER RH	NOT NECESSARY	\$14.00	\$0.00
1	FRONT FENDER INNER SHIELD RH	NOT NECESSARY	\$87.50	\$0.00
1	BONNET	NOT NECESSARY	\$586.00	\$0.00
1	HEADLAMP RH	NOT NECESSARY	\$1,283.10	\$0.00
1	HEADLAMP LOWER BRACKET RH	NOT NECESSARY	\$38.70	\$0.00
1	SUPPORT PANEL	NOT NECESSARY	\$446.20	\$0.00
	LESS 20.00% DISCOUNT		(\$710.48)	(\$117.50)
			\$2,841.92	\$470.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	LABOUR TO REMOVE & REFIT NECESSARY PARTS.INCLUSIVE OF THE REPAIR OF FRONT FENDER RH.		\$800.00	\$200.00
	SPRAY PAINT ON THE AFFECTED AREAS		\$800.00	\$400.00
	ANTI-RUST COATING	NOT NECESSARY	\$100.00	\$0.00
	WIRING		\$80.00	\$20.00
			\$1,780.00	\$620.00

GRAND TOTAL			\$4,621.92	\$1,090.00
	RECOMMENDED COST OF REPAIRS			\$1,090.00
Report Ref No: CD/FCI24060099/Upa3				

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser


DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X




PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X

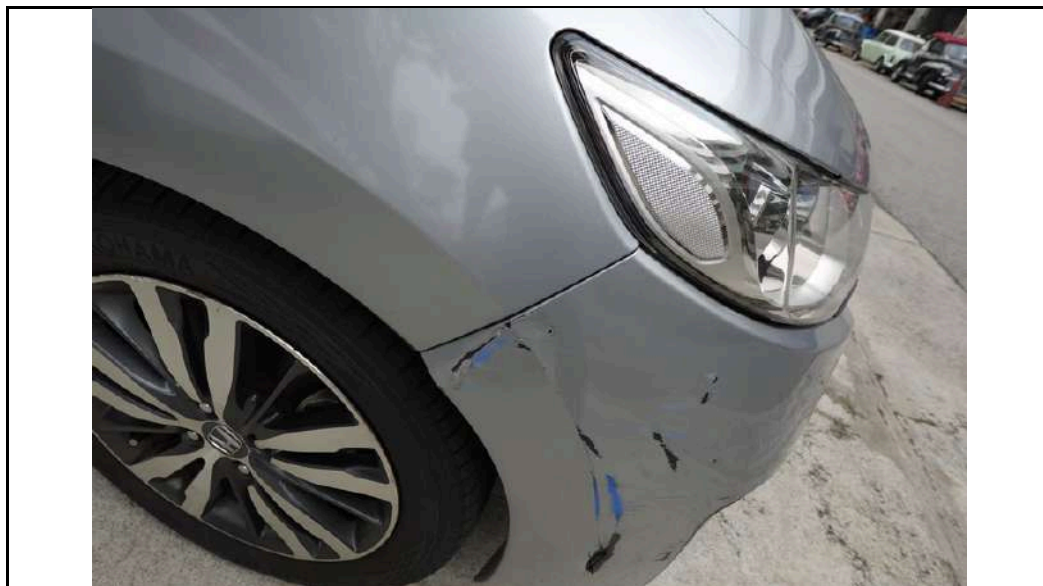


PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X



PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X

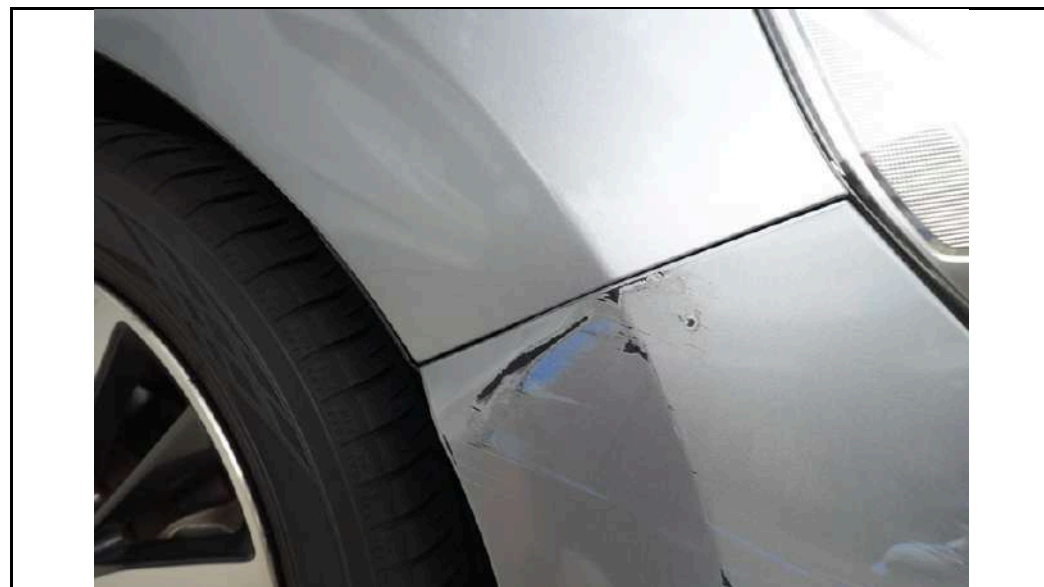

PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X

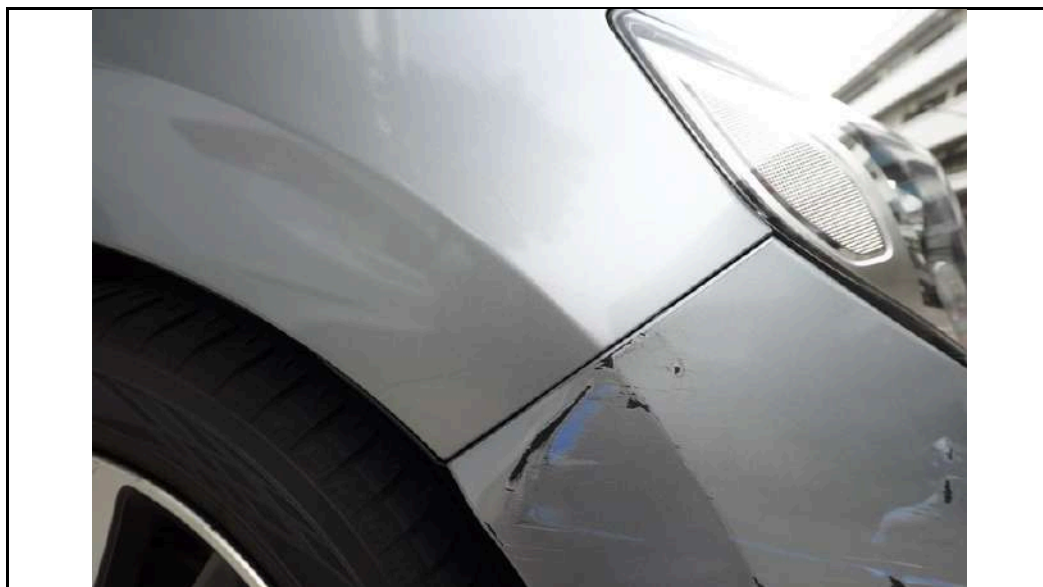

PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X



PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X



PHOTOGRAPHS FOR VEHICLE NO. : SLL 3767X

