



SMRT Automotive Services Pte Ltd


60 Woodlands Industrial Park E4, Singapore 757705

Tel : 65 6362 3422 Fax : 65 6368 7420

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5266L
Ref. No : TAX/03/16/2172
Reg. Date : 07/10/2009
Vehicle Type : TAXI
Make : HYUNDAI AZERA
Model : AZERA
Name of Driver : CHIA THIAM CHYE
Type of Accident : HEAD TO SIDE
Date / Time of Accident : 18/03/2016 10:25:00 PM
Accident Reported Date / Time : 19/03/2016 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 18/03/2016
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024080200
Special Instruction to ARC, if any :
TOWED \$40/SGW5059U
Prepared Date : 19/03/2016 08:37:43 AM

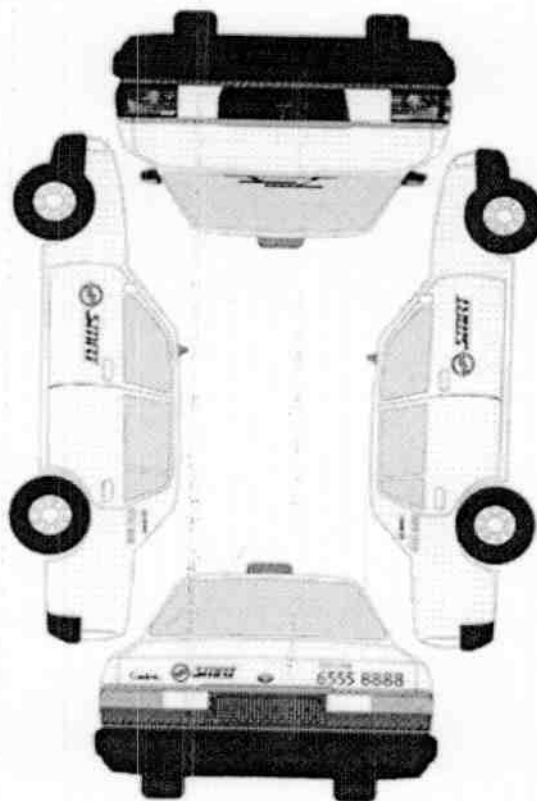

After Repair photo
Complete Repair
Require Nett Book value

check Book value

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

TAX/03/16/2172

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : KMHFC41DR9A370314

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,859.00	0.00
Total Spray Painting Charges	: 1,890.00	0.00
Total Material Charges	: 20,209.56 <i>75,241.95</i>	20,209.56
Other Charges	: 1,070.00	0.00
TOTAL	: 24,994.64 <i>30,090.95</i>	0.00
Lum Sum Total	: 25,000.00	0.00
No. of Repair Days	: 12.00	0.00 <i>10 Days</i>
Prepared / Adjusted By	:	
Prepared / Adjusted Date	: 19/03/2016 10:58:09 AM	01/01/1900 12:00:00 AM

Prepared Date : 19/03/2016 10:46:32 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount : 0.00	Prepared Date : 3/19/2016 11:00:01 AM

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR FRONT PORTION	1,859.00	0.00
Total Labour	1,859.00	0.00 1400

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00
TO REPSRAY FRONT HOOD	378.00	0.00
TO RESPRAY FRONT FENDER LH	378.00	0.00
TO RESPRAY FRONT FENDER RH	378.00	0.00
TO RESPRAY FRONT DOOR LH	378.00	0.00
Total Spray Painting & Panel Beating	1,890.00	0.00 1000

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00 X
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
TO APPLY RUST-PROOFING ON AFFECTED AREA	300.00	0.00 80
TO TOP UP A/C GAS	120.00	0.00 50
TO REMOVE AND REFIX UNDERCARRIAGE	250.00	0.00 100
TO REMOVE AND REFIT WIRE HARDESS	120.00	0.00 50
TO CHECK AND RESET CNG SYSTEM	120.00	0.00 50
Total Other Costs	1,070.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
865113L 000	FRONT	FRONT BUMPER COVER	1	473.30	10.00	425.97	Replace	Replace ✓	No
865123L 001	COMMO N	COVER, FRONT BUMPER LOWER	1	256.20	10.00	230.58	Replace	Replace ✓	No
865203L 000	COMMO N	ENERGY ABSORBER, FRONT BUMPER	1	96.90	10.00	87.21	Replace	Replace ✓	No
865303L 000	COMMO N	FRONT BUMPER RAIL	1	378.20	10.00	340.38	Replace	Replace ✓	No
922013L 000	COMMO N	FOG LAMP ASSY-FRONT LH	1	237.00	10.00	213.30	Replace	Replace ✓	No
922023L 000	COMMO N	FOG LAMP ASSY-FRONT RH	1	237.00	10.00	213.30	Replace	Replace ✓	No
865133L 000	COMMO N	BRACKET-FRONT BUMPER SIDE LH	1	22.20	10.00	19.98	Replace	Replace ✓	No
865143L 000	COMMO N	BRACKET-FRONT BUMPER SIDE RH	1	22.20	10.00	19.98	Replace	Replace ✓	No
8635131 500	COMMO N	GRILLE ASSY - RADIATOR	1	181.80	10.00	163.62	Replace	Replace ✓	No
	FRONT	FRONT NUMBER PLATE	1	35.00	0.00	35.00	Replace	Replace ✓	No
	FRONT	FRONT NUMBER PLATE FRAME	1	35.00	0.00	35.00	Replace	Replace ✓	No
664003L 200	COMMO N	FRONT BONNET ASSY	1	1,446.30	10.00	1,301.67	Replace	Replace ✓	No
	COMMO N	FRONT BONNET CHROME	1	380.00	10.00	342.00	Replace	Replace ✓	No
	FRONT	FRT BONNET MOULDING	1	162.60	10.00	146.34	Replace	Replace ✓	No
	COMMO N	BONNET INSULATOR	1	190.50	10.00	171.45	Replace	Replace ✓	No
	COMMO N	BONNET CABLE	1	70.05	10.00	63.04	Replace	Replace ✓	No
	COMMO N	BONNET LOCK	1	65.40	10.00	58.86	Replace	Replace ✓	No
7935921 000	FRONT1	Insulator-Front Hood	2	1.30	10.00	2.34	Replace	Replace ✓	No
	FRONT	FRT GRILLE EMBLEM	1	20.70	10.00	18.63	Replace	Replace ✓	No
791103K 000	FRONT1	Hinge Assy-Hood LH	1	71.80	10.00	64.62	Replace	Replace X	No
791203K 000	FRONT1	Hinge Assy-Hood RH	1	71.80	10.00	64.62	Replace	Replace X	No
864703L 000	FRONT1	Seal Strip-Hood Side LH	1	21.80	10.00	19.62	Replace	Replace ✓	No

10137-51

864803L 000	FRONT1	Seal Strip-Hood Side RH	1	21.80	10.00	19.62	Replace	Replace ☒	No
	COMMO N	WIPER GARNISH	1	80.60	10.00	72.54	Replace	Replace ☒	No
641013L 000	COMMO N	RADIATOR SUPPORT PANEL ASSY	1	874.20	10.00	786.78	Replace	Replace ☒	No
	COMMO N	RADIATOR AIR GUARD	2	17.50	10.00	31.50	Replace	Replace ☒	No
	COMMO N	RADIATOR TOP HOSE	1	50.18	10.00	45.16	Replace	Replace ☒	No
	COMMO N	RADIATOR BOTTOM HOSE	1	45.28	10.00	40.75	Replace	Replace ☒	No
	COMMO N	RADIATOR FAN MOTOR ASSY	1	642.71	10.00	578.44	Replace	Replace ☒	No
	COMMO N	RADIATOR SPARE TANK	1	47.11	10.00	42.40	Check	Replace ☒	No
	COMMO N	COOLANT	1	12.32	0.00	12.32	Replace	Replace ☒	No
976063L 180	COMMO N	A/C CONDENSER	1	1,278.00	10.00	1,150.20	Replace	Replace ☒	No
	FRONT	COVER ENGINE TOP	1	0.00	10.00	0.00	Replace	Replace ☒	No
863533L 300	COMMO N	Cover, Radiator Grille Upper	1	45.10	10.00	40.59	Replace	Replace ☒	No
	COMMO N	AIR RESONATOR BOX	1	525.00	10.00	472.50	Replace	Replace ☒	No
	COMMO N	AIRCON DISCHARGE HOSE	1	350.71	10.00	315.64	Replace	Replace ☒	No
	COMMO N	AIRCON SUCTION HOSE	1	380.00	10.00	342.00	Replace	Replace ☒	No
373003C 150	COMMO N	Alternator	1	1,190.30	10.00	1,071.27	Replace	Replace ☒	No
	COMMO N	AIRCON COMPRESSOR	1	907.00	10.00	816.30	Replace	Replace ☒	No
	FRONT	AIR DUCT	1	117.30	10.00	105.57	Replace	Replace ☒	No
252123C 100	FRONT1	V Belting	1	79.50	10.00	71.55	Replace	Replace ☒	No
251003C 100	FRONT1	Water Pump Assy.	1	271.20	10.00	244.08	Replace	Replace ☒	No
	COMMO N	Wiper washer tank	1	72.24	10.00	65.02	Replace	Replace ☒	No
981103L 000	COMMO N	Wiper Motor Assy	1	295.30	10.00	265.77	Replace	Replace ☒	No
	COMMO N	Wiper washer tank motor	1	118.72	10.00	106.85	Replace	Replace ☒	No
	COMMO N	WIPER WASHER TANK SENSOR	1	28.10	10.00	25.29	Replace	Replace ☒	No

	COMMO N	WIRE HARDNESS, MAIN	1	3,500.00	10.00	3,150.00	Replace	Replace <i>check</i>	No
		WIRE HARNESS HORN	1	654.00	10.00	588.60	Replace	Replace <i>check</i>	No <i>check</i>
		HEADLAMP BRACKET LH	1	32.20	10.00	28.98	Replace	Replace <i>check</i>	No
921013L 190	COMMO N	HEADLAMP ASSY-FRONT LH	1	2,566.60	10.00	2,309.94	Replace	Replace <i>check</i>	No
		HEADLAMP BRACKET RH	1	32.20	10.00	28.98	Replace	Replace <i>check</i>	No
921023L 190	COMMO N	FRONT HEADLAMP ASSY RH	1	2,566.60	10.00	2,309.94	Replace	Replace <i>check</i>	No
791103K 000	FRONT1	Hinge Assy-Hood LH	1	71.80	10.00	64.62	Replace	Replace <i>check</i>	No
966103L 000	COMMO N	Horn Assy - Low Pitch	1	67.50	10.00	60.75	Replace	Replace <i>check</i>	No
571003L 100	FRONT1	Power Steering Pump Assy	1	628.50	10.00	565.65	Replace	Replace <i>check</i>	No
575103L 190	FRONT1	P/steering High Pressure Hose	1	563.20	10.00	506.88	Replace	Replace <i>check</i>	No
	COMMO N	POWER STEERING PRESSURE HOSE	1	641.78	10.00	577.60	Replace	Replace <i>check</i>	No
	COMMO N	POWER STEERING FLUID RESERVOIR	1	150.00	10.00	135.00	Replace	Replace <i>check</i>	No
	COMMO N	POWER STEERING FLUID	1	14.00	0.00	14.00	Replace	Replace <i>check</i>	No
663103L 200	COMMO N	FENDER ASSY-FRONT LH	1	541.70	10.00	487.53	Replace	Replace <i>check</i>	No
868113L 000	COMMO N	FENDER PROTECTOR- FRONT LH	1	65.90	10.00	59.31	Replace	Replace <i>check</i>	No
760033L 020	SIDE1	Door Assy-Front LH	1	1,157.30	10.00	1,041.57	Replace	Replace <i>repair</i>	No
		SMRT LOGO DOOR	1	60.00	0.00	60.00	Replace	Replace <i>check</i>	No
663203L 200	COMMO N	FRONT FENDER ASSY, RH	1	541.70	10.00	487.53	Replace	Replace <i>check</i>	No
868123L 000	COMMO N	FENDER PROTECTOR- FRONT RH	1	65.90	10.00	59.31	Replace	Replace <i>check</i>	No
624053L 400	FRONT1	Crossmember Assy Front.	1	1,842.90	10.00	1,658.61	Replace	Replace <i>check</i>	No
	COMMO N	STICKER CNG	1	7.80	0.00	7.80	Replace	Replace <i>check</i>	No
	COMMO N	FRT FRNDER LINER CLIP	6	3.00	10.00	16.20	Replace	Replace <i>check</i>	No
LP37110 1C200	FRONT1	Battery Assy.	1	160.00	10.00	144.00	Replace	Replace <i>check</i>	No
	COMMO N	BATTERY CABLE EARTH	1	75.00	10.00	67.50	Replace	Replace <i>check</i>	No

14430.70.

	COMMO N	BATTERY TRAY	1	80.00	10.00	72.00	Replace	Replace <i>X</i>	No
TOTAL MATERIALS						20,209.56	<i>Chap</i>		

92

cl

Kalvin (C100)

M 2/13/16