



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

DIRECT ASIA INSURANCE (S) PL

INV No. AC2301964

20 ANSON ROAD
#08-01 TWENTY ANSON
SINGAPORE 079912

INV Date 29/03/2023
Reference CC4/DAI17008937/Dpa3q2
Code DAI

PROFESSIONAL SERVICE FEE

Vehicle No. FBG 2460G

Insured Veh. FX 6521B

Claim No. 70359/JT

Policy No.

Accident Date 26/04/2017

Inspection Date 08/05/2017

Description	Total
Survey Inspection	200.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	200.00
GST (8%)	16.00
Grand Total	216.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
DIRECT ASIA INSURANCE (S) PL 20 ANSON ROAD #08-01 TWENTY ANSONSINGAPORE 079912			Ref: CC4/DAI17008937/Dpa3q2 Date: 29/03/2023 Code: DAI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	FX 6521B	Veh. Inspected	FBG 2460G	
Policy No.		Coverage (\$)	0.00	
Claim No.	70359/JT	Excess (\$)	0.00	
Assign From	JOLEEN	Assign Date	08/05/2017	
2. Vehicle Particulars & Condition				
Make & Model	APRILIA RS 125	c.c	125	
Engine No.	HIDDEN	Year of Reg.	2012	
Chassis No.	ZD4PY0002BS006921	Colour	BLACK	
Odometer	63403 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	110/70 R17	BRIDGESTONE	2 mm	
L/H Front Tyre			mm	
R/H Rear Tyre	110/70 R17	BRIDGESTONE	2 mm	
L/H Rear Tyre			mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S & O/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/04/2017	Inspection Date	08/05/2017	
Survey held at	TEAMWORK GARAGE PTE LTD 53 UBI AVENUE 1 #01-24 SINGAPORE 408934.			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBG 2460G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT HEAD FARING	CRACKED	589.43	589.43
1	FRONT HEADLAMP	NOT NECESSARY	483.22	-
1	SET FRONT WING MIRROR	NOT NECESSARY	289.34	-
1	FRONT WINDSCREEN VISIOR	NOT NECESSARY	137.43	-
2	FRONT OUTER AIR GUIDE	NOT NECESSARY	238.44	-
2	FRONT SIGNAL LAMP	O/S BROKEN / N/S NOT NECESSARY	150.20	75.10
1	HANDLE BAR	NOT NECESSARY	384.55	-
1	SET FRONT HANDLE BAR BALANCER	NOT NECESSARY	120.46	-
1	FRONT CLUTCH LEVER	NOT NECESSARY	157.30	-
1	RH SIDE FAIRING	NOT NECESSARY	583.44	-
1	LH SIDE FAIRING	NOT NECESSARY	583.44	-
1	REAR LH FAIRING	CUT	439.24	439.24
1	REAR RH FAIRING	CUT	439.24	439.24
1	LOWER CLTUCH LEVER	NOT NECESSARY	174.32	-
1	RH LOWER STAND	NOT NECESSARY	89.30	-
1	REAR PILLION STAND	NOT NECESSARY	83.54	-
1	REAR EXHAUST	NOT NECESSARY	790.47	-
1	REAR EXHAUST BRACKET	NOT NECESSARY	153.44	-
1	REAR LH SIGNAL LAMP	NOT NECESSARY	87.30	-
1	FRONT FORK	NOT NECESSARY	1,500.43	-
	LESS 10% DISCOUNT		-747.45	-154.30
			6,727.08	1,388.71
	<u>SPECIAL NETT ITEMS</u>			
1	FORK SEAL (SN)	NOT NECESSARY	160.00	-
1	SEAL OIL (SN)	NOT NECESSARY	80.00	-
			240.00	-
	<u>LABOUR</u>			
	CHECK WIRING AND LIGHTING SYSTEM.	NOT NECESSARY	50.00	-
	ALIGN CHASSIS FRAME .	NOT NECESSARY	700.00	-

Report Ref No. CC4/DAI17008937/Dpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINTING ON AFFECTED AREAS .		600.00	150.00
	REMOVE AND REFIT STICKER ON AFFECTED AREAS .		300.00	120.00
			1,650.00	270.00
GRAND TOTAL			8,617.08	1,658.71
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,300.00

Report Ref No. CC4/DAI17008937/Dpa3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. FBG 2460G

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

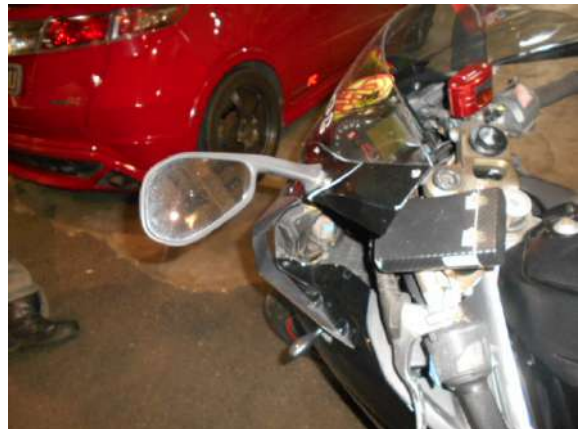



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. FBG 2460G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

