

ASS. REC. BY: Adrian LingREF: CC3/AIG/1901549/A9 502**ASSIGNMENT**

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____


Insured: _____

Policy No. 2100482801Claims No. 3632537990 SGSum Insured: _____ Excess: 0\$ 14/8/17

(Client's Record)

Make of Veh: _____

(Policy Condition)

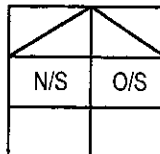Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 132K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 28 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Vehicle: IN / OUT

Person Contacted: _____

Veh No: SLA1222Y Yr Regn: 2016 / SeptType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A4 c.c. 1395Colour: White A/C: Insured / Std / NI / NASp. Reading: 16321 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAUZZZF40H A 029304Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/60R16R: 205/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Continental

Front:

Rear

R/Bal. 06 mm R/Bal. 06 mmL/Bal. 06 mm L/Bal. 06 mmD.O.A. _____ D.O.I. 10/08/17Survey held at PremiumDes. of Damages: Frnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	OD AIG.
	SLA1222Y - X
	Report via messenger.
14/5/17 @	11.57am Victor informed C/A via messenger.
14/5/17 @	2.57pm informed Tony C/A not more than \$59k on P/P basis & EX: 0.
31/5/17 @	1.26am 2nd report to Victor via messenger (supplementary).
31/5/17 @	1.50pm Andy Tong informed authorise on \$59k. via messenger.
20/11/17 @	4.47pm confirmed with Mr Boo Anai Pig \$59k, 28 days by email. (Red \$35501, 38%)

Date/Time, File Pass to? ☐ : Preli. Report1) 23/11 turn in ☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: 28Resurvey No. of Trip: 1Survey Fee: 200

Transportation:

S + RS, \$

Photos

Others

TOTAL

10200Report Format: NER-01Lump Sum / I.B.I. (\$) 59000Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AIG ASIA PACIFIC INSURANCE PTE LTD

Ref : CC3/AIG17015496/Aqb

78 SHENTON WAY #08-16
CHARTIS BUILDING
SINGAPORE 079120

Date : 11-08-2017



Code : AIG

1. Policy Particulars :- OWN DAMAGE

Insured Veh.	Veh. Inspected	SLA 1222Y
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	11/08/2017

2. Vehicle Particulars & Condition

Make & Model	c.c
Engine No.	Year of Reg.
Chassis No.	Colour
Odometer	Steering
Brakes	Modification
General	

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	07/08/2017	Inspection Date
Survey held at		

5a. Remarks

--

Survey Department Check List (Case Handler)

Reference No. : CC3/17015496/Agb
Policy Type: OD/TP/TP RES/TL/EVA

SLA 1228Y

Case Handler

Typist

Admin (*Cather*): Case handler to make sure all Information created by the assignment team are **ACCURATE**.

(1) Office Assign Form

- C Reference No.
- C Customer Code
- N Assign From
- C Assign Date
- C Veh No (Inspected)
- C Veh No (Insured)
- C D.O.A
- C Policy No
- C Claim No
- C Insurance Authorisation (CA /REV/REP)
- C Report Type
- C Weekend Charges
- N Survey held at/Repairer
- C Excess

Y-Date	N-Date	Y-Date	N-Date
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		

Surveyor (*Adrian*): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

- C Vehicle No
- C Regn Month/Year
- N Vehicle Type
- N Make & Model
- C Engine Capacity. (C.C)
- N Colour
- C Odometer. (Sp.Reading)
- C Chassis No
- N General Condition
- N Steering
- N Brake
- N Modification (Modi)
- C Tyre Size
- N Tyre Make
- C Tyre Balance
- C Date of Inspection
- N Survey held
- N Des.of Damages

☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		

(2) System - (Views/Merimen)

- C Damaged Vehicle Photographs Uploaded

☒	☒		
-------------------------------------	-------------------------------------	--	--

(3) Workshop Estimate/Assignment Form

- N ALL Parts condition
- C Market Value for OD cases
- C Estimate Repair Cost for PRI (RSI, TMI, MSIG)
- C Days of repair
- C Finalised Amount
- C Re-inspection Cases to Finalize within 5 Days

☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		
☒	☒		

(4) System - (Views/Merimen)

- C Resurvey photo Uploaded

☒	☒		
-------------------------------------	-------------------------------------	--	--

Check By:

Chen 20/12/17

Case Handler

Date

*C: Critical *N: Non-Critical

21/05/2014

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Wednesday, 20 December, 2017 4:47 PM
To: Boo seng yak; SUR; Carrine Leong; Nora Khai
Subject: RE: FINAL REVISION - SLA1222Y - OD AIG - SURVEYED 10 AUG 17

Dear Mr Boo,

Confirm final fig \$59,000.00 before GST and 28 repair days. (refer to the email dated 14/08/2017)

Kindly expedite the discharge voucher and tax invoice to us for close case.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak [mailto:boojohnny@gmail.com]
Sent: Thursday, 23 November, 2017 5:31 PM
To: Adrian Ling (LKKAUTO) <adrianling@lkkauto.com>; Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>; SUR <sur@lkkauto.com>; Carrine Leong <carrine.leong@premiumauto.com.sg>; Nora Khai <nora.khai@premiumauto.com.sg>
Subject: FINAL REVISION - SLA1222Y - OD AIG - SURVEYED 10 AUG 17

Hi Adrian and all,

Revised estimate is attached.

Please confirm repair cost of \$ 67,277.24 @ 28 days of repairs exclude 1 Public Holiday and 5 Sundays.

Your early closure is well appreciated.

Best regards - jb

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	07 Aug 2017 17:33	Clim Veh Model Changed		[] Merimen Administrator
2	07 Aug 2017 17:33	Clim Created	Reg No: SLA1222Y. Policy No: 2100482801-00000. Acct Date: 2017/08/07. Claim Type: SC. Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG). Ins.Status => Notification. Created from SAS:MPA117104387	[I] Merimen Administrator
3	11 Aug 2017 14:39	Clim Registration Modified	Setl.Type:3->0. Claim Type:SC->OD.	[] DENISE TAY KWEE CHENG
4	11 Aug 2017 14:39	Adj Clim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] DENISE TAY KWEE CHENG
5	11 Aug 2017 14:39	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] DENISE TAY KWEE CHENG
6	11 Aug 2017 14:39	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/08/22	[A] DENISE TAY KWEE CHENG
7	11 Aug 2017 14:39	Adj Mandate Set	Approved:8000.00.Reinsp:Adj decides.	[A] DENISE TAY KWEE CHENG
8	11 Aug 2017 14:39	Clim Registration Modified	Rep:1137->200611.	[A] DENISE TAY KWEE CHENG
9	11 Aug 2017 14:39	Clim Veh Model Changed	(204567) AUDI A4 1.4 T (A).	[A] DENISE TAY KWEE CHENG
10	11 Aug 2017 14:40	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] DENISE TAY KWEE CHENG
11	11 Aug 2017 17:41	Adj Rpt Initiated		[A] DENISE TAY KWEE CHENG
12	11 Aug 2017 17:41	Clim Details Notified		[A] DENISE TAY KWEE CHENG
13	11 Aug 2017 17:48	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/08/22	[A] DENISE TAY KWEE CHENG
14	11 Aug 2017 17:48	Adj Mandate Request	Cur.Req:59433.00:DAMAGE CONSISTENT REPAIR COST ECONOMICAL	[A] DENISE TAY KWEE CHENG
15	14 Aug 2017 10:23	Clim Registration Modified	Init.Est.:->5,000 - 6,000. Excess: -> 0.00. 2F Remarks: -> Not Applicable. GST: -> 7.00.	[I] Dally Amri, Mimi Zarina
16	14 Aug 2017 10:23	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
17	14 Aug 2017 11:57	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/08/22. Mandate Remarks: Repair limit not exceeding \$59,000.00. Re-inspection to be done for damage check and supplementary items / labour.	[I] Koh, Victor-CK
18	14 Aug 2017 11:57	Adj Mandate Set	Approved:47972.00:Repair limit not exceeding \$59,000.00. Re-inspection to be done for damage check and supplementary items / labour. Reinsp:Yes.	[I] Koh, Victor-CK
19	31 Aug 2017 11:21	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/08/22	[A] SHIAU CHAN
20	31 Aug 2017 11:26	Adj Mandate Request	Cur.Req:59000.00:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL. KINDLY APPROVE ON SUPPLEMENTARY. REPAIRER AWARE AND AGREED REPAIR COST NOT MORE THAN \$59,000.00	[A] SHIAU CHAN
21	31 Aug 2017 13:50	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2017/08/22. Mandate Remarks: Repair limit not exceeding \$59,000.00. Re-inspection to be done for damage check and supplementary items / labour.	[I] Fong, Andy-SY
22	31 Aug 2017 13:50	Adj Mandate Set	Approved:59000.00:Repair limit not exceeding \$59,000.00. Re-inspection to be done for damage check and supplementary items / labour.	[I] Fong, Andy-SY

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1550103	11/08/2017 17:41	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SLA1222Y		10.70
1550658	14/08/2017 09:47	Motor	AIG Asia Pacific Insurance Pte. Ltd.	AIG Asia Pacific Insurance Pte. Ltd. (SG)	SLA1222Y	DENISE TAY KWEE CHENG	xx.xx

Note: This document has not been finalised.**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Dally Amri, Mimi Zarina

Date: 31 Aug 2017

Preliminary Advice

Vehicle No	: SLA1222Y	Accident Date	: 07/08/2017
Make	: AUDI A4	Policy No.	: 2100482801-00000
Assignment Date	: 11/08/2017	Excess	: S\$0.00
Date of Inspection	: 11/08/2017	Est. Duration of Repair	: 0.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (HQ) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front & rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	94,501.00	(EST: \$75,871.00 + SUPPLEMENTARY \$18,630.00)
Revised Amount	:S\$	66,003.00	(INCLUSIVE OF SUPPLEMENTARY)
Check Items (Estimated)	:S\$	12,060.00	
Total	:S\$	78,063.00	
Lump Sum Repair	:S\$		

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	132,000.00
COE / PARF Rebate	:S\$	72,109.00
Salvage Value	:S\$	
Margin for Repair	:S\$	59,891.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : KINDLY APPROVE ON SUPPLEMENTARY.
REPAIRER AWARE AND AGREED REPAIR COST NOT MORE THAN \$59,000.00.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Monday, 14 August, 2017 2:57 PM
To: Claims Department
Cc: SUR
Subject: RE: SLA 1222Y / OD / AIG

Dear Tony,

As instructed by our client AIG insurance company, please proceed to repair the insured vehicle **SLA 1222Y** at repair cost not more than **\$59,000.00 on part by part basis. (Excess \$0/-).**

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Denise Tay (LKKAUTO)
Sent: Monday, 14 August, 2017 9:25 AM
To: Claims Department <claims@premiumauto.com.sg>
Cc: SUR <sur@lkkauto.com>
Subject: SLA 1222Y / OD / AIG

Dear Tony,

As spoken, please do not exceed \$59k on part by part.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Claim Audit

AUDIT TRAIL				
No	Date	Action	Remarks	By
1	07 Aug 2017 17:33	Clim Veh Model Changed		[] Merimen Administrator
2	07 Aug 2017 17:33	Clim Created	Reg No: SLA1222Y. Policy No: 2100482801-00000. Acct Date: 2017/08/07. Claim Type: SC. Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG). Ins.Status => Notification. Created from SAS:MPA117104387	[I] Merimen Administrator
3	11 Aug 2017 14:39	Clim Registration Modified	Setl.Type:3->0. Claim Type:SC->OD.	[] DENISE TAY KWEE CHENG
4	11 Aug 2017 14:39	Adj Clim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] DENISE TAY KWEE CHENG
5	11 Aug 2017 14:39	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] DENISE TAY KWEE CHENG
6	11 Aug 2017 14:39	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/08/22	[A] DENISE TAY KWEE CHENG
7	11 Aug 2017 14:39	Adj Mandate Set	Approved:8000.00.Reinsp:Adj decides.	[A] DENISE TAY KWEE CHENG
8	11 Aug 2017 14:39	Clim Registration Modified	Rep:1137->200611.	[A] DENISE TAY KWEE CHENG
9	11 Aug 2017 14:39	Clim Veh Model Changed	(204567) AUDI A4 1.4 T (A).	[A] DENISE TAY KWEE CHENG
10	11 Aug 2017 14:40	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] DENISE TAY KWEE CHENG
11	11 Aug 2017 17:41	Adj Rpt Initiated		[A] DENISE TAY KWEE CHENG
12	11 Aug 2017 17:41	Clim Details Notified		[A] DENISE TAY KWEE CHENG
13	11 Aug 2017 17:48	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/08/22	[A] DENISE TAY KWEE CHENG
14	11 Aug 2017 17:48	Adj Mandate Request	Cur.Reg:59433.00:DAMAGE CONSISTENT REPAIR COST ECONOMICAL	[A] DENISE TAY KWEE CHENG
15	14 Aug 2017 10:23	Clim Registration Modified	Init.Est.:>5,000 - 6,000. Excess: -> 0.00. 2F Remarks: -> Not Applicable. GST: -> 7.00.	[I] Dally Amri, Mimi Zarina
16	14 Aug 2017 10:23	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
17	14 Aug 2017 11:57	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/08/22. Mandate Remarks: Repair limit not exceeding \$59,000.00. Re-inspection to be done for damage check and supplementary items / labour.	[I] Koh, Victor-CK
18	14 Aug 2017 11:57	Adj Mandate Set	Approved:47972.00:Repair limit not exceeding \$59,000.00. Re-inspection to be done for damage check and supplementary items / labour. Reinsp:Yes.	[I] Koh, Victor-CK

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Invoice No	Invoice Date	Acc. Type	Acc. Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1550103	11/08/2017 17:41	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SLA1222Y		10.70
1550658	14/08/2017 09:47	Motor	AIG Asia Pacific Insurance Pte. Ltd.	AIG Asia Pacific Insurance Pte. Ltd. (SG)	SLA1222Y	DENISE TAY KWEE CHENG	xx.xx

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 11 Aug 2017

Preliminary Advice

Vehicle No	: SLA1222Y	Accident Date	: 07/08/2017
Make	: AUDI A4	Policy No.	: 2100482801-00000
Assignment Date	: 11/08/2017	Excess	: S\$0.00
Date of Inspection	: 11/08/2017	Est. Duration of Repair	: 0.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (HQ) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	75,871.00
Revised Amount	:S\$	47,972.00
Check Items (Estimated)	:S\$	11,461.00
Total	:S\$	59,433.00

Lump Sum Repair :S\$

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	132,000.00
COE / PARF Rebate	:S\$	72,109.00
Salvage Value	:S\$	
Margin for Repair	:S\$	59,891.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Text size + -

Enquire PARF/COE Rebate for Registered Vehicle**Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC

Owner ID: 6540B

Vehicle Details

Vehicle No.: SLA1222Y

Vehicle to be Exported: No

Intended De-registration
Date: 11 Aug 2017

Vehicle Make: AUDI

Vehicle Model: A4 1.4 TFSI S TRONIC

Primary Colour: White

Manufacturing Year: 2016

Engine No.: CVN017926

Chassis No.: WAUZZZF40HA029304

Maximum Power
Output: 110.0 kW (147 bhp)

Open Market Value: \$32,161.00

Original Registration
Date: 16 Sep 2016

First Registration Date: 16 Sep 2016

Transfer Count: 0

Actual ARF Paid: \$27,026.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry
Date: 15 Sep 2026

PARF Rebate Amount: \$20,269.00

Intended COE Rebate Details

COE Expiry Date: 15 Sep 2026

COE Category: B - Car above 1600cc or 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$57,002.00

COE Rebate Amount: \$51,840.00

Total Rebate Amount: \$72,109.00

The information contained herein is correct as at 11 Aug 2017



Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 6.0 SP3 and above. 1024 X 768 resolution

Copyright © 2017 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#) | [Rate this e-Service](#)

Last updated on 30 Jul 2017 at 12:58 AM

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	07/08/2017 16:17
Date Of Accident	07/08/2017 07:25
Exact Location Of Accident	ALONG CTE TOWARDS CITY (BEF AMK AVE 5)
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLA1222Y
Insured/Policyholder	
Name Of Registered Owner	CHUA KEE LAM
NRIC No	S6806540B
Email Address	BEEMER6806@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96835018
Alternative Phone No	OFFICE-96835018

Vehicle Particulars

Manufacturer	AUDI
Model	A4 SEDAN 1.4 TFSI S
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100482801-00000
Cover Note Number	

Driver

Name of Driver	CHUA KEE LAM
NRIC No	S6806540B
Date Of Birth	14/02/1968
Occupation	INDOOR
Date Of Driving Pass	20/11/1985
Driving Experience	31 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96835018
Fax Number	
Contact Number	OFFICE-96835018
Email Address	BEEMER6806@GMAIL.COM

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SKM298J
Vehicle Make/Model/Colour	
Details Of Properties	
Name of Driver	LEE YONG TECK
NRIC/Passport Number	S6847903G
Contact Number	
Address	2 SERANGOON GARDEN TERRACE
Postcode	554458
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Details of Witness

Name	
Phone Number	
Email Address	

Sketch Plan #2

Describe Circumstances of the Accident

At around 725 am I was driving along ITE towards City, after Via Chu bang exit, before Anit Ave 5 exit, on the 4th lane. As the morning traffic was heavy, front vehicles stopped. I also stopped. Suddenly my car was stationary at the time. Suddenly the van BIF9708 crashed into my car from behind. The impact was so great it pushed my car to hit the front vehicle of #298.

Declaration

We declare the foregoing particulars are true in every respect.


Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

 
Witnessed by Reporting Centre Personnel


Accident Photo




Accident Photo




Accident Photo

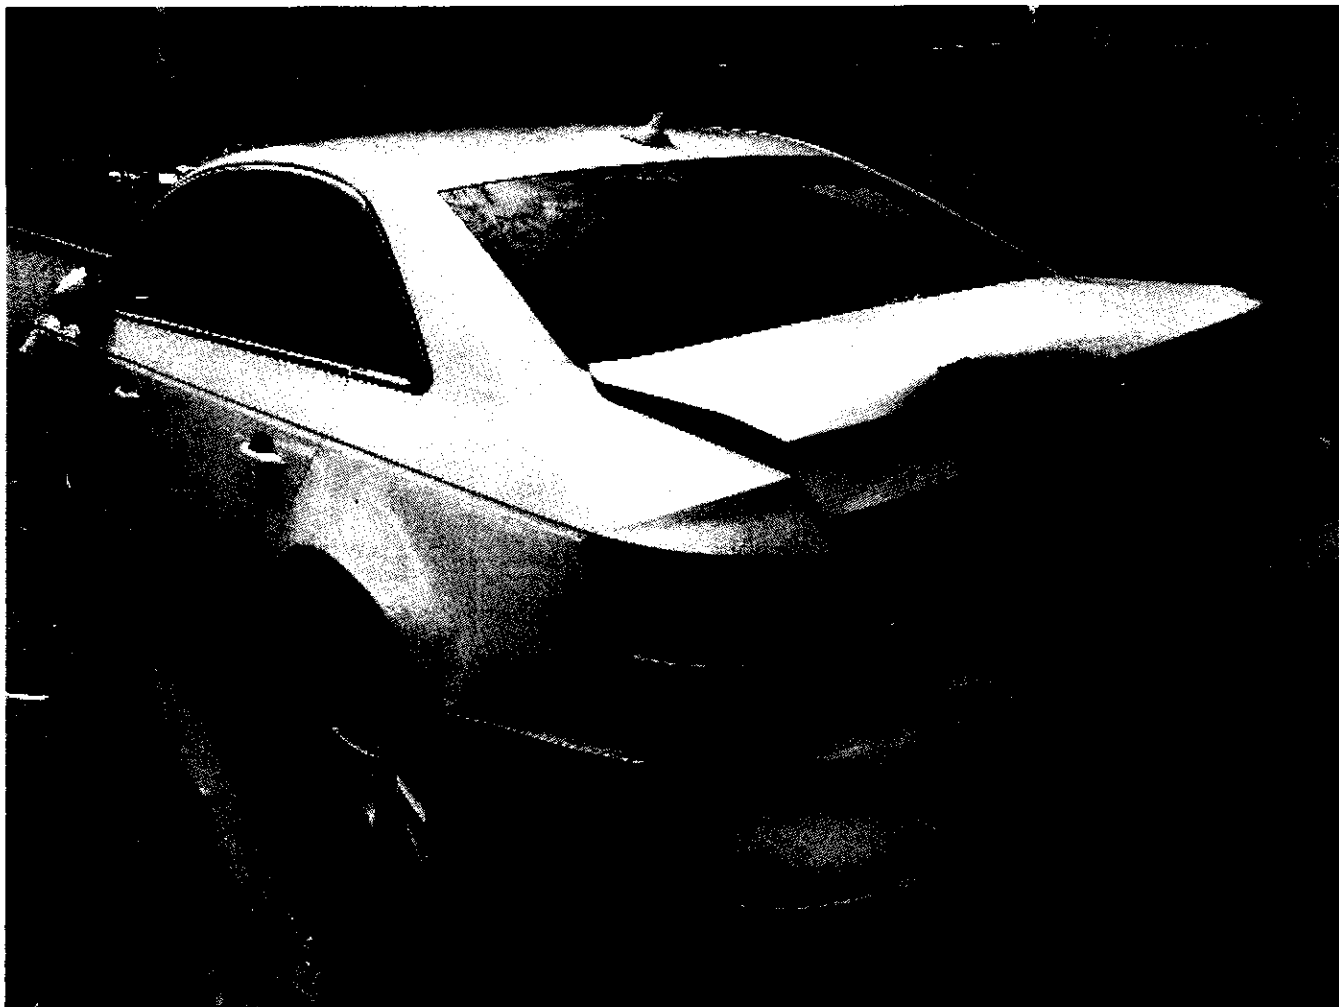


Accident Photo

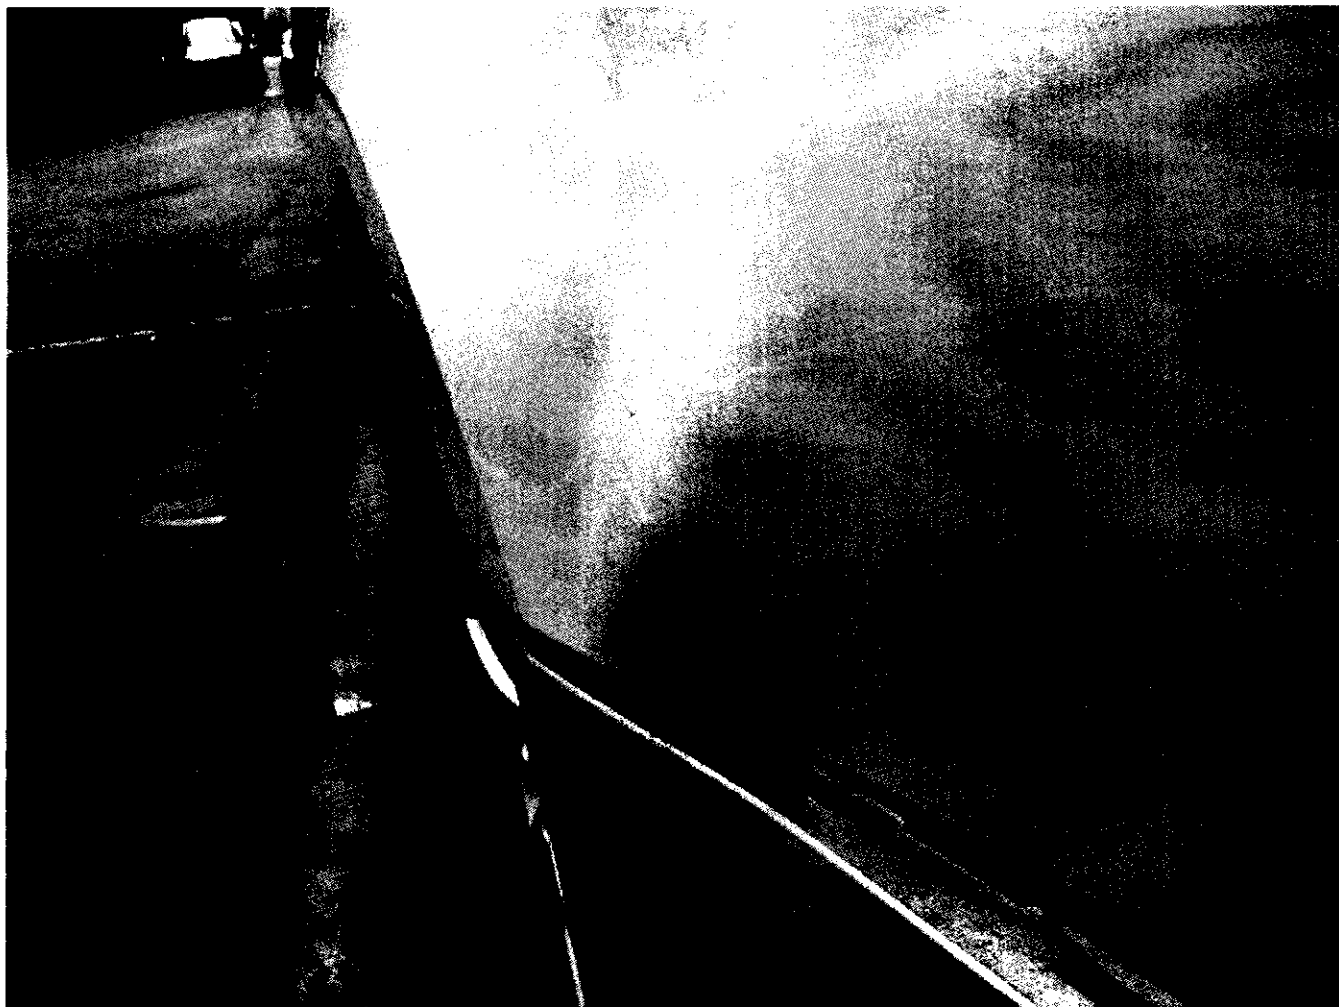

Accident Photo

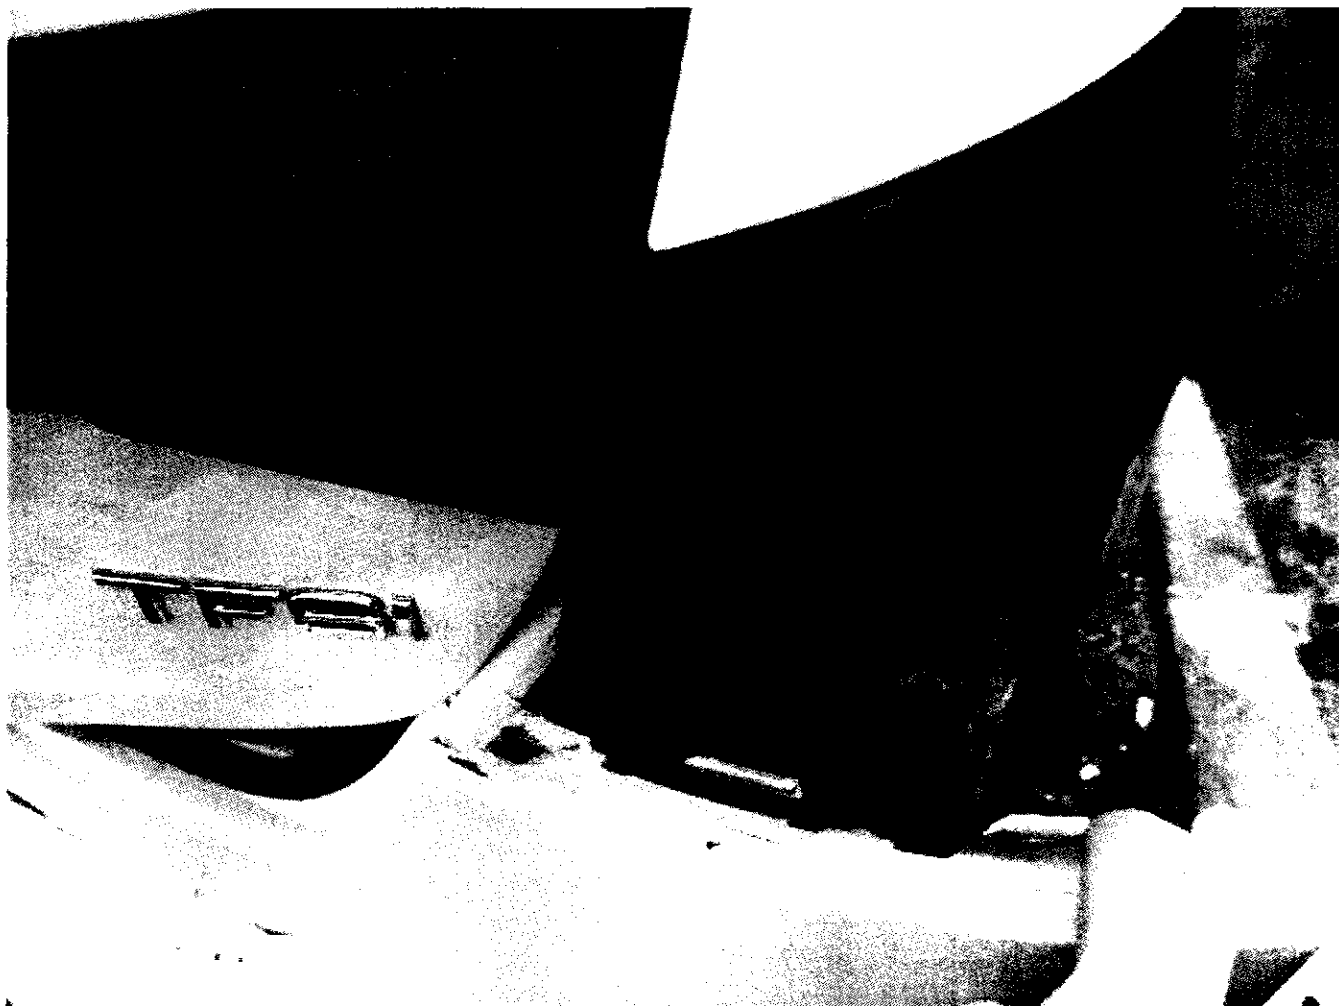

Accident Photo

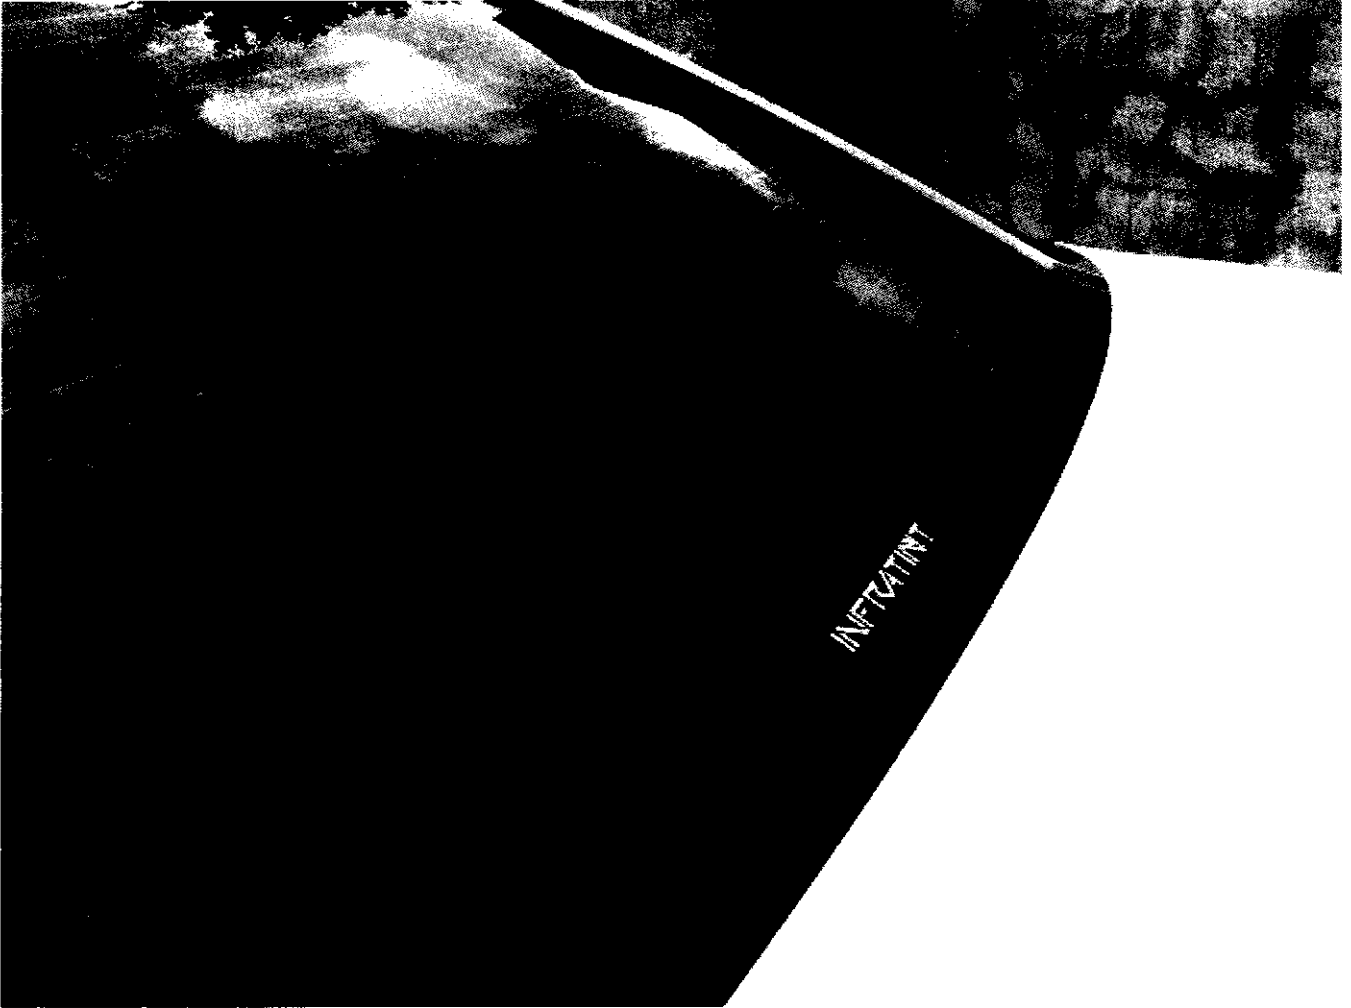



HOTLINE TEL: (65) 6419 3000
FAX: (65) 6415 3723

CERTIFICATE OF INSURANCE

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

MAX

AUDI AUTO PROTECTOR

OWN DAMAGE EXCESS S\$600.00 (1)

WINDSCREEN EXCESS S\$100.00

(for policies with effect from 1st November 2002)

CERTIFICATE NO. 2100482801-00000

SUM INSURED Market Value
INSURING WITH COE/PARF Yes

1) VEHICLE REGISTRATION NO.

SLA1222Y

2) NAME OF INSURED

CHUA KEE LAM

3) EFFECTIVE DATE OF THE COMMENCEMENT
OF INSURANCE FOR THE PURPOSES OF THE ACT

16 Sep 2016

4) DATE OF EXPIRY OF INSURANCE

15 Sep 2017

5) PERSON OR CLASSES OF PERSONS ENTITLED TO DRIVE *

SUBJECT TO AGE CONDITION : All Age Condition

a) The Insured.

b) Any other person who is driving on the Insured's order or with his permission.

This policy will indemnify the insured or any authorised driver only if he/she meets the age conditions.

A Young and/or Inexperienced Driver Excess ("YIDR") of S\$3,000.00, in addition to the

Policy Excess, applies to You and any Authorised Driver (named or unnamed) if You are or the said

Authorised Driver is below the age of 23 and/or has less than 2 years' driving experience.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6) LIMITATION AS TO USE *

Use only for social, domestic and pleasure purposes and for the Insured's business.

The Policy does not cover use for hire or rewards, tuition, driving test, racing, pace-making, reliability trial speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

APPROVED REPORTING CENTRES / AUDI AUTHORISED REPAIRERS

1. Audi Customer Service Center - 55 Ubi Road 1 (Tel: 63662323)

APPROVED REPORTING CENTRES / AIG AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

2. ComfortDelgro Engrg - 205 Biadell Rd (Tel: 63837118) 3. DPS Body & Paint Workshop - 209 Pandan Gardens (Tel: 65684501)

4. Ehoz - 30 Bukit Batok Cres (Tel: 66547777) 5. Glass-Fix - 52 Ubi Ave 3 (Tel: 62780887) - For windscreen only

6. Kan Eok Sing Motor - 61 Delfi Lane 12 (Tel: 67479560) 7. Lai Huat (Meng Kee) Motor - 21 Sin Ming Ind (Tel: 64538110)

8. Mova Automotive - 1008 Bukit Merah Lane 3 (Tel: 62723892) 9. Progressive Automotive - 3022A Ubi Rd 1 (Tel: 67415336)

10. SMF Motor - 1 Kaki Bukit Ave 6 Bld D (Tel: 67476106)

LOSS OF USE Loss Of Use 15 days Replacement Car only for repairs at Audi Customer Service Centre

NAMED DRIVER NA

HIRE PURCHASE COMPANY United Overseas Bank Limited
/ EMPLOYER'S LOAN

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

I/We hereby Certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act 1987 (Malaysia).

Issued At Singapore 20 Sep 2016

AIG Asia Pacific Insurance Pte Ltd.

S\$4321.00
FREMME LEE SING - MP
150 ALEXANDRA ROAD AUDI CUSTOMER SERVICE
CENTRE SINGAPORE 119938

AUTHORISED REPRESENTATIVE

ORIGINAL

PRIVACY

REPUBLIC OF SINGAPORE
 IDENTITY CARD NO. S6806540B



Name
 CHUA KEE LAM

蔡其南


Race
 CHINESE

Date of birth
 14-02-1968

Sex
 M

Country of birth
 SINGAPORE

S6806540B

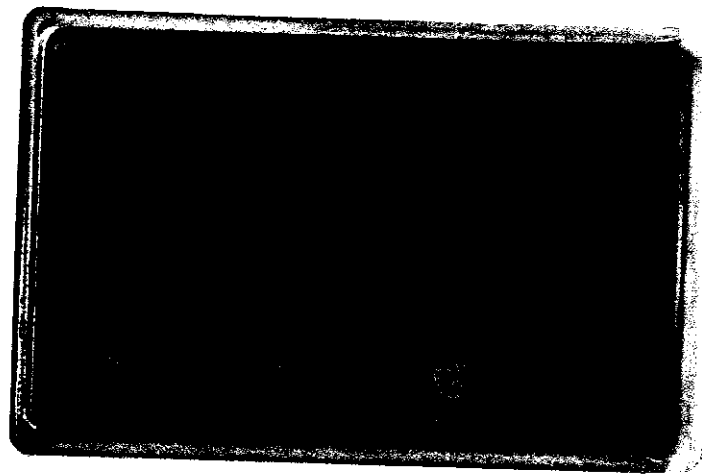

4812300




NMC No. S6806540B



Date of issue
 03-08-2010

605, 1000 TAMPARAN ROAD #02-15
 SINGAPORE 717130

Issue No. S6806540B Date: 13/08/2012 No: 7174284

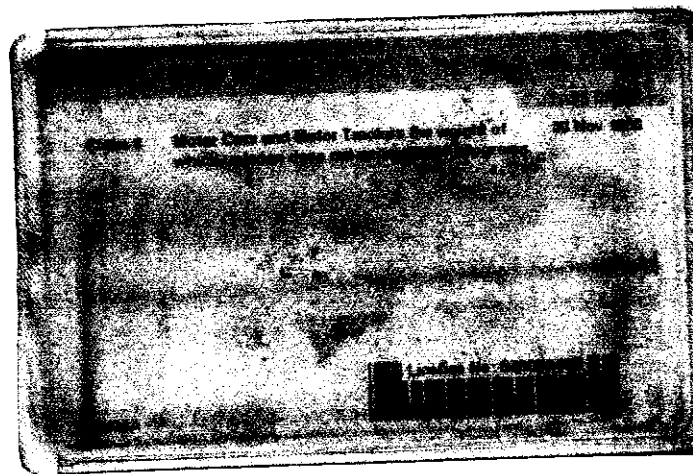

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0787/2017/CCS
Date : 8-Aug-17

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Chua Kee Lam
Address : 626 Upper Thomson Road
#02-15
Singapore 787130
Telephone : (HP) 96835018
Type of Claim : Own Damage Claim
Policy No. : 2100482801-00000
Vehicle No : **SLA 1222 Y**
Model Code : Audi A4 SEDAN 1.4 TFSI
Model / Year : Sep-16
Engine No : CVN 017926
Chassis No : WAUZZZF40HA029304
Mileage : -
Date In : 7-Aug-17
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 7-Aug-17
Place of Accident : Along CTE towards City (Bef AMK Ave 5)

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim
Surveyed Date : 10/08/17.
Authorised Date :
Excess Cost :
Liability :
Remarks : ~~Not~~ Authorized, 24 Days.

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLA 1222 Y.

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To recover and tow back vehicle from scene of accident.	S/N	Waived	✓
2	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N	\$ 360.00	✓
3	To dismantle and renew front bumper and bonnet. Align to position. Re-organise front crash management components. Reinstall all parts removed.		\$ 1,500.00	1250 ✓
4	To respray front bumper and bonnet.		\$ 1,600.00	1100 ✓
TOTAL LABOUR CHARGES - FRONT		:	<u>\$ 3,460.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLJ 8708 U.

SLA 12324

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
9	To remove all rear fittings, dismantle rear bumper and rear lid. Cut out and reweld rear end panelling, spare wheel housing, cross members and both rear fenders. Repair and align whole rear substructure to position. Renew rear bumper and rear lid. Reinstall all parts removed.	\$ 13,200.00	7000 ✓
10	To carry out stone chip primer work on rear panelling and spare wheel housing.	S/N \$ 800.00	600 ✓
11	To spray paint on rear bumper, rear lid, spare wheel housing, boot floor, both rear fenders, both sill panels, door entrances, drain panels, roof channels and rear end panelling. To carry out joint sealer works and cavity preservation.	\$ 8,500.00	4420 ✓
12	To carry out wheel alignment.	S/N \$ 240.00	? ✓
13	To carry out diagnostic check.	S/N \$ 384.00	✓
TOTAL LABOUR CHARGES - (REAR)		: \$ 35,804.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLA 1222 Y.

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and renew rear parking aid.	S/N	\$ 280.00	/
2	To remove and reinstall rear wire harness, audio equipment, control units, relay and fuse reays, end panelling, spare wheel housing and rear lid harness.	S/N	\$ 1,800.00	/
3	To remove and reinstall rear seats, back rest, carpets, ABCD pillar trims, disengage airbag system.	S/N	\$ 1,800.00	/
4	To remove and reinstall center console, renew all seat belts and airbag control unit.	S/N	\$ 2,400.00	/
5	To remove and renew both rear 1/4 glass and rear windscreen.	S/N	\$ 1,000.00	600;
6	To remove exhaust system and fuel tank assy. Inspect exhaust silencers for damage.	S/N	\$ 800.00	? ✓
7	To remove and reinstall rear suspension assy to facillitate cellette bench repairs. Inspect for damages and renew accordingly.	S/N	\$ 2,800.00	? ✓
8	To set up and place vehicle on cellette bench.	S/N	\$ 1,800.00	? ✓
SUB-TOTAL LABOUR CHARGES - (REAR)		:	\$ 12,680.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

		<u>Damage Parts & Prices</u>	
<u>S/N</u>	<u>Parts Description</u>	<u>S/NETT</u>	<u>REMARKS</u>
1	FRONT BUMPER <i>Dishled</i>	\$ 1,703.00	<i>1767.40</i>
2	FRONT BUMPER GRILLE - CENTER <i>Not New</i>	\$ 163.00	<i>? X</i>
3	RADIATOR GRILLE <i>Amled</i>	\$ 941.00	<i>753.40</i>
4	FRONT REINFORCEMENT BEAM <i>Best</i>	\$ 674.00	<i>539.20</i>
5	FRONT BUMPER FOAM - INNER <i>Amled</i>	\$ 101.00	<i>80.80</i>
6	FRONT BUMPER TOP COVER <i>Delled</i>	\$ 104.00	<i>82.80</i>
7	SIGN ' CAUTION ' STICKER <i>m</i>	\$ 12.00	<i>9.04</i>
8	AIR CONDITIONER STICKER <i>m</i>	\$ 6.00	<i>4.64</i>
9	FRONT LOCK CARRIER BRACKET <i>Amled</i>	\$ 112.00	<i>89.20</i>
10	FRONT BUMPER SUPPORT - LH/RH <i>new</i>	2 \$ 46.00	<i>36.00</i>
11	BONNET <i>Delled</i>	\$ 2,001.00	<i>1600.80</i>
12	BONNET ATTACHMENT PARTS <i>not New</i>	\$ 103.00	<i>X</i>
13	BONNET IMPACT PROTECTION - CENTER <i>3m</i>	\$ 23.00	<i>18.16</i>
14	BONNET IMPACT PROTECTION - LH/RH <i>3m</i>	2 \$ 46.00	<i>36.32</i>
15	BONNET LOCK STRIKER - LH/RH <i>2</i>	2 \$ 86.00	<i>X</i>
16	BONNET LOCK - LH/RH <i>me m</i>	2 \$ 360.00	<i>X</i>
17	BONNET LOCK BOWDEN CABLE	\$ 49.00	<i>X</i>
18	BONNET RELEASE LEVER	\$ 12.00	<i>X</i>
19	FRONT NUMBER PLATE <i>Best</i>	S/N \$ 25.00	<i>✓</i>
TOTAL SPARE PARTS CHARGES - FRONT		:	\$ 6,567.00
TOTAL LABOUR CHARGES - FRONT		:	\$ 3,460.00
GRAND TOTAL - FRONT		:	\$ 10,027.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	REAR BUMPER <i>Distorted</i>	\$ 1,844.00	✓ 1475.20
2	REAR BUMPER FIXING PARTS <i>new</i>	\$ 61.00	✓
3	REAR BUMPER SECURING PLATE <i>2nd</i>	4 \$ 53.00	✓ 41.92
4	REAR KICK SENSOR SECURING STRIP <i>cut</i>	\$ 182.00	✓ 145.20
5	REAR BUMPER SPOILER <i>Distorted</i>	\$ 203.00	✓ 162.40
6	REAR BUMPER LIGHT REFLECTOR - LH/RH <i>RH cracked.</i>	2 \$ 66.00	✓ 76.24 ✓
7	REAR REINFORCEMENT BEAM <i>Distorted</i>	\$ 756.00	✓ 604.40
8	REAR REINFORCEMENT BEAM SEAL - LH/RH <i>RH new</i>	2 \$ 44.00	✓
9	REAR BUMPER GUIDE - LOWER LH/RH <i>2nd</i>	2 \$ 72.00	✓ 28.08
10	REAR BUMPER GUIDE - UPPER LH/RH	2 \$ 36.00	✓ 28
11	REAR BUMPER GUIDE LOCK PIN <i>Not Nec</i>	2 \$ 11.00	✓
12	REAR PARKING AID SENSOR <i>2nd</i>	4 \$ 830.00	✓ 664
13	REAR BUMPER WIRING SET <i>Not Nec</i>	\$ 590.00	✓
14	REAR BUMPER SENSOR CABLE HOLDER <i>2nd</i>	\$ 8.00	✓ 6.08
15	REAR TAILGATE OPENING SENSOR <i>Not Nec</i>	\$ 179.00	✓
16	REAR TAILGATE OPENING CONTROL UNIT <i>Damaged</i>	\$ 365.00	✓ 292 ✓
17	RETAINER FOR CONTROL UNIT <i>Not Nec</i>	\$ 7.00	✓
18	REAR LID <i>Distorted</i>	\$ 2,184.00	✓ 1817.60
19	REAR LID ATTACHMENT PARTS <i>Not Nec</i>	\$ 122.00	✓
20	REAR LID HINGE - LH/RH <i>2nd</i>	2 \$ 388.00	✓ 304.60
SUB-TOTAL SPARE PARTS		\$ 8,001.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	REAR LID LOCK <i>Payd</i>	\$ 153.00	✓ 153.60
22	REAR LID LOCK COVER CAP <i>ht</i>	\$ 16.00	✓ 12.72
23	REAR LID LOCK PUSH BUTTON <i>damaged.</i>	\$ 468.00	✓ 374.40
24	REAR LICENSE PLATE LIGHT <i>could</i>	2 \$ 97.00	✓ 77.12
25	REAR LID LOCK STRIKER <i>best</i>	\$ 27.00	✓ 21.52
26	REAR LID ANTI-THEFT GUARD COVER - INNER <i>m</i>	\$ 53.00	✓ 42.24
27	REAR LID BLIND RIVET STUD <i>m</i>	2 \$ 16.00	✓ 12.64
28	REAR LID RIVET STUD COVER <i>m</i>	2 \$ 12.00	✓ 8.96
29	REAR LID STOP BUFFER <i>m</i>	2 \$ 27.00	✓ 36.32
30	REAR LID DAMPER <i>payd</i>	\$ 93.00	✓ 74.08
31	REAR LID SEAL <i>at</i>	\$ 165.00	✓ 131.60
32	REAR LID HINGE GUIDE COVER - LH/RH <i>Not Nec</i>	2 \$ 44.00	✓ 35.20
33	REAR LID STOPPER SET <i>m</i>	\$ 106.00	✓ 84.64
34	REAR LID ADHESIVE FOAM <i>m</i>	\$ 14.00	✓ 11.12
35	REAR LID AUDI LOGO <i>2 m</i>	\$ 105.00	✓ 84
36	AUDI 'A4' INCRPTION	\$ 81.00	✓ 64.72
37	AUDI 'TFSI' INCRPTION	\$ 81.00	✓ 64.72
38	LED TAIL LIGHT - OUTER LH/RH <i>LH could RH not</i>	2 \$ 1,568.00	✓ 2 784 1253.60
39	TAIL LIGHT TRIM - OUTER LH/RH <i>LH could RH not</i>	2 \$ 48.00	✓ 2 24 37.92
40	LED TAIL LIGHT - INNER LH/RH <i>LH could, RH not</i>	2 \$ 1,548.00	✓ 2 254 1238.40
SUB-TOTAL SPARE PARTS		\$ 4,722.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	TAIL LIGHT TRIM - INNER LH/RH <i>Rehomed.</i>	2 \$	48.00 ? 37.92 ✓
42	REAR CROSS PANEL <i>Disbited</i>	\$	222.00 ✓ 177.60
43	REAR CROSS PANEL REINFORCEMENT <i>Disbited</i>	\$	431.00 ✓ 344.40
44	REAR SPARE WHEEL WELL <i>Repair</i>		PRICE TBC ? X
45	REAR SPARE WHEEL MOUNTING <i>Re m</i>		PRICE TBC ? X
46	CLAMPING STRIP FOR BATTERY <i>Re m</i>		PRICE TBC ? X
47	BATTERY CONSOLE <i>Re m</i>	\$	25.00 ? X
48	BRACKET FOR AKF VALVE <i>Re m</i>	\$	50.00 ? X
49	REAR CROSS PANEL TRIM - UPPER <i>Disbited</i>	\$	141.00 ✓ 112.80
50	REAR INSERT PART <i>Repair</i>	\$	229.00 ? X
51	REAR LID TRIM - INNER <i>Rehomed.</i>	\$	280.00 ? 223.60 ✓
52	REAR FENDER - LH/RH <i>Lit Buckled, RH Re m</i>	2 \$	4,534.00 2267 1813.60
53	REAR 1/4 GLASS - LH/RH <i>Lit m</i>	2 \$	1,026.00 518. 410.40
54	REAR WINDSCREEN <i>m</i>	\$	969.00 ✓ 775.20
55	GLASS PRIMER <i>m</i>	3 \$	54.00 ✓ 42.96
56	REAR FENDER SOUND ABSORBER <i>Re m</i>	\$	426.00 ? 340.80 ✓
57	REAR SEAT GROMMET SET <i>m</i>	\$	30.00 ? 24 ✓
58	REAR NUMBER PLATE <i>Set</i>	S/N \$	25.00 ✓
59	1/4 GLASS SEALANT <i>m</i>	S/N \$	200.00 100 ✓
60	REAR WINDSCREEN SEALANT <i>m</i>	\$	200.00 ✓
SUB-TOTAL SPARE PARTS		\$	8,890.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

		<u>Damage Parts & Prices</u>	
<u>S/N</u>	<u>Parts Description</u>	<u>S/NETT</u>	<u>REMARKS</u>
61	ACRYLIC SEALER?	S/N \$ 360.00 ✓	
62	CAVITY WAX <i>me</i>	S/N \$ 280.00 ✓	
63	STONE CHIP	S/N \$ 360.00 ✓	
64	METAL FILLER POWDER <i>me</i>	S/N \$ 560.00 ✓	
65	FRONT SEAT BELT - LH/RH <i>Activated</i>	2 \$ 1,850.00 ✓	1477.20
66	FRONT SEAT BELT HEIGHT ADJUSTER - LH/RH <i>Dayd</i>	2 \$ 302.00 ?	241.60 ✓
67	REAR SEAT BELT - LH/RH <i>me me</i>	2 \$ 891.00 ✗	
68	REAR SEAT BELT - CENTER	\$ 469.00 ✗	
69	CONTROL UNIT FOR AIRBAG <i>Activated</i>	\$ 1,790.00 ✓	1432
70	CRASH SENSOR FOR AIRBAG	3 \$ 765.00 ✓	630
71	SUNDRIES <i>Rec.</i>	\$ 800.00 ?	270.08 ✓
TOTAL SPARE PARTS - REAR		: \$ 30,040.00	
TOTAL LABOUR CHARGES - REAR		: \$ 35,804.00	
GRAND TOTAL - REAR		: \$ 65,844.00	
GRAND TOTAL - FRONT & REAR		: \$ 75,871.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

47,972

91580.20

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PAJOD/0787/2017/CCS 23-Aug-17 Chang 1 of 1 SLA 1222 Y Audi A4 SEDAN 1.4 TFSI
Quantity	Description	Unit Price	Amount
Labours			
1	To remove front fittings, dismantle and renew a/c condenser, carry out vacuum / regas system. S/N	\$ 480.00	✓
2	To remove and renew both headlights, transfer all control unit etc. S/N	\$ 500.00	✓
Parts			
1	LED HEADLIGHT - LH/RH <i>cracked</i>	\$ 15,722.00	✓ 17577.60
2	LOCK CARRIER AIR GUIDE - LH/RH <i>dent</i>	\$ 44.00	✓ 34.88
3	A/C CONDENSER <i>dent</i>	\$ 525.00	✓ 419.60
4	REAR FENDER CONNECTING PLATE - LH <i>cracked</i>	\$ 47.00	✓ 37.20
5	REAR FENDER BOTTOM PLATE - LH OUTER <i>cracked</i>	\$ 422.00	✓ 337.20
6	REAR END PANEL SUPPORT - LH/RH	\$ 166.00	✓ 65.84
7	REAR END PANEL REINFORCEMENT - LH/RH INNER <i>dent</i>	\$ 348.00	✓ 278.40
8	REAR LID SPRING CONSOLE - LH/RH <i>Not Ne</i>	\$ 46.00	✓
9	D-PILLAR PARTITION - LH/RH <i>Not Ne</i>	\$ 40.00	✓
10	REAR FENDER SOUND ABSORBER <i>Not Ne</i>	\$ 213.00	✓
11	REAR STOWAGE COMPARTMENT <i>cracked</i>	\$ 77.00	✓ 61.36
GRAND TOTAL :		\$ 18,630.00	

For Premium Automobiles Pte Ltd



Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Dishled</i>	\$ 1,703.00	✓
2	FRONT BUMPER GRILLE - CENTER ?	\$ 163.00	?
3	RADIATOR GRILLE <i>Amled</i>	\$ 941.00	✓
4	FRONT REINFORCEMENT BEAM <i>Best</i>	\$ 674.00	✓
5	FRONT BUMPER FOAM - INNER <i>Amled</i>	\$ 101.00	✓
6	FRONT BUMPER TOP COVER <i>Delled</i>	\$ 104.00	✓
7	SIGN ' CAUTION ' STICKER <i>m</i>	\$ 12.00	✓
8	AIR CONDITIONER STICKER <i>m</i>	\$ 6.00	✓
9	FRONT LOCK CARRIER BRACKET ? <i>✓ over</i>	\$ 112.00	?
10	FRONT BUMPER SUPPORT - LH/RH <i>new</i>	2 \$ 46.00	✓
11	BONNET <i>Delled</i>	\$ 2,001.00	✓
12	BONNET ATTACHMENT PARTS <i>m</i>	\$ 103.00	✓
13	BONNET IMPACT PROTECTION - CENTER <i>3m</i>	\$ 23.00	✓
14	BONNET IMPACT PROTECTION - LH/RH <i>3m</i>	2 \$ 46.00	✓
15	BONNET LOCK STRIKER - LH/RH <i>2</i>	2 \$ 86.00	✓
16	BONNET LOCK - LH/RH <i>2</i>	2 \$ 360.00	✓
17	BONNET LOCK BOWDEN CABLE <i>3m</i>	\$ 49.00	✓
18	BONNET RELEASE LEVER <i>3m</i>	\$ 12.00	✓
19	FRONT NUMBER PLATE <i>Best</i>	S/N \$ 25.00	✓
TOTAL SPARE PARTS CHARGES - FRONT		:	\$ 6,567.00
TOTAL LABOUR CHARGES - FRONT		:	\$ 3,460.00
GRAND TOTAL - FRONT		:	<u>\$ 10,027.00</u>

All charges are not inclusive of GST.-

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	REAR BUMPER <i>Distorted</i>	\$ 1,844.00	✓
2	REAR BUMPER FIXING PARTS <i>new</i>	\$ 61.00	✓
3	REAR BUMPER SECURING PLATE <i>2nd</i>	4 \$ 53.00	✓
4	REAR KICK SENSOR SECURING STRIP <i>cut</i>	\$ 182.00	✓
5	REAR BUMPER SPOILER <i>Distorted</i>	\$ 203.00	✓
6	REAR BUMPER LIGHT REFLECTOR - LH/RH ²	2 \$ 66.00	
7	REAR REINFORCEMENT BEAM <i>Distorted</i>	\$ 756.00	✓
8	REAR REINFORCEMENT BEAM SEAL - LH/RH [?]	2 \$ 44.00	?
9	REAR BUMPER GUIDE - LOWER LH/RH ^{2nd}	2 \$ 72.00	✓
10	REAR BUMPER GUIDE - UPPER LH/RH	2 \$ 36.00	✓
11	REAR BUMPER GUIDE LOCK PIN [?]	2 \$ 11.00	?
12	REAR PARKING AID SENSOR <i>2nd</i>	4 \$ 830.00	✓
13	REAR BUMPER WIRING SET [?]	\$ 590.00	?
14	REAR BUMPER SENSOR CABLE HOLDER <i>2nd</i>	\$ 8.00	✓
15	REAR TAILGATE OPENING SENSOR [?]	\$ 179.00	?
16	REAR TAILGATE OPENING CONTROL UNIT [?] <i>dis</i>	\$ 365.00	?
17	RETAINER FOR CONTROL UNIT [?]	\$ 7.00	?
18	REAR LID <i>Distorted</i>	\$ 2,184.00	✓
19	REAR LID ATTACHMENT PARTS <i>new</i>	\$ 122.00	✓
20	REAR LID HINGE - LH/RH <i>2nd</i>	2 \$ 388.00	✓
SUB-TOTAL SPARE PARTS		\$ 8,001.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	REAR LID LOCK <i>Damaged</i>	\$ 153.00	✓
22	REAR LID LOCK COVER CAP <i>lit</i>	\$ 16.00	✓
23	REAR LID LOCK PUSH BUTTON <i>? de</i>	\$ 468.00	?
24	REAR LICENSE PLATE LIGHT <i>could</i>	2 \$ 97.00	✓
25	REAR LID LOCK STRIKER <i>Bent</i>	\$ 27.00	✓
26	REAR LID ANTI-THEFT GUARD COVER - INNER <i>u</i>	\$ 53.00	✓
27	REAR LID BLIND RIVET STUD <i>u</i>	2 \$ 16.00	✓
28	REAR LID RIVET STUD COVER <i>u</i>	2 \$ 12.00	✓
29	REAR LID STOP BUFFER <i>u</i>	2 \$ 27.00	✓
30	REAR LID DAMPER <i>Damaged</i>	\$ 93.00	✓
31	REAR LID SEAL <i>u</i>	\$ 165.00	✓
32	REAR LID HINGE GUIDE COVER - LH/RH <i>?</i>	2 \$ 44.00	?
33	REAR LID STOPPER SET <i>u</i>	\$ 106.00	✓
34	REAR LID ADHESIVE FOAM <i>u</i>	\$ 14.00	✓
35	REAR LID AUDI LOGO <i>u</i>	\$ 105.00	✓
36	AUDI 'A4' INCRPTION <i>u</i>	\$ 81.00	✓
37	AUDI 'TFSI' INCRPTION <i>u</i>	\$ 81.00	✓
38	LED TAIL LIGHT - OUTER LH/RH <i>LH could 2H Gre</i>	2 \$ 1,568.00	✓ 2
39	TAIL LIGHT TRIM - OUTER LH/RH <i>LH could RH out</i>	2 \$ 48.00	✓ 24
40	LED TAIL LIGHT - INNER LH/RH <i>LH could, RH out</i>	2 \$ 1,548.00	✓ 2
SUB-TOTAL SPARE PARTS		\$ 4,722.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	TAIL LIGHT TRIM - INNER LH/RH ?	2 \$	48.00 ? cut ✓
42	REAR CROSS PANEL Disbited	\$	222.00 ✓
43	REAR CROSS PANEL REINFORCEMENT Disbited	\$	431.00 ✓
44	REAR SPARE WHEEL WELL ?		PRICE TBC ?
45	REAR SPARE WHEEL MOUNTING ?		PRICE TBC ?
46	CLAMPING STRIP FOR BATTERY ?		PRICE TBC ?
47	BATTERY CONSOLE ?	\$	25.00 ?
48	BRACKET FOR AKF VALVE ?	\$	50.00 ?
49	REAR CROSS PANEL TRIM - UPPER Disbited	\$	141.00 ✓
50	REAR INSERT PART ?	\$	229.00 ?
51	REAR LID TRIM - INNER ?	\$	280.00 ? ✓
52	REAR FENDER - LH/RH Lit Buckled, RH Rgr	2 \$	4,534.00 2267
53	REAR 1/4 GLASS - LH/RH 1st R	2 \$	1,026.00 518.
54	REAR WINDSCREEN R	\$	969.00 ✓
55	GLASS PRIMER R	3 \$	54.00 ✓
56	REAR FENDER SOUND ABSORBER ?	\$	426.00 ?
57	REAR SEAT GROMMET SET ?	\$	30.00 ?
58	REAR NUMBER PLATE Sent	S/N \$	25.00 ✓
59	1/4 GLASS SEALANT R	S/N \$	200.00 100
60	REAR WINDSCREEN SEALANT R	\$	200.00 ✓
SUB-TOTAL SPARE PARTS		\$	8,890.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0787/2017/CCS
Date : 8-Aug-17

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120



Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Chua Kee Lam
Address : 626 Upper Thomson Road
#02-15
Singapore 787130
Telephone : (HP) 96835018
Type of Claim : Own Damage Claim
Policy No. : 2100482801-00000
Vehicle No : **SLA 1222 Y**
Model Code : Audi A4 SEDAN 1.4 TFSI
Model / Year : Sep-16
Engine No : CVN 017926
Chassis No : WAUZZZF40HA029304
Mileage : -
Date In : 7-Aug-17
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 7-Aug-17
Place of Accident : Along CTE towards City (Bef AMK Ave 5)

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLA 1222 Y.

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To recover and tow back vehicle from scene of accident.	S/N	Waived	
2	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N	\$ 360.00	\$ 360.00
3	To dismantle and renew front bumper and bonnet. Align to position. Re-organise front crash management components. Reinstall all parts removed.		\$ 1,500.00	\$ 1,250.00
3a	Added labour charges - see attached	S/N	\$ 980.00	\$ 980.00
4	To respray front bumper and bonnet.		\$ 1,600.00	\$ 1,100.00
TOTAL LABOUR CHARGES - FRONT		:	<u>\$ 4,440.00</u>	<u>\$ 3,690.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLA 1222 Y.

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
	<i>Labour charges - front c/f</i>		\$ 3,690.00
1	To remove and renew rear parking aid.	S/N \$ 280.00	\$ 280.00
2	To remove and reinstall rear wire harness, audio equipment, control units, relay and fuse reays, end panelling, spare wheel housing and rear lid harness.	S/N \$ 1,800.00	\$ 1,800.00
3	To remove and reinstall rear seats, back rest, carpets, ABCD pillar trims, disengage airbag system.	S/N \$ 1,800.00	\$ 1,800.00
4	To remove and reinstall center console, renew all seat belts and airbag control unit.	S/N \$ 2,400.00	\$ 2,400.00
5	To remove and renew both rear 1/4 glass and rear windscreen.	S/N \$ 1,000.00	\$ 600.00
6	To remove exhaust system and fuel tank assy. Inspect exhaust silencers for damage.	S/N \$ 800.00	\$ 800.00
7	To remove and reinstall rear suspension assy to facillitate cellette bench repairs. Inspect for damages and renew accordingly.	S/N \$ 2,800.00	\$ 2,800.00
8	To set up and place vehicle on cellette bench.	S/N \$ 1,800.00	\$ 1,800.00
SUB-TOTAL LABOUR CHARGES - (REAR)		: \$ 12,680.00	\$ 15,970.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLJ 8708 U. SLA12774

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
	cf		\$ 15,970.00
9	To remove all rear fittings, dismantle rear bumper and rear lid. Cut out and reweld rear end panelling, spare wheel housing, cross members and both rear fenders. Repair and align whole rear substructure to position. Renew rear bumper and rear lid. Reinstall all parts removed.	\$ 13,200.00	\$ 7,000.00
10	To carry out stone chip primer work on rear panelling and spare wheel housing.	S/N \$ 800.00	\$ 600.00
11	To spray paint on rear bumper, rear lid, spare wheel housing, boot floor, both rear fenders, both sill panels, door entrances, drain panels, roof channels and rear end panelling. To carry out joint sealer works and cavity preservation.	\$ 8,500.00	\$ 4,400.00
12	To carry out wheel alignment.	S/N \$ 240.00	\$ 240.00
14	To carry out diagnostic check.	S/N \$ 384.00	\$ 384.00
TOTAL LABOUR CHARGES - (REAR)		: \$ 35,804.00	\$ 28,594.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 1,703.00	\$ 1,362.40
2	FRONT BUMPER GRILLE - CENTER	\$ 163.00	
3	RADIATOR GRILLE	\$ 941.00	\$ 752.40
4	FRONT REINFORCEMENT BEAM	\$ 674.00	\$ 539.20
5	FRONT BUMPER FOAM - INNER	\$ 101.00	\$ 80.80
6	FRONT BUMPER TOP COVER	\$ 104.00	\$ 82.80
7	SIGN ' CAUTION ' STICKER	\$ 12.00	\$ 9.04
8	AIR CONDITIONER STICKER	\$ 6.00	\$ 4.64
9	FRONT LOCK CARRIER BRACKET	\$ 112.00	\$ 89.20
10	FRONT BUMPER SUPPORT - LH/RH	2 \$ 46.00	\$ 36.00
11	BONNET	\$ 2,001.00	\$ 1,600.80
12	BONNET ATTACHMENT PARTS	\$ 103.00	
13	BONNET IMPACT PROTECTION - CENTER	\$ 23.00	\$ 18.16
14	BONNET IMPACT PROTECTION - LH/RH	2 \$ 46.00	\$ 36.32
15	BONNET LOCK STRIKER - LH/RH	2 \$ 86.00	
16	BONNET LOCK - LH/RH	2 \$ 360.00	
17	BONNET LOCK BOWDEN CABLE	\$ 49.00	
18	BONNET RELEASE LEVER	\$ 12.00	
19	FRONT NUMBER PLATE	S/N \$ 25.00	\$ 25.00
TOTAL SPARE PARTS CHARGES - FRONT		: \$ 6,567.00	\$ 4,636.76
TOTAL LABOUR CHARGES - FRONT		: \$ 4,440.00	\$ 3,690.00
GRAND TOTAL - FRONT		: \$ 11,007.00	\$ 8,326.76

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
	<i>MATERIALS FRONT - CF</i>		\$ 4,636.76
1	REAR BUMPER	\$ 1,844.00	\$ 1,475.20
2	REAR BUMPER FIXING PARTS	\$ 61.00	
3	REAR BUMPER SECURING PLATE	4 \$ 53.00	\$ 41.92
4	REAR KICK SENSOR SECURING STRIP	\$ 182.00	\$ 145.20
5	REAR BUMPER SPOILER	\$ 203.00	\$ 162.40
6	REAR BUMPER LIGHT REFLECTOR - LH/RH	2 \$ 66.00	\$ 26.24
7	REAR REINFORCEMENT BEAM	\$ 756.00	\$ 604.40
8	REAR REINFORCEMENT BEAM SEAL - LH/RH	2 \$ 44.00	
9	REAR BUMPER GUIDE - LOWER LH/RH	2 \$ 72.00	\$ 28.08
10	REAR BUMPER GUIDE - UPPER LH/RH	2 \$ 36.00	\$ 28.00
11	REAR BUMPER GUIDE LOCK PIN	2 \$ 11.00	
12	REAR PARKING AID SENSOR	4 \$ 830.00	\$ 664.00
13	REAR BUMPER WIRING SET	\$ 590.00	
14	REAR BUMPER SENSOR CABLE HOLDER	\$ 8.00	\$ 6.08
15	REAR TAILGATE OPENING SENSOR	\$ 179.00	
16	REAR TAILGATE OPENING CONTROL UNIT	\$ 365.00	\$ 292.00
17	RETAINER FOR CONTROL UNIT	\$ 7.00	
18	REAR LID	\$ 2,184.00	\$ 1,817.60
19	REAR LID ATTACHMENT PARTS	\$ 122.00	
20	REAR LID HINGE - LH/RH	2 \$ 388.00	\$ 309.60
	SUB-TOTAL SPARE PARTS	\$ 8,001.00	\$ 10,237.48

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Material List for Accident Vehicle Regn No. SLA 1222 Y.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices		
		S/NETT	REMARKS	
		<i>cf</i>	\$	14,021.80
41	TAIL LIGHT TRIM - INNER LH/RH	2 \$	48.00 \$	37.92
42	REAR CROSS PANEL	\$	222.00 \$	177.60
43	REAR CROSS PANEL REINFORCEMENT	\$	431.00 \$	344.40
44	REAR SPARE WHEEL WELL		PRICE TBC	
45	REAR SPARE WHEEL MOUNTING		PRICE TBC	
46	CLAMPING STRIP FOR BATTERY		PRICE TBC	
47	BATTERY CONSOLE	\$	25.00	
48	BRACKET FOR AKF VALVE	\$	50.00	
49	REAR CROSS PANEL TRIM - UPPER	\$	141.00 \$	112.80
50	REAR INSERT PART	\$	229.00	
51	REAR LID TRIM - INNER	\$	280.00 \$	223.60
52	REAR FENDER - LH/RH	2 \$	4,534.00 \$	1,813.60
53	REAR 1/4 GLASS - LH/RH	2 \$	1,026.00 \$	410.40
54	REAR WINDSCREEN	\$	969.00 \$	775.20
55	GLASS PRIMER	3 \$	54.00 \$	42.96
56	REAR FENDER SOUND ABSORBER	\$	426.00 \$	340.80
57	REAR SEAT GROMMET SET	\$	30.00 \$	24.00
58	REAR NUMBER PLATE	S/N \$	25.00 \$	25.00
59	1/4 GLASS SEALANT	S/N \$	200.00 \$	100.00
60	REAR WINDSCREEN SEALANT	\$	200.00 \$	200.00
	SUB-TOTAL SPARE PARTS	\$	8,890.00 \$	18,650.08

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLA 1222 Y.

S/N	Parts Description	Damage Parts & Prices			
		S/NETT	REMARKS		
		<i>cf</i>	\$		18,650.08
61	ACRYLIC SEALER	S/N \$	360.00	\$	360.00
62	CAVITY WAX	S/N \$	280.00	\$	280.00
63	STONE CHIP	S/N \$	360.00	\$	360.00
64	METAL FILLER POWDER	S/N \$	560.00	\$	560.00
65	FRONT SEAT BELT - LH/RH	2 \$	1,850.00	\$	1,479.20
66	FRONT SEAT BELT HEIGHT ADJUSTER - LH/RH	2 \$	302.00	\$	241.60
67	REAR SEAT BELT - LH/RH	2 \$	891.00		
68	REAR SEAT BELT - CENTER	\$	469.00		
69	CONTROL UNIT FOR AIRBAG	\$	1,790.00	\$	1,432.00
70	CRASH SENSOR FOR AIRBAG	3 \$	765.00	\$	630.00
71	ADDED PARTS - SEE ATTACHED	\$	18,410.50	\$	14,420.28
73	SUNDRIES	\$	800.00	\$	270.08
	TOTAL SPARE PARTS - REAR	:	\$ 48,450.50	\$	38,683.24
	TOTAL LABOUR CHARGES - REAR	:	\$ 35,804.00	\$	28,594.00
	GRAND TOTAL - REAR	:	\$ 84,254.50	\$	67,277.24

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0787/2017/CCS 23-Aug-17 Chang 1 of 1 SLA 1222 Y Audi A4 SEDAN 1.4 TFSI
Quantity	Description	Unit Price	Amount
Labours			
1	To remove front fittings, dismantle and renew a/c condenser, carry out vacuum / regas system. S/N	\$ 480.00	\$ 480.00
2	To remove and renew both headlights, transfer all control unit etc. S/N	\$ 500.00	\$ 500.00
			\$ 980.00
Parts			
1	LED HEADLIGHT - LH/RH 2	\$ 15,722.00	\$ 12,577.60
2	LOCK CARRIER AIR GUIDE - LH/RH 2	\$ 44.00	\$ 34.88
3	A/C CONDENSER	\$ 525.00	\$ 419.60
4	REAR FENDER CONNECTING PLATE - LH	\$ 47.00	\$ 37.20
5	REAR FENDER BOTTOM PLATE - LH OUTER	\$ 422.00	\$ 337.20
6	REAR END PANEL SUPPORT - LH/RH 2	\$ 166.00	\$ 65.84
7	REAR END PANEL REINFORCEMENT - LH/RH INNER 2	\$ 348.00	\$ 278.40
8	REAR LID SPRING CONSOLE - LH/RH 2	\$ 46.00	
9	D-PILLAR PARTITION - LH/RH 2	\$ 40.00	
10	REAR FENDER SOUND ABSORBER	\$ 213.00	
11	REAR STOWAGE COMPARTMENT	\$ 77.00	\$ 61.36
12	FUSE UNIT <i>2pc</i>	\$ 454.00	\$ 363.20 <i>CP</i>
13	PLATE - BOOT <i>Donkey</i>	\$ 128.50	\$ 102.80 <i>CP</i>
14	BRACKET <i>Sent</i>	\$ 178.00	\$ 142.20 <i>CP</i>
12	FUSE UNIT		
	PARTS	\$ 18,410.50	\$ 14,420.28
	LABOUR	\$ 980.00	\$ 980.00
	GRAND TOTAL :	\$ 19,390.50	\$ 15,400.28

For Premium Automobiles Pte Ltd

Authorised Signature

60820

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLA 1222 Y

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0787/2017/MAS

20 Jan 2018

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SLA 1222 Y, Audi A4 SEDAN 1.4 TFSI

With reference to the above-mentioned vehicle, no. **SLA 1222 Y**, claimant, **Mr. Chua Kee Lam**, please find the related document per attached.

1. A copy of the Original invoice no. 85012051 – S\$63,130.00
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encls

AIG – SLA 1222 Y

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Telephone 6388 2223
Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Telephone 6386 2323

Customer Service
Service Appointment
Breakdown Service
6366 2323
9828 1233
email: customer.care@premiumauto.com.sg

INS TAX INVOICE
Company Reg No. 199902271W

Page 1 16:50

GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012051 Date: 17/01/2018 Order: SLA1222Y Term: 30	Account : A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SLA1222Y Regn Date: 16/09/2016 Mileage: 16321 WIP NO: 33834

Model: A4 SEDAN 1.4 TFSI Chassis: WAUZZZF40HA029304 Engine: CVN 017926 Dept: U

VSF No:

You have been assisted by:- UB-Carrine (11)

		Details	Qty	Unit Price	Amount
S	SUBLET	To carry out contractual LIMIT-sum repair basis as agreed	1.00	59,000.00	59,000.00

Parts 0.00
Labour 0.00
Sublet 59,000.00
Menus 0.00
Lubricant 0.00

Sub-Total 59,000.00

7% GST 4,130.00

Grand Total 63,130.00



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Customer

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SLA 1222 Y

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0787/2017/MAS
19 Sept 2017

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE : CLAIM – OWNER’S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A4 Sedan 1.4 TFSI
Vehicle Chassis No. : WAUZZZF40HA029304
Vehicle Regn No. : **SLA 1222 Y**
Vehicle Mileage : 16321 KM
Vehicle Owner : Mr. Chua Kee Lam
Certificate No : 2100482801-001000
Policy Excess : NIL
Accident Date : 7 Aug 2017
Place : Along Cte Towards City (Bef AMK Ave 5)
Repair Cost : \$ 63,130.00
WIP No. : 33834
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time :
Date : 19/9/17

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	11 Aug 2017 17:41		11 Aug 2017 14:39 Edit Adj Rpt	S\$59,000.00 Edit Estimates	S\$59,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	CHUA KEE LAM , ID: S6806540B, Tel: +6596835018, Email: BEEMER6806@GMAIL.COM								
Vehicle Reg. No.:	SLA1222Y	Date of Loss:	07/08/2017 07:00 - :59						
Claim Type:	OD / 3632537990SG	Policy/Cover Note No.:	2100482801-00000 (Comprehensive) Coverage: 16/09/2016 - 15/09/2017						
		Excess:	S\$0.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Dally Amri, Mimi Zarina] MimiZarina.DallyAmri@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 22/08/2017]								
Driver/Custodian:	CHUA KEE LAM (49 / Male), NRIC: S6806540B, Tel: +6596835018								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (31/08/2017): Alert - Adj Mandate Approved (S\$59000.00) - SLA1222Y - Claim Handler: Dally Amri... - AIG_SG (14/08/2017): Alert - Adj Mandate Approved (S\$47972.00) - SLA1222Y - Claim Handler: Dally Amri... - AIG_SG (14/08/2017): SLA1222Y / OD / 07/08/2017 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SLA1222Y (3632537990SG)**

OD

Aug 7 2017 7:25AM

[CHUA KEE LAM]

Premium Automobiles Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	Upload Video	Upload Audio	View View in Browser ▼	
----------------------------------	--	-------------------------------	------------------------------------	------------------------------	------------------------------	--	--

Video					1 per page ▼	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print	
1	07/08/17 17:33	Video - Accident [Linked Accident Report Documents]		Load MP4		
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print	
1	14/08/17 09:47	Video - Accident		Load MP4		

Assessment Reports					1 per page ▼	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print	
1	11/08/17 17:48	Adjuster Immediate Advice		Load HTM		
2	31/08/17 11:21	Adjuster Immediate Advice		Load HTM		

Photos/Images					3 per page ▼	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print	
1	11/08/17 16:38	General View		Load JPG	☒	
2	11/08/17 16:38	General View		Load JPG	☒	
3	11/08/17 16:38	General View		Load JPG	☒	
4	11/08/17 16:38	General View		Load JPG	☒	
5	11/08/17 16:38	General View		Load JPG	☒	
6	11/08/17 16:38	General View		Load JPG	☒	
7	11/08/17 16:38	General View		Load JPG	☒	
8	11/08/17 16:38	General View		Load JPG	☒	
9	11/08/17 16:38	General View		Load JPG	☒	
10	11/08/17 16:38	General View		Load JPG	☒	
11	11/08/17 16:38	General View		Load JPG	☒	
12	11/08/17 16:38	General View		Load JPG	☒	
13	11/08/17 16:38	General View		Load JPG	☒	
14	11/08/17 16:38	General View		Load JPG	☒	
15	11/08/17 16:38	General View		Load JPG	☒	
16	11/08/17 16:38	General View		Load JPG	☒	
17	11/08/17 16:38	General View		Load JPG	☒	
18	11/08/17 16:38	General View		Load JPG	☒	
19	11/08/17 16:38	General View		Load JPG	☒	
20	11/08/17 16:38	General View		Load JPG	☒	
21	11/08/17 16:38	General View		Load JPG	☒	
22	11/08/17 16:38	General View		Load JPG	☒	
23	11/08/17 16:38	General View		Load JPG	☒	
24	11/08/17 16:38	General View		Load JPG	☒	
25	11/08/17 16:38	General View		Load JPG	☒	
26	11/08/17 16:38	General View		Load JPG	☒	
27	11/08/17 16:38	General View		Load JPG	☒	

28	11/08/17 16:38	General View	1	Load JPG	☒
29	11/08/17 16:38	General View	1	Load JPG	☒
30	11/08/17 16:38	General View	1	Load JPG	☒
31	11/08/17 16:38	General View	1	Load JPG	☒
32	11/08/17 16:38	General View	1	Load JPG	☒
33	11/08/17 16:38	General View	1	Load JPG	☒
34	11/08/17 16:38	General View	1	Load JPG	☒
35	11/08/17 16:38	General View	1	Load JPG	☒
36	11/08/17 16:38	General View	1	Load JPG	☒
37	11/08/17 16:38	General View	1	Load JPG	☒
38	11/08/17 16:38	General View	1	Load JPG	☒
39	11/08/17 16:38	General View	1	Load JPG	☒
40	11/08/17 16:38	General View	1	Load JPG	☒
41	11/08/17 16:38	General View	1	Load JPG	☒
42	11/08/17 16:38	General View	1	Load JPG	☒
43	11/08/17 16:38	General View	1	Load JPG	☒
44	11/08/17 16:39	General View	1	Load JPG	☒
45	11/08/17 16:39	General View	1	Load JPG	☒
46	11/08/17 16:39	General View	1	Load JPG	☒
47	11/08/17 16:39	General View	1	Load JPG	☒
48	11/08/17 16:39	General View	1	Load JPG	☒
49	11/08/17 16:39	General View	1	Load JPG	☒
50	11/08/17 16:39	General View	1	Load JPG	☒
51	11/08/17 16:39	General View	1	Load JPG	☒
52	11/08/17 16:39	General View	1	Load JPG	☒
53	11/08/17 16:39	General View	1	Load JPG	☒
54	11/08/17 16:39	General View	1	Load JPG	☒
55	11/08/17 16:39	General View	1	Load JPG	☒
56	11/08/17 16:39	General View	1	Load JPG	☒
57	11/08/17 16:39	General View	1	Load JPG	☒
58	11/08/17 16:39	General View	1	Load JPG	☒
59	11/08/17 16:39	General View	1	Load JPG	☒
60	11/08/17 16:39	General View	1	Load JPG	☒
61	11/08/17 16:39	General View	1	Load JPG	☒
62	11/08/17 16:39	General View	1	Load JPG	☒
63	11/08/17 16:39	General View	1	Load JPG	☒
64	11/08/17 16:39	General View	1	Load JPG	☒
65	11/08/17 16:39	General View	1	Load JPG	☒
66	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
67	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
68	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
69	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
70	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
71	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
72	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
73	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
74	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
75	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
76	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
77	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒

78	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
79	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
80	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
81	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
82	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
83	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
84	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
85	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
86	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
87	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
88	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
89	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
90	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
91	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
92	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
93	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
94	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
95	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
96	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
97	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
98	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
99	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
100	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
101	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
102	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
103	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
104	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
105	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
106	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
107	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
108	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
109	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
110	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
111	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
112	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
113	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
114	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
115	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
116	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
117	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
118	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
119	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
120	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
121	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
122	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
123	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
124	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
125	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
126	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
127	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒

128	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
129	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
130	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
131	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
132	31/08/17 11:22	Reinspection Photo	1	Load JPG	☒
Documentation					
			1 per page	☒	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	11/08/17 16:37	Singapore Accident Statement	1	Load PDF	
2	11/08/17 16:37	Marked estimate	1	Load PDF	
3	11/08/17 16:37	Drivers Driving License	1	Load PDF	
4	11/08/17 16:37	Certificate of Insurance	1	Load PDF	
5	31/08/17 11:23	SUPPLEMENTARY LIST	1	Load PDF	
6	25/01/18 13:38	Discharge Voucher	1	Load PDF	
7	25/01/18 13:38	Workshop Invoice	1	Load PDF	
8	25/01/18 14:22	Supplementary	1	Load PDF	

Linked Accident Report Documents

				View	View in Browser
Video				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	07/08/17 17:33	Video - Accident	1	Load MP4	
Assessment Reports					
			1 per page	☒	
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	07/08/17 17:33	Accident Statement	1	Load HTM	
Photos/Images					
			3 per page	☒	
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	07/08/17 16:40	Accident Photo	1	Load JPG	☒
2	07/08/17 16:40	Accident Photo	1	Load JPG	☒
3	07/08/17 16:40	Accident Photo	1	Load JPG	☒
4	07/08/17 16:40	Accident Photo	1	Load JPG	☒
5	07/08/17 16:40	Accident Photo	1	Load JPG	☒
6	07/08/17 16:40	Accident Photo	1	Load JPG	☒
7	07/08/17 16:40	Accident Photo	1	Load JPG	☒
8	07/08/17 16:40	Accident Photo	1	Load JPG	☒
9	07/08/17 16:40	Accident Photo	1	Load JPG	☒
10	07/08/17 16:40	Accident Photo	1	Load JPG	☒
11	07/08/17 16:40	Accident Photo	1	Load JPG	☒
12	07/08/17 16:40	Accident Photo	1	Load JPG	☒
13	07/08/17 16:40	Accident Photo	1	Load JPG	☒
Documentation					
			1 per page	☒	
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	07/08/17 16:34	Sketch Plan	1	Load JPG	☒
2	07/08/17 16:34	Sketch Plan #2	1	Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

^
v

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CC3/AIG17015496/AQBE2

Date: 26/01/2018

REFERENCE

Insured/Claimant: CHUA KEE LAM Policy No: 2100482801-00000
Date of Loss: 07/08/2017 Nature of Claim: OD Claim No: 3632537990SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLA1222Y
Make & Model: AUDI A4, 1.4 T (A) Engine No: CVN017926
Reg. Date: 16/09/2016 (Man. Year: 2016) Chassis No: WAUZZZF40HA029304
Colour: White Odometer: 16321 km
Engine Capacity: 1395 cc
Market Value/New Car Price: S\$132,000.00
Sum Insured (\$\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 205/60 R16 Rear Tyre Size: 205/60 R16
Front Left Side: Continental 6 mm Rear Left Side: Continental 6 mm
Front Right Side: Continental 6 mm Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	51,336.20	38,683.24	12,652.96	24.65
Miscellaneous Items	0.00	0.00	0.00	
Labour	40,244.00	28,594.00	11,650.00	28.95
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	91,580.20	67,277.24	24,302.96	26.54
Approved Total (Overridden) (\$\$)		59,000.00		
(\$\$)	91,580.20	59,000.00	32,580.20	35.58
+ GST 7.00/7.00% (\$\$)	6,410.61	4,130.00	2,280.61	35.58
Nett Amount (\$\$)	97,990.81	63,130.00	34,860.81	35.58

INSPECTION

Date of Assignment: 11/08/2017
Date Inspected: 10/08/2017 Inspected At: Premium Automobiles Pte Ltd (HQ)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 28.0 days

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	1,703.00 FS	*1,362.40 FS
2	1		*FRONT BUMPER GRILLE - CENTER	Not Necessary	163.00 FS	*- FS
3	1		*RADIATOR GRILLE	Cracked	941.00 FS	*752.40 FS
4	1		*FRONT REINFORCEMENT BEAM	Bent	674.00 FS	*539.20 FS
5	1		*FRONT BUMPER FOAM - INNER	Cracked	101.00 FS	*80.80 FS
6	1		*FRONT BUMPER TOP COVER	Deformed	104.00 FS	*82.80 FS
7	1		*SIGN CAUTION STICKER	Necessary	12.00 FS	*9.04 FS
8	1		*AIR CONDITIONER STICKER	Necessary	6.00 FS	*4.64 FS
9	1		*FRONT LOCK CARRIER BRACKET	Cracked	112.00 FS	*89.20 FS
10	2		*FRONT BUMPER SUPPORT - LH/RH	Not Necessary	46.00 FS	*36.00 FS
11	1		*BONNET	Dented	2,001.00 FS	*1,600.80 FS
12	1		*BONNET ATTACHMENT PARTS	Not Necessary	103.00 FS	*- FS
13	1		*BONNET IMPACT PROTECTION - CENTER	Necessary	23.00 FS	*18.16 FS
14	2		*BONNET IMPACT PROTECTION - LH/RH	Necessary	46.00 FS	*36.32 FS
15	2		*BONNET LOCK STRIKER - LH/RH	Not Necessary	86.00 FS	*- FS
16	2		*BONNET LOCK - LH/RH	Not Necessary	360.00 FS	*- FS
17	1		*BONNET LOCK BOWDEN CABLE	Not Necessary	49.00 FS	*- FS
18	1		*BONNET RELEASE LEVER	Not Necessary	12.00 FS	*- FS
19	1		*FRONT NUMBER PLATE	Bent	25.00 FS	*25.00 FS
20	1		*REAR BUMPER	Distorted	1,844.00 FS	*1,475.20 FS
21	1		*REAR BUMPER FIXING PARTS	Not Necessary	61.00 FS	*- FS
22	4		*REAR BUMPER SECURING PLATE	Damaged	53.00 FS	*41.92 FS
23	1		*REAR KICK SENSOR SECURING STRIP	Cracked	182.00 FS	*145.20 FS
24	1		*REAR BUMPER SPOILER	Distorted	203.00 FS	*162.40 FS
25	1		*REAR BUMPER LIGHT REFLECTOR - LH / RH	N/S Cracked	66.00 FS	*26.24 FS
26	1		*REAR REINFORCEMENT BEAM	Distorted	756.00 FS	*604.40 FS
27	2		*REAR REINFORCEMENT BEAM SEAL - LH/RH	Not Necessary	44.00 FS	*- FS
28	2		*REAR BUMPER GUIDE - LOWER LH / RH	Damaged	72.00 FS	*28.08 FS
29	2		*REAR BUMPER GUIDE - UPPER LH / RH	Damaged	36.00 FS	*28.00 FS
30	2		*REAR BUMPER GUIDE LOCK PIN	Not Necessary	11.00 FS	*- FS
31	4		*REAR PARKING AID SENSOR	Damaged	830.00 FS	*664.00 FS
32	1		*SET REAR BUMPER WIRING	Not Necessary	590.00 FS	*- FS
33	1		*REAR BUMPER SENSOR CABLE HOLDER	Damaged	8.00 FS	*6.08 FS
34	1		*REAR TAILGATE OPENING SENSOR	Not Necessary	179.00 FS	*- FS
35	1		*REAR TAILGATE OPENING CONTROL UNIT	Damaged	365.00 FS	*292.00 FS
36	1		*RETAINER FOR CONTROL UNIT	Not Necessary	7.00 FS	*- FS
37	1		*REAR LID	Distorted	2,184.00 FS	*1,817.60 FS
38	1		*REAR LID ATTCHMENT PARTS	Not Necessary	122.00 FS	*- FS
39	2		*REAR LID HINGE - LH/RH	Bent	388.00 FS	*309.60 FS
40	1		*REAR LID LOCK	Damaged	153.60 FS	*153.60 FS
41	1		*REAR LID LOCK COVER CAP	Cut	16.00 FS	*12.72 FS
42	1		*REAR LID LOCK PUSH BUTTON	Damaged	468.00 FS	*374.40 FS
43	2		*REAR LICENSE PLATE LIGHT	Cracked	97.00 FS	*77.12 FS
44	1		*REAR LID LOCK STRIKER	Bent	27.00 FS	*21.52 FS
45	1		*REAR LID ANTI-THEFT GUARD COVER - INNER	Necessary	53.00 FS	*42.24 FS
46	2		*REAR LID BLIND RIVET STUD	Necessary	16.00 FS	*12.64 FS
47	2		*REAR LID RIVET STUD COVER	Necessary	12.00 FS	*8.96 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
48	2		*REAR LID STOP BUFFER	Necessary	36.32 FS	*36.32 FS
49	1		*REAR LID DAMPER	Damaged	93.00 FS	*74.08 FS
50	1		*REAR LID SEAL	Cut	165.00 FS	*131.60 FS
51	2		*REAR LID HINGE GUIDE COVER - LH/RH	Not Necessary	44.00 FS	*- FS
52	1		*SET REAR LID STOPPER	Necessary	106.00 FS	*84.64 FS
53	1		*REAR LID ADHESIVE FOAM	Necessary	14.00 FS	*11.12 FS
54	1		*REAR LID AUDI LOGO	Necessary	105.00 FS	*84.00 FS
55	1		*AUDI A4 INCRPTION	Necessary	81.00 FS	*64.72 FS
56	1		*AUDI TFSI INCRPTION	Necessary	81.00 FS	*64.72 FS
57	2		*LED TAIL LIGHT - OUTER LH/RH	N/S Cracked/O/S Cut	1,568.00 FS	*1,253.60 FS
58	2		*TAIL LIGHT TRIM - OUTER LH/RH	N/S Cracked / O/S Deformed	48.00 FS	*37.92 FS
59	2		*LED TAIL LIGHT - INNER LH / RH	N/S Cracked / O/S Cut	1,548.00 FS	*1,238.40 FS
60	2		*TAIL LIGHT TRIM - INNER LH/RH	Deformed	48.00 FS	*37.92 FS
61	1		*REAR CROSS PANEL	Distorted	222.00 FS	*177.60 FS
62	1		*REAR CROSS PANEL REINFORCEMENT	Distorted	431.00 FS	*344.40 FS
63	1		*REAR SPARE WHEEL WELL (NPA)	Repair	0.00 FS	*- FS
64	1		*REAR SPARE WHEEL MOUNTING (NPA)	Not Necessary	0.00 FS	*- FS
65	1		*CLAMPING STRIP FOR BATTERY (NPA)	Not Necessary	0.00 FS	*- FS
66	1		*BATTERY CONSOLE	Not Necessary	25.00 FS	*- FS
67	1		*BRACKET FOR AKF VALVE	Not Necessary	50.00 FS	*- FS
68	1		*REAR CROSS PANEL TRIM - UPPER	Distorted	141.00 FS	*112.80 FS
69	1		*REAR INSERT PART	Repair	229.00 FS	*- FS
70	1		*REAR LID TRIM - INNER	Deformed	280.00 FS	*223.60 FS
71	1		*REAR FENDER - LH/RH	N/S Buckled / O/S Repair	4,534.00 FS	*1,813.60 FS
72	1		*REAR 1/4 GLASS - LH/RH	N/S Necessary	1,026.00 FS	*410.40 FS
73	1		*REAR WINDSCREEN	Necessary	969.00 FS	*775.20 FS
74	3		*GLASS PRIMER	Necessary	54.00 FS	*42.96 FS
75	1		*REAR FENDER SOUND ABSORBER	Necessary	426.00 FS	*340.80 FS
76	1		*SET REAR SEAT GROMMET	Necessary	30.00 FS	*24.00 FS
77	1		*REAR NUMBER PLATE	Bent	25.00 FS	*25.00 FS
78	1		*1/4 GLASS SEALANT	Necessary	200.00 FS	*100.00 FS
79	1		*REAR WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS
80	1		*ACRYLIC SEALER	Necessary	360.00 FS	*360.00 FS
81	1		*CAVITY WAX	Necessary	280.00 FS	*280.00 FS
82	1		*STONE CHIP	Necessary	360.00 FS	*360.00 FS
83	1		*METAL FILLER POWDER	Necessary	560.00 FS	*560.00 FS
84	2		*FRONT SEAT BELT - LH/RH	Activated	1,850.00 FS	*1,479.20 FS
85	2		*FRONT SEAT BELT HEIGHT ADJUSTER - LH/RH	Damaged	302.00 FS	*241.60 FS
86	2		*REAR SEAT BELT - LH/RH	Not Necessary	891.00 FS	*- FS
87	1		*REAR SEAT BELT - CENTER	Not Necessary	469.00 FS	*- FS
88	1		*CONTROL UNIT FOR AIRBAG	Activated	1,790.00 FS	*1,432.00 FS
89	3		*CRASH SENSOR FOR AIRBAG	Activated	765.00 FS	*630.00 FS
90	1		*SUNDRIES	Necessary	800.00 FS	*270.08 FS
91	2		*LED HEADLIGHT - LH/RH	Cracked	12,577.60 FS	*12,577.60 FS
92	2		*LOCK CARRIER AIR GUIDE - LH/RH	Deformed	34.88 FS	*34.88 FS
93	1		*A/C CONDENSER	Dented	419.60 FS	*419.60 FS
94	1		*REAR FENDER CONNECTING PLATE - LH	Buckled	37.20 FS	*37.20 FS
95	1		*REAR FENDER BOTTOM PLATE - LH OUTER	Buckled	337.20 FS	*337.20 FS
96	2		*REAR END PANEL SUPPORT - LH/RH	Distorted	65.84 FS	*65.84 FS
97	2		*REAR END PANEL REINFORCEMENT - LH/RH INNER	Distorted	278.40 FS	*278.40 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
98	2		*REAR LID SPRING CONSOLE - LH/RH	Not Necessary	46.00 FS	*- FS
99	2		*D-PILLAR PARTITION - LH/RH	Not Necessary	40.00 FS	*- FS
100	1		*REAR FENDER SHROUD ABSORBER	Not Necessary	213.00 FS	*- FS
101	1		*REAR STOWAGE COMPARTMENT	Cracked	61.36 FS	*61.36 FS
102	1		*FUSE UNIT	Damaged	363.20 FS	*363.20 FS
103	1		*PLATE - BOOT	Damaged	102.80 FS	*102.80 FS
104	1		*BRACKET	Bent	142.20 FS	*142.20 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 51,336.20 38,683.24

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND RENEW PARKING AID	New	280.00	280.00
2	TO REMOVE AND REINSTALL REAR WIRE HARNESS, AUDIO EQUIPMENT, CONTROL UNITS, RELAY AND FUSE REAYS, END PANELLING, SPARE WHEEL HOUSING AND REAR LID HARNESS	New	1,800.00	1,800.00
3	TO REMOVE AND REINSTALL REAR SEATS, BACK REST, CARPETS, ABCD PILLAR TRIMS, DISENGAGE AIRBAG SYSTEM	New	1,800.00	1,800.00
4	TO REMOVE AND REINSTALL CENTER CONSOLE, RENEW ALL SEAT BELTS AND AIRBAG CONTROL UNIT	New	2,400.00	2,400.00
5	TO REMOVE AND RENEW BOTH REAR 1/4 GLASS AND REAR WINDSCREEN	New	1,000.00	600.00
6	TO REMOVE EXHAUST SYSTEM AND FUEL TANK ASSY. INSPECT EXHUAUST SILENCERS FOR DAMAGE	New	800.00	800.00
7	TO REMOVE AND REINSTALL REAR SUSPENSION ASSY TO FACILITATE CELLETTE BENCH REPAIRS. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY	New	2,800.00	2,800.00
8	TO SET UP AND PLACE VEHICLE ON CELLETTE BENCH	New	1,800.00	1,800.00
9	TO REMOVE ALL REAR FITTINGS, DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND REWELD REAR END PANELLING, SPARE WHEEL HOUSING, CROSS MEMBERS AND BOTH REAR FENDERS. REPAIR AND ALIGN WHOLE REAR SUBSTRUCTURE TO POSITION. RENEW REAR BUMPER AND REAR LID. REINSTALL ALL PARTS REMOVED	New	13,200.00	7,000.00
10	TO CARRY OUT STONE CHIP PRIMER WORK ON REAR PANELLING AND SPARE WHEEL HOUSING	New	800.00	600.00
11	TO SPRAY PAINT ON REAR BUMPER, REAR LID, SPARE WHEEL HOUSING, BOOT FLOOR, BOTH REAR FENDERS, BOTH SILL PANELS, DOOR ENTRANCES, DRAIN PANELS, ROOF CHANNELS AND REAR END PANELLING. TO CARRY OUT JOINT SEALER WORKS AND CAVITY PRESERVATION	New	8,500.00	4,400.00
12	TO CARRY OUT WHEEL ALIGNMENT	New	240.00	240.00
13	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
14	TO RECOVER AND TOW BACK VEHICLE FROM SCENE OF ACCIDENT (NPA)	New	0.00	0.00
15	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
16	TO DISMANTLE AND RENEW FRONT BUMPER AND BONNET. ALIGN TO POSITION. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	1,500.00	1,250.00
17	TO RESPRAY FRONT BUMPER AND BONNET	New	1,600.00	1,100.00
18	TO REMOVE FRONT FITTINGS, DISMANTLE AND RENEW A/C CONDENSER, CARRY OUT VACUUM / REGAS SYSTEM	New	480.00	480.00
19	TO REMOVE AND RENEW BOTH HEADLIGHTS, TRANSFER ALL CONTROLS UNIT ETC	New	500.00	500.00
Gross Labour Cost (\$\$)			40,244.00	28,594.00

Report was unsubmitted during this print-out.

No	Particulars	Lab.Type	Repairer's	Amount
----	-------------	----------	------------	--------

Report was unsubmitted during this print-out.				
---	--	--	--	--

< END OF ESTIMATES >