

REF:

CC3/ALL17021039 /A/bn2

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

\$4200
1200

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

200K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

08 hrs

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SL51381B

Yr Regn:

2017, Sept

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Audi TTC

C.C. 1798

Colour:

Grey.

A/C: Insured / Std / NI / NA

Sp. Reading:

1463.

T/Radio: Insured / Std / NI / NA

Eng/No:

TR4222FV6J1000 204

C/No:

Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 245/40 R18.

R: 245/40 R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental.

Front

Rear

R/Bal.

d

mm

R/Bal.

06

mm

L/Bal.

d

mm

L/Bal.

06

mm

D.O.A.

D.O.I.

17/11/17

Survey held at

Premium.

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front s/s.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

DD ALG.

SL51381B - X

20/11 - Report via menmen

21/11 - 16:51 Inform by Victor authorise repair excess 4200

21/11 - 4:58 email to premium authorise repair excess \$4200

Part by Part, \$16940.68 (Red 16989.32 : 50%)

RECEIVED 2 APR 2018

Date/Time, File Pass to?



: Prel. Report



: Final Report

1) 2/4 Typist

Date/Time, File Return to?

2)

Days Of Repair: 8

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S - RS - Si

Photos

Others

Add Fee:



: Site Insp (\$)



: Interview (\$)



: Tech. Invs (\$)



: Weekend (\$)

Report Format: DD

Lump Sum / I.B.I: (\$ 16,940.68)

TOTAL

200

10

210



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AIG ASIA PACIFIC INSURANCE PTE LTD

Ref : CC3/AIG17022039/Atb

78 SHENTON WAY #08-16
CHARTIS BUILDING
SINGAPORE 079120

Date : 20-11-2017



Code : AIG

1. Policy Particulars :- OWN DAMAGE

Insured Veh.	Veh. Inspected	SLS 1381B
Policy No. 1700049202	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	17/11/2017

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No. HIDDEN	Year of Reg.	
Chassis No.	Colour	
Odometer -	Steering	
Brakes	Modification	
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	15/11/2017	Inspection Date	17/11/2017
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1 . SINGAPORE 408699		

5a. Remarks

A)THE MARKET VALUE IS S\$------(EST. AVERAGE) B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.
--

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 20 Nov 2017

Preliminary Advice

Vehicle No	: SLS1381B	Accident Date	: 15/11/2017
Make	: AUDI TT	Policy No.	:
Assignment Date	: 20/11/2017	Excess	: S\$0.00
Date of Inspection	: 17/11/2017	Est. Duration of Repair	: 8.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (HQ) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	33,825.00
Revised Amount	:S\$	19,770.00
Check Items (Estimated)	:S\$	1,359.00
Total	:S\$	21,129.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	200,000.00
COE / PARF Rebate	:S\$	83,637.00
Salvage Value	:S\$	
Margin for Repair	:S\$	116,363.00

Remarks

- (x) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Tuesday, 21 November, 2017 4:58 PM
To: 'Claims'
Cc: SUR
Subject: sls 1381b OD AIG

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SLS 1381B (Excess \$4200/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

***SLS1381B (8800520472SG)**

OD

Nov 15 2017 7:20PM

[DAMAS PHILLIPPE GEORGES J. @DAMAS PHILIPPE G J E O]

Premium Automobiles Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 21/11/2017 16:51 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$19770.00) - SLS1381B - Claim Handler: Loo, Tong Shing

Approved:19770.00:Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type	Singapore NRIC
Owner ID	2890H
Vehicle Details	
Vehicle No.	SL51381B
Vehicle to be Exported	No
Intended De-registration Date	20 Nov 2017
Vehicle Make	AUDI
Vehicle Model	TT COUPE 1.8 TFSI S TRONIC
Primary Colour	Grey
Manufacturing Year	2017
Engine No.	CJS218452
Chassis No.	TRUZZZFV6J1000204
Maximum Power Output	132.0 kW (177 bhp)
Open Market Value	\$43,211.00
Original Registration Date	08 Sep 2017
First Registration Date	08 Sep 2017
Transfer Count	0
Actual ARF Paid	\$47,496.00
Intended PARF Rebate Details	
PARF Eligibility	Yes
PARF Eligibility Expiry Date	07 Sep 2027
PARF Rebate Amount	\$35,622.00
Intended COE Rebate Details	
COE Expiry Date	07 Sep 2027
COE Category	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years)	10
QP Paid	\$49,000.00
COE Rebate Amount	\$48,015.00
Total Rebate Amount	\$83,637.00

The information contained herein is correct as at 20 Nov 2017

OK

9412062


YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

Class 2B	Motorcycles =< 200 cc	12 Aug 2016
Class 3	Motor cars with unladen weight =< 3000kg with =< 7 passengers, exclusive of driver; and other motor vehicles with unladen weight =< 2500kg	12 Aug 2016



NRIC No. S2742890H

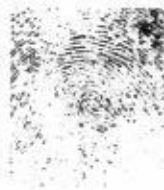

Nationality
BELGIAN
Date of issue
06-08-2016

Address

49 HOLLAND PARK
SINGAPORE 249490



NP 428A

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S2742890H



Name

DAMAS PHILIPPE GEORGES J.
@DAMAS PHILIPPE G J E O

Race

CAUCASIAN

Date of birth

11-10-1950

Country/Place of birth

BELGIUM

Sex

M

S2742890H

REPUBLIC OF SINGAPORE DRIVING LICENCE

Licence Number S2742890H

Name

DAMAS PHILIPPE GEORGES J.

Birth Date: 11 Oct 1950

Issue Date: 12 Aug 2016



002596282C



COVER NOTE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

The following are described on this Cover Note is hereby **NOT** COVERED on the terms and conditions of the policy issued to the Policyholder.

Name of Policyholder : DAMAS PHILIPPE GEORGES J. @DAMAS PHILIPPE
 Period of Insurance : 08 Sep 2017 to 07 Sep 2018
 Engine No. : CJS218452
 Chassis No. : TRUZZZFV6J1000204
 Cover Note No. : 51513816
 Endorsement No. : 1700049202
 Issued Date : 07 Sep 2017

ABOUT THE COVER

Make/Model : AUDI TTC 1.8 TFSI
 Engine Capacity/Tonnage : 1,798.00 CC
 Driver Restriction : NA
 Person or Classes of Persons Entitled to Drive* :
 Sum Insured : Market Value
 Off Peak Car : No
 First Year of Registration : 2017
 Insuring with COE/PARF : Yes

a) The Policyholder
 b) Any other person who is driving on the Policyholder's order or with his/her permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use*

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
 Fire - \$0 Own Damage - \$1200 Theft - \$0 Flood Cover - \$0

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)
 DAMAS PHILIPPE GEORGES J. @DAMAS PHILIPPE G J E O - \$1200 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

If you do not receive your Certificate of Insurance and policy documents within 30 days from the inception date stated on this cover note, please contact AIG immediately.
 We hereby certify that this Cover Note is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia). For Corporate Policies, this Cover Note is valid for 60 days from the commencement date of the period of insurance.

0504125217

PREMIUM LEASING - EF

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
 SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.

AUTHORISED REPRESENTATIVE Cheong Guan Yee

78 Shenton Way #07-16 AIG Building 5079120 | T: +65 6419 3000 | F: +65 6415 3723 | www.aig.com.sg

AIG Asia Pacific Insurance Pte. Ltd.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/1137/2017/JT
Date	:	16-Nov-17

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Damas Phillippe Georges J. @ Damas Philippe G J E O
Address	:	49 Holland Park

	:	Singapore 249490
Telephone	:	HP +65 9626 3638
Type of Claim	:	Own Damage Claim
Policy No.	:	1700049202
Vehicle No	:	SLS 1381 B
Model Code	:	Audi TT Coupe 1.8 TFS
Model / Year	:	Sep-17
Engine No	:	CJS 218452
Chassis No	:	TRUZZZFV6J1000204
Mileage	:	-
Date In	:	16-Nov-17
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	15-Nov-17
Place of Accident	:	Evans Road Traffic light @ Junction with Nassim Road

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLS 1381 B.

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00	/ ✓
2	To remove & transfer air con condenser, radiator, additional radiator, electrical fans & control unit. To carry out vacuum/regas & to pressurise cooling system.	S/N \$ 1,100.00	X.
3	To dismantle front bumper, LHS front fender and bonnet. Renew front lock carrier, align to position. Renew front bumper, LHS front fender, LHS headlight and bonnet. Re-organize front crash management components. Reinstall all parts removed.	\$ 5,250.00	2250. ✓
4	To dismantle LHS front door panel trims, remove wing mirror assy and renew door window moulding and LHS roof lining Reinstall all parts removed.	S/N \$ 700.00	X.
5	To respray front bumper, LHS front fender, bonnet, A-pillar and LHS front door.	\$ 4,000.00	1925, ✓
6	To renew LHS front rim and tire. Carry out wheel alignment.	S/N \$ 280.00	X
7	To carry out diagnostic checks.	S/N \$ 192.00	/ ✓
TOTAL LABOUR CHARGES		: \$ 12,002.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLS 1381 B.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Distorted</i>	\$ 1,896.00	- 1516.80
2	FRONT BUMPER FIXING PARTS <i>new</i>	\$ 239.00	+
3	FRONT BUMPER CLOSING ELEMENT - LHS <i>new</i>	\$ 90.00	+
4	FRONT WHEEL HOUSE LINER STRIP - LHS <i>new</i>	\$ 35.00	+
5	FRONT AIR GRILLE - LHS <i>new</i>	\$ 180.00	+
6	FRONT BUMPER GUIDE - LHS <i>Distorted</i>	\$ 31.00	- 24.48
7	FRONT FENDER - LHS <i>Distorted</i>	\$ 1,008.00	- 806.40
8	FRONT FENDER ATTACHMENT PARTS - LHS <i>not new</i>	\$ 33.00	+
9	FRONT FENDER BRACE - LHS <i>new</i>	\$ 100.00	- 79.44
10	FRONT FENDER CENTRE BRACKET - LHS	\$ 36.00	- 28.64
11	FRONT FENDER LOWER BRACKET - LHS <i>Distorted</i>	\$ 39.00	- 30.72
12	FRONT FENDER CLOSING ELEMENT - LHS <i>new</i>	\$ 45.00	?
13	FRONT FENDER UPPER BRACKET - LHS <i>Distorted</i>	\$ 44.00	- 34.96
14	FRONT WHEEL HOUSE LINER - LHS <i>torn</i>	\$ 250.00	- 199.20
15	WHEEL HOUSE LINER ATTACHMENT PARTS - LHS <i>Not new</i>	\$ 94.00	?
16	LED HEADLIGHT - LHS <i>Cracked</i>	\$ 7,834.00	- 6067.20
17	LED HEADLIGHT DAY RUNNING LIGHT CTRL UNIT - LHS <i>new</i>	\$ 492.00	+
18	LED HEADLIGHT POWER MODULE - LHS <i>new</i>	\$ 470.00	+
19	LED CONRNERING LIGHT CTRL UNIT - LHS <i>new</i>	\$ 470.00	+
20	BONNET <i>Distorted</i>	\$ 3,306.00	- 2644.20
TOTAL SPARE PARTS CHARGES - FRONT		\$ 16,692.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLS 1381 B.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	BONNET SEAL - LHS/RHS <i>Free</i>	\$ 86.00	— 6736
22	BONNET EDGE SEAL - CTR	\$ 25.00	— 19.68
23	FRONT FENDER SEAL - LHS <i>delud</i>	\$ 52.00	— 40.96
24	BONNET STRIKER - LHS/RHS <i>mn</i>	\$ 192.00	+
25	BONNET SWITCH <i>mn</i>	2 \$ 348.00	+
26	WASHER RESEVOIR <i>delud</i>	\$ 183.00	— 146
27	WASHER RESEVOIR PUMP <i>Not New</i>	\$ 112.00	?
28	WASHER WATER LEVEL SWITCH <i>Not New</i>	\$ 41.00	?
29	LOCK CARRIER <i>Ryio</i>	\$ 851.00	+
30	LOCK CARRIER SUPPORT <i>mn</i>	2 \$ 31.00	+
31	LOCK CARRIER BRACKET - LHS <i>Not New</i>	\$ 42.00	+
32	COOLANT CONCENTRATE <i>Not New</i>	\$ 132.00	+
33	FRONT WINDOW CHROME TRIM - LHS <i>Not New</i>	\$ 244.00	+
34	ROOF MOULDING - LHS <i>Not New</i>	\$ 567.00	?
35	ALUMINIUM RIM - LHS <i>Not New</i>	\$ 823.00	+
36	FRONT TIRE - LHS <i>Not New</i>	\$ 902.00	+
37	SUNDRIES <i>Not New</i>	\$ 500.00	?
TOTAL SPARE PARTS CHARGES		\$ 21,823.00	
TOTAL LABOUR CHARGES		\$ 12,002.00	
GRAND TOTAL		\$ 33,825.00	

33909

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Adrian G
17/11/17

are Authorised, 08 hrs.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

- : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/1137/2017/JT
Date	:	16-Nov-17

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Adrian

8 days exclude 1 Sunday - jb 15 Mar 18

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Damas Phillippe Georges J. @ Damas Philippe G J E O
Address	:	49 Holland Park
		Singapore 249490
Telephone	:	HP +65 9626 3638
Type of Claim	:	Own Damage Claim
Policy No.	:	1700049202
Vehicle No	:	SLS 1381 B
Model Code	:	Audi TT Coupe 1.8 TFS
Model / Year	:	Sep-17
Engine No	:	CJS 218452
Chassis No	:	TRUZZZFV6J1000204
Mileage	:	-
Date In	:	16-Nov-17
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	15-Nov-17
Place of Accident	:	Evans Road Traffic light @ Junction with Nassim Road

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLS 1381 B.

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$	480.00	\$ 480.00
2	To remove & transfer air con condenser, radiator, additional radiator, electrical fans & control unit. To carry out vacuum/regas & to pressurise cooling system.	S/N \$	1,100.00	
3	To dismantle front bumper, LHS front fender and bonnet. Renew front lock carrier, align to position. Renew front bumper, LHS front fender, LHS headlight and bonnet. Re-organize front crash management components. Reinstall all parts removed.	\$	5,250.00	\$ 2,250.00
4	To dismantle LHS front door panel trims, remove wing mirror assy and renew door window moulding and LHS roof lining Reinstall all parts removed.	S/N \$	700.00	
5	To respray front bumper, LHS front fender, bonnet, A-pillar and LHS front door.	\$	4,000.00	\$ 1,925.00
6	To renew LHS front rim and tire. Carry out wheel alignment.	S/N \$	280.00	
7	To carry out diagnostic checks.	S/N \$	192.00	\$ 192.00
TOTAL LABOUR CHARGES		:	<u>\$ 12,002.00</u>	<u>\$ 4,847.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLS 1381 B.

S/N	Parts Description	Damage Pa	
		S/NETT	RI
1	FRONT BUMPER	\$	1,896.00
2	FRONT BUMPER FIXING PARTS	\$	239.00
3	FRONT BUMPER CLOSING ELEMENT - LHS	\$	90.00
4	FRONT WHEEL HOUSE LINER STRIP - LHS	\$	35.00
5	FRONT AIR GRILLE - LHS	\$	180.00
6	FRONT BUMPER GUIDE - LHS	\$	31.00
7	FRONT FENDER - LHS	\$	1,008.00
8	FRONT FENDER ATTACHMENT PARTS - LHS	\$	33.00
9	FRONT FENDER BRACE - LHS	\$	100.00
10	FRONT FENDER CENTRE BRACKET - LHS	\$	36.00
11	FRONT FENDER LOWER BRACKET - LHS	\$	39.00
12	FRONT FENDER CLOSING ELEMENT - LHS	\$	45.00
13	FRONT FENDER UPPER BRACKET - LHS	\$	44.00
14	FRONT WHEEL HOUSE LINER - LHS	\$	250.00
15	WHEEL HOUSE LINER ATTACHMENT PARTS - LHS	\$	94.00
16	LED HEADLIGHT - LHS	\$	7,834.00
17	LED HEADLIGHT DAY RUNNING LIGHT CTRL UNIT - LHS	\$	492.00
18	LED HEADLIGHT POWER MODULE - LHS	\$	470.00
19	LED CONRNERING LIGHT CTRL UNIT - LHS	\$	470.00
20	BONNET	\$	3,306.00
TOTAL SPARE PARTS CHARGES - FRONT		\$	16,692.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Costs & Prices

MARKS

\$ 1,516.80

\$ 24.48

\$ 806.40

\$ 79.44

\$ 28.64

\$ 30.72

\$ 34.96

\$ 199.20

\$ 6,267.20

\$ 2,644.80

\$ 11,632.64

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLS 1381 B.

S/N	Parts Description	c/f	Damage Parts & Prices	
			S/NETT	REMARKS
			\$	11,632.64
21	BONNET SEAL - LHS/RHS		\$ 86.00	\$ 67.36
22	BONNET EDGE SEAL - CTR		\$ 25.00	\$ 19.68
23	FRONT FENDER SEAL - LHS		\$ 52.00	\$ 40.96
24	BONNET STRIKER - LHS/RHS		\$ 192.00	
25	BONNET SWITCH	2	\$ 348.00	
26	WASHER RESEVOIR		\$ 183.00	\$ 146.00
27	WASHER RESEVOIR PUMP		\$ 112.00	
28	WASHER WATER LEVEL SWITCH		\$ 41.00	
29	LOCK CARRIER		\$ 851.00	
30	LOCK CARRIER SUPPORT	2	\$ 31.00	
31	LOCK CARRIER BRACKET - LHS		\$ 42.00	
32	COOLANT CONCENTRATE		\$ 132.00	
33	FRONT WINDOW CHROME TRIM - LHS		\$ 244.00	
34	ROOF MOULDING - LHS		\$ 567.00	
35	ALUMINIUM RIM - LHS		\$ 823.00	
36	FRONT TIRE - LHS		\$ 902.00	
37	ADDED PARTS -SEE ATTACHED		\$ 105.00	\$ 84.00
38	SUNDRIES		\$ 500.00	\$ 103.04
	TOTAL SPARE PARTS CHARGES	:	\$ 21,928.00	\$ 12,093.68
	TOTAL LABOUR CHARGES	:	\$ 12,002.00	\$ 4,847.00
	GRAND TOTAL	:	\$ 33,930.00	\$ 16,940.68

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No.
Date
Service Advisor
Pages
Regn No
Model No

PA/OD/1137/2017/JT
29-Nov-17
JB

SLS1381B
TT 1.8 TFSI

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Bonnet AUDI emblem <i>NCC</i>	\$ 105.00	\$ 84.00
		<u>\$ 105.00</u>	
<u>LABORS</u>			
TOTAL		\$ 105.00	\$ 84.00

For Premium Automobiles Pte Ltd



Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note

: This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLS 1381 B

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/1137/2017/MAS

27 March 2018

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SLS 1381 B, Audi TT Coupe 1.8 TFSI S-Tro

With reference to the above-mentioned vehicle, no **SLS 1381 B**, claimant,
Mr. Damas Philippe Georges J. @Damas Philippe G J E O, please find the
related document per attached.

1. A copy of the Original invoice no. 85012274 – S\$16,842.53
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the
payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at
6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai

Claims Dept

Encls

AIG – SLS 1381 B

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	20 Nov 2017 15:47		20 Nov 2017 11:50 Edit Adj Rpt	S\$16,940.68 Edit Estimates	S\$16,940.68 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured: **DAMAS PHILLIPPE GEORGES J. @DAMAS PHILIPPE G J E O**, ID: S2742890H, Tel: +6596263638, Email: CONAKAT88@HOLLANDSING.COM

Vehicle Reg. No.: **SLS1381B** Date of Loss: 15/11/2017 19:00 - :59 [2 Months and 7 Days From LTA Reg Date (Man Yr)]

Claim Type: **OD / 8800520472SG** Policy/Cover Note No.: (Comprehensive)
Excess: S\$1,200.00

Repairer: **Premium Automobiles Pte Ltd (UBI)** 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911

Handling Insurer: **AIG Asia Pacific Insurance Pte. Ltd. (SG)** - Tel: 65-6419-3000 ... [Handled by **Loo, Tong Shing**] TongShing.Loo@aig.com

Adjuster: **LKK Auto Consultants Pte Ltd (HQ)** - Tel: 6256-3561 ... [Handled by **ADRIAN LING**] ... **[Final Rpt due 29/11/2017]**

Driver/Custodian: **DAMAS PHILLIPPE GEORGES J. @DAMAS PHILIPPE G J E O** (67 / Male), NRIC: S2742890H, Tel: +6596263638

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

- AIG_SG (08/12/2017): **SLS1381B / OD / 15/11/2017 / Coverage & Excess update**
- AIG_SG (21/11/2017): **Alert - Adj Mandate Approved (S\$19770.00) - SLS1381B - Claim Handler: Loo, Tong ...**
- AIG_SG (20/11/2017): **SLS1381B / OD / 15/11/2017 / Coverage & Excess update**
- AIG_SG (20/11/2017): **SLS1381B / OD / 15/11/2017 / Coverage & Excess update**

ALL ASSOCIATED TASKS

[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLS1381B (8800520472SG)
OD

Nov 15 2017 7:20PM

[DAMAS PHILLIPPE GEORGES J. @DAMAS PHILIPPE G J E O]
Premium Automobiles Pte Ltd

Upload Documents		Upload Photos		Compose New Letter		Upload Video		Upload Audio		View Use Viewer	
										1 per page 1	
Assessment Reports											
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)								Thumbnail	Print
1	20/11/17 15:51	Adjuster Immediate Advice								1 Load HTM	
										3 per page 1	
Photos/Images											
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)								Thumbnail	Print
1	20/11/17 15:41	General View								1 Load JPG	1
2	20/11/17 15:41	General View								1 Load JPG	1
3	20/11/17 15:41	General View								1 Load JPG	1
4	20/11/17 15:41	General View								1 Load JPG	1
5	20/11/17 15:41	General View								1 Load JPG	1
6	20/11/17 15:41	General View								1 Load JPG	1
7	20/11/17 15:41	General View								1 Load JPG	1
8	20/11/17 15:41	General View								1 Load JPG	1
9	20/11/17 15:41	General View								1 Load JPG	1
10	20/11/17 15:41	General View								1 Load JPG	1
11	20/11/17 16:07	General View								1 Load JPG	1
12	20/11/17 16:07	General View								1 Load JPG	1
13	20/11/17 16:07	General View								1 Load JPG	1
14	20/11/17 16:07	General View								1 Load JPG	1
15	20/11/17 16:07	General View								1 Load JPG	1
16	20/11/17 16:07	General View								1 Load JPG	1
17	20/11/17 16:07	General View								1 Load JPG	1
18	20/11/17 16:07	General View								1 Load JPG	1
19	20/11/17 16:07	General View								1 Load JPG	1
20	20/11/17 16:07	General View								1 Load JPG	1
21	20/11/17 16:07	General View								1 Load JPG	1
22	20/11/17 16:07	General View								1 Load JPG	1
23	20/11/17 16:07	General View								1 Load JPG	1
24	20/11/17 16:07	General View								1 Load JPG	1
25	20/11/17 16:07	General View								1 Load JPG	1
26	20/11/17 16:07	General View								1 Load JPG	1
27	20/11/17 16:07	General View								1 Load JPG	1
28	20/11/17 16:07	General View								1 Load JPG	1
29	20/11/17 16:07	General View								1 Load JPG	1
30	20/11/17 16:07	General View								1 Load JPG	1
31	20/11/17 16:07	General View								1 Load JPG	1
32	20/11/17 16:07	General View								1 Load JPG	1
33	20/11/17 16:07	General View								1 Load JPG	1
34	20/11/17 16:07	General View								1 Load JPG	1
										1 per page 1	
Documentation											
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)								Thumbnail	Print
1	20/11/17 14:29	Singapore Accident Statement								1 Load PDF	
2	20/11/17 14:29	ESTIMATE								1 Load PDF	
3	20/11/17 14:29	Driver's Driving License								1 Load PDF	

4	20/11/17 14:29	Certificate of Insurance	1	Load PDF	
5	06/12/17 14:30	Foreign Driving License	1	Load PDF	
6	03/04/18 09:53	WORKSHOP INVOICE	1	Load PDF	
7	03/04/18 09:53	DISCHARGE VOUCHER	1	Load PDF	
8	03/04/18 09:56	Supplementary	1	Load PDF	

Linked Accident Report Documents

View
Use Viewer

Assessment Reports
1 per page
Thumbnail
Print

No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	16/11/17 13:12	Accident Statement	1	Load HTM	

Photos/Images
3 per page
Thumbnail
Print

No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	16/11/17 13:08	Accident Photo	1	Load JPG	
2	16/11/17 13:08	Accident Photo	1	Load JPG	
3	16/11/17 13:08	Accident Photo	1	Load JPG	
4	16/11/17 13:08	Accident Photo	1	Load JPG	
5	16/11/17 13:08	Accident Photo	1	Load JPG	
6	16/11/17 13:08	Accident Photo	1	Load JPG	
7	16/11/17 13:08	Accident Photo	1	Load JPG	
8	16/11/17 13:08	Accident Photo	1	Load JPG	
9	16/11/17 13:08	Accident Photo	1	Load JPG	
10	16/11/17 13:08	Accident Photo	1	Load JPG	
11	16/11/17 13:08	Accident Photo	1	Load JPG	
12	16/11/17 13:08	Accident Photo	1	Load JPG	

Documentation
1 per page
Thumbnail
Print

No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	16/11/17 13:00	Sketch Plan	1	Load JPG	
2	16/11/17 13:00	Sketch Plan #2	1	Load JPG	

Documents Checklist

DOCUMENTS CHECKLIST
Reset
Save
Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer
Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CC3/AIG17022039/ATBN2

Date: 03/04/2018

REFERENCE

Insured/Claimant: DAMAS PHILIPPE GEORGES J. @DAMAS
PHILIPPE G J E O

Policy No:

Date of Loss: 15/11/2017

Nature of
Claim:

OD Claim No: 8800520472SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLS1381B

Make & Model: AUDI TT, COUPE 1.8T (A)

Reg. Date: 08/09/2017 (Man. Year: 2017)

Colour: Grey

Engine Capacity: 1798 cc

Market Value/New Car Price: S\$200,000.00

Sum Insured (S\$): Market Value/New Car Price

Engine No: CJS218452

Chassis No: TRUZZZFV6J1000204

Odometer: 1463 km

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/40R18

Rear Tyre Size: 245/40R18

Front Left Side: Continental 6 mm

Rear Left Side: Continental 6 mm

Front Right Side: Continental 6 mm

Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	21,907.00	12,093.68	9,813.32	44.80
Miscellaneous Items	0.00	0.00	0.00	
Labour	12,002.00	4,847.00	7,155.00	59.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	33,909.00	16,940.68	16,968.32	50.04
- Excess (S\$)	1,200.00	1,200.00	0.00	0.00
(S\$)	32,709.00	15,740.68	16,968.32	51.88
+ GST 7.00/7.00% (S\$)	2,289.63	1,101.85	1,187.78	51.88
Nett Amount (S\$)	34,998.63	16,842.53	18,156.10	51.88

INSPECTION

Date of Assignment: 20/11/2017

Date Inspected: 17/11/2017 Inspected At:

Premium Automobiles Pte Ltd (HQ)
55 Ubi Road 1
Singapore 408699

Estimated Period of Repair: 8.0 days

Adjuster: ADRIAN LING

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	1,896.00 FS	*1,516.80 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	239.00 FS	*- FS
3	1		*FRONT BUMPER CLOSING ELEMENT-LHS	Not Necessary	90.00 FS	*- FS
4	1		*FRONT WHEEL HOUSE LINER STRIP-LHS	Not Necessary	35.00 FS	*- FS
5	1		*FRONT AIR GRILLE-LHS	Not Necessary	180.00 FS	*- FS
6	1		*FRONT BUMPER GUIDE-LHS	Damaged	31.00 FS	*24.48 FS
7	1		*FRONT FENDER-LHS	Distorted	1,008.00 FS	*806.40 FS
8	1		*FRONT FENDER ATTACHMENT PARTS-LHS	Not Necessary	33.00 FS	*- FS
9	1		*FRONT FENDER BRACE-LHS	Bent	100.00 FS	*79.44 FS
10	1		*FRONT FENDER CENTRE BRACKET-LHS	Damaged	36.00 FS	*28.64 FS
11	1		*FRONT FENDER LOWER BRACKET-LHS	Damaged	39.00 FS	*30.72 FS
12	1		*FRONT FENDER CLOSING ELEMENT-LHS	Not Necessary	45.00 FS	*- FS
13	1		*FRONT FENDER UPPER BRACKET-LHS	Distorted	44.00 FS	*34.96 FS
14	1		*FROTN WHEEL HOUSE LINER-LHS	Torn	250.00 FS	*199.20 FS
15	1		*WHEEL HOUSE LINER ATTACHMENT PARTS-LHS	Not Necessary	94.00 FS	*- FS
16	1		*LED HEADLIGHT-LHS	Cracked	7,834.00 FS	*6,267.20 FS
17	1		*LED HEADLIGHT DAY RUNNING LIGHT CTRL UNIT-LHS	Not Necessary	492.00 FS	*- FS
18	1		*LED HEADLIGHT POWER MODULE-LHS	Not Necessary	470.00 FS	*- FS
19	1		*LED CONRNERING LIGHT CTRL UNIT-LHS	Not Necessary	470.00 FS	*- FS
20	1		*BONNET	Distorted	3,306.00 FS	*2,644.80 FS
21	2		*BONNET SEAL-LHS/RHS	Necessary	86.00 FS	*67.36 FS
22	1		*BONNET EDGE SEAL-CTR	Necessary	25.00 FS	*19.68 FS
23	1		*FRONT FENDER SEAL-LHS	Deformed	52.00 FS	*40.96 FS
24	2		*BONNET STRIKER-LHS/RHS	Not Necessary	192.00 FS	*- FS
25	2		*BONNET SWITCH	Not Necessary	348.00 FS	*- FS
26	1		*WASHER RESEVOIR	Deformed	183.00 FS	*146.00 FS
27	1		*WASHER RESEVOIR PUMP	Not Necessary	112.00 FS	*- FS
28	1		*WASHER WATER LEVEL SWITCH	Not Necessary	41.00 FS	*- FS
29	1		*LOCK CARRIER	Repair	851.00 FS	*- FS
30	2		*LOCK CARRIER SUPPORT	Not Necessary	31.00 FS	*- FS
31	1		*LOCK CARRIER BRACKET-LHS	Not Necessary	42.00 FS	*- FS
32	1		*COOLANT CONCENTRATE	Not Necessary	132.00 FS	*- FS
33	1		*FROTN WINDOW CHROME TRIM-LHS	Not Necessary	244.00 FS	*- FS
34	1		*ROOF MOULDING-LHS	Not Necessary	567.00 FS	*- FS
35	1		*ALUMINIUM RIM-LHS	Not Necessary	823.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	1		*FRONT TIRE-LHS	Not Necessary	902.00 FS	*- FS
37	1		*SUNDRIES	Necessary	500.00 FS	*103.04 FS
38	1		*BONNET AUDI EMBLEM	Necessary	84.00 FS	*84.00 FS
F=Franchise part. S=SpcNett.						
Total Parts (\$\$)					21,907.00	12,093.68

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,FOG LAMPS,OUTSIDE TEMPERATURE SENSOR,HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE & TRANSFER AIR CON CONDENSER,RADIATOR,ADDITIONAL RADIATOR,ELECTRICAL FANS & CONTROL UNIT.TO CARRY OUT VACUUM/REGAS & TO PRESSURISE COOLING SYSTEM	New	1,100.00	-
3	TO DISMANTLE FRONT BUMPER,LHS FRONT FENDER AND BONNET.RENEW FRONT LOCK CARRIER,ALIGN TO POSITION.RENEW FRONT BUMPER,LHS FRONT FENDER,LHS HEADLIGHT AND BONNET.RE-ORGANIZE FRONT CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	5,250.00	2,250.00
4	TO DISMANTLE LHS FRONT DOOR PANEL TRIMS,REMOVE WING MIRROR ASSY AND RENEW DOOR WINDOW MOULDING AND LHS ROOF LINING.REINSTALL ALL PARTS REMOVED	New	700.00	-
5	TO RESPRAY FRONT BUMPER,LHS FRONT FENDER,BONNET,A-PILLAR AND LHS FRONT DOOR	New	4,000.00	1,925.00
6	TO RENEW LHS FRONT RIM AND TIRE.CARRY OUT WHEEL ALIGNMENT	New	280.00	-
7	TO CARRY OUT DIAGNOSTIC CHECKS	New	192.00	192.00
Gross Labour Cost (\$\$)			12,002.00	4,847.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >