

22/03/2002

SS. REC. BY:

REF: CS/CT117072448/44608 Special Instruction:

Surveyor

Marian

ASSIGNMENT (Office)

From (Person):

Cheng Born Sen

of

CT1

Date/Time:

24/11/17 @ 11:35 am

Estimated Cost:

Bill to:

OD TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SJT 570J

Insured:

at Workshop m/s

Specialist

Tel:

6747 2112

of

Ubi

Policy No:

DMPCSN 303076700

Claim No:

SNM17D06527C01

Sum Insured:

Excess:

0p.

Make of Veh:

(Client's Record)

D.O.A.

10/11/17

CA / REV

REP. / REV 24 HRS

3.30pm

H.O.D. Endorsement:

Date/Time:

Person Contacted:

Vehicle IN/OUT

| Date/Time | Action/Instruction () Estimate |
|-------------|--|
| | SJT 570J C66/CT117072448/M1213. Dmg. 10/11/17 |
| 29/11 | Report via MOWMEN |
| 29/11-11:45 | authorise repair by Alfred Toh |
| 30/11- | inform/email authorise repair to Wei Sun excess waived |
| | Part by Part \$4708.90, 5days. (Red: 26th 35% 35%) |

REF:

CA /

ASSIGNMENT

From:

Date:

Estimated Cost:

Veh No:

SJJ5700J

Yr Regn:

4/12

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA /

Make:

Mer Benz C180 cc 1597

Colour:

Silver

A/C: Insured / Std / NI / NA

Sp. Reading

106379

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WDD2040452A 681031

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

225/45 ZR17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

FALKEN

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

10/11/17

D.O.I.

24/11/17

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Rev

The U/C / Chassis frame / Body Structure affected due to collision.

☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SJJ5700J

at Workshop m/s

Sperdy

of

3.30

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:


NIL

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

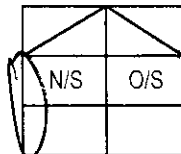

Bal. or Market Value:

874

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

5

days

Res.:

Yes or No

Lump Sum:

1.3%

%

3 Val.:

Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Date / Time

Action / Instruction

LTA 47840

4 yrs. Insur. exp 13

No second hand parts

RECEIVED 20 JAN

Date/Time. File Pass to?



Preli. Report



Final Report

Date/Time. File Return to?

Days Of Repair:

5

Resurvey No. of Trip:

1

Survey Fee:

Transportation:

S + RS SI

Photos

Others

Add Fee:



Site Insp (\$



Interview (\$



Tech. Insp (\$



Weekend (\$

Report Format:

OD

Lump Sum / B.I. (\$

4703.90

TOTAL

150

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CT117022418/Utb

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 24-11-2017



Code : CTI

1. Policy Particulars :- OWN DAMAGE

| | | | |
|--------------|-----------------------------|----------------|------------|
| Insured Veh. | | Veh. Inspected | SJJ 5700J |
| Policy No. | DMPCSN3030761700 | Coverage (\$) | 0.00 |
| Claim No. | SNM17D06527C01 | Excess (\$) | 0.00 |
| Assign From | CHONG BOON SEN (MERIMEN) | Assign Date | 24/11/2017 |

2. Vehicle Particulars & Condition

| | | | |
|--------------|--------|--------------|---|
| Make & Model | | c.c | 0 |
| Engine No. | HIDDEN | Year of Reg. | |
| Chassis No. | | Colour | |
| Odometer | - | Steering | |
| Brakes | | Modification | |
| General | | | |

3. Conditions of Tyres

| | Size | Make | Balance |
|----------------|------|------|---------|
| R/H Front Tyre | | | mm |
| L/H Front Tyre | | | mm |
| R/H Rear Tyre | | | mm |
| L/H Rear Tyre | | | mm |

4. Description of Damages

| | |
|--|--|
| | |
|--|--|

5. General Information

| | | | |
|----------------|--|-----------------|------------|
| Accident Date | 10/11/2017 | Inspection Date | 24/11/2017 |
| Survey held at | SPECIALISTS MOTOR PTE LTD BLK 3018A UBI ROAD 1 #01-24-26 SINGAPORE 408711 | | |

5a. Remarks

| |
|--|
| A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) |
| B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS. |

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

| Case | Refined | Int Submitted | Adj Assigned | Adj Rpt | Adj Submitted | Ins Auth'd | Status |
|------|---|---|--|---------|---------------|------------|--|
| Main | 22 Nov 2017 Sendback Est | 23 Nov 2017 09:19 \$7,327.25 | 24 Nov 2017 11:35 Assign | | | | New Assignment Cancel Case |

| | | | | |
|------|-----------|---------------|-----------|--------------------------|
| Main | Reference | Claim Details | Documents | Show All |
|------|-----------|---------------|-----------|--------------------------|

CLAIM SUBFOLDER DETAILS

| | | | |
|-------------------|---|---|--|
| Insured: | | JAREL ABDUL JALIL BIN ABDUL AZIZ, ID: S7410335I, Tel: +6582282010, Email: jarel777@singnet.com.sg | |
| Vehicle Reg. No.: | SJJ5700J | Date of Loss: | 10/11/2017 17:00 - :59 |
| Claim Type: | OD / SNM17D06527C01 | Policy/Cover Note No.: | DMPCSN3030761700 (Comprehensive) Coverage: 11/07/2017 - 11/04/2018 |
| | | Excess: | \$0.00 |
| Repairer: | Specialists Motor Pte Ltd (HQ) Blk 3018A Ubi Road 1, #01-24/25/26, 408711 Ubi - Tel: 6747 2112 | | |
| Handling Insurer: | China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen] | | |
| Adjuster: | LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 05/12/2017] | | |
| Driver/Custodian: | JAREL ABDUL JALIL BIN ABDUL AZIZ (43 / Male), NRIC: S7410335I, Tel: +6582282010 | | |
| Adj Asg. Remarks: | SURVEY REVERT | | |

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

| Due Date | Priority | Type | Task Group | Subject | Handler | Assigned By | Completed On | Created On | Done? |
|-------------|----------|------|------------|---------|---------|-------------|--------------|------------|-------|
| No results. | | | | | | | | | |

Wei Sun

Not in

24/11/2017

11:46am

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

| | |
|----------------------------|---|
| Date Of Report | 11/11/2017 11:38 |
| Date Of Accident | 10/11/2017 17:15 |
| Exact Location Of Accident | AFTER BEDOK NORTH FLYOVER TOWARDS BEDOK RESERVOIR |
| Country/State of Loss | SINGAPORE |

DETAILS OF OWN VEHICLE

| | |
|-----------------------------|----------------------------------|
| Vehicle Registration Number | SJJ5700J |
| Insured/Policyholder | |
| Name Of Registered Owner | JAREL ABDUL JALIL BIN ABDUL AZIZ |
| NRIC No | S7410335I |
| Email Address | JAREL777@SINGNET.COM.SG |
| Mobile Phone No | (LOCAL) +65-82282010 |
| Alternative Phone No | OTHERS-82282010 |

Vehicle Particulars

| | |
|--|---------------|
| Manufacturer | MERCEDES-BENZ |
| Model | C180 |
| Exact Purpose for which vehicle was being used at time of accident | PRIVATE USE |
| Are you claiming under your own insurance policy for repair to your vehicle? | NO |
| If No, Please state action to be taken | THIRD PARTY |
| Vehicle Category | PRIVATE CAR |

Insurance Company

| | |
|---------------------------|---|
| Name of Insurance Company | CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD. |
| Type Of Coverage | COMPREHENSIVE |
| Fleet Policy | NO |
| Policy Number | DMPCSN3030761700 |
| Cover Note Number | |

Driver

| | |
|----------------------|----------------------------------|
| Name of Driver | JAREL ABDUL JALIL BIN ABDUL AZIZ |
| NRIC No | S7410335I |
| Date Of Birth | 24/03/1974 |
| Occupation | OUTDOOR |
| Date Of Driving Pass | 19/03/1996 |
| Driving Experience | 21 YEARS AND 7 MONTHS |
| Gender | MALE |
| Mobile Number | +65-82282010 |
| Fax Number | |
| Contact Number | OTHERS-82282010 |
| EEmail Address | JAREL777@SINGNET.COM.SG |

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time: 11/11 1130

Driver's Signature
(if driver is not the policyholder)
Date & Time: 11/11 1130

Reporting Centre Person's Signature
Name: 11/11/2017
NRIC/FIN No.: 20821 11001912

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

| | |
|---------------|----------------|
| Owner ID Type | Singapore NRIC |
| Owner ID | 0335I |

Vehicle Details

| | |
|-------------------------------|--------------------|
| Vehicle No. | SJJ5700J |
| Vehicle to be Exported | No |
| Intended De-registration Date | 24 Nov 2017 |
| Vehicle Make | MERCEDES BENZ |
| Vehicle Model | C 180 KOMPRESSOR |
| Primary Colour | Silver |
| Manufacturing Year | 2012 |
| Engine No. | 27191031352733 |
| Chassis No. | WDD2040452A681031 |
| Maximum Power Output | 115.0 kW (154 bhp) |
| Open Market Value | \$32,540.00 |
| Original Registration Date | 12 Apr 2012 |
| First Registration Date | 12 Apr 2012 |
| Transfer Count | 0 |
| Actual ARF Paid | \$32,540.00 16270 |

Intended PARF Rebate Details

| | |
|------------------------------|-------------|
| PARF Eligibility | Yes |
| PARF Eligibility Expiry Date | 11 Apr 2022 |
| PARF Rebate Amount | \$22,778.00 |

Intended COE Rebate Details

| | |
|---------------------|--------------------------|
| COE Expiry Date | 11 Apr 2022 |
| COE Category | A - Car (1600cc & below) |
| COE Period(Years) | 10 |
| QP Paid | \$56,501.00 |
| COE Rebate Amount | \$24,762.00 |
| Total Rebate Amount | \$47,540.00 |

The information contained herein is correct as at 24 Nov 2017

OK


ANNOUNCING Dickson Automobile

as sgCarMart Premium Dealer for the fourth consecutive year


**DICKSON
AUTOMOBILE**

Username / Email Add

password

Submit Qu



Connect

Sign Up New Account


Forgot Password

Post an Advertisement
 Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

New E200 Avantgarde Facelift Stock Clearance. \$215k

 Year End Stock Clearance, Brand
 New Units Silver And Grey
 Available. High Specs
 Auto Midas StarAd

HIN LUNG AUTO
 Ho Bee Group
One Stop Car Hub
 Finance, Insurance, Workshop
 New and Used Cars
 30 years of car sale

Browse by Category

« Back (1 2) Next »

Sort by Date Posted

20 results/page

39 vehicles

mercedes benz c180

Advanced Search

Submit

| | Make | Model | Price | Depreciation | Reg Date | Eng Cap | Mileage | Veh Type | Status |
|-------------------------|--|------------------------|----------|--------------|-------------|----------|------------|----------|-------------------|
| Search Selection | mercedes benz c180 | | Any | Any | 2012 | Any | Any | Any | Available |
| | Mercedes-Benz C-Class C180 CGI Avantgarde | | \$83,800 | \$14,540 /yr | 16-Aug-2012 | 1,595 cc | 80,808 km | Luxury | Available |
| | Well Maintained, C&C Compact Executive Sedan That Gives You Day To Day Fuss-Free Reliability. A Show Of Distinct Attainment When Driving An Ever Popular Merc C-Class, Don't Miss This Opportunity To Ow... | | | | | | | | PREMIUM AD |
| | Cars 88 Pte Ltd | | | | | | | | |
| | Posted: 24-Nov-2017 Tags: 2012 Mercedes-Benz C180, 2012 Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Used Mercedes-Benz | | | | | | | | |
| | Mercedes-Benz C-Class C180 CGI Coupe | | \$83,000 | \$13,260 /yr | 01-Nov-2012 | 1,595 cc | 49,000 km | Sports | Available |
| | 1 Owner! C&C Unit! Full Service Records From Agent!. Own This Powerful And The Most Reliable Luxury Coupe In The Market For Your Daily Drive! Immaculate Condition! Very Reliable And Fuel Economy. Zero ... | | | | | | | | |
| | TS Wheeler Capital Pte Ltd | | | | | | | | |
| | Posted: 23-Nov-2017 Tags: 2012 Mercedes-Benz C180, 2012 Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Used Mercedes-Benz | | | | | | | | |
| | Mercedes-Benz C-Class C180 CGI Coupe | | \$87,800 | \$14,210 /yr | 24-Oct-2012 | 1,595 cc | 143,000 km | Sports | Available |
| | C&C Unit! Full Agent And Servicing Done Recently! 1 Time Free Servicing With C&C! Luxury Diamond White With Interior Red Flamingo Leather. 1 Owner Only. Accident Free. Low Depreciation. Value Buy! Wel... | | | | | | | | PREMIUM AD |
| | Euro Performance Asia Pte Ltd | | | | | | | | |
| | Posted: 23-Nov-2017 Tags: 2012 Mercedes-Benz C180, 2012 Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Mercedes-Benz C180, Used Mercedes-Benz | | | | | | | | |
| | Mercedes-Benz C-Class C180K | | \$83,500 | \$15,280 /yr | 16-May-2012 | 1,597 cc | 119,000 km | Luxury | Available |
| | Full Serviced By C&C. Well Maintained And Serviced Done Regularly. Lowest Depreciation In Market. 1 Owner Only, Accident Free. Comes With Exclusive Polishing And Cleaning Package. Excellent Condition... | | | | | | | | PREMIUM AD |
| | Euro Performance Asia Pte Ltd | | | | | | | | |
| | Posted: 23-Nov-2017 Tags: 2012 Mercedes-Benz C180K, 2012 Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Used Mercedes-Benz | | | | | | | | |
| Car Buying | Car Selling | Car Aftermarket | | | | | | | |
| Car Ownership | On The Move | Lifestyle | | | | | | | |
| | Buy Tyres Online! Latest Special Offers from Tyrepac! | | | | | | | | |
| | Mercedes-Benz C-Class C180K | | \$78,800 | \$14,910 /yr | 02-Mar-2012 | 1,597 cc | 80,000 km | Luxury | Available |
| | C&C Unit. Showroom Condition. Low Maintenance And Powerful And Fuel Efficient. Reverse Camera. Flexible Loan Available. Small Yet Equipped With A Boot Enough To Stow Again One Large Golf Bag And Still... | | | | | | | | |
| | Posted: 23-Nov-2017 Tags: 2012 Mercedes-Benz C180K, 2012 Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Used Mercedes-Benz | | | | | | | | |
| | Mercedes-Benz C-Class C180K Avantgarde | | \$81,800 | \$14,910 /yr | 14-May-2012 | 1,597 cc | 114,000 km | Luxury | Available |
| | New Compressor Engine That Gave You Enormous Power, More Quiet Smooth And Help Fuel Efficiency, Meticulously Taken Care By Owner. Car In Tip Top Condition. STA And Vicom Evaluation Welcome, Elegant Gr... | | | | | | | | PREMIUM AD |
| | Shuang Hup Credit | | | | | | | | |
| | Posted: 22-Nov-2017 Tags: 2012 Mercedes-Benz C180K, 2012 Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Mercedes-Benz C180K, Used Mercedes-Benz | | | | | | | | |
| | Mercedes-Benz C-Class C180K Avantgarde | | \$81,800 | \$14,900 /yr | 16-May-2012 | 1,597 cc | 91,200 km | Luxury | Available |
| | 1 Careful Owner. Excellent Condition In Town! Guarantee Accident Free. Cycle And Carriage Unit. 100% Quality Buy! Vehicle In Showroom Condition By Professional Groomer. Elegant Silver With Black Leath... | | | | | | | | |

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 23 Nov 2017)

Parts: 143 MERCEDES-BENZ C180 1.6 Kompressor (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Specialists Motor Pte Ltd/SJJ5700J/23/11/2017 09:19

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *

Estimates on Parts

| No. | Qty | Part No. | Particulars | %Disc | %Depr | Amount |
|-----|-----|----------|-----------------------------------|-------|-------|-------------------------|
| 1 | 1 | NA | *2K ADHESIVE L/SIDE | 0.00 | 0.00 | SVC *107.18 F X |
| 2 | 1 | NA | *CTR REAR BUMPER MLDG | 0.00 | 0.00 | Svc *100.00 F X |
| 3 | 1 | NA | *L/R BUMPER GUIDE | 0.00 | 0.00 | nm X*25.00 F X |
| 4 | 1 | NA | *L/R BUMPER MOULDING | 0.00 | 0.00 | nm *75.00 F X |
| 5 | 1 | NA | *L/R INN BUMPER BRKT | 0.00 | 0.00 | nm *40.00 F X |
| 6 | 1 | NA | *L/R INN PARKING SENS | 0.00 | 0.00 | nm *380.00 F X |
| 7 | 1 | NA | *L/R LAMP | 0.00 | 0.00 | crs *330.00 F X |
| 8 | 1 | NA | *L/R WHL-HOUSE COVER | 0.00 | 0.00 | nm X*120.00 F X |
| 9 | 1 | NA | *L/R WING | 0.00 | 0.00 | DD *1,080.00 F X |
| 10 | 1 | NA | *L/R WING INSULATION | 0.00 | 0.00 | nm *20.00 F X |
| 11 | 1 | NA | *L/ROOF CVR MOULDING | 0.00 | 0.00 | SVC *270.00 F X |
| 12 | 1 | NA | *LWR REAR SCREEN SUPP | 0.00 | 0.00 | nm *11.46 F X |
| 13 | 1 | NA | *LWR REAR SCREEN SUPP | 0.00 | 0.00 | nm *3.40 F X |
| 14 | 1 | NA | *R/R BUMPER MOULDING | 0.00 | 0.00 | SC *75.00 F X |
| 15 | 1 | NA | *REAR BUMPER C-MEMBER | 0.00 | 0.00 | nm *345.00 F X |
| 16 | 1 | NA | *REAR BUMPER COVER | 0.00 | 0.00 | deep cut *750.00 F X |
| 17 | 1 | NA | *REAR LAMP PANEL | 0.00 | 0.00 | nm *90.00 F X |
| 18 | 1 | NA | *REAR SCREEN <i>clw moulding.</i> | 0.00 | 0.00 | nm *650.00 F X |
| 19 | 1 | NA | *REAR SCREEN BOND KIT | 0.00 | 0.00 | nm X*51.75 F |
| 20 | 1 | NA | *REAR SCREEN FIX SET | 0.00 | 0.00 | nm X *-F |
| 21 | 1 | NA | *SPECIALIST AUDATEX FEE | 0.00 | 0.00 | *42.00 F |
| 22 | 1 | NA | *SPECIALIST CHECK LGHT AFT REP | 0.00 | 0.00 | *40.00 F X |
| 23 | 1 | NA | *SPECIALIST COMP WHEEL ALIGN | 0.00 | 0.00 | nm *120.00 F X |
| 24 | 1 | NA | *SPECIALIST R&R REAR GLASS | 0.00 | 0.00 | repeated nm *140.00 F X |
| 25 | 1 | NA | *SPECIALIST R&R REVERSE SENSOR | 0.00 | 0.00 | nm *120.00 F X |
| 26 | 1 | NA | *SPECIALIST R&R UPHOLS & ETC | 0.00 | 0.00 | repeated nm *280.00 F X |
| 27 | 1 | NA | *SPECIALIST TST CAR | 0.00 | 0.00 | nm *50.00 F X |
| 28 | 1 | NA | *SUNDRY PARTS | 0.00 | 0.00 | *100.00 F X |
| 29 | 1 | NA | *UPPER INTERMED LAYER | 0.00 | 0.00 | nm X*10.50 F |
| 30 | 1 | NA | *W/S TOP SEAL L&R | 0.00 | 0.00 | nm *60.00 F X |

F=Franchise part.

Sub Total (\$\$) 5,486.29
+ Margin on L,N Items 5.00% (\$\$) 274.31
Total Parts (\$\$) 5,760.60

Specialists Motor Pte Ltd/SJJ5700J/23/11/2017 09:19. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

| No | Particulars | Lab.Type | Amount |
|--------------------------|-------------------------------|----------|---------------|
| Labour Items | | | |
| 1 | Total Paint Labour | New | 483.00 ✓ |
| 2 | Total Paint Materials | New | 172.85 ✓ |
| 3 | Total Panel/Mechanical Labour | New | 910.80 |
| | | | 846.65 |
| Gross Labour Cost (\$\$) | | | 1,566.65 |

Specialists Motor Pte Ltd/SJJ5700J/23/11/2017 09:19. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Specialists Motor Pte Ltd
Blk 3018A Ubi Road 1
#01-24/26
Singapore 408711

Claim Reference:
Assessment Number: SM100194
Version: SPECIALM/1
Date Calculated: 22/11/2017 10:00

Full Report - V1
Registration: SJJ5700J
Printed: 22/11/2017 18:00

Summary Information

Claim

| | | | |
|-----------------------|--------------------------------|----------------------------|------------|
| Location: | Singapore (SG) | Currency: | SGD |
| Printed by: | Specialist Motor | Date of Incident: | 10/11/2017 |
| Authorisation Status: | Interim | Able to Authorise Repairs: | TBA |
| Work Provider: | China Taiping Insurance (S) Pt | Repairs Authorised: | TBA |
| Claim Reference: | | Estimated Repair Time: | |
| Policy Number: | DMPCSN3030761700 | Quote Due Date: | |
| Other Reference: | SM/SJJ5700J/1711288 | Actual Repair Days: | |
| Third Party: | | Parts Ordered Date: | |
| Insured Amount: | | Hire Car Start: | |
| Under Warranty: | | Hire Car End: | |
| Warranty Expired: | | Vehicle Collected: | |

Not Allowed
1/5
5 day
Whaphen Atterly
Excess nil

Vehicle Details

Vehicle

| | |
|---------------------|-------------------|
| Manufacturer: | MERCEDES |
| Model: | C Class |
| Sub Model: | C 180 KOMPR BE |
| Model Sheet Number: | 3AL 27 |
| Registration: | SJJ5700J |
| Registration Month: | April |
| Registration Year: | 2012 |
| VIN Number: | WDD2040452A681031 |
| Manufacture Year: | 2012 |
| Odometer: | Not Known |
| Colour: | |
| Engine Number: | |
| Fuel Level: | % |

Model Specs

| | |
|----------------------|----------------------|
| FROM A679/F847/R228. | MODIFICAT PACK 11/2 |
| MODEL 2012 | RAIN SENSOR |
| MEDIA INTERFACE | MIRROR PACKAGE |
| AUDIO 20 CD CHANGER | GRILLE WITH STAR |
| STORAGE PACKAGE | ALU DESIGN PARTS |
| TRIM AVANTGARDE | CUP HOLDER |
| STRG WHEEL LEATHER | H/DUTY ALTERNATOR |
| FUEL TANK 66L | ENGINE PROTECTION |
| AUTO GEARBOX 5 SPEED | PARAMETER STEERING |
| CRUISE CONTROL | WHEELS 7.5J X 17 ALU |
| SPARE WHEEL | ELEC PANORAMIC ROOF |
| PARKTRONIC | TWO COAT METALLIC |
| PREPARE OFF VEHICLE | CLEAR COAT HARD |
| TYRES 225/45 YR 17 | |

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering:

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Severity of Impact:
Vehicle Status on
Inspection:
Date of Inspection: 22/11/2017

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

LKK Auto Consultants hence notify the Repairer of the following:



- To resurvey before after spray painting
- To resurvey (or damaged parts) during resurvey
- Resurvey are subject to confirmation
- Party survey on a "Without Prejudice" basis
- No illegal modification is allowed
- Supplementary item must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Specialists Motor Pte Ltd

Claim Reference:
Assessment Number: SM100194
Version: SPECIALM/1
Date Calculated: 22/11/2017 10:00

Full Report - V1
Registration: SJJ5700J
Printed: 22/11/2017 18:00

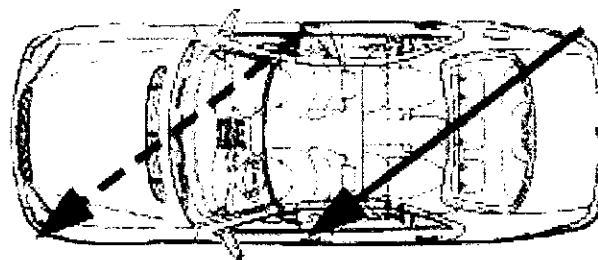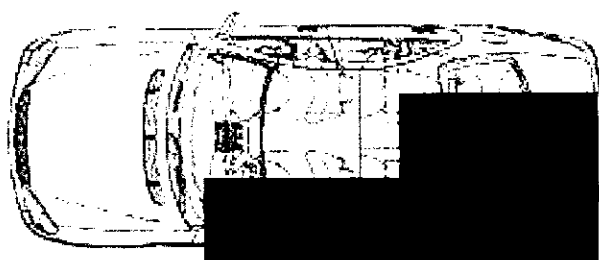

Primary Impact
Secondary Impact

Addresses

Cost Summary

| | |
|---------------------------|------------|
| Total Labour | \$1,393.80 |
| Total Paint/Material | \$172.85 |
| Total Parts | \$4,924.00 |
| Total of Additional Costs | \$792.00 |
| Repair Cost Exc GST: | \$7,282.65 |
| Overall Discount (0.0%): | - \$0.00 |
| Excess: | -\$500.00 |
| After Deduction - | |
| Grand Total Exc GST: | \$6,782.65 |
| 7 % GST: | \$474.79 |
| Grand Total Inc GST: | \$7,257.44 |

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /

| Guide Number | Repair Details | WU | Cost Price (\$) |
|--------------|--|--------------|-----------------|
| 60-2175 01 | R + R ATTACHED PARTS AT REAR COVER PANEL TO REPLACE L/R WING INCLUDES: REAR PANEL TRIMS, BOOT COMPART, INTERIOR IN REAR, ON ENTR- ANCE, REAR BUMPER, TAILLAMP, PARTITION PANEL UNDER WING, HEAD- LINING, SEAT BELT AND REAR PANEL- WINDOW REMOVE AND REFIT | 58.0 | 266.80 |
| 63-1882 01 | RENEW L/R WING | 107.0 | 492.20 |
| 88-8805 02 | DIS + ASS REAR BUMPER (REMOVED) | 2.0 | 9.20 |
| 88-8905 01 | ADD TO RENEW REAR BUMPER CPL (LUXURY VERSION VEHICLE) | 3.0 | 13.80 |
| 88-9626 ZAX | R + R L/R BUMPER MOULDING | 1.0 | 4.60 |
| 88-9626 ZAX | R + R REAR CENTRE BUMPER MOULDING | 1.0 | 4.60 |
| 88-9626 ZAX | R + R R/R BUMPER MOULDING | 1.0 | 4.60 |
| 88-8910 ZAX | ADDITION TO RENEW REAR BUMPER (VEHICLE WITH PARKTRONIC SYSTEM) | 3.0 | 13.80 |
| 88-8956 ZAX | R + R REAR LOWER BUMPER CROSSMEMBER (BUMPER REMOVED) | 9.0 | 41.40 |
| 97-2500 ZAX | CAVITY PROTECTION (ADD/WORK) | 2.0 | 9.20 |
| 97-2500 ZAX | L/R WING CAVITY PROTECTION | 2.0 | 9.20 |
| 60-1648 ZAX | R + R REAR MATS AND SEATS AND BRING THEM | 7.0 | 32.20 |

Specialists Motor Pte Ltd

Claim Reference:

Assessment Number: SM100194

Version: SPECIALM/1

Date Calculated: 22/11/2017 10:00

Full Report - V1

Registration: SJJ5700J

Printed: 22/11/2017 18:00

| | | | |
|--------------------|---|---------|------------|
| 54-7989 02 | TO STORAGE R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS) | 2.0 | 9.20 |
| LABOUR COST | | | |
| | Total Work Units | 198.0 | |
| | Corrosion Protection | | |
| | Corrosion Protection External Labour | 0.0HRS | 0.00 |
| | Corrosion Protection Internal Labour | 0.4HRS | 18.40 |
| | Sub Total | 19.8HRS | \$910.80 |
| | Paint Labour | 10.5HRS | \$483.00 |
| | Total Labour | 30.3HRS | \$1,393.80 |

| PAINT WORK | | Time Basis 10 WU = 1 HR. Price = \$46.00/HR | |
|------------------------------|---|---|-----------------|
| Guide Number | Description | WU | Cost Price (\$) |
| | - TWO COAT METALLIC | | |
| | - PREPARE OFF VEHICLE | | |
| 2583 | REAR BUMPER COVER REPAIR PAINT PLASTIC | 17.0 | |
| 2931 | BOOTLID/TAILGATE REPAIR PAINTING <50% | 19.0 | |
| 2711 | LWR REAR CENTRE PARTREPAIR PAINTING | 16.0 | |
| | >50% | | |
| 3481 | L/R WING REPAIR PAINTING >50% | 20.0 | |
| LABOUR COST - PAINT | | | |
| | TIME(PAINT) | 72.0 | |
| | Preparation Main Work Plastic | 8.0 | |
| | Preparation Main Work Metal | 25.0 | |
| | Preparation Work Multi Layer Paint | 0.0 | |
| | Total Work Units (10WU/HR) | 105.0 | |
| | Total Paintwork Labour | 10.5HRS | \$483.00 |
| MATERIAL COST - PAINT | | | |
| | Repair Painting | | \$76.47 |
| | Repair Painting Plastic | | \$55.08 |
| | Material-Const Main Work Plastic | | \$12.70 |
| | Total Excluding Pearlescent Uplift | | \$172.85 |
| | Pearlescent Uplift @ 0.0% | | \$0.00 |
| | Total Paint Material Cost | | \$172.85 |

PARTS

| Guide No. | Qty | Description | Part Number | Supplier | Bet. | Price (\$) |
|-----------|-----|----------------------|-------------------|----------|------|------------|
| 2107 | 1 | 2K ADHESIVE L/SIDE | 009 989 3671 12 | | 0% | 107.18 |
| 2427 | 1 | L/ROOF CVR MOULDING | 204 690 7182 9040 | | 0% | 270.00 |
| 2583 | 1 | REAR BUMPER COVER | 204 880 | | 0% | 750.00* |
| | | | 7540649999 | | | |
| 2593 | 1 | L/R BUMPER GUIDE | 204 880 0730 | | 0% | 25.00* |
| 2615 | 1 | CTR REAR BUMPER MLDG | 204 885 3121 | | 0% | 100.00* |
| 2617 | 1 | L/R BUMPER MOULDING | 204 885 2921 | | 0% | 75.00* |
| 2618 | 1 | R/R BUMPER MOULDING | 204 885 3021 | | 0% | 75.00* |
| 2629 | 1 | L/R INN BUMPER BRKT | 204 885 3614 | | 0% | 40.00* |
| 2640 | 1 | REAR BUMPER C-MEMBER | 204 610 0014 | | 0% | 345.00* |
| 2669 | 1 | L/R INN PARKING SENS | 212 542 0018 | | 0% | 380.00* |
| 3151 | 1 | REAR SCREEN | 204 670 1700 | | 0% | 650.00* |
| 3155 | 3 | LWR REAR SCREEN SUPP | 220 671 0297 | | 0% | 11.46U |

Price Valid: 01/06/2015

**CHINA TAIPING
INSURANCE (S) PTE LTD
3 ANSON ROAD
#15-02 SPRINGLEAF
TOWER
079909**

Claim Reference: SNM17D06527C01
Assessment Number: SM100194
Version: CHINATAI/2
Date Calculated: 27/11/2017 06:56

Full Report - V1
Registration: SJJ5700J
Printed: 27/11/2017 14:56

Summary Information

Claim

| | | | |
|-----------------------|--------------------------------|----------------------------|------------|
| Location: | Singapore (SG) | Currency: | SGD |
| Printed by: | Mr K.K Lau | Date of Incident: | 10/11/2017 |
| Authorisation Status: | Interim | Able to Authorise Repairs: | TBA |
| Work Provider: | China Taiping Insurance (S) Pt | Repairs Authorised: | TBA |
| Claim Reference: | SNM17D06527C01 | Estimated Repair Time: | |
| Policy Number: | DMPCSN3030761700 | Quote Due Date: | |
| Other Reference: | SM/SJJ5700J/1711288 | Actual Repair Days: | |
| Third Party: | | Parts Ordered Date: | |
| Insured Amount: | | Hire Car Start: | |
| Under Warranty: | | Hire Car End: | |
| Warranty Expired: | | Vehicle Collected: | |

Vehicle Details

Vehicle

| | |
|---------------------|-------------------|
| Manufacturer: | MERCEDES |
| Model: | C Class |
| Sub Model: | C 180 KOMPR BE |
| Model Sheet Number: | 3AL 27 |
| Registration: | SJJ5700J |
| Registration Month: | April |
| Registration Year: | 2012 |
| VIN Number: | WDD2040452A681031 |
| Manufacture Year: | 2012 |
| Odometer: | Not Known |
| Colour: | |
| Engine Number: | |
| Fuel Level: | % |



Model Specs

| | |
|----------------------|----------------------|
| FROM A679/F847/R228. | MODIFICAT PACK 11/2 |
| MODEL 2012 | RAIN SENSOR |
| MEDIA INTERFACE | MIRROR PACKAGE |
| AUDIO 20 CD CHANGER | GRILLE WITH STAR |
| STORAGE PACKAGE | ALU DESIGN PARTS |
| TRIM AVANTGARDE | CUP HOLDER |
| STRG WHEEL LEATHER | H/DUTY ALTERNATOR |
| FUEL TANK 66L | ENGINE PROTECTION |
| AUTO GEARBOX 5 SPEED | PARAMETER STEERING |
| CRUISE CONTROL | WHEELS 7.5J X 17 ALU |
| SPARE WHEEL | ELEC PANORAMIC ROOF |
| PARKTRONIC | TWO COAT METALLIC |
| PREPARE OFF VEHICLE | CLEAR COAT HARD |
| TYRES 225/45 YR 17 | |

Vehicle Condition

Vehicle Status

| | | |
|-------------------------|-------------------------------|------------|
| Pre-Accident Condition: | Severity of Impact: | |
| Steering: | Vehicle Status on Inspection: | |
| Brakes Pedal Travel: | Date of Inspection: | 22/11/2017 |
| Place of Inspection: | | |
| Pre-Accident Damage: | | |
| Tyres Condition: | | |
| Tread Depth LHF: | Tread Depth RHF: | |
| Tread Depth LHR: | Tread Depth RHR: | |
| Damage Areas: | Direction of Impact: | |

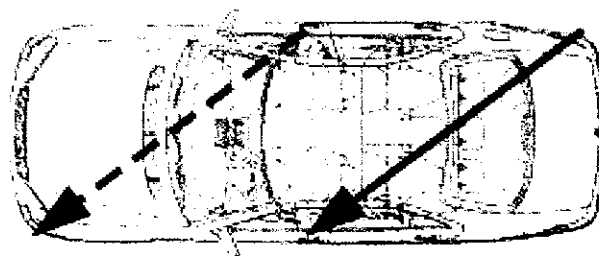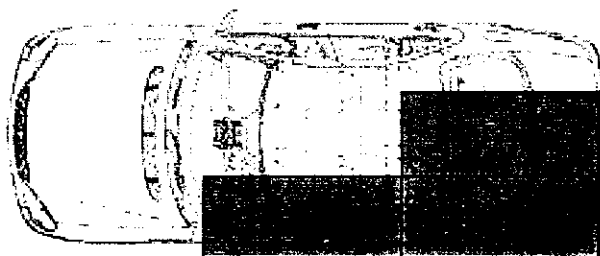CHINA TAIPING INSURANCE (S) PTE LTD**Claim Reference: SNM17D06527C01****Assessment Number: SM100194****Version: CHINATAI/2****Date Calculated: 27/11/2017 06:56****Full Report - V1****Registration: SJJ5700J****Printed: 27/11/2017 14:56**

Primary Impact
Secondary Impact

Addresses**Cost Summary**

| | |
|---------------------------|------------|
| Total Labour | \$1,352.40 |
| Total Paint/Material | \$172.85 |
| Total Parts | \$3,921.25 |
| Total of Additional Costs | \$202.00 |
| Excess: | - \$0.00 |
| Grand Total Exc GST: | \$5,648.50 |
| 7 % GST: | \$395.40 |
| Grand Total Inc GST: | \$6,043.90 |

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

| | | WU | Cost Price (\$) |
|-------------|--|--------------|------------------------|
| 60-2175 01 | R + R ATTACHED PARTS AT REAR COVER PANEL TO REPLACE L/R WING INCLUDES: REAR PANEL TRIMS, BOOT COMPART, INTERIOR IN REAR, ON ENTR- ANCE, REAR BUMPER, TAILLAMP, PARTITION PANEL UNDER WING, HEAD- LINING, SEAT BELT AND REAR PANEL- WINDOW REMOVE AND REFIT | 58.0 | 266.80 |
| 63-1882 01 | RENEW L/R WING | 107.0 | 492.20 |
| 88-8805 02 | DIS + ASS REAR BUMPER (REMOVED) | 2.0 | 9.20 |
| 88-8905 01 | ADD TO RENEW REAR BUMPER CPL (LUXURY VERSION VEHICLE) | 3.0 | 13.80 |
| 88-9626 ZAX | R + R L/R BUMPER MOULDING | 1.0 | 4.60 |
| 88-9626 ZAX | R + R REAR CENTRE BUMPER MOULDING | 1.0 | 4.60 |
| 88-9626 ZAX | R + R R/R BUMPER MOULDING | 1.0 | 4.60 |
| 88-8910 ZAX | ADDITION TO RENEW REAR BUMPER (VEHICLE WITH PARKTRONIC SYSTEM) | 3.0 | 13.80 |
| 97-2500 ZAX | CAVITY PROTECTION (ADD/WORK) | 2.0 | 9.20 |
| 97-2500 ZAX | L/R WING CAVITY PROTECTION | 2.0 | 9.20 |
| 60-1648 ZAX | R + R REAR MATS AND SEATS AND BRING THEM TO STORAGE | 7.0 | 32.20 |
| 54-7989 02 | R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS) | 2.0 | 9.20 |

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D06527C01

Assessment Number: SM100194

Version: CHINATAI/2

Date Calculated: 27/11/2017 06:56

Full Report - V1

Registration: SJJ5700J

Printed: 27/11/2017 14:56

LABOUR COST

| | | |
|--------------------------------------|---------|------------|
| Total Work Units | 189.0 | |
| Corrosion Protection | | |
| Corrosion Protection External Labour | 0.0HRS | 0.00 |
| Corrosion Protection Internal Labour | 0.4HRS | 18.40 |
| Sub Total | 18.9HRS | \$869.40 |
| Paint Labour | 10.5HRS | \$483.00 |
| Total Labour | 29.4HRS | \$1,352.40 |

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number Description WU Cost Price (\$)

- TWO COAT METALLIC
- PREPARE OFF VEHICLE

| | | |
|------|--|------|
| 2583 | REAR BUMPER COVER REPAIR PAINT PLASTIC | 17.0 |
| 2931 | BOOTLID/TAILGATE REPAIR PAINTING <50% | 19.0 |
| 2711 | LWR REAR CENTRE PARTREPAIR PAINTING >50% | 16.0 |
| 3481 | L/R WING REPAIR PAINTING >50% | 20.0 |

LABOUR COST - PAINT

| | | |
|------------------------------------|---------|----------|
| TIME(PAINT) | 72.0 | |
| Preparation Main Work Plastic | 8.0 | |
| Preparation Main Work Metal | 25.0 | |
| Preparation Work Multi Layer Paint | 0.0 | |
| Total Work Units (10WU/HR) | 105.0 | |
| Total Paintwork Labour | 10.5HRS | \$483.00 |

MATERIAL COST - PAINT

| | |
|------------------------------------|----------|
| Repair Painting | \$76.47 |
| Repair Painting Plastic | \$55.08 |
| Material-Const Main Work Plastic | \$12.70 |
| Total Excluding Pearlescent Uplift | \$172.85 |
| Pearlescent Uplift @ 0.0% | \$0.00 |
| Total Paint Material Cost | \$172.85 |

PARTS

Price Valid: 01/06/2015

| Guide No. | Qty | Description | Part Number | Supplier | Bet. | Price (\$) |
|-----------|-----|----------------------|-------------------|----------|------|------------|
| 2107 | 1 | 2K ADHESIVE L/SIDE | 009 989 3671 12 | | 0% | 107.18 |
| 2615 | 1 | CTR REAR BUMPER MLDG | 204 885 3121 | | 0% | 100.00* |
| 2593 | 1 | L/R BUMPER GUIDE | 204 880 0730 | | 0% | 25.00* |
| 2617 | 1 | L/R BUMPER MOULDING | 204 885 2921 | | 0% | 75.00* |
| 2629 | 1 | L/R INN BUMPER BRKT | 204 885 3614 | | 0% | 40.00* |
| 3281 | 1 | L/R LAMP | 204 906 0203 | | 0% | 330.00* |
| 3481 | 1 | L/R WING | 204 630 0921 | | 0% | 1,080.00* |
| 2427 | 1 | L/ROOF CVR MOULDING | 204 690 7182 9040 | | 0% | 270.00* |
| 3155 | 3 | LWR REAR SCREEN SUPP | 220 671 0297 | | 0% | 11.46U |
| 3170 | 2 | LWR REAR SCREEN SUPP | 221 678 0179 | | 0% | 3.40U |
| 2618 | 1 | R/R BUMPER MOULDING | 204 885 3021 | | 0% | 75.00* |
| 2583 | 1 | REAR BUMPER COVER | 204 880 | | 0% | 750.00* |
| | | | 7540649999 | | | |
| 3151 | 1 | REAR SCREEN | 204 670 1700 | | 0% | 650.00* |
| 3160 | 1 | REAR SCREEN BOND KIT | 000 670 0100 | | 0% | 51.75U |
| 3163 | 1 | REAR SCREEN FIX SET | USE SINGLE PARTS | | 0% | 0.00 |
| 3169 | 2 | UPPER INTERMED LAYER | 204 671 0050 | | 0% | 10.50U |

CHINA TAIPING INSURANCE (S) PTE LTD**Claim Reference: SNM17D06527C01****Assessment Number: SM100194****Version: CHINATAI/2****Date Calculated: 27/11/2017 06:56****Full Report - V1****Registration: SJJ5700J****Printed: 27/11/2017 14:56**

| | | | | | |
|---------------|---|------------------|-------------------------|----|-------------------|
| 1000 | 1 | W/S TOP SEAL L&R | Renew | 0% | 60.00* |
| f: OEM Parts | | | Sub Total | | \$3,639.29 |
| g: Original | | | Mark Up From Cost (5 %) | | \$181.96 |
| h: Secondhand | | | Sundry Parts (Fixed) | | \$100.00 |
| p: Parallel | | | Total Parts | | \$3,921.25 |
| x: Exchange | | | | | |

THIS ASSESSMENT CONTAINS UNPRICED PARTS**NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER****Extras**

| Description | Betterment | Price |
|------------------------------|-------------------|-----------------|
| AUDATEX FEE SPECIALIST | 0% | \$42.00 |
| CHECK LGHT AFT REPSPECIALIST | | \$40.00 |
| R&R REVERSE SPECIALIST | 0% | \$120.00 |
| SENSOR | | |
| Total Extras | | \$202.00 |

Final Calculation

| | |
|-----------------------------------|-------------------|
| Total Parts | \$3,921.25 |
| Labour | |
| Total Panel/Mechanical | \$851.00 |
| Total Paintwork | \$483.00 |
| Corr Prot Internal 4 WU | \$18.40 |
| Total Labour | \$1,352.40 |
| Additional Costs | |
| Corr Prot Materials External | \$0.00 |
| Cost of Specialist | \$202.00 |
| Total of Additional Costs | \$202.00 |
| Total Paint/Material Costs | \$172.85 |
| Grand Total Excludes GST | \$5,648.50 |
| GST @ 7 % | \$395.40 |
| Grand Total Includes GST | \$6,043.90 |

Assessment Notes

Specialists Motor Pte Ltd

Claim Reference:

Assessment Number: SM100194

Version: SPECIALM/1

Date Calculated: 22/11/2017 10:00

Full Report - V1

Registration: SJJ5700J

Printed: 22/11/2017 18:00

| | | | | | | | |
|---------------|---|----------------------|------------------|-------------------------|----|-----------|---|
| 3160 | 1 | REAR SCREEN BOND KIT | 000 670 0100 | 0% | 11 | 51.75U | X |
| 3163 | 1 | REAR SCREEN FIX SET | USE SINGLE PARTS | 0% | 11 | 0.00 | X |
| 3169 | 2 | UPPER INTERMED LAYER | 204 671 0050 | 0% | 11 | 10.50U | X |
| 3170 | 2 | LWR REAR SCREEN SUPP | 221 678 0179 | 0% | 11 | 3.40U | X |
| 3281 | 1 | L/R LAMP | ✓ 204 906 0203 | 0% | 11 | 330.00* | X |
| 3481 | 1 | L/R WING | ✓ 204 630 0921 | 0% | 11 | 1,080.00* | X |
| 3525 | 1 | L/R WING INSULATION | 204 682 1230 | 0% | 11 | 20.00* | X |
| 3677 | 1 | L/R WHL-HOUSE COVER | 204 690 6130 | 0% | 11 | 120.00* | X |
| 1000 | 1 | W/S TOP SEAL L&R | Renew | 0% | 11 | 60.00* | X |
| 1000 | 1 | REAR LAMP PANEL | Renew | 0% | 11 | 90.00* | X |
| f: OEM Parts | | | | Sub Total | | | |
| g: Original | | | | Mark Up From Cost (5 %) | | | |
| h: Secondhand | | | | Sundry Parts (Fixed) | | | |
| p: Parallel | | | | Total Parts | | | |
| x: Exchange | | | | | | | |
| | | | | \$4,594.29 | | | |
| | | | | \$229.71 | | | |
| | | | | \$100.00 | | | |
| | | | | \$4,924.00 | | | |

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

| Description | Betterment | Price |
|------------------------------|------------|----------|
| AUDATEX FEE SPECIALIST | 0% | \$42.00 |
| CHECK LGHT AFT REPSPECIALIST | | \$40.00 |
| COMP WHEEL ALIGN SPECIALIST | 0% | \$120.00 |
| R&R UPHOLS & ETC SPECIALIST | | \$280.00 |
| R&R REVERSE SPECIALIST | 0% | \$120.00 |
| SENSOR | | |
| R&R REAR GLASS SPECIALIST | | \$140.00 |
| TST CAR SPECIALIST | 0% | \$50.00 |
| Total Extras | | \$792.00 |

Final Calculation

| | |
|--|------------|
| Total Parts | \$4,924.00 |
| Labour | |
| Total Panel/Mechanical | \$892.40 |
| Total Paintwork | \$483.00 |
| Corr Prot Internal 4 WU | \$18.40 |
| Total Labour | \$1,393.80 |
| Additional Costs | |
| Corr Prot Materials External | \$0.00 |
| Cost of Specialist | \$792.00 |
| Total of Additional Costs | \$792.00 |
| Total Paint/Material Costs | \$172.85 |
| Repair Costs Excludes GST | \$7,282.65 |
| Deductions | |
| Deduction for Excess (Fixed) | -\$500.00 |
| Total Deductions | -\$500.00 |
| Grand Total Excludes GST (After Deduction) | \$6,782.65 |
| GST @ 7 % | \$474.79 |
| Grand Total Includes GST (After Deduction) | \$7,257.44 |

Assessment Notes

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Thursday, 30 November, 2017 10:11 AM
To: 'cardoc@singnet.com.sg'
Cc: SUR
Subject: SJJ 5700J OD CHINA TAIPIN

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SJJ 5700J (Excess WAVIED)**

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

SJJ5700J (SNM17D06527C01)

OD

Nov 10 2017 5:00PM

[JAREL ABDUL JALIL BIN ABDUL AZIZ]
Specialists Motor Pte Ltd

Reply

Reply All

Mark as Unread

Print Message

Delete Message

Forward

From

China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on 29/11/2017 11:45 AM.

To

LKK_HQ

Subject

Alert - Adj Mandate Approved (S\$4500.00) - SJJ5700J - Claim Handler: Chong Boon Sen

Approved: 4500.00: PLEASE PROCEED TO AUTHORIZE REPAIRS AT \$4,500.00. EXCESS WAIVED.

DOCUMENTS SUMMARY

There are no documents.

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore

408933

Claim Reference: SNM17D06527C01
Assessment Number: SM100194
Version: LKKAUTOC/4
Date Calculated: 18/01/2018 08:55

Full Report - V1
Registration: SJJ5700J
Printed: 18/01/2018 16:58

Summary Information

Claim

| | | | |
|-----------------------|--------------------------------|----------------------------|------------|
| Location: | Singapore (SG) | Currency: | SGD |
| Printed by: | MR LAU | Date of Incident: | 10/11/2017 |
| Authorisation Status: | Interim | Able to Authorise Repairs: | TBA |
| Work Provider: | China Taiping Insurance (S) Pt | Repairs Authorised: | TBA |
| Claim Reference: | SNM17D06527C01 | Estimated Repair Time: | |
| Policy Number: | DMPCSN3030761700 | Quote Due Date: | |
| Other Reference: | SM/SJJ5700J/1711288 | Actual Repair Days: | |
| Third Party: | | Parts Ordered Date: | |
| Insured Amount: | | Hire Car Start: | |
| Under Warranty: | | Hire Car End: | |
| Warranty Expired: | | Vehicle Collected: | |

Vehicle Details

Vehicle

| | |
|---------------------|-------------------|
| Manufacturer: | MERCEDES |
| Model: | C Class |
| Sub Model: | C 180 KOMPR BE |
| Model Sheet Number: | 3AL 27 |
| Registration: | SJJ5700J |
| Registration Month: | April |
| Registration Year: | 2012 |
| VIN Number: | WDD2040452A681031 |
| Manufacture Year: | 2012 |
| Odometer: | Not Known |
| Colour: | |
| Engine Number: | |
| Fuel Level: | % |

Model Specs

| | |
|----------------------|----------------------|
| FROM A679/F847/R228. | MODIFICAT PACK 11/2 |
| MODEL 2012 | RAIN SENSOR |
| MEDIA INTERFACE | MIRROR PACKAGE |
| AUDIO 20 CD CHANGER | GRILLE WITH STAR |
| STORAGE PACKAGE | ALU DESIGN PARTS |
| TRIM AVANTGARDE | CUP HOLDER |
| STRG WHEEL LEATHER | H/DUTY ALTERNATOR |
| FUEL TANK 66L | ENGINE PROTECTION |
| AUTO GEARBOX 5 SPEED | PARAMETER STEERING |
| CRUISE CONTROL | WHEELS 7.5J X 17 ALU |
| SPARE WHEEL | ELEC PANORAMIC ROOF |
| PARKTRONIC | TWO COAT METALLIC |
| PREPARE OFF VEHICLE | CLEAR COAT HARD |
| TYRES 225/45 YR 17 | |

Vehicle Condition

Vehicle Status

| | |
|-------------------------|-------------------------------|
| Pre-Accident Condition: | Severity of Impact: |
| Steering: | Vehicle Status on Inspection: |
| Brakes Pedal Travel: | Date of Inspection: |
| Place of Inspection: | 22/11/2017 |
| Pre-Accident Damage: | |
| Tyres Condition: | |
| Tread Depth LHF: | Tread Depth RHF: |
| Tread Depth LHR: | Tread Depth RHR: |
| Damage Areas: | Direction of Impact: |

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM17D06527C01

Full Report - V1


Assessment Number: SM100194

Registration: SJJ5700J

Version: LKKAUTOC/4

Printed: 18/01/2018 16:58

Date Calculated: 18/01/2018 08:55

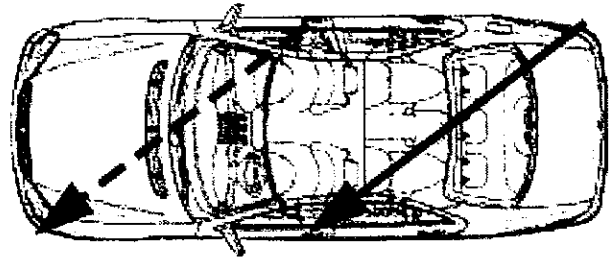

Primary Impact
Secondary Impact

Addresses

Cost Summary

| | |
|---------------------------|------------|
| Total Labour | \$1,324.80 |
| Total Paint/Material | \$172.85 |
| Total Parts | \$3,129.25 |
| Total of Additional Costs | \$82.00 |
| Excess: | - \$0.00 |
| Grand Total Exc GST: | \$4,708.90 |
| 7 % GST: | \$329.62 |
| Grand Total Inc GST: | \$5,038.52 |

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /

| Guide Number | Repair Details | WU | Cost Price (\$) |
|--------------------------------------|---|---------|-----------------|
| 60-2175 01 | R + R ATTACHED PARTS AT REAR COVER PANEL TO REPLACE L/R WING INCLUDES: REAR PANEL TRIMS, BOOT COMPART, INTERIOR IN REAR, ON ENTRANCE, REAR BUMPER, TAILLAMP, PARTITION PANEL UNDER WING, HEADLINING, SEAT BELT AND REAR PANEL-WINDOW REMOVE AND REFIT | 58.0 | 266.80 |
| 63-1882 01 | RENEW L/R WING | 107.0 | 492.20 |
| 88-8805 02 | DIS + ASS REAR BUMPER (REMOVED) | 2.0 | 9.20 |
| 88-8905 01 | ADD TO RENEW REAR BUMPER CPL (LUXURY VERSION VEHICLE) | 3.0 | 13.80 |
| 88-9626 ZAX | R + R L/R BUMPER MOULDING | 1.0 | 4.60 |
| 88-8910 ZAX | ADDITION TO RENEW REAR BUMPER (VEHICLE WITH PARKTRONIC SYSTEM) | 3.0 | 13.80 |
| 60-1648 ZAX | R + R REAR MATS AND SEATS AND BRING THEM TO STORAGE | 7.0 | 32.20 |
| 54-7989 02 | R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS) | 2.0 | 9.20 |
| LABOUR COST | | | |
| Total Work Units | | 183.0 | |
| Corrosion Protection External Labour | | 0.0HRS | 0.00 |
| Corrosion Protection Internal Labour | | 0.0HRS | 0.00 |
| Sub Total | | 18.3HRS | \$841.80 |
| Paint Labour | | 10.5HRS | \$483.00 |

Total Labour **28.8HRS** **\$1,324.80**

| PAINT WORK | | Time Basis 10 WU = 1 HR. Price = \$46.00/HR | |
|---|--|--|------------------------|
| Guide Number | Description | WU | Cost Price (\$) |
| | - TWO COAT METALLIC | | |
| | - PREPARE OFF VEHICLE | | |
| 2583 | REAR BUMPER COVER REPAIR PAINT PLASTIC | 17.0 | |
| 2931 | BOOTLID/TAILGATE REPAIR PAINTING <50% | 19.0 | |
| 2711 | LWR REAR CENTRE PARTREPAIR PAINTING | 16.0 | |
| | >50% | | |
| 3481 | L/R WING REPAIR PAINTING >50% | 20.0 | |
| LABOUR COST - PAINT | | | |
| TIME(PAINT) | | 72.0 | |
| Preparation Main Work Plastic | | 8.0 | |
| Preparation Main Work Metal | | 25.0 | |
| Preparation Work Multi Layer Paint | | 0.0 | |
| Total Work Units (10WU/HR) | | 105.0 | |
| Total Paintwork Labour | | 10.5HRS | \$483.00 |
| MATERIAL COST - PAINT | | | Cost Price |
| Repair Painting | | | \$76.47 |
| Repair Painting Plastic | | | \$55.08 |
| Material-Const Main Work Plastic | | | \$12.70 |
| Total Excluding Pearlescent Uplift | | | \$172.85 |
| Pearlescent Uplift @ 0.0% | | | \$0.00 |
| Total Paint Material Cost | | | \$172.85 |

PARTS

Price Valid: 01/06/2015

| Guide No. | Qty | Description | Part Number | Supplier | Bet. | Price (\$) |
|------------------|------------|----------------------|--------------------|-----------------|-------------|-------------------|
| 2107 | 1 | 2K ADHESIVE L/SIDE | 009 989 3671 12 | | 0% | 0.00F |
| 2617 | 1 | L/R BUMPER MOULDING | 204 885 2921 | | 0% | 75.00* |
| 3281 | 1 | L/R LAMP | 204 906 0203 | | 0% | 330.00* |
| 3481 | 1 | L/R WING | 204 630 0921 | | 0% | 1,080.00* |
| 2427 | 1 | L/ROOF CVR MOULDING | 204 690 7182 9040 | | 0% | 0.00F |
| 3170 | 2 | LWR REAR SCREEN SUPP | 221 678 0179 | | 0% | 0.00G |
| 3155 | 3 | LWR REAR SCREEN SUPP | 220 671 0297 | | 0% | 0.00F |
| 2583 | 1 | REAR BUMPER COVER | 204 880 | | 0% | 750.00* |
| | | | 7540649999 | | | |
| 3151 | 1 | REAR SCREEN | 204 670 1700 | | 0% | 650.00* |
| 3160 | 1 | REAR SCREEN BOND KIT | 000 670 0100 | | 0% | 0.00F |
| 3163 | 1 | REAR SCREEN FIX SET | USE SINGLE PARTS | | 0% | 0.00F |
| 3169 | 2 | UPPER INTERMED LAYER | 204 671 0050 | | 0% | 0.00F |
| f: OEM Parts | | | Saving | | | \$371.82 |
| g: Original | | | Sub Total | | | \$2,885.00 |
| h: Secondhand | | | Mark Up From Cost | (5 %) | | \$144.25 |
| p: Parallel | | | Sundry Parts | (Fixed) | | \$100.00 |
| x: Exchange | | | Total Parts | | | \$3,129.25 |

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

| Description | Betterment | Price |
|--------------------|-------------------|--------------|
| AUDATEX FEE | SPECIALIST 0% | \$42.00 |


| | | |
|-----------------------------------|----------|-------------------|
| CHECK LGHT AFT REPSPECIALIST | | \$40.00 |
| Total Extras | | \$82.00 |
| Final Calculation | | |
| Total Parts | | \$3,129.25 |
| Labour | | |
| Total Panel/Mechanical | \$841.80 | |
| Total Paintwork | \$483.00 | |
| Total Labour | | \$1,324.80 |
| Additional Costs | | |
| Corr Prot Materials External | \$0.00 | |
| Corr Prot Materials Internal | \$0.00 | |
| Cost of Specialist | \$82.00 | |
| Total of Additional Costs | | \$82.00 |
| Total Paint/Material Costs | | \$172.85 |
| Grand Total Excludes GST | | \$4,708.90 |
| GST @ 7 % | | \$329.62 |
| Grand Total Includes GST | | \$5,038.52 |

Assessment Notes



PAS AUTO PTE LTD

BLK 32 SIN MING DRIVE #01-325 S(575706)
TEL NO : 64523938 (6 LINES) FAX NO : 64527936
A/C DEPT : 64590882
Business Reg & GST NO : 201512120M

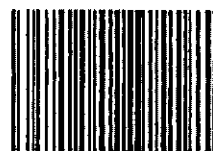

D151780

TAX INVOICE

SPECIALISTS MOTOR PTE LTD

BLK 3018A UBI ROAD 1

#01-24/26

SINGAPORE 408711

REMARK : SJJ5700J WEI SHUN

WDD2040452A681031

DELIVER TO :

DELIVER ON 11/12/17

INV NO : I151780

DATE : 12/12/2017

A/C NO : 306924

TERM : 30

PAGE : 1 OF 1

ISSUE : HJS

Printed on 12/12/2017 09:23:47

| ITEM | PART NO | DESCRIPTION | LOCATION | QTY | UNIT | PRICE | TOTAL AMT. |
|------|----------------|-------------------------------|----------|-----|------|---------|------------|
| 1 | 204 906 0203MB | TAILLAMP LH 204 820 1864 (40) | 2W2A06 | 1 | PCS | 330.00 | 330.00 |
| 2 | 204 630 0921MB | RR FENDER LH(100) | 3W2J00 | 1 | PCS | 1,080.0 | 1,080.00 |
| 3 | 204 670 1700MB | RR SCREEN | 2W3A03 | 1 | PCS | 650.00 | 650.00 |

RECEIVED BY

PICKED BY: 8839

SUB-TOTAL : S\$ 2,060.00

ADD 7% GST : S\$ 144.20

TOTAL : S\$ 2,204.20

Goods sold are not returnable except Repairs/Service at authorized workshop.



PAS AUTO PTE LTD

BLK 32 SIN MING DRIVE #01-325 S(575706)
TEL NO : 64523938 (6 LINES) FAX NO : 64527936
A/C DEPT : 64590882
Business Reg & GST NO : 201512120M



D152209

TAX INVOICE

SPECIALISTS MOTOR PTE LTD

BLK 3018A UBI ROAD 1

#01-24/26

SINGAPORE 40871

REMARK : SJJ5700J WEI SHUN
WDD2040452A681031

DELIVER TO :

DELIVER ON 11/12/17

INV NO : I152209

DATE : 12/12/2017

A/C NO : 306924

TERM : 30

PAGE : 1 OF 1

ISSUE : HJS

Printed on 12/12/2017 15:49:27

| ITEM | PART NO | DESCRIPTION | LOCATION | QTY | UNIT | PRICE | TOTAL AMT. |
|------|-------------------|-----------------------|----------|-----|------|--------|------------|
| 1 | 204 880 8340 9999 | TRIM BUMPER 9999 | 2W3A03 | 1 | PCS | 750.00 | 750.00 |
| 2 | 204 885 2921MB | RR BUMPER MOULDING LH | SS2Q12 | 1 | PCS | 75.00 | 75.00 |

RECEIVED BY

PICKED BY: 8839

SUB-TOTAL : S\$ 825.00

ADD 7% GST : S\$ 57.75

TOTAL : S\$ 882.75

Goods sold are not returnable except Repairs/Service at authorized workshop.

...CLAIM SUBFOLDER...(Pending for Survey Report)

| CLAIM SUBFOLDER TRACKING | | | | | | | |
|--------------------------|-----------------------------|--|--------------------------------------|--------------------------------------|--------------------------------|------------|---|
| Case | Notified | Est Submitted | Adj Assigned | Adj Rpt | Adj Submitted | Ins Auth'd | Status |
| Main | 22 Nov 2017 Sendback Est | 23 Nov 2017 09:19 S\$7,327.25 | 24 Nov 2017 11:35 Edit Adj Rpt | S\$4,708.90 Edit Estimates | S\$4,708.90 View Rpt | | Pending for Survey Report Cancel Case |

| | | | | |
|-------------|------------------|----------------------|------------------|-----------------|
| Main | Reference | Claim Details | Documents | Show All |
|-------------|------------------|----------------------|------------------|-----------------|

CLAIM SUBFOLDER DETAILS

| | | | |
|-------------------|---|------------------------|--|
| Insured: | JAREL ABDUL JALIL BIN ABDUL AZIZ , ID: S7410335I, Tel: +6582282010, Email: jarel777@singnet.com.sg | | |
| Vehicle Reg. No.: | SJJ5700J | Date of Loss: | 10/11/2017 17:00 - :59 |
| Claim Type: | OD / SNM17D06527C01 | Policy/Cover Note No.: | DMPCSN3030761700 (Comprehensive) Coverage: 11/07/2017 - 11/04/2018 |
| | | Excess: | S\$0.00 |
| Repairer: | Specialists Motor Pte Ltd (HQ) Blk 3018A Ubi Road 1, #01-24/25/26, 408711 Ubi - Tel: 6747 2112 | | |
| Handling Insurer: | China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen] | | |
| Adjuster: | LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 05/12/2017] | | |
| Driver/Custodian: | JAREL ABDUL JALIL BIN ABDUL AZIZ (43 / Male), NRIC: S7410335I, Tel: +6582282010 | | |
| Adj Asg. Remarks: | SURVEY REVERT | | |

ASSOCIATED MAIL RECEIVED
[View All](#)
[Compose Case Mail](#)

- CHINA_TAIPING (06/12/2017): Alert - Adj Mandate Approved (S\$5608.50) - SJJ5700J - Claim Handler: Chong Boon ...
- CHINA_TAIPING (29/11/2017): Alert - Adj Mandate Approved (S\$4500.00) - SJJ5700J - Claim Handler: Chong Boon ...

ALL ASSOCIATED TASKS
[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

| Due Date | Priority | Type | Task Group | Subject | Handler | Assigned By | Completed On | Created On | Done? |
|-------------|----------|------|------------|---------|---------|-------------|--------------|------------|-------|
| No results. | | | | | | | | | |

Claim Documents

SJJ5700J (SNM17D06527C01)
OD
Nov 10 2017 5:00PM
[JAREL ABDUL JALIL BIN ABDUL AZIZ]
Specialists Motor Pte Ltd

| | | | | | | | | |
|--------------------|-----------------|-----------------------------------|---------------|-----------|-------------------------------------|--|---------------------------------|-------------------------------------|
| Upload Documents | | | Upload Photos | | Compose New Letter | | View <div>View in Browser</div> | |
| Assessment Reports | | | | | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | Specialists Motor Pte Ltd (HQ) | | Thumbnail | Print | | | |
| 1 | 23/11/17 09:19 | Repairer Estimates | | Load HTM | | | | |
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | | Thumbnail | Print | | | |
| 1 | 27/11/17 15:01 | Adjuster Immediate Advice | | Load HTM | | | | |
| 2 | 05/12/17 13:59 | Adjuster Immediate Advice | | Load HTM | | | | |
| Photos/Images | | | | | | | 3 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | Specialists Motor Pte Ltd (HQ) | | Thumbnail | Print | | | |
| 1 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 2 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 3 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 4 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 5 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 6 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 7 | 23/11/17 09:38 | Accident Photo | | Load JPG | <input checked="" type="checkbox"/> | | | |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | | Thumbnail | Print | | | |
| 1 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 2 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 3 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 4 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 5 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 6 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 7 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 8 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 9 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 10 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 11 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 12 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 13 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 14 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 15 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 16 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 17 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 18 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 19 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 20 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 21 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 22 | 24/11/17 16:46 | General View | | Load JPG | <input checked="" type="checkbox"/> | | | |
| 23 | 24/11/17 16:46 | Odometer Reading | | Load JPG | <input checked="" type="checkbox"/> | | | |

| | | | | | |
|----------------------|-----------------|-----------------------------------|------------|-----------|-------|
| 24 | 24/11/17 16:46 | General View | 1 | Load JPG | ✓ |
| 25 | 24/11/17 16:46 | Chassis Number | 1 | Load JPG | ✓ |
| 26 | 27/11/17 15:02 | General View | 1 | Load JPG | ✓ |
| 27 | 27/11/17 15:02 | General View | 1 | Load JPG | ✓ |
| 28 | 27/11/17 15:02 | General View | 2 | Load JPG | ✓ |
| 29 | 27/11/17 15:02 | General View | 1 | Load JPG | ✓ |
| 30 | 27/11/17 15:02 | General View | 1 | Load JPG | ✓ |
| 31 | 27/11/17 15:02 | General View | 1 | Load JPG | ✓ |
| 32 | 27/11/17 15:02 | General View | 1 | Load JPG | ✓ |
| 33 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 34 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 35 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 36 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 37 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 38 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 39 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 40 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 41 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| 42 | 22/12/17 09:42 | Reinspection Photo | 1 | Load JPG | ✓ |
| Documentation | | | | | |
| | | | 1 per page | ✓ | ✓ |
| No | Finalized On | Specialists Motor Pte Ltd (HQ) | | Thumbnail | Print |
| 1 | 23/11/17 09:37 | CI | 1 | Load TIF | |
| 2 | 23/11/17 09:37 | DRIVER | 1 | Load TIF | |
| 3 | 23/11/17 09:37 | GIA-1 | 1 | Load TIF | |
| 4 | 23/11/17 09:37 | GIA-2 | 1 | Load TIF | |
| 5 | 23/11/17 09:37 | SKETCH PLAN-2 | 1 | Load TIF | |
| 6 | 23/11/17 09:37 | SKETCH PLAN-1 | 1 | Load TIF | |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | | Thumbnail | Print |
| 1 | 27/11/17 15:02 | Audatex | 1 | Load PDF | |
| 2 | 27/11/17 15:11 | SURVEYOR MARKING | 1 | Load PDF | |
| 3 | 01/02/18 12:22 | Parts Invoice | 1 | Load PDF | |

Documents Checklist

| DOCUMENTS CHECKLIST | Reset | Save | Print |
|--|-------|------|-------|
| There are no document checklists configured. | | | |

| Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) |
|--|
| <div style="border: 1px solid black; height: 40px; width: 100%;"></div> <div style="text-align: right;"> ^ v </div> |
| Show Remarks To: <input type="checkbox"/> Repairer <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small> |

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CT117022418/UTBE2

Date: 01/02/2018

REFERENCE

| | | | | | |
|-------------------|----------------------------------|------------------|------------------|-----------|----------------|
| Insured/Claimant: | JAREL ABDUL JALIL BIN ABDUL AZIZ | Policy No: | DMPCSN3030761700 | Claim No: | SNM17D06527C01 |
| Date of Loss: | 10/11/2017 | Nature of Claim: | OD | | |

DESCRIPTION & IDENTIFICATION OF VEHICLE

| | | | |
|-----------------------------|--|-------------|-------------------|
| Reg No: | SJJ5700J | Engine No: | 27191031352733 |
| Make & Model: | MERCEDES-BENZ C180, 1.6 Kompressor (A) | Chassis No: | WDD2040452A681031 |
| Reg. Date: | 12/04/2012 (Man. Year: 2012) | Odometer: | 106379 km |
| Colour: | Silver | | |
| Engine Capacity: | 1597 cc | | |
| Market Value/New Car Price: | S\$74,000.00 | | |
| Sum Insured (S\$): | Market Value/New Car Price | | |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

| | | | | |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition: | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification: | No | Pre-accident Condition: |

CONDITION OF TYRES

| | | | |
|-------------------|-------------|------------------|-------------|
| Front Tyre Size: | 225/45Z R17 | Rear Tyre Size: | 225/45Z R17 |
| Front Left Side: | Falken 6 mm | Rear Left Side: | Falken 6 mm |
| Front Right Side: | Falken 6 mm | Rear Right Side: | Falken 6 mm |

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|-------------------------------------|-----------------|-----------------|-----------------|---------------|
| Parts | 5,760.60 | 3,211.25 | 2,549.35 | 44.25 |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 1,566.65 | 1,497.65 | 69.00 | 4.40 |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Calculated Gross Total (S\$) | 7,327.25 | 4,708.90 | 2,618.35 | 35.73 |
| - Excess (S\$) | 500.00 | 0.00 | 500.00 | 100.00 |
| (S\$) | 6,827.25 | 4,708.90 | 2,118.35 | 31.03 |
| + GST 7.00/7.00% (S\$) | 477.91 | 329.62 | 148.29 | 31.03 |
| Nett Amount (S\$) | 7,305.16 | 5,038.52 | 2,266.64 | 31.03 |

INSPECTION

| | | | |
|-----------------------------|------------|-------------------|--|
| Date of Assignment: | 24/11/2017 | Present Location: | Specialists Motor Pte Ltd (HQ) |
| Date Inspected: | 24/11/2017 | Inspected At: | Blk 3018A Ubi Road 1, #01-24/25/26 Singapore 408711 |
| Estimated Period of Repair: | 5.0 days | | |

Adjuster: MARCUS CHUA

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG **Version:** 1.0 (Last Synchronised: 01 Feb 2018)
Parts: 143 **MERCEDES-BENZ C180 1.6 Kompressor (A) (Catalogue:Merimen Singapore 1.0)**
Labour: Repairer's **(Price-denominated Standard List)**
Print Code: (Unsubmitted, no print-code for SJJ5700J)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *

Recommended Parts

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|---------------------------------------|---------------|------------|-------------|
| 1 | 1 | NA | *2K ADHESIVE L/SIDE (WCP) | Serviceable | 107.18 F | *- F |
| 2 | 1 | NA | *CTR REAR BUMPER MLDG (WCP) | Serviceable | 100.00 F | *- F |
| 3 | 1 | NA | *L/R BUMPER GUIDE (WCP) | Not Necessary | 25.00 F | *- F |
| 4 | 1 | NA | *L/R BUMPER MOULDING (WCP) | Necessary | 75.00 F | *75.00 F |
| 5 | 1 | NA | *L/R INN BUMPER BRKT (WCP) | Not Necessary | 40.00 F | *- F |
| 6 | 1 | NA | *L/R INN PARKING SENS (WCP) | Not Necessary | 380.00 F | *- F |
| 7 | 1 | NA | *L/R LAMP (WCP) | Cracked | 330.00 F | *330.00 F |
| 8 | 1 | NA | *L/R WHL-HOUSE COVER (WCP) | Not Necessary | 120.00 F | *- F |
| 9 | 1 | NA | *L/R WING (WCP) | Dented | 1,080.00 F | *1,080.00 F |
| 10 | 1 | NA | *L/R WING INSULATION (WCP) | Not Necessary | 20.00 F | *- F |
| 11 | 1 | NA | *L/ROOF CVR MOULDING (WCP) | Serviceable | 270.00 F | *- F |
| 12 | 1 | NA | *LWR REAR SCREEN SUPP (WCP) | Not Necessary | 11.46 F | *- F |
| 13 | 1 | NA | *LWR REAR SCREEN SUPP (WCP) | Not Necessary | 3.40 F | *- F |
| 14 | 1 | NA | *R/R BUMPER MOULDING (WCP) | Serviceable | 75.00 F | *- F |
| 15 | 1 | NA | *REAR BUMPER C-MEMBER (WCP) | Not Necessary | 345.00 F | *- F |
| 16 | 1 | NA | *REAR BUMPER COVER (WCP) | Deep Cut | 750.00 F | *750.00 F |
| 17 | 1 | NA | *REAR LAMP PANEL (WCP) | Not Necessary | 90.00 F | *- F |
| 18 | 1 | NA | *REAR SCREEN (WCP) | Necessary | 650.00 F | *650.00 F |
| 19 | 1 | NA | *REAR SCREEN BOND KIT (WCP) | Not Necessary | 51.75 F | *- F |
| 20 | 1 | NA | *REAR SCREEN FIX SET (WCP) | Not Necessary | 0.00 F | *- F |
| 21 | 1 | NA | *SPECIALIST AUDATEX FEE | | 42.00 F | *42.00 FS |
| 22 | 1 | NA | *SPECIALIST CHECK LGHT AFT REP | | 40.00 F | *40.00 FS |
| 23 | 1 | NA | *SPECIALIST COMP WHEEL ALIGN (WCP) | Not Necessary | 120.00 F | *- F |
| 24 | 1 | NA | *SPECIALIST R&R REAR GLASS (WCP) | Repeated | 140.00 F | *- F |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|---|-----|----------|---|---------------|------------|------------|
| 25 | 1 | NA | *SPECIALIST R&R REVERSE SENSOR (WCP) | Not Necessary | 120.00 F | *- F |
| 26 | 1 | NA | *SPECIALIST R&R UPHOLS & ETC (WCP) | Repeated | 280.00 F | *- F |
| 27 | 1 | NA | *SPECIALIST TST CAR (WCP) | Not Necessary | 50.00 F | *- F |
| 28 | 1 | NA | *SUNDRY PARTS | Necessary | 100.00 F | *100.00 FS |
| 29 | 1 | NA | *UPPER INTERMED LAYER (WCP) | Not Necessary | 10.50 F | *- F |
| 30 | 1 | NA | *W/S TOP SEAL L&R (WCP) | Not Necessary | 60.00 F | *- F |
| F=Franchise part. S=SpcNett. | | | | | | |
| Sub Total (\$\$) | | | | | 5,486.29 | 3,067.00 |
| + Margin on L,N Items 5.00/5.00% (\$\$) | | | | | 274.31 | 144.25 |
| Total Parts (\$\$) | | | | | 5,760.60 | 3,211.25 |

| |
|---|
| Report was unsubmitted during this print-out. |
|---|

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

| No | Particulars | Lab.Type | Repairer's | Amount |
|-------------------------------|-------------------------------|----------|-----------------|-----------------|
| <u>Labour Items</u> | | | | |
| 1 | Total Paint Labour | New | 483.00 | 483.00 |
| 2 | Total Paint Materials | New | 172.85 | 172.85 |
| 3 | Total Panel/Mechanical Labour | New | 910.80 | 841.80 |
| Gross Labour Cost (\$) | | | 1,566.65 | 1,497.65 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >