



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
 TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
 GST:M9-0009639-E RCB NO:06470300B

DRAFT FINALISATION

M/S : AXA INSURANCE PTE LTD
 8 SHENTON WAY
 #27-01 AXA TOWER
 SINGAPORE 068811

TEL: 63387288

FAX: 63382522

ATTN: Motor Claim Department

Claim No: MC0912620

Ref No: MF0910815

Date: 31 Jan 2018

Policy No: GA151662/1

Veh Reg No: SKZ5889C

Make/Model: TOYOTA HARRIER
 ELEGANCE 2.0

Your Ref No: S7M004R9
Claim Type: Own Damage
Accident Date: 24/11/2017

DRAFT FINALISATION

Repair Cost to Vehicle No (For Finalization):SKZ5889C

Description	U/Price	Quantity	Cost <u>S\$</u>	Amount <u>S\$</u>
SPARE PARTS				
1 FRONT BONNET		1 PC	530.00	
2 FRONT BONNET LOCK		1 PC	50.00	
3 FRONT BONNET CHROME MOULDING OUTER		1 PC	90.00	
4 FRONT GRILLE		1 PC	200.00	
5 FRONT GRILLE CLIPS		8 PC	8.00	
6 HEADLAMP WITH HID LH & RH		2 PC	1,800.00	
7 HEADLAMP TOP SIDE PANEL LH & RH		2 PC	130.00	
8 FRONT BUMPER		1 PC	530.00	
9 FRONT BUMPER SIDE RETAINER LH & RH		2 PC	76.00	
10 FRONT BUMPER CLIPS		10 PC	18.00	
11 FRONT BUMPER INNER TOP BEAM CTR		1 PC	100.00	
12 FRONT BUMPER REINFORCEMENT		1 PC	145.00	
13 FRONT BUMPER SPONGE CTR BIG		1 PC	40.00	
14 FRONT BUMPER SIDE SPONGE SMALL LH & RH		2 PC	36.00	
15 FRONT BUMPER TOW COVER RH		1 PC	12.00	
16 FRONT BUMPER LOWER GRILLE CTR		1 PC	85.00	
17 FRONT BUMPER LOWER SPOILER BLACK		1 PC	100.00	
18 ENGINE UNDER COVER CTR		1 PC	65.00	
19 FOGLAMP RH		1 PC	115.00	
20 FOGLAMP COVER OUTER RH		1 PC	40.00	
21 RADIATOR SUPPORT PANEL		1 PC	320.00	
22 RADIATOR SUPPORT PANEL INNER SIDE AIR GUIDE BIG RH		1 PC	45.00	
23 RADIATOR SUPPORT PANEL TOP GARNISH		1 PC	135.00	
24 RADIATOR SUPPORT PANEL TOP GARNISH CLIPS		12 PC	18.00	
25 BRACE PANEL		1 PC	75.00	
26 AIR CON CONDENSER PIPE (COND-VALVE)		1 PC	200.00	
27 FRONT FENDER LH & RH		2 PC	580.00	
28 FRONT FENDER COWLING RH		1 PC	155.00	
29 FRONT FENDER COWLING CLIPS		20 PC	30.00	
30 RADIATOR SUPPORT SIDE GARNISH RH		1 PC	20.00	
31 WIPER GRILLE SIDE GARNISH RH		1 PC	20.00	

AH LIM MOTOR COMPANY
 No. 10 Ang Mo Kio Industrial Park 2A
 #01-09 AMK Autopoint Singapore 568047
 Tel: 6483 1244 Fax: 6483 6170

5,768.00

Special Nett

32 RADIATOR COOLANT	1 PC	35.00
---------------------	------	-------



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

M/S : AXA INSURANCE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811

TEL: 63387288 FAX: 63382522
ATTN: Motor Claim Department

Claim No: MC0912620
Ref No: MF0910815
Date: 31 Jan 2018
Policy No: GA151662/1
Veh Reg No: SKZ5889C
Make/Model: TOYOTA HARRIER
ELEGANCE 2.0

Your Ref No: S7M004R9
Claim Type: Own Damage
Accident Date: 24/11/2017

Repair Cost to Vehicle No (For Finalization):SKZ5889C

Description	U/Price	Quantity	Cost S\$	Amount S\$
				35.00
LABOUR				
33 TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS AND ETC. TO REMOVE AND REINSTALL DAMAGED ELECTRICAL UNITS, TEST AND RECTIFY FOR PROPER FUNCTIONING.		1 PC	20.00	
34 TO REMOVE AND REPLACE A/C CONDENSER AND PIPES, RADIATOR AND HOSES, VACUUM A/C SYSTEM AS WELL AS REFILL A/C GAS.		1 PC	100.00	
35 TO DISMANTLE ALL DAMAGED PARTS.TO CUT & WELD RADIATOR SUPPORT PANEL,BRACE PANEL,FRONT BUMPER REINFORCEMENT,FRT BUMPER TOP BEAM CTR,SIDE BRACKET,HEADLAMP TOP PANEL.TO KNOCK & REPAIR FRT DOOR,FRT WHEELHOUSE SIDE PANEL, FRT CHASSIS FRAME.		1 PC	800.00	
36 TO SPRAY FRT BONNET,FRT BUMPER,FRT BUMPER REINFORCEMENT,FRT BUMPER TOP BEAM CTR,FRT BUMPER SIDE BRACKET,BRACE PANEL,RADIATOR SUPPORT PANEL,HEADLAMP TOP PANEL,FRT FENDER, FRT DOOR,FRT CHASSIS FRAME,FRT WHEELHOUSE PANEL.		1 PC	700.00	
				1,620.00

Amount Before Excess	S\$ 7,423.00
Less Excess	S\$ 500.00
Amount Before GST	S\$ 6,923.00
Add GST @ 7%	484.61
Total Amount payable	S\$ 7,407.61

TOTAL: SINGAPORE DOLLAR SEVEN THOUSAND FOUR HUNDRED AND SEVEN AND CENTS SIXTY ONE ONLY

The above vehicle was surveyed by GUO XIANG - LKK on 27/11/2017

For AH LIM MOTOR COMPANY
AH LIM MOTOR COMPANY
No. 10 Ang Mo Kio Industrial Park 2A
#01-09 AMK Autopoint Singapore 568047
Tel: 6483 1244 Fax: 6483 6170
AUTHORISED SIGNATURE



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : AXA INSURANCE SINGAPORE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811

TEL: 63387288

FAX: 63382522

ATTN: Motor Claim Department

LKIC Auto.

Estimate No: MC0912620

Date: 25 Nov 2017

Policy No: GA151662/1

Veh Reg No: SKZ5889C

Make/Model: TOYOTA HARRIER
ELEGANCE 2.0


Your Ref No: SKZ5889C

Claim Type: Own Damage

Accident Date: 24/11/2017

Estimate Repair Cost to Vehicle No :SKZ5889C

Description	U/Price	Quantity	Cost	Amount
			<u>S\$</u>	<u>S\$</u>
SPARE PARTS				
1 FRONT BONNET X Report - Buc		1 PC	530.00	
2 FRONT BONNET HINGE LH & RH X		2 PC	60.00	
3 FRONT BONNET ABSORBER LH & RH X Report Report		2 PC	180.00	
4 FRONT BONNET LOCK BT		1 PC	50.00	
5 FRONT BONNET LOCK CABLE X Report		1 PC	22.00	
6 FRONT BONNET INSULATOR CLIPS X		9 PC	9.00	
7 FRONT BONNET CHROME MOULDING OUTER Cost		1 PC	90.00	
8 FRONT GRILLE PR		1 PC	200.00	
9 FRONT GRILLE CLIPS PR		8 PC	8.00	
10 HEADLAMP WITH HID LH & RH CRA		2 PC	1,800.00	
11 HEADLAMP LOWER BEAM LH & RH - CHECK PRICE LH? RH BT		2 PC	0.0000	
12 HEADLAMP CLIPS X Report Report		4 PC	4.00	
13 HEADLAMP TOP SIDE PANEL LH & RH X Report Report BT		2 PC	130.00	
14 FRONT BUMPER Dis		1 PC	530.00	
15 FRONT BUMPER SIDE RETAINER LH & RH PR		2 PC	76.00	
16 FRONT BUMPER CLIPS PR		12 PC	12.00	
17 FRONT BUMPER INNER TOP BEAM CTR BT		1 PC	100.00	
18 FRONT BUMPER INNER TOP SIDE BRACKET LH & RH X		2 PC	90.00	
19 FRONT BUMPER REINFORCEMENT BT		1 PC	145.00	
20 FRONT BUMPER REINFORCEMENT BRACKET LH & RH X Report Report		2 PC	160.00	
21 FRONT BUMPER SPONGE CTR BIG CRA		1 PC	40.00	
22 FRONT BUMPER SIDE SPONGE SMALL LH & RH Dis		2 PC	36.00	
23 FRONT BUMPER TOW COVER LH & RH X Report Report Dis		12 PC	24.00	
24 FRONT BUMPER LOWER GRILLE CTR X Report Report Dis		1 PC	85.00	
25 FRONT BUMPER LOWER COVER X Report Report Dis		1 PC	45.00	
26 FRONT BUMPER LOWER SPOILER BLACK Dis CRA		1 PC	100.00	
27 ENGINE UNDER COVER CTR X Report Report Dis		1 PC	60.00	
28 FOGLAMP X Report Report Dis		1 PC	230.00	
29 FOGLAMP COVER OUTER LH & RH X Report Report Dis		2 PC	80.00	
30 RADIATOR SUPPORT PANEL X Report Report Dis		1 PC	320.00	
31 RADIATOR SUPPORT PANEL INNER SIDE AIR GUIDE BIG LH & RH X Report Report Dis		2 PC	90.00	
32 RADIATOR SUPPORT PANEL INNER SIDE AIR GUIDE SMALL LH & RH X Report Report Dis		2 PC	90.00	
33 RADIATOR SUPPORT PANEL TOP GARNISH PR		1 PC	135.00	
34 RADIATOR SUPPORT PANEL TOP GARNISH CLIPS PR		12 PC	18.00	
35 BRACE PANEL BT		1 PC	75.00	
36 HORN X Report Report Dis		2 PC	100.00	
37 AIR CON CONDENSER-ASSY-ORI X		1 PC	530.00	
38 AIR CON CONDENSER PIPE (COND-VALVE) X Report Report Dis		1 PC	200.00	
39 AIR CON CONDENSER PIPE (COND-COMP) X		1 PC	135.00	

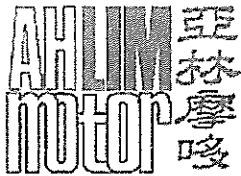

AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimnc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : AXA INSURANCE SINGAPORE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811
TEL: 63387288 FAX: 63382522
ATTN: Motor Claim Department

Estimate No: MC0912620
Date: 25 Nov 2017
Policy No: GA151662/1
Veh Reg No: SKZ5889C
Make/Model: TOYOTA HARRIER
ELEGANCE 2.0

Your Ref No: SKZ5889C
Claim Type: Own Damage
Accident Date: 24/11/2017

Estimate Repair Cost to Vehicle No :SKZ5889C

Description	U/Price	Quantity	Cost	Amount
			S\$	S\$
40 AIR CON CONDENSER FAN MOTOR		1 PC	160.00	
41 AIR CON CONDENSER FAN BLADE		1 PC	65.00	
42 RADIATOR ASSY ORI		1 PC	480.00	
43 RADIATOR FAN BLADE		1 PC	60.00	
44 RADIATOR FAN MOTOR		1 PC	160.00	
45 RADIATOR FAN COWLING		1 PC	125.00	
46 RADIATOR SPARE TANK		1 PC	130.00	
47 WIPER WASHER TANK RH		1 PC	65.00	
48 FRONT FENDER LH & RH		2 PC	580.00	
49 FRONT FENDER COWLING		1/2 PC	310.00	
50 FRONT FENDER COWLING CLIPS		20 PC	30.00	

8,754.00

Special Nett

51 RADIATOR COOLANT	1 PC	35.00
52 NUMBER PLATE	1 PC	35.00

70.00

LABOUR

53 TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS AND ETC. TO REMOVE AND REINSTALL DAMAGED ELECTRICAL UNITS, TEST AND RECTIFY FOR PROPER FUNCTIONING.	1 PC	40.00
54 TO REMOVE AND REPLACE A/C CONDENSER AND PIPES, RADIATOR AND HOSES, VACUUM A/C SYSTEM AS WELL AS REFILL A/C GAS.	1 PC	120.00
55 TO REMOVE & REINSTALL FRONT ENGINE MOUNTING, GEARBOX MOUNTING	1 PC	150.00
56 LABOUR TO RESET ENGINE MANAGEMENT SYSTEM WITH DIAGNOSTIC FAULT - AIR BAG LIGHT & ENGINE LIGHT.	1 PC	180.00
57 TO DISMANTLE ALL DAMAGED PARTS. TO CUT & WELD RADIATOR SUPPORT PANEL, BRACE PANEL, FRONT BUMPER REINFORCEMENT, FRT BUMPER TOP BEAM CTR, SIDE BRACKET, HEADLAMP TOP PANEL. TO KNOCK & REPAIR FRT DOOR, FRT WHEELHOUSE SIDE PANEL, FRT CHASSIS FRAME.	1 PC	1,200.00
58 TO SPRAY FRT BONNET, FRT BUMPER, FRT BUMPER REINFORCEMENT, FRT BUMPER TOP BEAM CTR, FRT BUMPER SIDE BRACKET, BRACE PANEL, RADIATOR SUPPORT PANEL, HEADLAMP TOP PANEL, FRT FENDER, FRT DOOR, FRT CHASSIS FRAME, FRT WHEELHOUSE PANEL.	1 PC	1,400.00





AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : AXA INSURANCE SINGAPORE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811
TEL: 63387288 FAX: 63382522
ATTN: Motor Claim Department

Estimate No: MC0912620
Date: 25 Nov 2017
Policy No: GA151662/1
Veh Reg No: SKZ5889C
Make/Model: TOYOTA HARRIER
ELEGANCE 2.0

Your Ref No: SKZ5889C
Claim Type: Own Damage
Accident Date: 24/11/2017

Estimate Repair Cost to Vehicle No :SKZ5889C

Description	U/Price	Quantity	Cost S\$	Amount S\$
				3,090.00
Amount Before Excess				S\$ 11,914.00
Add GST @ 7%				833.98
Total Amount payable				S\$ 12,747.98

TOTAL: SINGAPORE DOLLAR TWELVE THOUSAND SEVEN HUNDRED FORTY SEVEN AND CENTS NINETY EIGHT ONLY

Please arrange this vehicle to be surveyed soonest possible.
Thank You

Excess : \$500

Authorized.

part by part.


before paint photos.

5 Days.

27/11/17

Gue Qian - 82880282

For AH LIM MOTOR COMPANY

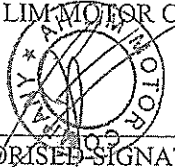
AUTHORISED SIGNATURE



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

M/S : AXA INSURANCE SINGAPORE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811
TEL: 63387288 FAX: 63382522
ATTN: Motor Claim Department

Estimate No: MC0912620
Date: 30 Nov 2017
Policy No: GA151662/1
Veh Reg No: SKZ5889C
Make/Model: TOYOTA HARRIER
ELEGANCE 2.0

Your Ref No: S7M004R9
Claim Type: Own Damage
Accident Date: 24/11/2017


Estimate Repair Cost to Vehicle No :SKZ5889C

Description	U/Price	Quantity	Cost S\$	Amount S\$
Supplementary Parts to Repair				
SPARE PARTS				
1 RADIATOR SUPPORT SIDE GARNISH RH / <i>De</i>		1 PC	20.00	
2 WIPER GRILLE SIDE GARNISH RH / <i>GA</i>		1 PC	20.00	
				40.00

Amount Before Excess	S\$ 40.00
GST Amount	S\$ 2.80
Total Amount payable	S\$ 42.80

The above vehicle was surveyed by GUO XIANG - LKK on 27/11/2017

For AH LIM MOTOR COMPANY

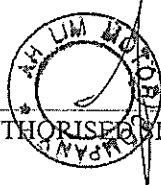
AUTHORISED SIGNATURE

Guo Xiang
20/11/17



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9929



Dept Direct: 6305 5510

Dept Direct: 6305 9611

Dept Direct: 6417 9792



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9793

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea).

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

TAX INVOICE : AR201711-17760
DATE : 30/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID

DESCRIPTION

StkLoc

QTY

U/PRICE

AMOUNT

1 T90467-07220

CLIP,

U1

10

1.80

18.00

ZYX10

SUPPLIER

SUB-TOTAL 18.00
ADD GST 2.00 % 1.26
TOTAL AMOUNT SGD 19.26

[P] 30/11/2017 10:35:16AM

[E] 30/11/2017 10:34:05AM

Goods Sold are not refundable for Cash

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : STEVEN



* AR201711-17760 *

This is computer generated document.

No signature is required.

Goods Received in Good Order

Signature / Co Stamp / Date

ORIGINAL



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9939



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9795

Dept Direct: 6417 9793

Wiper blade: NWB (Nippon Wiper blade), Super (Made in Korea),

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

=====
AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

TAX INVOICE : AR201711-16612
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 2
CURR. : SGD

SQ STOCKED	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. T53510-48230 ZSU60 AVU65	FRT BONET LOCK	U1 L2-D5-D	1	50.00 ✓	50.00
2. T52029-48010 ZSU60 AVU65	FRT BUMPER UPPER REINF	U1 L1-D31	1	100.00 ✓	100.00
3. T52614-48040 ZSU60 AVU65	FRT BUMPER SPONGE	U1 L2-A14	1	40.00 ✓	40.00
4. T81210-48050 ZSU60 AVU65	FOG LAMP RH	U1 L2-E1	1	115.00 ✓	115.00
5. T81481-48190 ZSU60 AVU65	FOG LAMP COVER RH	U1 L2-D5-G	1	40.00 ✓	40.00
6. T53205-48030 ZSU60 AVU65	RAD SUPPORT PANEL	U1 L1-D9	1	320.00 ✓	320.00
7. T52618-48010 ZSU60 AVU65	FRT BUMPER LWR GARNISH	U1 L2-A13	1	65.00 ✓	65.00
8. T53301-48170 ZSU60 AVU65	FRT BONET	U1 SUPPLIER	1	530.00 ✓	530.00
9. T53101-48720/2 ZSU60	RAD GRILLE (PREMIUM)	U1 SUPPLIER	1	200.00 ✓	200.00
10. T52119-48C60-C1 ZSU60	FRT BUMPER	U1 SUPPLIER	1	530.00 ✓	530.00
11. T53875-48120 ZSU60 AVU65	FRT FENDER LINER RH	U1 SUPPLIER	1	155.00 ✓	155.00
12. T53289-48020 ZSU60 AVU65	SUPPORT TOP GARNISH	U1 SUPPLIER	1	135.00 ✓	135.00

page 4

CONTINUE NEXT PAGE
ORIGINAL



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580


Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

=====

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

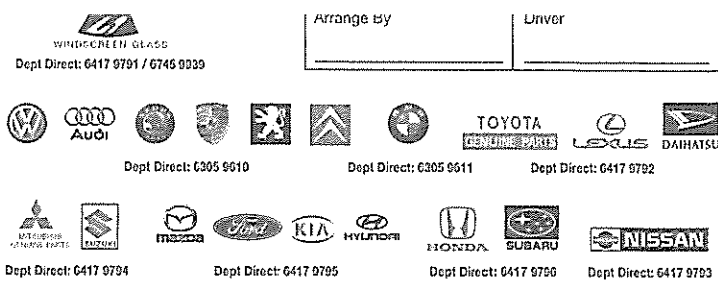

Wiper blade: NWD (Nippon Wiper blade), Gilper (Made in Korea),

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

TAX INVOICE : AR201711-16612
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 2 of 2
CURR. : SGD

SQ STOCKED

DESCRIPTION

StkLoc

QTY

U/PRICE

AMOUNT

SUB-TOTAL : 2,280.00

ADD GST 7.00 % 159.60

E & O.E TOTAL AMOUNT SGD : 2,439.60

[P] 28/11/2017 3:55:23PM

[E] 28/11/2017 3:17:13PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : STEVEN



* AR 2 0 1 7 1 1 - 1 6 6 1 2 *

This is computer generated document.

No signature is required.

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

=====

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 0039



Dept Direct: 6305 9510

Dept Direct: 6305 9511

Dept Direct: 6417 9792



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9793

Wiper blade: NWD (Nippon Wiper blade), Silper (Made in Korea).

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

=====

TAX INVOICE : AR201711-16705
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1	T52535-48040 ZSU60 AVU65	FRT BUMPER S/RETAINER RH	U1 SUPPLIER	1	38.00 ✓	38.00
2	T52536-48030 ZSU60 AVU65	FRT BUMPER S/RETAINER LH	U1 SUPPLIER	1	38.00 ✓	38.00

10983

SUB-TOTAL : 76.00
ADD GST 7.00 % 5.32

E. & O.E TOTAL AMOUNT SGD : 81.32

[P] 28/11/2017 4:23:23PM

[E] 28/11/2017 4:22:57PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : STEVEN



* A R 2 0 1 7 1 1 - 1 6 7 0 5 *

This is computer generated document.

No signature is required.

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

WINDSCREEN GLASS
Dept Direct: 6417 9701 / 6745 9939



Dept Direct: 6417 9704

Dept Direct: 6417 9705

Dept Direct: 6417 9706

Dept Direct: 6417 9703

Wiper blade: NWD (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)

Spark plug: Nippon Densco, NGK (Made in Japan)

TAX INVOICE : AR201711-16770
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 DAYS
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. T52021-48040 ZSU60	FRT BUMPER REINFORCEMENT U1		1	145.00	145.00

SUPPLIER

JAGAN

READ Y ✓

page 2

SUB-TOTAL : 145.00
ADD GST 7.00 % 10.15

E & OE TOTAL AMOUNT SGD : 155.15

[P] 28/11/2017 5:31:24PM

[E] 28/11/2017 5:30:51PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : STEVEN



* AR201711-16770 *

This is computer generated document.

No signature is required.

ORIGINAL

Goods Received in Good Order

Signature / Cb Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9393



Dept Direct: 6305 5610

Dept Direct: 6305 5611

Dept Direct: 6417 9792



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9795

Dept Direct: 6417 9795

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

TAX INVOICE : AR201711-16606
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 3 of 3
CURR : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
15. T53811-48210 ZSU60 AVU65	FRT FENDER RH	PA PL2-B1-06B	1	290.00	290.00
16. T90467-07166 JB33/ACV30/31R	CLIP FOR SHIELD	PA PL2-K1-06J	20	1.50	30.00
17. T53866-48070 ZSU60 AVU65	WIPER GARNISH S/COVER RH	PA PL2-J1-08E	1	20.00	20.00
18. T88706-48010 ZSU60	LIQUID PIPE ASSY	PA PL2-J1-04S	1	200.00	200.00
19. T81110-48440 ZSU60 AVU65	HEAD LAMP RH ASSY	PA NEW	1	900.00	900.00
20. T81150-48890 ZSU60 AVU65	HEAD LAMP LH ASSY	PA NEW	1	900.00	900.00
21. T53112-48150 ZSU60 AVU65	FRT BUMPER LWR GRILLE	PA NEW	1	85.00	85.00

SUB-TOTAL : 3,294.00
ADD GST 7.00 % 230.58

E & OE TOTAL AMOUNT SGD: 3,524.58

[P] 28/11/2017 3:38:05PM

[E] 28/11/2017 3:13:37PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : STEVEN

This is computer generated document.

No signature is required.



* AR 201711-16606 *

Goods Received in Good Order

Signature / Co Stamp / Date

ORIGINAL



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9939



Dept Direct: 6305 0610

Dept Direct: 6305 9511

Dept Direct: 6417 9792



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9793

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

TAX INVOICE : AR201711-16606
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 2 of 3
CURR : SGD

EQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
8. T16693-36010 ZSU60 AVU65	SUPPORT AIR GUIDE RH (BIG)	PA PL2-Q1-08B	1	45.00	45.00
9. T16697-36010 ZSU60 AVU65	SUPPORT AIR GUIDE LH (BIG)	PA PL2-Q1-07B	1	45.00	45.00
10. T52537-48010/20 ZSU60 AVU65	FRT BUMPER TOP BEAM RH	PA PL2-F1-06B	1	65.00	65.00
11. T52538-48010/20 ZSU60 AVU65	FRT BUMPER TOP BEAM LH	PA PL2-H1-05B	1	65.00	65.00
12. T190467-07217	CLIP	PA PL2-K1-06J	12	1.50	18.00
13. T53208-48090 ZSU60 AVU65	BRACE PANEL	PA PL2-F1-06B	1	75.00	75.00
14. T53812-48190 ZSU60 AVU65	FRT FENDER LH	PA PL2-C1-12B	1	290.00	290.00

CONTINUE NEXT PAGE

[P] 28/11/2017 3:38:05PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

ORIGINAL

[E] 28/11/2017 3:13:37PM



日美汽車私人有限公司 JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9339

Arrange By

Driver

MLC



Dept Direct: 6305 5610

Dept Direct: 6305 5611

Dept Direct: 6417 9752



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9793

Wiper blade: NWB (Nippon Wiper blade). Siliper (Made in Korea).
Forch (Made in Germany)
Spark plug: Nippon Denso. NGK (Made In Japan)

AH LIM MOTOR COMPANY
10 ANG MO KIO PARKS 2A
#01-09 AMK AUTO POINT

SINGAPORE 568047
TEL : 64831244 FAX : 64836170
ATTN : SIMON 96205405

TAX INVOICE : AR201711-16606
DATE : 28/11/2017
CUSTOMER ID : AHL008
VEH REG. NO. : SKZ5889C
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 3
CURR : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. T175770-48030 ZSU60 AVU65	FRT BONET MLDG	PA PL2-A1-231	1	90.00 ✓	90.00
2. T152161-16010ROC ALL MODEL	BUMPER CLIP	PA PL2-N1-04A	8	1.00 ✓	8.00
3. T152611-48170 ZSU60 AVU65	FRT BUMPER SPONGE RH	PA PL2-Q1-08B	1	18.00 ✓	18.00
4. T152612-48030 ZSU60 AVU65	FRT BUMPER SPONGE LH	PA PL2-Q1-08A	1	18.00 ✓	18.00
5. T153285-48020-CU ZSU60 AVU65	FRT BUMPER HOLE COVER RH	PA PL2-A1-203	1	12.00 ✓	12.00
6. T152411-48020 ZSU60 AVU65	FRT BUMPER LWR GUARD	PA PL2-E1-01S	1	100.00 ✓	100.00
7. T16691-37010 ZSU60	RAD SUPPORT GARNISH RH (SMALL)	PA PL2-N1-09A	1	20.00 ✓	20.00 ✓

CONTINUE NEXT PAGE

[P] 28/11/2017 3:38:05PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

ORIGINAL

[E] 28/11/2017 3:13:37PM

Pass
page