

# CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: ASGD1111

Version: CHENGHOE/1

Date Calculated: 07/12/2017 08:38

Full Report - V1

Registration: SGD1111C

Printed: 07/12/2017 17:38

## PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
742	R/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	11.0	
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
475	LEFT BONNET HINGE SURFACE PAINT	4.0	
476	RIGHT BONNET HINGE SURFACE PAINT	4.0	
741	L/F WING SURFACE PAINT	5.0	
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	9.0	
2208	R/SILL PANELLING SURFACE PAINT PLAST.	6.0	
<b>LABOUR COST - PAINT</b>			
	<b>TIME(PAINT)</b>	<b>101.0</b>	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	<b>Total Work Units (10WU/HR)</b>	<b>131.0</b>	
	<b>Total Paintwork Labour</b>	<b>13.1HRS</b>	<b>\$602.60</b>
<b>MATERIAL COST - PAINT</b>			
	<b>New Part Painting</b>		<b>Cost Price</b>
	New Part Painting - Plastic K1R		\$110.42
	Material-Constant Main Work Metal		\$55.10
	Surface-/Blend Paint		\$28.60
	Surface Paint Plastic		\$47.81
	Material-Const Main Work Plastic		\$17.95
	Total Excluding Pearlescent Uplift		\$9.00
	Pearlescent Uplift @ 0.0%		\$268.88
	<b>Total Paint Material Cost</b>		<b>\$0.00</b>
			<b>\$268.88</b>

## PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	✓ 1	FRONT BUMPER COVER	204 880	Bul/cm	0%	690.00*
			6447649999			
304	✓ 1	R/F BUMPER COVER	204 880 3324		0%	38.00*
311	✓ 1	L/F BUMPER MOULDING	204 885 3721		0%	45.00*
312	✓ 1	R/F BUMPER MOULDING	204 885 3821		0%	45.00*
336	X 1	FRT CTR BUMPER CARR	204 885 4065		0%	55.00*
362	X ✓ 1	R/F OUTER SENSOR	212 542 0118	short	0%	150.00*
366	✓ 1	R/F INNER SENSOR	212 542 0018		0%	150.00*
405	✓ 1	FRONT GRILLE	204 880 2083 9776		0%	395.00*
432	✓ 1	STAR EMBLEM	204 817 0616		0%	45.00*
435	✓ 1	BONNET SEAL	204 880 0297		0%	22.00*
471	✓ 1	BONNET	204 880 0957		0%	1,050.00*
481	X 1	BONNET INSULATION	204 682 0626		0%	122.00*

# CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: ASGD1111

Version: CHENGHOE/1

Date Calculated: 07/12/2017 08:38

Full Report - V1

Registration: SGD1111C

Printed: 07/12/2017 17:38

507 ✓	1	L/SPRING ELEMENT	204 880 0127	0%	CM	18.00*	✓
508 ✓	1	R/SPRING ELEMENT	204 880 0127	0%	CM	18.00*	✓
562 ✓	1	RIGHT HEADLAMP ASSY	204 820 3839	0%	CM	1,610.00*	✓
606 ✓	1	R/HEADLAMP WASH TRIM	204 880 4324 9999	0%	CM	38.00*	✓
626 ✓	1	R/H-LAMP WASHER JET	204 860 2847	0%	CM	95.00*	✓
742 ✓	1	R/F WING	204 880 1418	0%	B	462.00*	✓
812 ✓	1	R/F WING BADGE	204 817 7220	0%	me	40.00*	✓
840 ✓	1	R/F W-HOUSE CVR FRT	204 690 5930	0%	CM	105.00*	✓ 64.00
1001 ✓	1	FRT LWR CROSSMEMBER	207 620 1600	0%	Bu	160.00*	✓
1008 ✓	1	R/F BUMP IMPACT DAMP	204 620 0995	0%	CM	145.00*	✓
1180 ✓	1	R/F UPP REINF	204 620 1291	0%	Bu	118.00*	✓
1188 ✓	1	R/F C-MEMBER STRUT	204 620 0285	0%	Di	20.00*	✓
1446 X	1	HEADLAMP HOSE	204 860 2592	0%	B	68.00*	✓
2430 ✓	1	R/WATER DEFLECTER	204 690 7162	0%	De	123.00*	✓
9652 ✓	1	R/F OUT TRANSFORMER	218 900 9103	0%	De	685.00*	✓
1000X	1	RH HEADLAMP BULB	Renew	0%	B	268.00*	✓
f: OEM Parts		Sub Total				\$6,780.00	
g: Original		Mark Up From Cost		(5 %)		\$339.00	
h: Secondhand		Sundry Parts		(Fixed)		\$100.00	
p: Parallel		Total Parts				\$7,219.00	
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

## Extras

Description	Betterment	Price
AUDATEX FEE	SPECIALIST	0%
ERASE MEMORY N	SPECIALIST	\$42.00
RESET		\$200.00
Total Extras		\$242.00

## Final Calculation

Total Parts		\$7,219.00
Labour		
Total Panel/Mechanical	\$809.60	
Total Paintwork	\$602.60	
Total Labour		\$1,412.20
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$242.00	
Total of Additional Costs		\$242.00
Total Paint/Material Costs		\$268.88
Grand Total Excludes GST		\$9,142.08
GST @ 7 %		\$639.95
Grand Total Includes GST		\$9,782.03

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

## Assessment Notes

**CHINA TAIPING  
INSURANCE (S) PTE LTD  
3 ANSON ROAD  
#15-02 SPRINGLEAF  
TOWER**

**079909**

**Claim Reference: SNM17D06979C01  
Assessment Number: ASGD1111  
Version: CHINATAI/2  
Date Calculated: 12/12/2017 08:08**

**Full Report - V1  
Registration: SGD1111C  
Printed: 12/12/2017 16:09**

**Summary Information**

**Claim**

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Mr K.K Lau	Date of Incident:	06/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM17D06979C01	Estimated Repair Time:	7 day(s)
Policy Number:	DMPCSN3004981700	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

**Vehicle**

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 250 CGI
Model Sheet Number:	3AK 42
Registration:	SGD1111C
Registration Month:	April
Registration Year:	2012
VIN Number:	WDD2043472F860384
Manufacture Year:	2012
Odometer:	Not Known
Colour:	Other
Engine Number:	
Fuel Level:	%

**Model Specs**

FROM VIN F847336	ELECT FOLDING MIRROR
DIPPING MIRROR	ELECTRIC LEFT SEAT
MODIFICAT PACK 11/2	MODEL 2012
RAIN SENSOR	LED DAYT RUN LAMPS
INTERIOR LAMP PACK	MEDIA INTERFACE
MIRROR PACKAGE	NAVIG SYSTEM COMAND
SMART LIGHT SYSTEM	HEADLAMP WASHERS
LEATHER UPHOLSTERY	ALU DESIGN PARTS
MEMORY PACKAGE	CUP HOLDER
THROUGH-LOAD EQUIPM	STRG WHEEL LEATHER
HIGH BEAM ASSISTANT	H/DUTY ALTERNATOR
FUEL TANK 66L	ENGINE PROTECTION
ECO START/STOP	ELECTRIC HORN
7 SPEED AUTOMATIC	PARAMETER STEERING
TYRE PRESSURE SENSOR	PRE-SAFE SYSTEM
CRUISE CONTROL	225/45-245/40 WR 17
7.5-/8.5 J X 17 ALU	SPARE WHEEL
ELEC PANORAMIC ROOF	PARKTRONIC
CHROME PACKAGE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

**Vehicle Condition**

**Vehicle Status**

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	07/12/2017

**CHINA TAIPING INSURANCE (S) PTE LTD****Claim Reference: SNM17D06979C01****Full Report - V1****Assessment Number: ASGD1111****Registration: SGD1111C****Version: CHINATAI/2****Printed: 12/12/2017 16:09****Date Calculated: 12/12/2017 08:08**

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:



Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

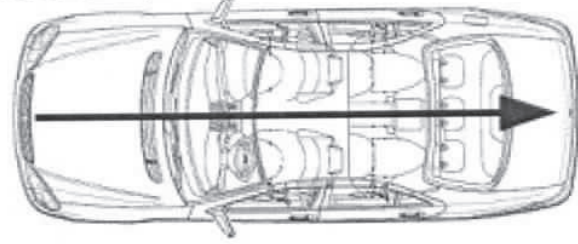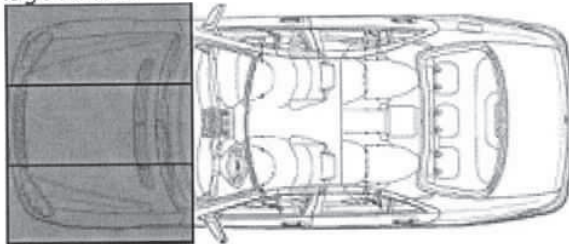**Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD

Address :

BLK 1019, YISHUN IND PK A

01-374/382

Post Code : 768761

**Cost Summary**

Total Labour	\$1,384.60
Total Paint/Material	\$268.88
Total Parts	\$7,090.90
Total of Additional Costs	\$242.00
Repair Cost Exc GST:	\$8,986.38
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,250.00
After Deduction -	
Grand Total Exc GST:	\$7,736.38
7 % GST:	\$541.55
Grand Total Inc GST:	\$8,277.93

**Repair Information****LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR  
Price/Dent = \$46.00/HR

**Repair /****Guide Number Repair Details**

		WU	Cost Price (\$)
54-1011 01	CARRY OUT SHORT TEST	3.0	13.80
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	9.0	41.40
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 01	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60

# CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D06979C01

Assessment Number: ASGD1111

Version: CHINATAI/2

Date Calculated: 12/12/2017 08:08

Full Report - V1

Registration: SGD1111C

Printed: 12/12/2017 16:09

88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
88-2506 01	RENEW BONNET INCLUDES: R + R BONNET, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	11.0	50.60
82-4612 01)	RENEW R/HEADLAMP (REMOVED)	3.0	13.80
82-4608 01)	R + R BOTH XENON HEADLAMPS (BUMPER REMOVED)	5.0	23.00
88-3954 01	R + R RIGHT FRONT WING (BUMPER REMOVED)	5.0	23.00
88-3956 01)	RENEW R/F WING (REMOVED)	2.0	9.20
NO NUMBER	RENEW R/F WING BADGE	3.0	13.80
83-6543 02)	R + R CONDENSER	2.0	9.20
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	12.0	55.20
62-1266 01	RENEW FRONT CROSSMEMBER AND REINFORCEMENT BETWEEN WHEELHOUSES DOES NOT INCLUDE: R + R BUMPER AND LAMP UNITS	14.0	64.40
54-1120 02	R + R BATTERY	4.0	18.40
88-5233 01	R + R R/SILL TRIM	5.0	23.00
67-7825 01	R + R L/FRONT SCREEN MOULDING	1.0	4.60
67-7828 01	R + R R/FRONT SCREEN MOULDING	1.0	4.60
68-5661 ZAX	ADDITION TO R + R CENTRE CONSOLE (VEH WITH MEDIA INTERFACE AND COMAND)	2.0	9.20
68-5671 01	ADD/WORK VEHICLE WITH RADIO	3.0	13.80
68-5665 01	R + R CENTRE CONSOLE	8.0	36.80
91-1910 01)	RENEW AIRBAG/BELT TENSIONER SYSTEM CONTROL UNIT	2.0	9.20
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)	2.0	9.20
61-1086 01	R + R FRONT AND CENTRE ENGINE COMPARTMENT COVERING	3.0	13.80
09-6820 02)	R + R AIR INTERCOOLER	5.0	23.00
0475	REPAIR LEFT BONNET HINGE	3.0*	13.80
0476	REPAIR RIGHT BONNET HINGE	3.0*	13.80
1112	REPAIR R/F WHEELHOUSE ASSY	15.0*	69.00
1156	REPAIR R/UPP W-HOUSE S-MEMB	3.0*	13.80
1210	REPAIR R/F S-MEMBER EXTENS	20.0*	92.00

## LABOUR COST

Total Work Units

170.0

Corrosion Protection External Labour

0.0HRS

0.00

Corrosion Protection Internal Labour

0.0HRS

0.00

Sub Total

17.0HRS

\$782.00

Paint Labour

13.1HRS

\$602.60

# CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D06979C01

Assessment Number: ASGD1111

Version: CHINATAI/2

Date Calculated: 12/12/2017 08:08

Full Report - V1

Registration: SGD1111C

Printed: 12/12/2017 16:09

Total Labour

30.1HRS

\$1,384.60

## PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number Description

WU

Cost Price (\$)

- TWO COAT METALLIC
- PREPARE OFF VEHICLE

471	BONNET NEW PART PAINTING	28.0
742	R/F WING NEW PART PAINTING	9.0
283	FRONT BUMPER COVER NEW PART PAINT K1R	11.0
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0
475	LEFT BONNET HINGE SURFACE PAINT	4.0
476	RIGHT BONNET HINGE SURFACE PAINT	4.0
741	L/F WING SURFACE PAINT	5.0
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0
1482	RIGHT FRONT DOOR SURFACE PAINT	9.0
2208	R/SILL PANELLING SURFACE PAINT PLAST.	6.0

## LABOUR COST - PAINT

TIME(PAINT)

101.0

Preparation Main Work Plastic

5.0

Preparation Main Work Metal

25.0

Preparation Work Multi Layer Paint

0.0

Total Work Units (10WU/HR)

131.0

Total Paintwork Labour

13.1HRS

\$602.60

## MATERIAL COST - PAINT

Cost Price

New Part Painting

\$110.42

New Part Painting - Plastic K1R

\$55.10

Material-Constant Main Work Metal

\$28.60

Surface-/Blend Paint

\$47.81

Surface Paint Plastic

\$17.95

Material-Const Main Work Plastic

\$9.00

Total Excluding Pearlescent Uplift

\$268.88

Pearlescent Uplift @ 0.0%

\$0.00

Total Paint Material Cost

\$268.88

## PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
471	1	BONNET	204 880 0957		0%	1,050.00*
435	1	BONNET SEAL	204 880 0297		0%	22.00*
283	1	FRONT BUMPER COVER	204 880		0%	690.00*
			6447649999			
405	1	FRONT GRILLE	204 880 2083 9776		0%	395.00*
336	1	FRT CTR BUMPER CARR	204 885 4065		0%	55.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600		0%	160.00*
1446	1	HEADLAMP HOSE	204 860 2592		0%	68.00*
311	1	L/F BUMPER MOULDING	204 885 3721		0%	45.00*
507	1	L/SPRING ELEMENT	204 880 0127		0%	18.00*
1008	1	R/F BUMP IMPACT DAMP	204 620 0995		0%	145.00*

# CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: SNM17D06979C01

Assessment Number: ASGD1111

Version: CHINATAI/2

Date Calculated: 12/12/2017 08:08

Full Report - V1

Registration: SGD1111C

Printed: 12/12/2017 16:09

304	1	R/F BUMPER COVER	204 880 3324	0%	38.00*
312	1	R/F BUMPER MOULDING	204 885 3821	0%	45.00*
1188	1	R/F C-MEMBER STRUT	204 620 0285	0%	20.00*
366	1	R/F INNER SENSOR	212 542 0018	0%	150.00*
9652	1	R/F OUT TRANSFORMER	218 900 9103	0%	685.00*
362	1	R/F OUTER SENSOR	212 542 0118	0%	150.00*
1180	1	R/F UPP REINF	204 620 1291	0%	118.00*
840	1	R/F W-HOUSE CVR FRT	204 690 5930	0%	105.00*
742	1	R/F WING	204 880 1418	0%	462.00*
812	1	R/F WING BADGE	204 817 7220	0%	40.00*
606	1	R/HEADLAMP WASH TRIM	204 880 4324 9999	0%	38.00*
626	1	R/H-LAMP WASHER JET	204 860 2847	0%	95.00*
508	1	R/SPRING ELEMENT	204 880 0127	0%	18.00*
2430	1	R/WATER DEFLECTER	204 690 7162	0%	123.00*
1000	1	RH HEADLAMP BULB	Renew	0%	268.00*
562	1	RIGHT HEADLAMP ASSY	204 820 3839	0%	1,610.00*
432	1	STAR EMBLEM	204 817 0616	0%	45.00*
f: OEM Parts				Sub Total	\$6,658.00
g: Original				Mark Up From Cost (5 %)	\$332.90
h: Secondhand				Sundry Parts (Fixed)	\$100.00
p: Parallel				<b>Total Parts</b>	<b>\$7,090.90</b>
x: Exchange					

## NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

### Extras

Description	Betterment	Price
AUDATEX FEE SPECIALIST	0%	\$42.00
ERASE MEMORY N SPECIALIST		\$200.00
RESET		
<b>Total Extras</b>		<b>\$242.00</b>

### Final Calculation

<b>Total Parts</b>	<b>\$7,090.90</b>
<b>Labour</b>	
Total Panel/Mechanical	\$782.00
Total Paintwork	\$602.60
<b>Total Labour</b>	<b>\$1,384.60</b>
<b>Additional Costs</b>	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$242.00
<b>Total of Additional Costs</b>	<b>\$242.00</b>
<b>Total Paint/Material Costs</b>	<b>\$268.88</b>
<b>Repair Costs Excludes GST</b>	<b>\$8,986.38</b>
<b>Deductions</b>	
Deduction for Excess ( Fixed )	-\$1,250.00
<b>Total Deductions</b>	<b>-\$1,250.00</b>
<b>Grand Total Excludes GST (After Deduction)</b>	<b>\$7,736.38</b>
GST @ 7 %	\$541.55
<b>Grand Total Includes GST (After Deduction)</b>	<b>\$8,277.93</b>

**CHINA TAIPING INSURANCE (S) PTE LTD**

**Claim Reference: SNM17D06979C01**

**Full Report - V1**

**Assessment Number: ASGD1111**

**Registration: SGD1111C**

**Version: CHINATAI/2**

**Printed: 12/12/2017 16:09**

**Date Calculated: 12/12/2017 08:08**

---

**Assessment Notes**

---

51 Ubi Avenue 1, #01-25  
Paya Ubi Industrial Park  
Singapore  
408933

Claim Reference: SNM17D06979C01  
Assessment Number: ASGD1111  
Version: LKKAUTOC/5  
Date Calculated: 05/06/2018 04:58

Full Report - V1  
Registration: SGD1111C  
Printed: 05/06/2018 12:09

## Summary Information

### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	06/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM17D06979C01	Estimated Repair Time:	7 day(s)
Policy Number:	DMPCSN3004981700	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

### Vehicle Details

#### Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 250 CGI
Model Sheet Number:	3AK 42
Registration:	SGD1111C
Registration Month:	April
Registration Year:	2012
VIN Number:	WDD2043472F860384
Manufacture Year:	2012
Odometer:	Not Known
Colour:	Other
Engine Number:	
Fuel Level:	%

#### Model Specs


FROM VIN F847336	ELECT FOLDING MIRROR
DIPPING MIRROR	ELECTRIC LEFT SEAT
MODIFICAT PACK 11/2	MODEL 2012
RAIN SENSOR	LED DAYT RUN LAMPS
INTERIOR LAMP PACK	MEDIA INTERFACE
MIRROR PACKAGE	NAVIG SYSTEM COMAND
SMART LIGHT SYSTEM	HEADLAMP WASHERS
LEATHER UPHOLSTERY	ALU DESIGN PARTS
MEMORY PACKAGE	CUP HOLDER
THROUGH-LOAD EQUIPM	STRG WHEEL LEATHER
HIGH BEAM ASSISTANT	H/DUTY ALTERNATOR
FUEL TANK 66L	ENGINE PROTECTION
ECO START/STOP	ELECTRIC HORN
7 SPEED AUTOMATIC	PARAMETER STEERING
TYRE PRESSURE SENSOR	PRE-SAFE SYSTEM
CRUISE CONTROL	225/45-245/40 WR 17
7.5-/8.5 J X 17 ALU	SPARE WHEEL
ELEC PANORAMIC ROOF	PARKTRONIC
CHROME PACKAGE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

## Vehicle Condition


### Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	07/12/2017
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:

Tread Depth LHR:  
 Damage Areas:

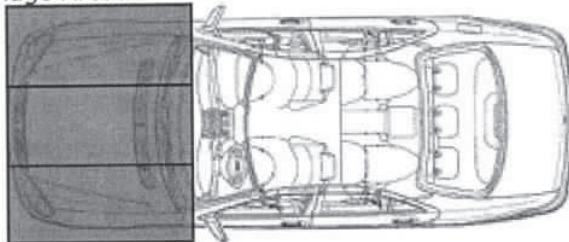

Tread Depth RHR:  
 Direction of Impact:

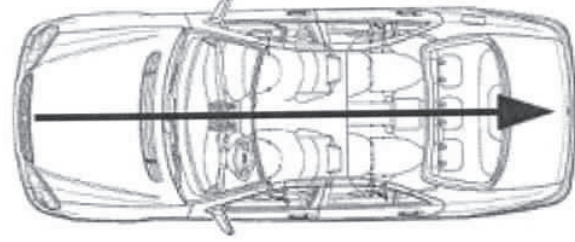

### Addresses

#### Repairer

Name : CHENG HOE MOTOR PTE LTD  
 Address :  
 BLK 1019, YISHUN IND PK A  
 01-374/382  
 Post Code : 768761

### Cost Summary

Total Labour	\$1,315.60
Total Paint/Material	\$268.88
Total Parts	\$7,356.55
Total of Additional Costs	\$242.00
Repair Cost Exc GST:	\$9,183.03
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,250.00
After Deduction -	
Grand Total Exc GST:	\$7,933.03
7 % GST:	\$555.31
Grand Total Inc GST:	\$8,488.34

### Repair Information

#### LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR  
 Price/Dent = \$46.00/HR

#### Repair /

#### Guide Number Repair Details

		WU	Cost Price (\$)
54-1011 01	CARRY OUT SHORT TEST	3.0	13.80
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	9.0	41.40
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 01	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
88-2506 01	RENEW BONNET	11.0	50.60

	INCLUDES: R + R BONNET, CONVERT ATTACHED PARTS, RENEW IF NECESSARY		
82-4612 01)	RENEW R/HEADLAMP (REMOVED)	3.0	13.80
82-4608 01)	R + R BOTH XENON HEADLAMPS (BUMPER REMOVED)	5.0	23.00
88-3954 01	R + R RIGHT FRONT WING (BUMPER REMOVED)	5.0	23.00
88-3956 01)	RENEW R/F WING (REMOVED)	2.0	9.20
NO NUMBER	RENEW R/F WING BADGE	3.0	13.80
83-6543 02)	R + R CONDENSER	2.0	9.20
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE	12.0	55.20
	INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION		
62-1266 01	RENEW FRONT CROSSMEMBER AND REINFORCEMENT BETWEEN WHEELHOUSES DOES NOT INCLUDE: R + R BUMPER AND LAMP UNITS	14.0	64.40
54-1120 02	R + R BATTERY	4.0	18.40
88-5233 01	R + R R/SILL TRIM	5.0	23.00
67-7825 01	R + R L/FRONT SCREEN MOULDING	1.0	4.60
67-7828 01	R + R R/FRONT SCREEN MOULDING	1.0	4.60
68-5661 ZAX	ADDITION TO R + R CENTRE CONSOLE (VEH WITH MEDIA INTERFACE AND COMAND)	2.0	9.20
68-5671 01	ADD/WORK VEHICLE WITH RADIO	3.0	13.80
68-5665 01	R + R CENTRE CONSOLE	8.0	36.80
91-1910 01)	RENEW AIRBAG/BELT TENSIONER SYSTEM CONTROL UNIT	2.0	9.20
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)	2.0	9.20
61-1086 01	R + R FRONT AND CENTRE ENGINE COMPARTMENT COVERING	3.0	13.80
09-6820 02)	R + R AIR INTERCOOLER	5.0	23.00
0475	REPAIR LEFT BONNET HINGE	3.0*	13.80
0476	REPAIR RIGHT BONNET HINGE	3.0*	13.80
1112	REPAIR R/F WHEELHOUSE ASSY	10.0*	46.00
1156	REPAIR R/UPP W-HOUSE S-MEMB	3.0*	13.80
1210	REPAIR R/F S-MEMBER EXTENS	10.0*	46.00
<b>LABOUR COST</b>			
	<b>Total Work Units</b>	<b>155.0</b>	
	<b>Corrosion Protection External Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
	<b>Corrosion Protection Internal Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
	<b>Sub Total</b>	<b>15.5HRS</b>	<b>\$713.00</b>
	<b>Paint Labour</b>	<b>13.1HRS</b>	<b>\$602.60</b>
	<b>Total Labour</b>	<b>28.6HRS</b>	<b>\$1,315.60</b>

**PAINT WORK**

Guide Number Description

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

WU

Cost Price (\$)

	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
742	R/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	11.0	
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
475	LEFT BONNET HINGE SURFACE PAINT	4.0	
476	RIGHT BONNET HINGE SURFACE PAINT	4.0	
741	L/F WING SURFACE PAINT	5.0	
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	9.0	
2208	R/SILL PANELLING SURFACE PAINT PLAST.	6.0	
<b>LABOUR COST - PAINT</b>			
	<b>TIME(PAINT)</b>	<b>101.0</b>	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	<b>Total Work Units (10WU/HR)</b>	<b>131.0</b>	
	<b>Total Paintwork Labour</b>	<b>13.1HRS</b>	<b>\$602.60</b>
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
	New Part Painting		<b>\$110.42</b>
	New Part Painting - Plastic K1R		<b>\$55.10</b>
	Material-Constant Main Work Metal		<b>\$28.60</b>
	Surface-/Blend Paint		<b>\$47.81</b>
	Surface Paint Plastic		<b>\$17.95</b>
	Material-Const Main Work Plastic		<b>\$9.00</b>
	<b>Total Excluding Pearlescent Uplift</b>		<b>\$268.88</b>
	<b>Pearlescent Uplift @ 0.0%</b>		<b>\$0.00</b>
	<b>Total Paint Material Cost</b>		<b>\$268.88</b>

#### PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Price (\$)
471	1	BONNET	204 880 0957		0% <b>1,050.00*</b>
435	1	BONNET SEAL	204 880 0297		0% <b>22.00*</b>
283	1	FRONT BUMPER COVER	204 880		0% <b>690.00F</b>
			6447649999		
405	1	FRONT GRILLE	204 880 2083 9776		0% <b>395.00*</b>
1001	1	FRT LWR CROSSMEMBER	207 620 1600		0% <b>160.00*</b>
311	1	L/F BUMPER MOULDING	204 885 3721		0% <b>45.00*</b>
507	1	L/SPRING ELEMENT	204 880 0127		0% <b>18.00*</b>
1008	1	R/F BUMP IMPACT DAMP	204 620 0995		0% <b>145.00*</b>
304	1	R/F BUMPER COVER	204 880 3324		0% <b>38.00*</b>
312	1	R/F BUMPER MOULDING	204 885 3821		0% <b>45.00*</b>
1188	1	R/F C-MEMBER STRUT	204 620 0285		0% <b>20.00*</b>
366	1	R/F INNER SENSOR	212 542 0018		0% <b>150.00*</b>
9652	1	R/F OUT TRANSFORMER	218 900 9103		0% <b>685.00*</b>
362	1	R/F OUTER SENSOR	212 542 0118		0% <b>150.00*</b>

1180	1	R/F UPP REINF	204 620 1291	0%	118.00*
840	1	R/F W-HOUSE CVR FRT	204 690 5930	0%	64.00*
742	1	R/F WING	204 880 1418	0%	462.00*
812	1	R/F WING BADGE	204 817 7220	0%	40.00*
606	1	R/HEADLAMP WASH TRIM	204 880 4324 9999	0%	38.00*
9650	1	R/H-LAMP LVL C-UNIT	166 900 2800	0%	685.00*
626	1	R/H-LAMP WASHER JET	204 860 2847	0%	95.00*
508	1	R/SPRING ELEMENT	204 880 0127	0%	18.00*
2430	1	R/WATER DEFLECTER	204 690 7162	0%	123.00*
562	1	RIGHT HEADLAMP ASSY	204 820 3839	0%	1,610.00*
432	1	STAR EMBLEM	204 817 0616	0%	45.00*
f: OEM Parts				Sub Total	\$6,911.00
g: Original				Mark Up From Cost (5 %)	\$345.55
h: Secondhand				Sundry Parts (Fixed)	\$100.00
p: Parallel				<b>Total Parts</b>	<b>\$7,356.55</b>
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Extras**

Description	Betterment	Price
AUDATEX FEE SPECIALIST	0%	\$42.00
ERASE MEMORY N SPECIALIST		\$200.00
RESET		
<b>Total Extras</b>		<b>\$242.00</b>

**Final Calculation**

<b>Total Parts</b>	<b>\$7,356.55</b>
<b>Labour</b>	
Total Panel/Mechanical	\$713.00
Total Paintwork	\$602.60
<b>Total Labour</b>	<b>\$1,315.60</b>
<b>Additional Costs</b>	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$242.00
<b>Total of Additional Costs</b>	<b>\$242.00</b>
<b>Total Paint/Material Costs</b>	<b>\$268.88</b>
<b>Repair Costs Excludes GST</b>	<b>\$9,183.03</b>
<b>Deductions</b>	
Deduction for Excess ( Fixed )	-\$1,250.00
<b>Total Deductions</b>	<b>-\$1,250.00</b>
<b>Grand Total Excludes GST (After Deduction)</b>	<b>\$7,933.03</b>
GST @ 7 %	\$555.31
<b>Grand Total Includes GST (After Deduction)</b>	<b>\$8,488.34</b>

**Assessment Notes**

CHENG HOE MOTOR PTE  
LTD  
BLK 1019, YISHUN  
INDUSTRIAL PARK A  
#01-374/382  
SINGAPORE 768761

Our finalization

Claim Reference:  
Assessment Number: ASGD1111  
Version: CHENGHOE/1  
Date Calculated: 10/03/2018 03:19

Full Report - V1  
Registration: SGD1111C  
Printed: 10/03/2018 11:34

### Summary Information

#### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	06/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	7 day(s)
Policy Number:	DMPCSN3004981700	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

### Vehicle Details

#### Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 250 CGI
Model Sheet Number:	3AK 42
Registration:	SGD1111C
Registration Month:	April
Registration Year:	2012
VIN Number:	WDD2043472F860384
Manufacture Year:	2012
Odometer:	Not Known
Colour:	Other
Engine Number:	
Fuel Level:	%

#### Model Specs

FROM VIN F847336	ELECT FOLDING MIRROR
DIPPING MIRROR	ELECTRIC LEFT SEAT
MODIFICAT PACK 11/2	MODEL 2012
RAIN SENSOR	LED DAYT RUN LAMPS
INTERIOR LAMP PACK	MEDIA INTERFACE
MIRROR PACKAGE	NAVIG SYSTEM COMAND
SMART LIGHT SYSTEM	HEADLAMP WASHERS
LEATHER UPHOLSTERY	ALU DESIGN PARTS
MEMORY PACKAGE	CUP HOLDER
THROUGH-LOAD EQUIPM	STRG WHEEL LEATHER
HIGH BEAM ASSISTANT	H/DUTY ALTERNATOR
FUEL TANK 66L	ENGINE PROTECTION
ECO START/STOP	ELECTRIC HORN
7 SPEED AUTOMATIC	PARAMETER STEERING
TYRE PRESSURE SENSOR	PRE-SAFE SYSTEM
CRUISE CONTROL	225/45-245/40 WR 17
7.5-/8.5 J X 17 ALU	SPARE WHEEL
ELEC PANORAMIC ROOF	PARKTRONIC
CHROME PACKAGE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

### Vehicle Condition

#### Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection: 07/12/2017

**Claim Reference:****Assessment Number: ASGD1111****Version: CHENGHOE/1****Date Calculated: 10/03/2018 03:19****Full Report - V1****Registration: SGD1111C****Printed: 10/03/2018 11:34**

Place of Inspection:


Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:

Tread Depth LHR:


Damage Areas:

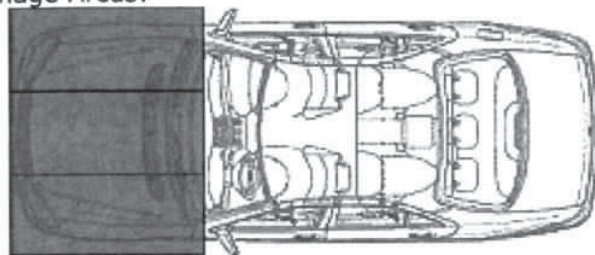

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

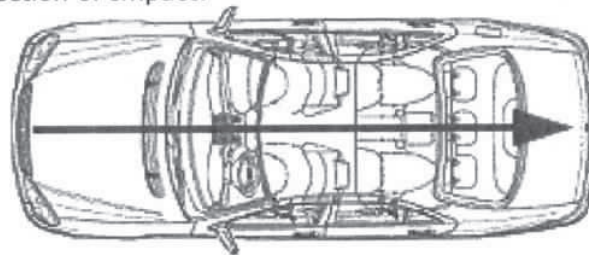**Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD

Address :

BLK 1019, YISHUN IND PK A

01-374/382

Post Code : 768761

**Cost Summary**

Total Labour	\$1,343.20
Total Paint/Material	\$268.88
Total Parts	\$7,356.55
Total of Additional Costs	\$242.00
Excess:	TBA
Grand Total Exc GST:	\$9,210.63
7 % GST:	\$644.74
Grand Total Inc GST:	\$9,855.37

**Repair Information****LABOUR****Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR****Price/Dent = \$46.00/HR****Repair /****Guide Number Repair Details**

		<b>WU</b>	<b>Cost Price (\$)</b>
54-1011 01	CARRY OUT SHORT TEST	<b>3.0</b>	<b>13.80</b>
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	<b>9.0</b>	<b>41.40</b>
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	<b>9.0</b>	<b>41.40</b>
88-1105 01	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	<b>6.0</b>	<b>27.60</b>
88-1358 01	ADD TO DIS + ASS FRONT BUMPER	<b>3.0</b>	<b>13.80</b>