

22/03/2002

ASS. REC. BY:

REF:

CS/SFF17023793/17 gbe2

Special Instruction:

Surveyor:

ASSIGNMENT (Office)

From (Person):

Abdul Rahman

of

SFF

Date/Time:

14.12.2017

Estimated Cost:

Bill to:

OD / ~~TP~~ / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SJF 9972K

Insured:

GBC 7544L

at Workshop m/s

Fastech Auto

Tel:

6746 5405

of

Blk 1 Kaki Bukit Ave 6 #01-46

Policy No:

Claim No:

PEMD / 105 / 009 / 2017 / 173

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

13.12.2017

CA / REV / REP. / REV 24 HRS 'wp'

15.12.2017

H.O.D. Endorsement:

Date/Time:

14.12.2017 1:18pm

Person Contacted:

Nany

Vehicle IN / OUT

Date/Time	Action/Instruction (✓) Estimate	Do Not Finalize
	SJF 9972K - x	
	GBC 7544L - x	
	Ls \$ 35000, 21 days (Red \$ 57879.75, 62%.)	

REF: SPF

ASSIGNMENT

27/05/14

From: Date 15/12/17

Estimated Cost:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MVTo inspect Vehicle No SJF 9972K
at Workshop no Fastech Auto
of 31k1 kaki Bukit Ave 6 # 01-46
Insured

Policy No.

Claims No.

Sum Insured: Excess

(Client's Record)

Make of Veh.

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N.S	O.S

Bal. or Market Value

IDAO Accident Report: Consistent?: Yes or No

GIA / PP Seen: Consistent?: Yes or No

Est. Repairs: 21 days Res: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS 'wp'

Date: Person Contacted

Vehicle: IN / OUT

Veh No: SJF 9972K. Reg: 2014 May.

Type: ☒ M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi Q3 1984

Colour: White A.C. Insured / Std / Nil / NA

So Reading: T Radio: Insured / Std / Nil / NA

Eng No

C No: WAUZZZ8U6ER041502

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orMod: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size F: 235/55R17.

R: 235/55R17.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Continental.

Front

Rear

R.Bal. 06 mm R.Bal. 06 mm

L.Bal. 06 mm L.Bal. 06 mm

D.O.A. D.O.A. 15/12/17.

Survey held at: Fastech

Des. of Damages: ☒ Frt / Rear / O/S / ☒ N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date Time Action Instruction

TP SPF.

MV: 108 (cost)
PV: 72.5K
Nett: 35.5K

REC

Date Time File Pass to: ☐ Preli. Report29/1/14 ☐ Final Report

Date Time File Return to:

Days Of Repair: 21

Resurvey No. of Trip: 3

Survey Fee

Transport

Lump Sum

Fuel

Tolls

Other

Total

350

350

Report Format:

Lump Sum: 35000

Add Fee: ☐ Site Insp: \$☐ Interview: \$☐ Test: \$☐ Des. and: \$

Tp




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AUTOMOTIVE ENGINEERING & MGT DIVISION		Ref : CS/SPF17023793/Aqb	
ACCIDENT CLAIM SECTION (SINGAPORE POLICE FORCE) 1 MOUNT PLEASANT ROAD BLK 8 OLD POLICE ACADEMY SINGAPORE 298333		Date : 14-12-2017	
		Code : SPF	
1. Policy Particulars - THIRD PARTY CLAIM			
Insured Veh.	GBC 7544L	Veh. Inspected	SJF 9972K
Policy No.		Coverage (\$)	0.00
Claim No.	AEMD/105/009/2017/173	Excess (\$)	0.00
Assign From	ABDUL RAHMAN	Assign Date	14/12/2017
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	13/12/2017	Inspection Date	15/12/2017
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks			
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

Survey Department Check List (Case Handler)

Reference No. : C9/344/703713/Agb
 Policy Type: OD / TP / TP RES / TL / EVA

SJF 9972k

Admin (Cath): Case handler to make sure all Information created by the assignment team are **ACCURATE**.

(1) Office Assign Form

- C Reference No.
- C Customer Code
- N Assign From
- C Assign Date
- C Veh No (Inspected)
- C Veh No (Insured)
- C D.O.A
- C Policy No
- C Claim No
- C Insurance Authorisation (CA /REV/REP)
- C Report Type
- C Weekend Charges
- N Survey held at/Repairer
- C Excess

Case Handler		Typist	
Y-Date	N-Date	Y-Date	N-Date
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			

Surveyor (Adam): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

- C Vehicle No
- C Regn Month/Year
- N Vehicle Type
- N Make & Model
- C Engine Capacity. (C.C)
- N Colour
- C Odometer. (Sp.Reading)
- C Chassis No
- N General Condition
- N Steering
- N Brake
- N Modification (Modi)
- C Tyre Size
- N Tyre Make
- C Tyre Balance
- C Date of Inspection
- N Survey held
- N Des.of Damages

✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			

(2) System - (Views/Merimen)

- C Damaged Vehicle Photographs Uploaded

✓		
---	--	--

(3) Workshop Estimate/Assignment Form

- N ALL Parts condition
- C Market Value for OD cases
- C Estimate Repair Cost for PRI (RSI, TMI, MSIG)
- C Days of repair
- C Finalised Amount
- C Re-inspection Cases to Finalize within 5 Days

✓		
✓		

(4) System - (Views/Merimen)

- C Resurvey photo Uploaded

✓		
---	--	--

Check By:

Case Handler

Date

Adam 27/1/18



SINGAPORE POLICE FORCE

SPF Accidents Claims Section
Automotive Engg & Mgmt Div
Police Logistics Department
No. 1 Mount Pleasant Road
Block 8 Old Police Academy
#02-12 Singapore 298333

Your Ref : SJF9972K

Our Ref : AEMD/105/009/2017/173

Date : 14 Dec 2017

Tel: 64784840

Fax: 64784848

Messrs LKK Auto Consultants Pte Ltd
Paya Ubi Industrial Park
51 Ubi Avenue 1 #01/02-25
Singapore 408933

Via Fax only: 62564315

Dear Sir/Madam,

ACCIDENT INVOLVING GOVT VEHICLE GBC7544L AND OTHER VEHICLE SJF9972K ON 13 DECEMBER 2017

We refer to the above matter.

- 2 Please arrange for an inspection of vehicle no. **SJR3055J** at **Fastech Auto Pte Ltd** of Blk 1 Kaki Bukit Avenue 6 Autobay #01-46/48/50, Singapore 417883.
- 3 For appointment kindly contact **Nancy Lam** at Tel: 67465405.
- 4 Estimates were not provided by the workshop.
- 5 Thank you.

Yours faithfully,

Abdul Rahman
Accident Claims Officer
for ASST DIRECTOR

A FORCE FOR THE NATION

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type	Singapore NRIC
Owner ID	9960A

Vehicle Details

Vehicle No.	SJF9972K
Vehicle to be Exported	No
Intended De-registration Date	13 Dec 2017
Vehicle Make	AUDI
Vehicle Model	Q3 2.0 TFSI QU (170BHP)
Primary Colour	White
Manufacturing Year	2013
Engine No.	CCZ405115
Chassis No.	WAUZZZ8U6ER041502
Maximum Power Output	125.0 kW (167 bhp)
Open Market Value	\$33,043.00
Original Registration Date	27 May 2014
First Registration Date	27 May 2014
Transfer Count	0
Actual ARF Paid	\$38,261.00

Intended PARF Rebate Details

PARF Eligibility	Yes
PARF Eligibility Expiry Date	26 May 2024
PARF Rebate Amount	\$28,695.00

Intended COE Rebate Details

COE Expiry Date	26 May 2024
COE Category	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years)	10
QP Paid	\$68,103.00
COE Rebate Amount	\$43,937.00
Total Rebate Amount	\$72,632.00

The information contained herein is correct as at 13 Dec 2017

OK

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 9960A

Vehicle Details

Vehicle No.: SJF9972K

Vehicle to be Exported: Yes

Intended De-registration Date: 18 Dec 2017

Vehicle Make: AUDI

Vehicle Model: Q3 2.0 TFSI QU (170BHP)

Primary Colour: White

Manufacturing Year: 2013

Engine No.: CCZ405115

Chassis No.: WAUZZZ8U6ER041502

Maximum Power Output: 125.0 kW (167 bhp)

Open Market Value: \$33,043.00

Original Registration Date: 27 May 2014

First Registration Date: 27 May 2014

Transfer Count: 0

Actual ARF Paid: \$38,261.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 26 May 2024

PARF Rebate Amount: \$28,695.00

Intended COE Rebate Details

COE Expiry Date: 26 May 2024

COE Category: B - Car above 1600cc or 97kW (130bhp)


COE Period(Years): 10

QP Paid: \$68,103.00

COE Rebate Amount: \$43,845.00

Total Rebate Amount: \$72,540.00

The information contained herein is correct as at 18 Dec 2017

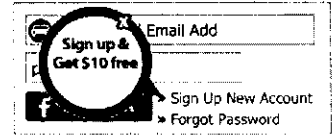

Post an Advertisement
 Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

Low Downpayment. Monthly \$673 Only. Excellent Economy



Only 673 Per Month. More Than
 9 Years To Drive. Low Mileage,
 Well Maintained.
 Direct Owner - Start Ad



Browse by Category ▼

Sort by Date Posted ▼

20 results/page ▼

6 vehicles

Audi Q3

Advanced Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Audi Q3		Any	Any	2014	Any	Any	Any	Available
	Audi Q3 1.4A TFSI		\$103,800	\$14,060 /yr	11-Jun-2014	1,395 cc	18,000 km	SUV	Available
Genuine Low Mileage Of 18000km, As Good As New. Elegant White SUV, Agent Unit, Serviced By Agent, Very Well Maintained, Flexible In-house Loan Packages Available. Consignment Unit. Please Call To Arra...									
Posted: 14-Nov-2017 Tags: 2014 Audi Q3, 2014 Audi Q3, Audi Q3, Audi Q3, Audi, Q3, Q3, Used Audi									
	Audi Q3 2.0A TFSI Quattro		\$111,800	\$14,060 /yr	21-Jul-2014	1,984 cc	59,893 km	SUV	Available
Agent Unit, Maintained At Agent, Exclusive 1 Year Republic Auto Maintenance Package, 2.0L Model, 1 Owner, Well Maintained, Enjoy Exclusive Interest Rates At 2.78%, 60% Loan, Please Call/SMS Now For En...									
Republic Auto									
Posted: 24-Nov-2017 Tags: 2014 Audi Q3, 2014 Audi Q3, Audi Q3, Audi Q3, Audi, Q3, Q3, Used Audi									
	Audi Q3 1.4A TFSI		\$109,800	\$14,320 /yr	29-Sep-2014	1,395 cc	35,000 km	SUV	Available
Elegant Silver SUV, Agent Unit, Serviced By Agent, One Owner Only, Low Mileage Done, Very Well Maintained, Flexible In-house Loan Packages Available.									
Prime Motor & Leasing									
Posted: 15-Dec-2017 Tags: 2014 Audi Q3, 2014 Audi Q3, Audi Q3, Audi Q3, Audi, Q3, Q3, Used Audi									
	Audi Q3 1.4A TFSI		\$113,000	\$14,620 /yr	29-Oct-2014	1,395 cc	31,000 km	SUV	Available
STA Grade A! One Lady Owner. Cheapest In The Market, Well Maintain! Prestige Condition! Agent Unit! Low Mileage! Low Down Payment! View To Believe. High Trade Int Price Negotiable. Call Us Now Before ...									
Posted: 18-Nov-2017 Tags: 2014 Audi Q3, 2014 Audi Q3, Audi Q3, Audi Q3, Audi, Q3, Q3, Used Audi									

Car Buying

Car Selling


Car Aftermarket

Buying a pre-owned car, but
 Unsure of its Condition?
 Get, STA Car Evaluation

Car Ownership

On The Move

Lifestyle



Audi Q3 1.4A TFSI **\$107,800** **\$13,520 /yr** **31-Dec-2014** **1,395 cc** **-** **SUV** **Available**

Up To 90% Loan! Flexible Repayment With In House Financing. Our Vehicle Inspected By Professional Team For Highest Quality With Opt Extended Warranty Available. Owning A Car Is So Much Easier With Us....

Universe Motoring

Posted: 16-Dec-2017 Tags: 2014 Audi Q3, 2014 Audi Q3, Audi Q3, Audi Q3, Audi, Q3, Q3, Used Audi

PREMIUM AD



Audi Q3 1.4A TFSI **\$105,000** **\$13,120 /yr** **31-Dec-2014** **1,395 cc** **32,888 km** **SUV** **Available**

Price Reduced For Quick Sale. Fixed Price. Consignment Sale. Please Do Not Go Down To Our Office. Lady Driver, Only Used To Ferry Kids To School. Lowest Mileage For Similar Q3. Lowest Depreciation In ...

Posted: 30-Nov-2017 Tags: 2014 Audi Q3, 2014 Audi Q3, Audi Q3, Audi Q3, Audi, Q3, Q3, Used Audi

PREMIUM AD

Save this search criteria, to get email alerts whenever a match is found.

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

For old adver

view Expired ads

20 results/page

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	14/12/2017 16:19
Date Of Accident	13/12/2017 14:00
Exact Location Of Accident	CLEMENTI AVE 2 AND AVE 5
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJF9972K
Insured/Policyholder	
Name Of Registered Owner	TAN ENG HUA
NRIC No	S0239960A
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-96367233
Alternative Phone No	OTHERS-96367233

Vehicle Particulars

Manufacturer	AUDI
Model	Q3-2.0 TFSI QUATTRO (170 BHP) (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	VPA/P1609037
Cover Note Number	

Driver

Name of Driver	CHEN BOON ENG
NRIC No	S0037189J
Date Of Birth	27/01/1952
Occupation	INDOOR
Date Of Driving Pass	21/01/1974
Driving Experience	43 YEARS AND 10 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-96367233
Fax Number	
Contact Number	
EEmail Address	NOEMAIL

Address

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured SPOUSE

Vehicle Registration Number of Driver's Own Vehicle -

Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident COLLISION - CROSS JUNCTION

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Was any body injured in the Accident? YES

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES

If Yes, Please state which Police Station

Police Station Name KAMPONG JAVA NEIGHBOURHOOD POLICE CENTRE

Police Station Address ROAD: 21 KAMPONG JAVA ROAD , POSTCODE: 228892 , COUNTRY: SINGAPORE

Police Station Contact TEL NO: 1800-2959999 - FAX NO: 63918499

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

REFER TO SKETCH PLAN/POLICE REPORT

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? NO

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number GBC7544L

Vehicle Make/Model/Colour MERCEDES BENZ VITO 116CDI L

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SLG7475M
Vehicle Make/Model/Colour HONDA VEZEL 1.5X CVT
Details Of Properties
Name of Driver
NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

Details of Witness

Name
Phone Number
Email Address

DETAILS OF INJURED PERSON 1

Name CHEN BOON ENG
Approximate Age
Injuries Sustain
Injured person in which vehicle? SJF9972K
Were seat belts worn? YES
Was injured conveyed to hospital by ambulance? NO
Address
Postcode

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid
8. Consent under the Personal Data Protection Act (PDPA)

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims,
- (ii) investigating the accident and/or my claims,
- (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me,
- (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

(d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.


(e) the information so collected under (d) above may be shared / disclosed:

- (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
- (ii) for complying with requirements under any regulations, laws or court orders

Reporting Centre Personnel's Signature
Name: J. K. ...
NRIC/FIN No: J. K. ...

Sketch Plan #2

SKETCH PLAN

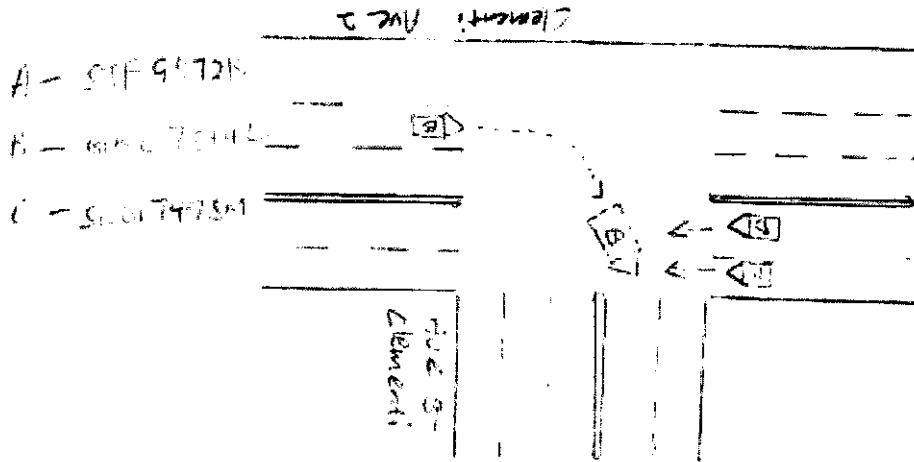

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

From the police report (SIF 7514L, SIF 9572K, SIF 7473M)

DECLARATION

I/We declare the foregoing particulars are true in every respect

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: J. G. G. G.
NRIC/FIN No: 824052714

Police Report



**SINGAPORE
POLICE FORCE**



T/20171213/2189

Police Station Of Origin:
Kampong Java N.P.C
21 Kampong Java Road SINGAPORE
228892
Tel No. 1800-2959999

1 of 3

Report No. T/20171213/2189

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 13/12/2017 22:55		Vide Report No. D/20171213/0079	Station Diary No. 430
Informant's Particulars			
Name of Informant: CHEN BOON ENG		Address: 62 HUDDINGTON AVENUE SINGAPORE 557632	
ID Type / ID No.: NRIC NO / S0037189J		Contact No.: Home/Office: Mobile: 96367233	
Nationality: SINGAPORE CITIZEN		Email:	
Sex: Female	Age: 65	Date of Birth: 27/01/1952	Type of Informant: Driver
Race: Chinese		Language:	Institution / School Name:
Occupation: Housewife		Driving Licence Information: Class: Date of Expiry:	

General Information of the Accident				
Type of - Accident:	Non-Injury Police Vehicle	Drink Drive No	Date/Time of Accident: 13/12/2017 14:00	Type of Location: T-Junction
Location: Along Road 1 CLEMENTI AVENUE 2				
T-Junction of Clementi Avenue 2 and Clementi Avenue 5				
Weather: Clear		Road Surface: Dry	Road Speed Limit:	
Traffic Flow: Dual Carriage Way		Traffic Control: Traffic Light - Working	Traffic Volume: Light	
Type of Collision: Between Moving Vehicles - Head To Side			Anyone conveyed by ambulance No	

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
GBC7544L	Van				Slightly Damaged	2
SJF9972K	Car				Seriously Damaged	1
SLG7475M	Car				Slightly Damaged	1

Police Report



SINGAPORE
POLICE FORCE



7/20171213/2189

Police Station Of Origin:
Kampong Java N.P.C
21 Kampong Java Road SINGAPORE
228892
Tel No: 1800-2959999

2 of 3

Report No. 7/20171213/2189

CONTINUATION OF REPORT

Brief Details.

I was driving my vehicle SJF9972K travelling straight on the extreme right lane along Clementi Ave 2 towards Clementi Road at around 50km/h-60km/h. The traffic light ahead was green in my favour. To my left was a Honda Vezel SLG7475M, travelling alongside me at a similar speed.

From a Distance (There was no vehicle in front of me at that time), I noticed two vehicles on the opposite side of the road (the first and second turning lanes) make a right turn into Clementi Ave 5. They made the turn without incident. I then flashed my high beam to warn the vehicles behind them of my approach. The vehicle on the first inner lane stopped and did not move to make the turn. However, the vehicle on the second lane, which was a police van GBC7544L, did not stop and continued travelling to make the turn without slowing down.

I was shocked that the police van did not stop and was proceeding with the turn despite my approach. I immediately applied my brake forcefully and held tightly to my steering wheel but could not stop on time, thereby colliding head on to the side of the police van. As I was aware of the Honda Vezel SLG7475M next to me travelling at a similar speed, I avoided swerving my car to the left so as to avoid hitting the car. Likewise, the Honda Vezel was not able to stop in time and similarly collided into the turning police van. The momentum of the collision with the police van caused my vehicle to slide to the left, causing a sideways collision on the left of my vehicle with the Honda Vezel as well.

After the incident, the driver of the Honda Vezel (she told me that her name is Joyce Eng and she is a Uber driver) and I disembarked. The driver of the police van spoke to us. The driver is a young Chinese lady. When I spoke to her, she apologized and told me that she did not notice my car. There was another female passenger in the police van.

Around 10-20 minutes later, a few police officers turned up at scene. Two of the officers-one male, one female both Chinese-approached me to check if I was ok. The male officer told me that the driver of the police van was his subordinate who was heading back to police station at Clementi Ave 5 after carrying out some investigation. They apologized and explained that the driver and her companion were probably tired after working since the early morning.

Both myself and Joyce Eng gave the police officers our NRIC, driving license and particulars. The lady police van driver did not give us her identification and particulars. As a result of the accident, my car was badly damaged and I also sustained injuries. My right thumb is bruised and swollen with minor lacerations and I felt pain at my left neck and shoulder.

I wish to state that I have already seen a Dr.

Police Report



SINGAPORE
POLICE FORCE



T/20171213/2189

Police Station Of Origin:
Kampong Java N.P.C
21 Kampong Java Road SINGAPORE
228892
Tel No: 1800-2959999

3 of 3

Report No. T/20171213/2189

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference

Signature Of Officer Recording The Report:
E /
Sgt 1 KADIJAH D/O ABBAS

Signature Of Informant:


Signature Of Interpreter:
Not applicable

Date/Time:
13/12/2017 22:55

Officer In Charge Of Case:
TP / DDGVT /

Classification Of Case:

Contact No.:

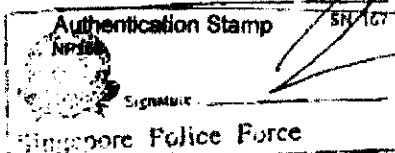

Fastech Auto Ptd Ltd

TPSPF Xero Chen

1 Kaki Bukit Avenue 6, #01-46/48/50, Autobay, Singapore 417883

H/P: 9487 7074 Tel:6741 7244, 6746 5405 Fax:6745 8520, 6746 5786

Email: general@fastechauto.com.sg

Vehicle No.: SJF9972K

Vehicle Made & Model: AUDI Q3 2.0T

QTY	List Items:	Amount \$
1	Front bonnet <i>grip</i>	2,019.00 ✓
1	Front bonnet rubber <i>12</i>	58.60 ✓
1	Front bonnet insulator <i>10</i>	219.51 ✓
10	Front bonnet insulator clips @ 5.50 <i>mm</i>	55.00 ✓
2	Front bonnet hinges @ 110.75 <i>best</i>	221.50 ✓
2	Front bonnet dampers - L/R @ 183.16 <i>best</i>	336.32 ✓
2	Front bumpers - L/R @ 978.95 <i>disht</i>	1,975.90 ✓
1	Front bumper - CTR <i>grip</i>	280.93 ✓
1	Front bumper lower guard <i>disht</i>	531.75 ✓
2	Front bumper fog lamps - L/R @ 289.83 <i>RH rem</i>	579.66 <i>20</i>
2	Front bumper fog lamps covers - L/R @ 110.23 <i>RH disht</i>	220.46 <i>10-22</i>
2	Front bumper spray nozzle covers @ 66.20 <i>RH disht</i>	132.40 <i>66.20</i>
1	Front bumper sponge <i>disht</i>	130.72 ✓
2	Front bumper securing strips @ 55 <i>mm</i>	110.00 ✓
2	Front bumper side guards - L/R @ 89.05 <i>disht</i>	179.10 ✓
2	Front bumper brackets @ 115 <i>best</i>	230.00 ✓
2	Front bumper side guides @ 68.55 <i>mm</i>	137.10 ✓
1	Front bumper reinforcement <i>best</i>	860.50 ✓
2	Front bumper reinforcement stays @ 135 <i>mm</i>	270.00 x
2	Front bumper side grips @ 42 <i>mm</i>	84.00 ✓
2	Front fenders - L/R 851.50 <i>disht</i>	1,703.00 ✓
2	Front fender inner shields - L/R @ 176.38 <i>green</i>	353.16 x
30	Front fender inner shield clips @ 4.50	135.00 +
1	Front fender wheel housing - RH <i>Pyic</i>	826.95 x
2	Front fender wheel arch garnishs @ 150.22 <i>disht</i>	300.44 ✓
1	Front door - LH <i>disht</i>	2,567.50 ✓
1	Front door protector <i>mm</i>	462.50 ✓
1	Front door side mirror assy <i>2</i>	1,153.50 +
1	Front door glass <i>mm</i>	1,055.65 +
1	Front door glass outer moulding <i>mm</i>	241.62 +
1	Front door glass run channel <i>mm</i>	481.93 +

Vehicle No.: SJF9972K

Vehicle Make & Model: AUDI Q3 2.0T

1	Front door outer handle	Damaged	190.63	✓
1	Front door inner lock	Damaged	581.43	✓
1	Front door inner board	Distorted	1,189.52	✓
1	Front door insulation	new	130.20	X
1	Front door glass regulator	Damaged	481.92	✓
1	Front door glass regulator motor	Damaged	485.60	✓
1	Front door frame inner pad	new	181.42	X
1	Front door w/strip	new	244.63	✓
1	Front door checker	Best	105.00	✓
2	Front door hinges @ 115	Best	230.00	✓
1	Front door pillar - LH	Damaged	1,465.00	X
1	Front grille assy	new	890.65	✓
2	Front grille PDC sensors @ 288.19	Damaged	576.38	✓
2	Front headlamps - L/R @ 1678.35	new	3,356.70	✓
2	Front headlamp HID control units @ 724.95	new	1,449.90	X
2	Front headlamp HID bulb - L/R @ 499.50		999.00	X
2	Front headlamp brackets @ 145	Best	290.00	✓
2	Front headlamp top mounts @ 81.27	Damaged	163.54	✓
2	Front headlamp side garnishes @ 48.55		97.10	X
2	Front headlamp spray nozzle pens @ 185.22		370.44	X
2	Front headlamp spray nozzle hose		180.65	X
1	Front support panel	Distorted	894.95	✓
1	Front support top garnish	new	148.55	✓
2	Front shock absorbers - L/R 581.90		1,163.80	X
2	Front lower arms - L/R @ 680.60		1,361.20	X
2	Horns @ 110.20		220.40	X
1	Air intercooler	Distorted	899.66	✓
1	Air intercooler intake duct	Damaged	189.55	✓
1	Air intercooler pipe - inlet	new	441.50	X
1	Air intercooler pipe - outlet	new	481.60	X
1	Air cleaner intake duct	new	461.50	✓
1	Air cleaner hose	new	180.90	✓
1	Air cleaner box assy	new	665.90	✓
1	Air cleaner resonator	new	421.20	X
1	Air con condenser	Distorted	870.85	✓
1	Air con discharge pipe	new	517.05	X
1	Air con suction pipe	Best	429.30	✓

23007.62

Vehicle No.: SJF9972K

Vehicle Make & Model: AUDi Q3 2.0T

1	Air con liquid pipe <i>MP MC</i>	292.95	X
1	Air con compressor <i>2yd</i>	1,490.50	✓
1	Air con compressor belt <i>ht</i>	281.90	✓
1	Air con fan motor <i>2yd</i>	577.80	✓
1	Air con fan blade <i>ht</i>	285.90	✓
1	Radiator assy <i>Debris</i>	866.90	✓
2	Radiator top mountings @ 18.60 <i>ven</i>	37.20	✓
1	Radiator top hose <i>twisted</i>	142.65	✓
1	Radiator bottom hose <i>ven</i>	180.95	X
2	Radiator bottom mountings @ 18.60 <i>ven</i>	37.20	✓
1	Radiator spare tank <i>3yd</i>	140.95	X
1	Radiator spare tank hose <i>ven</i>	120.63	X
1	Radiator fan cowling <i>couled</i>	344.89	✓
1	Radiator fan blade <i>ht</i>	285.90	✓
1	Radiator fan motor <i>2yd</i>	654.75	✓
1	Radiator fan motor relay <i>ven</i>	551.60	X
1	Thermostat housing <i>3yd</i>	191.63	X
1	Thermostat housing hose <i>ven</i>	162.43	X
1	Thermostat housing refrigerant hose <i>ven</i>	181.25	X
1	Trans oil cooler <i>2yd</i>	661.50	X
1	Trans oil cooler hose - inlet <i>2yd</i>	121.30	X
1	Trans oil cooler hose - outlet <i>2yd</i>	136.20	X
1	Power steering cooler pipe <i>2yd</i>	581.95	✓
1	Power steering cooler hose <i>2yd</i>	286.30	✓
1	Power steering oil tank <i>2yd</i>	128.95	X
1	Power steering hose <i>2yd</i>	110.32	X
1	Power steering oil tank bracket <i>ven</i>	105.20	X
1	Alternator assy <i>Damaged</i>	1,585.90	✓
1	Turbo charge intake pipe <i>2yd</i>	585.90	X
1	Turbo charge intake hose <i>2yd</i>	561.20	✓
1	Turbo charge head shield <i>2yd</i>	241.93	✓
1	Throttle body assy <i>2yd</i>	1,831.50	✓
1	Throttle body hose <i>2yd</i>	421.60	✓
1	Inlet manifold <i>2yd</i>	1,101.50	✓
1	Engine oil pump <i>2yd</i>	641.50	X
1	Engine undercover <i>2yd</i>	180.95	X
1	Engine air vacuum pump <i>2yd</i>	180.95	X

16292.63

Vehicle No.: SJF9972K

Vehicle Make & Model: AUDi Q3 2.0T

1	Engine E.C.U control unit	2,687.50 ✓
1 set	Engine room wire harness	1,899.63 ✓
1	Engine mounting - RH	341.50 ✓
1	Engine mounting - LH	321.60 ✓
1	Engine mounting - Rear	310.50 ✓
1	Main fuse box assy	1,085.60 +
1	Battery tray	121.60 +
1	Washer tank	180.93 +
1	Washer tank motor	130.55 +
1	Steering wheel	2,423.25 ✓
1	Steering wheel air bag	2,656.80 ✓
1	Steering wheel clock spring sensor	881.55 ✓
2	Safety belts - L/R @ 778.95	1,557.90 ✓
2	Safety belt trims - L/R @ 210.89	421.80 +
2	Safety belt buckles - L/R @ 280.60	561.20 +
1	Passenger air bag	3,891.93 ✓
1	Dashboard assy	4,905.90 ✓
2	Air bag impact sensors @ 280.50	561.00 ✓
1	Air bag control unit	1,897.60 ✓
1	Glove box compartment	310.60 +
Sub-total		84,362.89
Less 5%		4,218.14
Total List		80,144.75

494,000
46,000
46,000

Special Nett Items:

1 set	Front no. plate	60.00 35
2	Front wheel sport rims - L/R @ 550	110.00 ✓
2	Front tyres - L/R @ 480	960.00 +
1 bot	Air con oil	60.00 40
1 bot	Radiator coolant	65.00 40
4L	Trans fluid	120.00 +
1	Auto transmission gear assy - USED	4,500.00 +
Total Special Nett		5,875.00

Vehicle No.: SJF9972K

Vehicle Make & Model: AUDI Q3 2.0T

Labour Charges:

Towing charges	180.00 150.
To remove, refix front undercarriage	600.00 x
To lift up whole engine to assist repair	800.00 x
To remove, refix front interior trims to assist repair	180.00 100.
To remove, refix A/C condenser & refill A/C gas	180.00 150
To respray undercoating	200.00 60.
To check front electrical wiring	150.00 50.
To remove, refix auto transmission	450.00 x
To check wheel alignment	120.00 x
To diagnos, erase fault memory after repair	450.00 150.
To remove, refix engine parts	400.00 x
To remove, refix air bag systems	500.00 400
To remove, refix dashboard	450.00 250
To respray painting & etc	2,200.00 1400
Panel beating, cut, weld, remove & replacing above parts	4,500.00 1800
Total Labour	<u>6,860.00</u>

4510
Total 51555.91 11360
H/S: 3SK
2 days

LKK Auto Consultants hereby notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

ESTIMATE PARTS AND LABOUR GRAND TOTAL \$

92,879.75

92879.75



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION

Ref : CS/SPF17023793/Aqbe2

ACCIDENT CLAIM SECTION
(SINGAPORE POLICE FORCE)
1 MOUNT PLEASANT ROAD
BLK 8 OLD POLICE ACADEMY SINGAPORE 298333

Date : 01-02-2018



Code : SPF

1. Policy Particulars - THIRD PARTY CLAIM

Insured Veh.	GBC 7544L	Veh. Inspected	SJF 9972K
Policy No.		Coverage (\$)	0.00
Claim No.	AEMD/105/009/2017/173	Excess (\$)	0.00
Assign From	ABDUL RAHMAN	Assign Date	14/12/2017

2. Vehicle Particulars & Condition

Make & Model	AUDI Q3	c.c	1984
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	WAUZZZ8U6ER041502	Colour	WHITE
Odometer	-	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/55 R17	CONTINENTAL	6 mm
L/H Front Tyre	235/55 R17	CONTINENTAL	6 mm
R/H Rear Tyre	235/55 R17	CONTINENTAL	6 mm
L/H Rear Tyre	235/55 R17	CONTINENTAL	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY AND FRONT PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	13/12/2017	Inspection Date	15/12/2017
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	21 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJF 9972K

Qty	Description of Parts	Condition	Estimate By Workshop(\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT BONNET	DISTORTED	2,019.00	2,019.00
1	FRONT BONNET RUBBER	CUT	58.60	58.60
1	FRONT BONNET INSULATOR	CRUMPLED	219.51	219.51
10	FRONT BONNET INSULATOR CLIPS @\$5.50	NECESSARY	55.00	55.00
2	FRONT BONNET HINGES @\$110.75	BENT	221.50	221.50
2	FRONT BONNET DAMPERS - L/R @\$183.16	BENT	336.32	336.32
2	FRONT BUMPERS - L/R @\$978.95	DISTORTED	1,975.90	1,975.90
1	FRONT BUMPER - CTR	DISTORTED	280.93	280.93
1	FRONT BUMPER LOWER GUARD	DISTORTED	531.75	531.75
2	FRONT BUMPER FOG LAMPS - L/R @\$289.83	O/S CRACKED	579.66	289.83
2	FRONT BUMPER FOG LAMPS COVERS - L/R @\$110.23	O/S DISTORTED	220.46	110.23
2	FRONT BUMPER SPRAY NOZZLE COVERS @\$66.20	O/S DAMAGED	132.40	66.20
1	FRONT BUMPER SPONGE	CRACKED	130.72	130.72
2	FRONT BUMPER SECURING STRIPS @\$55.00	NECESSARY	110.00	110.00
2	FRONT BUMPER SIDE GUARDS - L/R @\$89.05	DISTORTED	179.10	179.10
2	FRONT BUMPER BRACKETS @\$115.00	BENT	230.00	230.00
2	FRONT BUMPER SIDE GUIDES @\$68.55	NECESSARY	137.10	137.10
1	FRONT BUMPER REINFORCEMENT	BENT	860.50	860.50
2	FRONT BUMPER REINFORCEMENT STAYS @\$135.00	NOT NECESSARY	270.00	-
2	FRONT BUMPER SIDE GRIPS @\$42.00	NECESSARY	84.00	84.00
2	FRONT FENDER - L/R @\$851.50	DISTORTED	1,703.00	1,703.00
2	FRONT FENDER INNER SHIELDS - L/R @\$176.38	NOT NECESSARY	353.16	-
30	FRONT FENDER INNER SHIELD CLIPS @\$4.50	NOT NECESSARY	135.00	-
1	FRONT FENDER WHEEL HOUSING - RH	TO REPAIR SEE LABOUR	826.95	-
2	FRONT FENDER WHEEL ARCH GARNISH @\$150.22	DEFORMED	300.44	300.44
1	FRONT DOOR - LH	DISTORTED	2,567.50	2,567.50
1	FRONT DOOR PROTECTOR	MISSING	462.50	462.50
1	FRONT DOOR SIDE MIRROR ASSY	NOT NECESSARY	1,153.50	-
1	FRONT DOOR GLASS	NOT NECESSARY	1,055.65	-
1	FRONT DOOR GLASS OUTER MOULDING	NOT NECESSARY	241.62	-
1	FRONT DOOR GLASS RUN CHANNEL	NOT NECESSARY	481.93	-
1	FRONT DOOR OUTER HANDLE	DAMAGED	190.63	190.63
1	FRONT DOOR INNER LOCK	DAMAGED	581.43	581.43

Report Ref No. CS/SPF17023793/Aqbe2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR INNER BOARD	DEFORMED	1,189.52	1,189.52
1	FRONT DOOR INSULATION	NOT NECESSARY	130.20	-
1	FRONT DOOR GLASS REGULATOR	DAMAGED	481.92	481.92
1	FRONT DOOR GLASS REGULATOR MOTOR	DAMAGED	485.60	485.60
1	FRONT DOOR FRAME INNER PAD	NOT NECESSARY	181.42	-
1	FRONT DOOR W/STRIP	NECESSARY	244.63	244.63
1	FRONT DOOR CHECKER	BENT	105.00	105.00
2	FRONT DOOR HINGES @\$115.00	BENT	230.00	230.00
1	FRONT DOOR PILLAR - LH	TO REPAIR SEE LABOUR	1,465.00	-
1	FRONT GRILLE ASSY	CRACKED	890.65	890.65
2	FRONT GRILLE PDC SENSORS @\$288.19	DAMAGED	576.38	576.38
2	FRONT HEADLAMPS - L/R @\$1678.35	CRACKED	3,356.70	3,356.70
2	FRONT HEADLAMP HID CONTROL UNITS @\$724.95	NOT NECESSARY	1,449.90	-
2	FRONT HEADLAMP HID BULB - L/R @\$499.50	NOT NECESSARY	999.00	-
2	FRONT HEADLAMP BRACKETS @\$145.00	BENT	290.00	290.00
2	FRONT HEADLAMP TOP MOUNTS @\$81.27	DAMAGED	163.54	163.54
2	FRONT HEADLAMP SIDE GARNISH @\$48.55	NOT NECESSARY	97.10	-
2	FRONT HEADLAMP SPRAY NOZZLE PENS @\$185.22	NOT NECESSARY	370.44	-
2	FRONT HEADLAMP SPRAY NOZZLE HOSE	NOT NECESSARY	180.65	-
1	FRONT SUPPORT PANEL	DISTORTED	894.95	894.95
1	FRONT SUPPORT TOP GARNISH	DEFORMED	148.55	148.55
2	FRONT SHOCK ABSORBER - L/R @\$581.90	NOT NECESSARY	1,163.80	-
2	FRONT LOWER ARM - L/R @\$680.60	NOT NECESSARY	1,361.20	-
2	HORNS @\$110.20	NOT NECESSARY	220.40	-
1	AIR INTERCOOLER	DISTORTED	899.66	899.66
1	AIR INTERCOOLER INTAKE DUCT	DAMAGED	189.55	189.55
1	AIR INTERCOOLER PIPE - INLET	NOT NECESSARY	441.50	-
1	AIR INTERCOOLER PIPE - OUTLET	NOT NECESSARY	481.60	-
1	AIR CLEANER INTAKE DUCT	DEFORMED	461.50	461.50
1	AIR CLEANER HOSE	DEFORMED	180.90	180.90
1	AIR CLEANER BOX ASSY	DEFORMED	665.90	665.90
1	AIR CLEANER RESONATOR	NOT NECESSARY	421.20	-
1	AIR CON CONDENSER	DISTORTED	870.85	870.85
1	AIR CON DISCHARGE PIPE	NOT NECESSARY	517.05	-
1	AIR CON SUCTION PIPE	BENT	429.30	429.30

Report Ref No. CS/SPF17023793/Aqbe2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop(\$)	Our Adjusted (\$)
1	AIR CON LIQUID PIPE	NOT NECESSARY	292.95	-
1	AIR CON COMPRESSOR	DAMAGED	1,490.50	1,490.50
1	AIR CON COMPRESSOR BELT	CUT	281.90	281.90
1	AIR CON FAN MOTOR	DAMAGED	577.80	577.80
1	AIR CON FAN BLADE	CUT	285.90	285.90
1	RADIATOR ASSY	DISTORTED	866.90	866.90
2	RADIATOR TOP MOUNTINGS @\$18.60	NECESSARY	37.20	37.20
1	RADIATOR TOP HOSE	TWISTED	142.65	142.65
1	RADIATOR BOTTOM HOSE	NOT NECESSARY	180.95	-
2	RADIATOR BOTTOM MOUNTINGS @\$18.60	NECESSARY	37.20	37.20
1	RADIATOR SPARE TANK	NOT NECESSARY	140.95	-
1	RADIATOR SPARE TANK HOSE	NOT NECESSARY	120.63	-
1	RADIATOR FAN COWLING	CRACKED	344.89	344.89
1	RADIATOR FAN BLADE	CUT	285.90	285.90
1	RADIATOR FAN MOTOR	DAMAGED	654.75	654.75
1	RADIATOR FAN MOTOR RELAY	NOT NECESSARY	551.60	-
1	THERMOSTAT HOUSING	NOT NECESSARY	191.63	-
1	THERMOSTAT HOUSING HOSE	NOT NECESSARY	162.43	-
1	THERMOSTAT HOUSING REFRIGERANT HOSE	NOT NECESSARY	181.25	-
1	TRANS OIL COOLER	NOT NECESSARY	661.50	-
1	TRANS OIL COOLER HOSE - INLET	NOT NECESSARY	121.30	-
1	TRANS OIL COOLER HOSE - OUTLET	NOT NECESSARY	136.20	-
1	POWER STEERING COOLER PIPE	NOT NECESSARY	581.95	-
1	POWER STEERING COOLER HOSE	NOT NECESSARY	286.30	-
1	POWER STEERING OIL TANK	NOT NECESSARY	128.95	-
1	POWER STEERING HOSE	NOT NECESSARY	110.32	-
1	POWER STEERING OIL TANK BRACKET	NOT NECESSARY	105.20	-
1	ALTERNATOR ASSY	DAMAGED	1,585.90	1,585.90
1	TURBO CHARGE INTAKE PIPE	NOT NECESSARY	585.90	-
1	TURBO CHARGE INTAKE HOSE	NOT NECESSARY	561.20	-
1	TURBO CHARGE HEAD SHIELD	NOT NECESSARY	241.93	-
1	THROTTLE BODY ASSY	NOT NECESSARY	1,831.50	-
1	THROTTLE BODY HOSE	NOT NECESSARY	421.60	-
1	INLET MANIFOLD	NOT NECESSARY	1,101.50	-
1	ENGINE OIL PUMP	NOT NECESSARY	641.50	-
1	ENGINE UNDERCOVER	NOT NECESSARY	180.95	-

Report Ref No. CS/SPF17023793/Aqbe2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ENGINE AIR VACUUM PUMP	NOT NECESSARY	180.95	-
1	ENGINE E.C.U CONTROL UNIT	NOT NECESSARY	2,687.50	-
1	SET ENGINE ROOM WIRE HARNESS	NOT NECESSARY	1,899.63	-
1	ENGINE MOUNTING - RH	NOT NECESSARY	341.50	-
1	ENGINE MOUNTING - LH	NOT NECESSARY	321.60	-
1	ENGINE MOUNTING - REAR	NOT NECESSARY	310.50	-
1	MAIN FUSE BOX ASSY	NOT NECESSARY	1,085.60	-
1	BATTERY TRAY	NOT NECESSARY	121.60	-
1	WASHER TANK	NOT NECESSARY	180.93	-
1	WASHER TANK MOTOR	NOT NECESSARY	130.55	-
1	STEERING WHEEL	NOT NECESSARY	2,423.25	-
1	STEERING WHEEL AIR BAG	ACTIVATED	2,656.80	2,656.80
1	STEERING WHEEL CLOCK SPRING SENSOR	ACTIVATED	881.55	881.55
2	SAFETY BELTS - L/R @\$778.95	ACTIVATED	1,557.90	1,557.90
2	SAFETY BELT TRIMS - L/R @\$210.89	NOT NECESSARY	421.80	-
2	SAFETY BELT BUCKLES - L/R @\$280.60	NOT NECESSARY	561.20	-
1	PASSENGER AIR BAG	ACTIVATED	3,891.93	3,891.93
1	DASHBOARD ASSY	TORN	4,905.90	4,905.90
2	AIR BAG IMPACT SENSORS @\$280.50	ACTIVATED	561.00	561.00
1	AIR BAG CONTROL UNIT	ACTIVATED	1,897.60	1,897.60
1	GLOVE BOX COMPARTMENT	NOT NECESSARY	310.60	-
	LESS 5% DISCOUNT		-4,218.14	-2,470.05
			80,144.75	46,930.91
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT NO. PLATE (SN)	BENT	60.00	35.00
2	FRONT WHEEL SPORT RIMS - L/R @\$550.00 (SN)	NOT NECESSARY	110.00	-
2	FRONT TYRES - L/R @\$480.00 (SN)	NOT NECESSARY	960.00	-
1	BOT AIR CON OIL (SN)	NECESSARY	60.00	40.00
1	BOT RADIATOR COOLANT (SN)	NECESSARY	65.00	40.00
4	L TRANS FLUID (SN)	NOT NECESSARY	120.00	-
1	AUTO TRANSMISSION GEAR ASSY - USED (SN)	NOT NECESSARY	4,500.00	-
			5,875.00	115.00
	<u>LABOUR</u>			
	TOWING CHARGES.		180.00	150.00
	TO REMOVE, REFIX FRONT UNDERCARRIAGE.	NOT NECESSARY	600.00	-

Report Ref No. CS/SPF17023793/Aqbe2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO LIFT UP WHOLE ENGINE TO ASSIST REPAIR.		800.00	-
	TO REMOVE, REFIX FRONT INTERIOR TRIMS TO ASSIST REPAIR.		180.00	100.00
	TO REMOVE, REFIX A/C CONDENSER & REFILL A/C GAS.		180.00	150.00
	TO RESPRAY UNDERCOATING.		200.00	60.00
	TO CHECK FRONT ELECTRICAL WIRING.		150.00	50.00
	TO REMOVE, REFIX AUTO TRANSMISSION.	NOT NECESSARY	450.00	-
	TO CHECK WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	TO DIAGNOS, ERASE FAULT MEMORY AFTER REPAIR.		450.00	150.00
	TO REMOVE, REFIX ENGINE PARTS.	NOT NECESSARY	400.00	-
	TO REMOVE, REFIX AIR BAG SYSTEMS.		500.00	400.00
	TO REMOVE, REFIX DASHBOARD.		450.00	250.00
	TO RESPRAY PAINTING & ETC.		2,200.00	1,400.00
	PANEL BEATING, CUT, WELD, REMOVE & REPLACING ABOVE PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER WHEEL HOUSING - RH AND FRONT DOOR PILLAR - LH.		4,500.00	1,800.00
			11,360.00	4,510.00
GRAND TOTAL			97,379.75	51,555.91

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			35,000.00
---	--	--	------------------

Report Ref No. CS/SPF17023793/Aqbe2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.