

ASS. REC BY: CS/MSG17024206 / R1qd3
Car/Vent: Rasul
From (Persons): Winnie Chua
ASSIGNMENT (Office): MSG
Date/Time: 20/12/17 @ 2:17pm
Estimated Cost: _____ Bill to: _____

OD: TP+WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SKB 8383B Insured: _____

at Workshop: Inline Auto Tel: 6710 4876 - TM

of 5 Soon Lee street #01-57 627607 pioneer

Policy No: A28744453QMY Claim No: 541139

Sum Insured: _____ Excess: \$ 600.00

Make of Veh: _____ DOA: 14/12/2017
(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 9:05am @ 21/12/17 Person Contacted: Tay Vehicle: IN OUT

Date/Time: _____ Action/Instruction (✓) Estimate

Pls check tyre and Brake system in order.

SKB 8383B-X

22/12/17 @ 4:37pm revert to Winnie Chua via Merimen.

22/12/17 Winnie Chua said cost +15% + labour = ?? x 80% as LS best.

22/12/17 @ 10:20am Siew Wei informed C/A @ LS \$281k

22/12/17 @ 10:37am informed Vicky C/A not more than LS \$281k & ex: \$610.

Topic

90496

COE LPIRY: 2021/may

ASSIGNMENT

Ver No: SKB 838313 Yr Regn: 2011 may

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make B.M.M 740 LIA cc 2979

Colour	Black	A/C	Insured / Std / NI / NA
--------	-------	-----	-------------------------

Sp. Reading 17 2089 Tr/Radio: Insured / Std / NI / NA

Eng/No:

C/No: W3AKB42000CY83391

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: Order / Jammed / Leaked / Burnt or

Modi : Nil / Si Rlm / STD A/Rlm of

Tyre Size: F: 245 50R18

R. 1. 4.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or *Constantine*

Front	6	mm	Rear	6	mm
R/Bal.			R/Bal.		

Technical drawing of a mechanical part, likely a bracket or support, showing two views: a front view (top) and a side view (bottom). The front view shows a rectangular base with a vertical support on the right side. The side view shows the profile of the part, including a curved top surface. Dimensions are provided in millimeters (mm).

Dimensions (mm):

- Overall width: 100
- Overall height: 100
- Base width: 60
- Base height: 10
- Support width: 10
- Support height: 60
- Top surface width: 40
- Top surface height: 10
- Curved top surface radius: R10

D.O.A. 14/12/12 D.O.I. 21/12/17

Survey held at INLINE Ant

Des. of Damages (Frt / Rear / O/S / N/S / U/C / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Action / Instruction
US \$ 28000, 9 days (red \$ 14848, 35%)

COR seen
24/04/18

RECEIVED 24 APR 2018

☐: Prell. Report

Days Of Repair: 4

☐ : Final Report

Resurvey No. of Trip:

Survey Fee

2

Add Fee: Site Insc: \$

Transportation

MEP-92

Lump Sum / L.B.A: (S) 28000

Site Insc 18

☐ Interview (S)

☐ Tech. Inv. (2)

Washington (S)

Pharmaceutical

1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 2680, 26

1000



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MSIG INSURANCE (SINGAPORE) PTE LTD		Ref : CS/MSG17024206/R1qd3	
16 RAFFLES QUAY #24-01 HONG LEONG BLDG SINGAPORE 048581		Date : 21-12-2017	
		Code : MSG	
1. Policy Particulars :- OWN DAMAGE			
Insured Veh.		Veh. Inspected	SKB 8383B
Policy No.	A28744453QMY	Coverage (\$)	0.00
Claim No.	541139	Excess (\$)	600.00
Assign From	MERIMEN (WINNIE CHUA)	Assign Date	21/12/2017
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	14/12/2017	Inspection Date	21/12/2017
Survey held at	-		
5a. Remarks			
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)			
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.			

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Int Auth'd	Status
Main	18 Dec 2017		20 Dec 2017 14:17 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	WEE CHIN CHYE, ID: S1799049G, Tel: +6596932992, Email: NOEMAIL		
Vehicle Reg. No.:	SKB8383B	Date of Loss:	14/12/2017 17:00 - :59
Claim Type:	OD / 541139	Policy/Cover Note No.:	A28744453QMY (Comprehensive) Coverage: 20/05/2017 - 19/05/2018
		Excess:	S\$600.00
Repairer:	Inline Auto Pte Ltd (HQ) 5 Soon Lee Street #01-57, Pioneer Point Singapore 627607, 627607 Pioneer - Tel: 67104876		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Winnie Chua Ping Ping - 6594 2556]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 21/12/2017]		
Driver/Custodian:	WEE CHIN CHYE (50 / Male), NRIC: S1799049G, Tel: +6596932992		
Adj Asg. Remarks:	Please check whether the tyre and brake system in order. 2 round of maintenance records are in merimen. Please revert. tks.		

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

The vehicle ~~sustained~~ badly damaged ^{at the} in front ^{portion}. Operational test to the braking sys. unable to be ~~contact~~ conducted. However, the static brake ~~do~~ test indicate ~~the~~ show that the brake sys. is in order. Tyre condition in serviceable condition with ~~damaged~~ ~~and the remaining~~ — am

Winnie Chua

From: info@inlineauto.com
Sent: Tuesday, 19 December, 2017 5:44 PM
To: Winnie Chua
Subject: Re: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139 (to arrange survey?)
Attachments: ic, driving licence.pdf; recent 2 invoice SKB8383B.pdf; Quotation#321 (SKB8383B).pdf

Hi Winnie,

Kindly refer attached.

The towing fee will forwards to u by tomorrow.

Thank you & best regards.

INLINE AUTO PTE LTD
6710 4876
VICKY

Quoting Winnie Chua <pingping_chua@sg.msig-asia.com>:

> Dear Mr Tay,
>
> Please let us have:
>
>
> 1) Estimates, copy of ic, driving licence and certificate of insurance
>
> 2) Original towing fee
>
> 3) 2 round of maintenance records.
>
> Best Regards
>
> Winnie Chua
> Admin Officer, Claims Services (Motor) Direct line +65 6594 2556 |
> Direct fax +65 6225 7402 |
> pingping_chua@sg.msig-asia.com<mailto:pingping_chua@sg.msig-asia.com>
>
> [cid:image001.png@01D378C0.E23A1E70]

>
> MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong
> Building, Singapore 048581 | T: +65 6220 9644 | F: +65 6225
> 6371 | Co. Reg. No. 200412212G |
> msig.com.sg<<https://www.msig.com.sg>> [fb msig sg]
> <<https://www.facebook.com/msigsg/>> [twitter MSIG_SG]
> <https://twitter.com/MSIG_SG> [in msig sg]
> <<https://www.linkedin.com/company-beta/1905007/>> [MSIGSingapore]
> <<https://www.youtube.com/user/MSIGSingapore>>

>
> [MS&AD_Extract 150%]

>
>
>
>
> _____
>

> CONFIDENTIALITY NOTICE

> This e-mail (including any attachments) may contain information that
> is privileged or confidential. The sending of this e-mail to any
> person other than the intended recipient is not a waiver of the
> privilege or confidentiality that attaches to it. If you are not the
> intended recipient, please notify the sender immediately, delete the
> email and do not copy, distribute or disclose its contents.

TO:

CLAIM NO:

LETTER OF UNDERTAKING

FOR THE REPAIR OF VEHICLE NO. SKB 8383B .

We, the undersigned, confirm that we will undertake to repair the vehicle bearing

Registration No SKB 8383B to its pre-accident condition, and to the satisfaction of its

owner, at a total cost not exceeding not more than \$28,000.00 on Lump Sum basis (before excess)

subject to no breach of Terms & Condition of the POLICY, and to the legal requirement of the local Land Transport Authority (LTA).

There should be **no further supplementary** to the repair cost.

The repair job should not be exceeding NA days to complete the entire repair.

29/12/2017.

Date



Workshop Stamp/ Signature



29/12/2017

Date

Rasul

Witness by surveyor

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Friday, 29 December, 2017 10:37 AM
To: info@inlineauto.com
Cc: SUR
Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139 (Pending approval)
Attachments: SKB 8383B UNDERTAKING LETTER.pdf

Dear Vicky,

As instructed by our client, please proceed to repair the insured vehicle SKB 8383B at repair cost not more than Lump Sum \$28,000.00 (excess \$600/-).

Please take noted that the towing fee is subject to receipt and sign & cop the undertaking letter and send it back to us.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Wishes you a Happy New Year 2018

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25
| S(408933)

-----Original Message-----

From: info@inlineauto.com [mailto:info@inlineauto.com]

Sent: Friday, 29 December, 2017 10:00 AM

To: Shiau Chan (LKKAuto) <siewsc@lkkauto.com>

Subject: Re: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139 (Pending approval)

Hi Shiau Chan,

Mr Tay said for SKB8383B sum of the repair around SGD\$ 28K.

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	18 Dec 2017 10:54	Clim Veh Model Changed	(201451) BMW 740i 3.0 (A).	[I] Winnie Chua Ping Ping
2	18 Dec 2017 10:54	Clim Created	Reg No: SKB8383B, Policy No: A28744453QMY, Acct Date: 2017/12/14, Claim Type: OD, Insurer: MSIG Insurance (Singapore) Pte. Ltd. (HQ), Workshop: Inline Auto Pte Ltd (HQ), Ins.Status => Incoming Claim, Created from SAS:MVA117165145	[I] Winnie Chua Ping Ping
3	20 Dec 2017 09:11	Adj Co Assigned	MSIG Insurance (Singapore) Pte. Ltd. (Internal Surveyor):Please check whether the tyre and brake system in order. 2 round of maintenance records are in merimen. Please revert. tks.	[I] Winnie Chua Ping Ping
4	20 Dec 2017 09:11	Adj Next Rpt Changed	Next Rpt:Im, Advice, Due Date:2017/12/21	[I] Winnie Chua Ping Ping
5	20 Dec 2017 09:11	Adj Mandate Set	Approved:25000.00.Reinsp:Adj decides.	[I] Winnie Chua Ping Ping
6	20 Dec 2017 09:21	Assignment 1st Accessed		[A] Pauline Soh Li Ping
7	20 Dec 2017 14:17	Adj Assignment Cancelled	LKK	[I] Winnie Chua Ping Ping
8	20 Dec 2017 14:17	Adj Est Details Deleted	Deleting Est Details For Cancelling Adjuster Assignment	[I] Winnie Chua Ping Ping
9	20 Dec 2017 14:17	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):Please check whether the tyre and brake system in order. 2 round of maintenance records are in merimen. Please revert. tks.	[I] Winnie Chua Ping Ping
10	20 Dec 2017 14:17	Adj Next Rpt Changed	Next Rpt:Im, Advice, Due Date:2017/12/21	[I] Winnie Chua Ping Ping
11	20 Dec 2017 14:17	Adj Mandate Set	Approved:25000.00.Reinsp:Adj decides.	[I] Winnie Chua Ping Ping
12	20 Dec 2017 14:17	Assignment 1st Accessed		[A] LOW AI PHING
13	21 Dec 2017 14:49	Adj Adjuster Assigned	[None] -> MOHD RASUL	[A] Nivitha Govindasamy
14	22 Dec 2017 15:54	Adj Rpt Initiated		[A] SHIAU CHAN
15	22 Dec 2017 16:36	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2018/01/19	[A] SHIAU CHAN
16	22 Dec 2017 16:36	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2018/01/19	[A] SHIAU CHAN
17	22 Dec 2017 16:37	Adj Mandate Request	Cur.Reg:40819.00:DAMAGES CONSISTENT. THE VEHICLE BADLY DAMAGED AT THE FRONT PORTION. OPERATIONAL TEST TO THE BRAKING SYSTEM UNABLE TO BE CONDUCTED. HOWEVER, STATIC BRAKE TEST SHOW THAT THE BRAKING SYSTEM IS IN ORDER. TYRE CONDITION IN SERVICEABLE	[A] SHIAU CHAN
18	27 Dec 2017 15:33	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2018/01/19, Mandate Remarks: please advise if repair at cost plus or list? thank you.	[I] Lui Siew Wei
19	27 Dec 2017 15:33	Adj Mandate Set	Approved:0.00:please advise if repair at cost plus or list? thank you.	[I] Lui Siew Wei
20	28 Dec 2017 16:33	Adj Mandate Request	Cur.Reg:40819.00:According to the repairer, they will the repair the vehicle at Lump Sum basis with list parts prices. Disagreement to adopt "cost-plus" repair form uploaded in Merimen System. KINDLY ADVISE THE REPAIR COST TO OFFER REPAIRER. (MAR	[A] SHIAU CHAN
21	29 Dec 2017 10:20	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2018/01/19. Mandate Remarks: a if c; check items to be confirmed repair cost @ lump sum limit at \$28K & is subject to finalisation please negotiate spare parts at list less 10% + labor less 20% towing fee is subject to r	[I] Lui Siew Wei
22	29 Dec 2017 10:20	Adj Mandate Set	Approved:28000.00:a if c; check items to be confirmed repair cost @ lump sum limit at \$28K & is subject to finalisation please negotiate spare parts at list less 10% + labor less 20% towing fee is subject to receipt thank you	[I] Lui Siew Wei

ACTIVITY

[20/12/2017 14:16] Pauline Soh Li Ping:
Car in, IHS unable to attend (ET & AL-Appr full, DC - Meeting)
[20/12/2017 14:13] Pauline Soh Li Ping:
Typo error. Should be no one pick call
[20/12/2017 14:13] Pauline Soh Li Ping:
Pending for workshop to arrange and revert with survey appt.
[20/12/2017 14:08] Pauline Soh Li Ping:
No one pick call
* [20/12/2017 09:26] Pauline Soh Li Ping:
No one pick call



Vehicle No SKB 8383B .
Date of Accident 14.12.17 .
Date of Survey 21.12.17 .

**DISAGREEMENT TO ADOPT "COST-PLUS" REPAIR BY WORKSHOP
(OWN DAMAGE CLAIM)**

I, TAY CHOON CHOON (workshop's Service Advisor),
hereby confirm that INLINE AUTO (name of Workshop)
is not agreeable to adopt "Cost-Plus" basis for the settlement of the own
damage claim for vehicle number SKB 8383B .

Surveyor

Workshop's Service Advisor

Signature _____

Signature 

Name _____

Name TAY CHOON CHOON

Date/Time _____

Date/Time 28.12.17 .

Reason for not signing this form by Workshop's Service Advisor, if applicable
(To be completed by Surveyor):

**MSIG**


Vehicle No SKB 8383B .
 Date of Accident 14.12.17 .
 Date of Survey 21.12.17 .

**DISAGREEMENT TO ADOPT "COST-PLUS" REPAIR BY WORKSHOP
 (OWN DAMAGE CLAIM)**

I, TAY CHOON CHOON (workshop's Service Advisor),
 hereby confirm that INLINE AUTO (name of Workshop)
 is not agreeable to adopt "Cost-Plus" basis for the settlement of the own
 damage claim for vehicle number SKB 8383B .

SurveyorWorkshop's Service Advisor

Signature _____

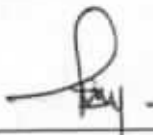Signature 

Name _____

Name TAY CHOON CHOON

Date/Time _____

Date/Time 28.12.17 .

Reason for not signing this form by Workshop's Service Advisor, if applicable
 (To be completed by Surveyor):

Shiau Chan (LKKAUTO)

To: Lui Siew Wei; Winnie Chua; SUR; Joslin Lim
Cc: Christopher Chionh
Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139

Dear Siew Wei,

According to the repairer, they will repair the vehicle at Lump Sum basis with list parts prices.

~~We are pending for their disagreement to adopt "cost-plus" repair form.~~ *uploaded in Memo.*

Wishes you a Happy New Year 2018

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25
| S(408933)

-----Original Message-----

From: Shiau Chan (LKKAUTO)

Sent: Thursday, 28 December, 2017 9:21 AM

To: Lui Siew Wei <siewwei_lui@sg.msig-asia.com>; Winnie Chua <pingping_chua@sg.msig-asia.com>; SUR
<sur@lkkauto.com>; Joslin Lim <joslin_lim@sg.msig-asia.com>

Cc: Christopher Chionh <christopher_chionh@sg.msig-asia.com>

Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139

Dear Siew Wei,

Noted.

Wishes you a Happy New Year 2018

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25
| S(408933)

-----Original Message-----

From: Lui Siew Wei [mailto:siewwei_lui@sg.msig-asia.com]

Sent: Thursday, 28 December, 2017 8:42 AM

To: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>; Winnie Chua <pingping_chua@sg.msig-asia.com>; SUR
<sur@lkkauto.com>; Joslin Lim <joslin_lim@sg.msig-asia.com>

Cc: Christopher Chionh <christopher_chionh@sg.msig-asia.com>

Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139

Dear Shiau Chan,

We refer to your earlier email.

We have spoken to your surveyor about the parts price at list price.

Please continue to liaise with workshop if they can repair at cost plus basis.

Please come back to us soon.

Thank you.

Siew Wei

-----Original Message-----

From: Shiau Chan (LKKAuto) [mailto:siewsc@lkkauto.com]

Sent: Wednesday, 27 December, 2017 6:08 PM

To: Winnie Chua <pingping_chua@sg.msig-asia.com>; SUR <sur@lkkauto.com>; Joslin Lim <joslin_lim@sg.msig-asia.com>

Cc: Lui Siew Wei <siewwei_lui@sg.msig-asia.com>

Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139

Dear Winnie,

1. Photos have been uploaded in Merimen.

2. The maintenance records provided had showed the vehicle was well maintained. Several wear & tear parts were placed. Engine oil, coolant were also replaced as seen from the records provided.

3. The rear absorber was intact and not sunken down.

Wishes you a Happy New Year 2018

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25
| S(408933)

-----Original Message-----

From: Shiau Chan (LKKAuto)

Sent: Wednesday, 27 December, 2017 11:24 AM

To: Winnie Chua <pingping_chua@sg.msig-asia.com>; SUR <sur@lkkauto.com>

Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139

Dear Winnie,

Thank you for the email.

We will check and revert to you.

Wishes you a Happy New Year 2018

Best Regards,

Shiau Chan (LKKAuto)

From: Winnie Chua <pingping_chua@sg.msig-asia.com>
Sent: Wednesday, 27 December, 2017 10:43 AM
To: SUR
Subject: FW: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139
Importance: High

Dear Shiau Chan,

Please refer to the email below.

We have requested more internal servicing records from the workshop, eg. Change engine oil, filter, last change of tyre?

We need the following from you:

- 1) Surveyed photos (in merimen),
- 2) Your comments on the 2 maintenance records given by workshop, if it applicable for this accident.
- 3) Has the rear absorber sunken down? *No*

*This vehicle has
regular
maintenance.*

Best Regards

Winnie Chua
Admin Officer, Claims Services (Motor)
Direct line +65 6594 2556 | Direct fax +65 6225 7402 | pingping_chua@sg.msig-asia.com

MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong Building, Singapore 048581 | T: +65 6220 9644
| F: +65 6225 6371 | Co. Reg. No. 200412212G | msig.com.sg

-----Original Message-----

*cost x 1.15%
+ labour
= 72 x 80%*

R

1.) Photos have been uploaded in
Merimen

From: Winnie Chua
Sent: Wednesday, 27 December, 2017 10:31 AM
To: 'info@inlineauto.com' <info@inlineauto.com>
Subject: RE: OD CLAIM SKB8383B DOA: 14/12/2017 OUR REF: M541139
Importance: High

Dear Mr Tay,

Do you still have any other internal servicing record, eg. Change engine oil, filter, last change of tyre?

Please forward to us for our perusal.

Best Regards

*2.) The maintenance records provided
had
been showed the vehicle was
well maintained. Several wear & tear
parts have placed. Engine oil, coolant
coolant¹ were also upload as seen from
the records provided.
3.) The rear absorber was intact and not sunken down.*

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Winnie Chua Ping Ping

Date: 22 Dec 2017

Preliminary Advice

Vehicle No	: SKB8383B	Accident Date	: 14/12/2017
Make	: BMW 740I	Policy No.	: A28744453QMY
Assignment Date	: 20/12/2017	Excess	: S\$600.00
Date of Inspection	: 21/12/2017	Est. Duration of Repair	: 9.00
Inspection At	: INLINE AUTO PTE LTD (HQ) 5 SOON LEE STREET #01-57, PIONEER POINT SINGAPORE 627607 SINGAPORE 627607		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	42,848.00
Revised Amount	:S\$	31,017.00
Check Items (Estimated)	:S\$	9,802.00
Total	:S\$	40,819.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	102,000.00
COE / PARF Rebate	:S\$	70,256.00
Salvage Value	:S\$	
Margin for Repair	:S\$	31,744.00

Remarks

() The vehicle is economical/ not economical for repair.

(X) The above survey was conducted on a 'without prejudice' basis.
THE VEHICLE BADLY DAMAGED AT THE FRONT PORTION. OPERATIONAL TEST TO THE BRAKING SYSTEM UNABLE TO BE CONDUCTED. HOWEVER, STATIC BRAKE TEST SHOW THAT THE BRAKING SYSTEM IS IN ORDER. TYRE CONDITION IN SERVICEABLE CONDITION WITH REMAINING 6mm. KINDLY ADVISE THE REPAIR COST TO OFFER REPAIRER. (MARGIN OF REPAIR: \$31,744.00)
REPAIRER ASKING FOR LUMP SUM REPAIR BASIS.

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Winnie Chua Ping Ping

Date: 22 Dec 2017

Preliminary Advice

Vehicle No	: SKB8383B	Accident Date	: 14/12/2017
Make	: BMW 740I	Policy No.	: A28744453QMY
Assignment Date	: 20/12/2017	Excess	: S\$600.00
Date of Inspection	: 21/12/2017	Est. Duration of Repair	: 9.00
Inspection At	: INLINE AUTO PTE LTD (HQ) 5 SOON LEE STREET #01-57, PIONEER POINT SINGAPORE 627607 SINGAPORE 627607		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	42,848.00
Revised Amount	:S\$	31,017.00
Check Items (Estimated)	:S\$	9,802.00
Total	:S\$	40,819.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	102,000.00
COE / PARF Rebate	:S\$	70,256.00
Salvage Value	:S\$	
Margin for Repair	:S\$	31,744.00

Remarks

() The vehicle is economical/ not economical for repair.

(X) The above survey was conducted on a 'without prejudice' basis.
THE VEHICLE BADLY DAMAGED AT THE FRONT PORTION. OPERATIONAL TEST TO THE BRAKING SYSTEM UNABLE TO BE CONDUCTED. HOWEVER, STATIC BRAKE TEST SHOW THAT THE BRAKING SYSTEM IS IN ORDER. TYRE CONDITION IN SERVICEABLE CONDITION WITH REMAINING 6mm. KINDLY ADVISE THE REPAIR COST FOR OFFER REPAIRER. (MARGIN OF REPAIR: \$31,744.00) REPAIRER ASKING FOR LUMP SUM REPAIR BASIS.



- Which bank offers the highest Fixed Deposit rates?
- Vios returns to BM in 2018
- The Perfect Storm of the Stock Market II

Username / Email Add
 password

[Sign Up New Account](#)
[Forgot Password](#)

Post an Advertisement
 Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [Ways of Selling](#)

New 5 Year Coe Renewal Toyota Wish 1.8A



\$2000 Downpayment Monthly
 From \$688 (Onwards). Lowest
 3.88% P.A. @ GV Car Financing.
 GV Credit Pte Ltd. (Sole AG)

HIN LUNG AUTO
 Ho Bee Group
One Stop Car Hub
 Finance, Insurance, Workshop
 New and Used Cars

30 years
 of car sale

Browse by Category

Sort by Date Posted 20 results/page

1 vehicles

BMW 740

Advanced Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	BMW 740		Any	Any	2011	Any	Any	Any	Available
		BMW 7 Series 740i Sunroof	\$105,800	\$17,690 /yr	31-Aug-2011	2,979 cc	89,905 km	Luxury	Available
\$10K Down Payment With The Lowest Installment Of \$1.8k Only! In House Loan/Balloon Scheme Available With 100% Fast Approval Rate! 1 Owner Only! PML Unit! Nice Bidded No "5454", Most Powerful, Popular ...									
Le Motor Enterprise									
Posted: 21-Dec-2017 Tags: 2011 BMW 740i, 2011 BMW 740i, BMW 740i, BMW 740i, BMW 740i, BMW 740i, Used BMW									

Save this search criteria, to get email alerts whenever a match is found.

For old advertisements, view [Expired ads](#)

20 results/page

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, low mileage cars, car brands, carpark rates & car insurance. Find buy used BMW 740, BMW 740 Singapore, used BMW 740 Singapore, used BMW 740, used vehicles Singapore or even buy used BMW 740 Singapore. We have new car dealers comprising parallel importers, authorised car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for Singapore jobs, message services, real estate properties for sale, mover, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

- Home
- New Car
- Used Car
- Sell Car
- Motoring Directory
- Products Guide
- Article
- Forum
- Tool & Tip

- About Us
- Careers
- Contact Us
- Sitemap

- Terms of Service
- Privacy Policy
- Personal Data Protection Statement

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	9049G
Vehicle Details	
Vehicle No.:	SKB8383B
Vehicle to be Exported:	No
Intended De-registration Date:	19 Dec 2017
Vehicle Make:	B.M.W.
Vehicle Model:	740LI A
Primary Colour:	Grey
Manufacturing Year:	2010
Engine No.:	16797555N54B30A
Chassis No.:	WBAKB42000CY83391
Maximum Power Output:	240.0 kW (321 bhp)
Open Market Value:	\$78,125.00
Original Registration Date:	20 May 2011
First Registration Date:	20 May 2011
Transfer Count:	1
Actual ARF Paid:	\$78,125.00 33
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	19 May 2021
PARF Rebate Amount:	\$50,781.00
Intended COE Rebate Details	

COE Expiry Date:	19 May 2021
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$57,002.00
COE Rebate Amount:	\$19,475.00
Total Rebate Amount:	\$70,256.00

The information contained herein is correct as at 18 Dec 2017

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 15/12/2017 16:14
 Date Of Accident 14/12/2017 17:10
 Exact Location Of Accident NORTH SOUTH EXPRESSWAY TO JB
 Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKB8383B
Insured/Policyholder
 Name Of Registered Owner WEE CHIN CHYE
 NRIC No S1799049G
 Email Address NOEMAIL
 Mobile Phone No (LOCAL) +65-96932992
 Alternative Phone No Office-96932992

Vehicle Particulars

Manufacturer BMW
 Model 740LI

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category PRIVATE CAR

Insurance Company

Name of Insurance Company MSIG INSURANCE (SINGAPORE) PTE. LTD.
 Type Of Coverage COMPREHENSIVE
 Fleet Policy NO
 Policy Number A28744453 QMY
 Cover Note Number

Driver

Name of Driver WEE CHIN CHYE
 NRIC No S1799049G
 Date Of Birth 14/07/1967
 Occupation INDOOR
 Date Of Driving Pass 01/01/2002
 Driving Experience 15 YEARS AND 11 MONTHS
 Gender MALE
 Mobile Number (LOCAL) +65-96932992

Fax Number	
Contact Number	OFFICE-96932992
EMail Address	NOEMAIL
Address	
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	NO COLLISION
Weather Conditions	RAINING
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	NO
Was any other material or property damaged?	NO
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLS REFER ATTACHED ACCIDENT REPORT FROM THE DRIVER, ATTENDED BY LYNDIA

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

Sketch Plan

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/IN No.:
Email: info@general.com.sg

Sketch Plan #2

SKETCH PLAN

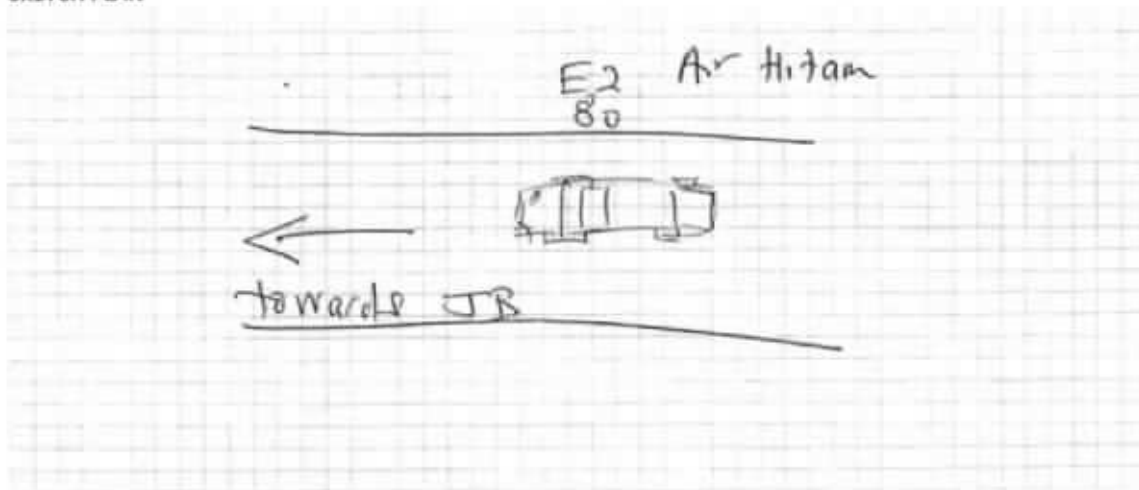

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was travelling at 90 km/h towards Johore Bahru at the North-South Express Way. It started to rain heavily. Upon I tried to reduce speed. Upon brake applying, the car skidded & spin hitting the centre divider. No other cars or any people was involved in the accident.

DECLARATION

(We declare the foregoing particulars are true in every respect.)

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature:
Name:
NRIC/FIN No.:


Accident Photo



Accident Photo



Accident Photo

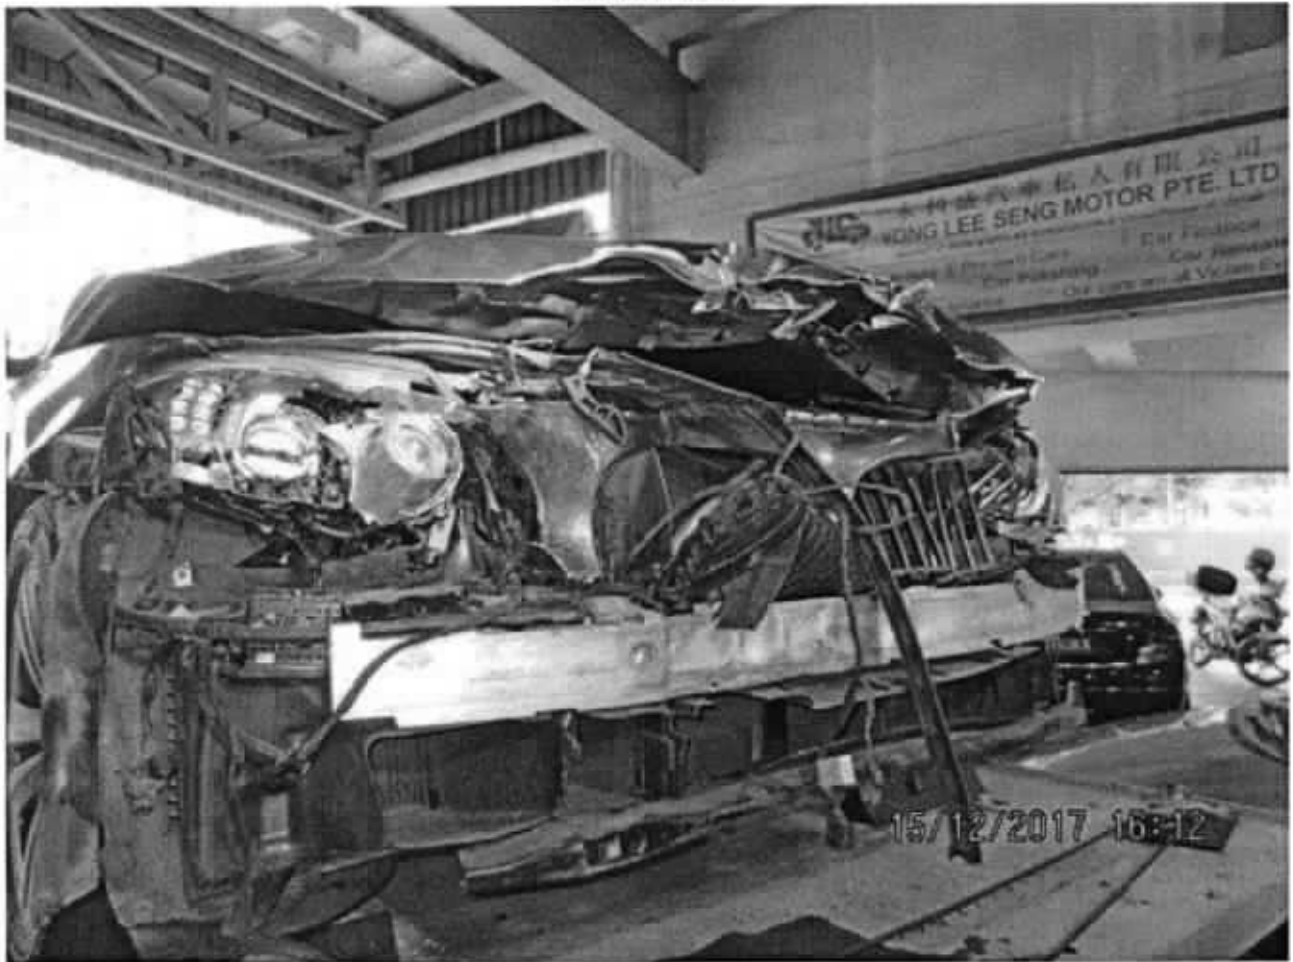

Accident Photo



Accident Photo



Accident Photo



REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S1799049G



Name
WEE CHIN CHYE

黄振财

Race
CHINESE

Date of Birth 14-07-1967 Sex M

Country of Birth
SINGAPORE



3881613



NRIC No. S1799049G



DATE OF EXPIRY
05-12-2004

APT RES 25, HONG SAN WALK #04-05
SINGAPORE 160051

NRIC No. S1799049G Date: 27/10/2009 No: 62-16238

REPUBLIC OF SINGAPORE **DRIVING LICENCE**

Portrait photo of a man.

Licence Number: **S 1799049G**
Name: **WEE CHIN CHYE**

Birth Date: **14 Jul 1967**
Issue Date: **09 Jan 2003**

Barcode: **000100962E**

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(S)

Class	Motor Vehicle	Pass Date
Class 3	Motor Vehicle	

Barcode: **S 1799049G**

I N V O I C E

UEN / GST Reg: 201623021G

Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B
 Make / Model: BMW / F02/740li
 Chassis: CY83391
 Mileage: 150926 km

Invoice # 153188
 Terms Cash
 CustID 287
 Status Paid
 Services GS
 StaffID 7.5
 Date 1/3/2017

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	Engine Oil Service	-	\$0.00	1	\$0.00
2	-Essenza 5w-50 X 4Litre	-	\$128.00	1	\$128.00
3	-Additional Engine Oil X 2.5 Litre	-	\$75.00	1	\$75.00
4	-Oil Filter(HU816)	-	\$0.00	1	\$0.00
5	Air Filter Dirty -Replace (A0290)	-	\$38.00	1	\$38.00
6	A/C Filter Dirty -Replace (AC177C)	-	\$58.00	1	\$58.00

Labour descriptions:
 Remarks: 1)Front Tyre Tread At Minimum
 2)Air Intake Dust Found Crack

Subtotal \$299.00
 GST \$0.00
 Total \$299.00

Issued by
 Name & Signature

Accepted by
 Customer Name & Signature



I N V O I C E

UEN / GST Reg. 201623021G

Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B
 Make / Model: BMW / F02/740li
 Chassis: CY83391
 Mileage: 151042 km

Invoice # 153193
 Terms Cash
 CustID 287
 Status Paid
 Services Repairs
 StaffID 5
 Date 2/3/2017

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	Replace Spark Plug -Bosch X 6pcs	-	\$0.00	1	\$0.00
2	Replace Air Intake Dust (1371 582 312)	-	\$0.00	1	\$0.00
3	Replce Wiper Blade (6161 2147 365)	-	\$0.00	1	\$0.00
4	*All Spare Part Are Supply By Owner (Item No.1-3)*	-	\$0.00	1	\$0.00
5	Labour Charge	-	\$60.00	1	\$60.00
Labour descriptions: Remarks:			Subtotal		\$60.00
			GST		\$0.00
			Total		\$60.00

Issued by
 Name & Signature

Accepted by
 Customer Name & Signature



[Handwritten signature]

T A X I N V O I C E

UEN / GST Reg. 201623021G

Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B
 Make / Model: BMW / F02/740li
 Chassis: CY83391
 Mileage: 161746 km

Invoice # 153743
 Terms Cash
 CustID 287
 Status Paid
 Services GS & R
 StaffID 710
 Date 10/7/2017

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	Engine Oil Service	-	\$0.00	1	\$0.00
2	-Essenza 5W 50 X 4.0 Litre	-	\$128.00	1	\$128.00
3	-Additional Engine Oil X 2.5Litre	-	\$75.00	1	\$75.00
4	-Oil Filter (HU816X)	-	\$0.00	1	\$0.00
5	LHF Absorber Oil Leaking	-	\$0.00	1	\$0.00
6	- Replace Absorber Set (Supply By Owner)	-	\$0.00	1	\$0.00
7	- Absorber	-	\$0.00	1	\$0.00
8	- Top Mounting	-	\$0.00	1	\$0.00
9	- Dust Cover & Stopper	-	\$0.00	1	\$0.00
10	Reprogramming & Coding For New Absorber Set	-	\$250.00	1	\$250.00
11	Both Trush Arm Bushing Crack	-	\$0.00	1	\$0.00
12	- Replace Trush Arm Bushing (Supply By Owner)	-	\$0.00	1	\$0.00
13	Panel Beating & Spray Painting (RHF Door)	-	\$200.00	1	\$200.00
14	Labour Charge	-	\$200.00	1	\$200.00
Labour descriptions:			Subtotal		\$853.00
Remarks:			GST		\$59.71
			Total		\$912.71

- 1) All Tyre Not In Good Condition
- 2) Control Arm Bushing Worn (Front L&R)
- 3) Shock Absorber Oil Leak (LHF)
- 4) All Brake Pad Finish
- 5) Flywheel Oil Seal Oil Leak

Issued by
 Name & Signature



Accepted by
 Customer Name & Signature

T A X I N V O I C E

UEN / GST Reg. 201623021G

Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B
 Make / Model: BMW / F02/740li
 Chassis: CY83391
 Mileage: 166233 km

Invoice # 153981
 Terms Cash
 CustID 282
 Status Paid
 Services Repairs
 StaffID 5
 Date 5/9/2017

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	*Water Pump Leaking	-	\$0.00	1	\$0.00
2	- Found Coolant Stain At Pump	-	\$0.00	1	\$0.00
3	*Coolant Hose (Under Top Hose) Coolant Lenk	-	\$0.00	1	\$0.00
4	*Coolant Pressure Test Found Oil Filter Housing Coolant Leak	-	\$0.00	1	\$0.00
5	- Replace Water Pump (Owner Supply)	-	\$0.00	1	\$0.00
6	- Labour Charge For Water Pump	-	\$80.00	1	\$80.00
7	- Replace Oil Filter Housing Gasket (Owner Supply)	-	\$0.00	1	\$0.00
8	- Replace Oil Cooler Gasket (Owner Supply)	-	\$0.00	1	\$0.00
9	- Labour Charge For Remove Intake Manifold To Replace Oil Filter Housing Gasket	-	\$180.00	1	\$180.00
10	- Replace Coolant Hose (Owner Supply)	-	\$0.00	1	\$0.00
11	- Labour Charge For Replace Coolant Hose	-	\$80.00	1	\$80.00
12	- Coolant (LM 6932) (FOC)	-	\$0.00	1	\$0.00

Labour descriptions:

Remarks: * Wind Noise During Vehicle Speed 80-90km/h .

Subtotal \$340.00
 GST \$23.80
 Total \$363.80

Issued by
 Name & Signature



Accepted by
 Customer Name & Signature

T A X I N V O I C E

UEN / GST Reg: 201623021G

Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B
 Make / Model: BMW / F02/740li
 Chassis: CY83391
 Mileage: 166814 km

Invoice # 154018
 Terms Cash
 CustID 287
 Status Paid
 Services Repairs
 StaffID 11
 Date 14/9/2017

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	Engine Power Reduce Sign Onn	-	\$0.00	1	\$0.00
2	- Basic Diagnosis	-	\$40.00	1	\$40.00
3	- Fault Stored In DME	-	\$0.00	1	\$0.00
4	- Mixture Too Lean (118004)	-	\$0.00	1	\$0.00
5	- Charge Pressure Control (120308)	-	\$0.00	1	\$0.00
6	- Plasiability Pressure Too Low	-	\$0.00	1	\$0.00
7	- Labour Charge For Replace Charge Pressure Control (Parts Owner Supply)	-	\$180.00	1	\$180.00
Labour descriptions:			Subtotal		\$220.00
Remarks: 1) Bonnet Damper Weak			GST		\$15.40
			Total		\$235.40

Issued by
 Name & Signature



Accepted by
 Customer Name & Signature

T A X I N V O I C E

UEN / GST Reg 201623021G


Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B
 Make / Model: BMW / F02/740li
 Chassis: CY83391
 Mileage: 168869 km

Invoice # 154204
 Terms Cash
 CustID 282
 Status Paid
 Services Repairs
 StaffID 7.5
 Date 30/10/2017

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	LHS (passenger) Front & Rear Carpet Wet	-	\$0.00	1	\$0.00
2	- Seating LHF Steering Cover To Engine Compartment	-	\$80.00	1	\$80.00
3	LHF Undercarriage Noisy During Over Hump	-	\$0.00	1	\$0.00
4	- Refix Missing Screw & Clip At LHF Chassis Cover	-	\$0.00	1	\$0.00
5	Remove LHS Carpet For Drying	-	\$240.00	1	\$240.00
6	- Remove LHF & Rear Seat	-	\$0.00	1	\$0.00
7	- Taken 3 Days Proceed	-	\$0.00	1	\$0.00
Labour descriptions:			Subtotal		\$320.00
Remarks:			GST		\$22.40
			Total		\$342.40

Issued by
 Name & Signature

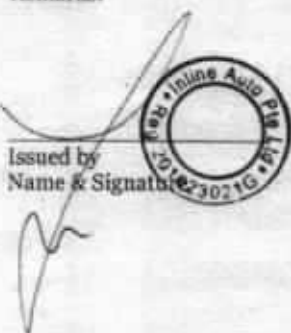

Accepted by
 Customer Name & Signature

CASH D.O / ORDER BILL

No. 1548

德摩哆意外討賠有限公司

TECMOTOR ACCIDENT CLAIM SDN. BHD.

No. 2 & 4, Jalan Mutiara Emas 5/11, Taman Mount Austin, 81100 Johor Bahru, Johor.

(Co No, 978065-X)

Office Tel/Fax : 07-353 8461

M/s

CASH

車號

Vehicle No SKB8383B

日期

Date 14. 12. 17

No.	數量 Quantity	貨 PARTICULARS 名	銀 Amount 額 RM
1		YANG PENG TO JB	750 00
2			
3		JB TO SPORG	450 00
4		MALAYSIA CANE IMM EXPORT LEVI	200 00
5			
E. & O. E.			共銀 TOTAL RM 1400 00

Approved By 經手人

Q U O T A T I O N

UEN / GST Reg: 201623021G

Customer: MARK
 Address:
 Singapore
 Contact Person:
 Contact #: 96932992

Vehicle #: SKB8383B

Make / Model: BMW / F02/740li

Quotation # 321
 CustID 287
 Date 19/12/2017

parts discount 10%

Descriptions	Price	Qty	Total
1 Chassis No. : WBAKB42000CY83391	\$0.00		\$0.00
2 Front Bumper	\$1,398.00	1	\$1,398.00 MIS ✓
3 Front Bumper Fog Lamp Cover L & R	\$160.00	2	\$320.00 MIS ✓
4 Bumper Front Lower Grille	\$210.00	1	\$210.00 MIS ✓
5 Front Grille L & R	\$260.00	2	\$520.00 BPO ✓
6 Front Bumper Parking Sensor	\$280.00	4	\$1,120.00 MIS ✓
7 Front Bumper Parking Sensor Holder	\$60.00	4	\$240.00 MIS ✓
8 Front Headlamp Washer Jet Cover	\$80.00	2	\$160.00 MIS ✓
9 Headlamp Washer Jet	\$300.00	2	\$600.00 MIS ✓
10 Front Fog Lamp	\$480.00	2	\$960.00 MIS ✓
11 Front Bumper Under Spoiler	\$160.00	1	\$160.00 MIS ✓
12 Front Number Plate Graphics	\$75.00	1	\$75.00 MIS ✓
13 Front Bumper Sponge	\$160.00	1	\$160.00 MIS ✓
14 Front Bumper Reinforcement Bar	\$680.00	1	\$680.00 TH ✓
15 Front Bumper Lower Support	\$480.00	1	\$480.00 TH ✓
16 Front Bumper Side Camera	\$1,960.00	1	\$1,960.00 BPO ✓
17 Bonnet	\$2,600.00	1	\$2,600.00 TCEW ✓
18 Bonnet Hinges	\$260.00	2	\$520.00 ? x sue
19 Bonnet Safety Latch	\$210.00	1	\$210.00 Bst ✓
20 Bonnet L & R Lock	\$260.00	2	\$520.00 TH ✓
21 Bonnet L & R Upper Lock	\$110.00	2	\$220.00 TH ✓
22 Bonnet Seal	\$60.00	1	\$60.00 nee ✓

121653

	Descriptions	Price	Qty	Total	
23	Bonnet Logo	\$130.00	1	\$130.00	na -
24	Bonnet Insulator	\$380.00	1	\$380.00	? DE -
25	Insulator Clips	\$5.00	10	\$50.00	na -
26	Bonnet Lock Cable	\$160.00	1	\$160.00	? cut -
27	Headlamp (XENON)	\$2,980.00	2	\$5,960.00	DR -
28	Headlamp Bracket	\$180.00	2	\$360.00	BR20 -
29	Front Fender L. & R	\$989.00	2	\$1,978.00	RH-B1 / LH-R
30	Front Fender Inner Shield	\$160.00	2	\$320.00	cut -
31	Front Fender Inner Lip	\$75.00	2	\$150.00	cut -
32	Front Connecting Support	\$290.00	1	\$290.00	PH -
33	Front Panel Support L. & R	\$290.00	2	\$580.00	PH -
34	Front Cross Brace L. & R	\$130.00	2	\$260.00	PH -
35	Front Connecting Panel	\$390.00	1	\$390.00	PH -
36	Front Panel Support L. & R	\$160.00	2	\$320.00	PH -
37	Front Spacer Bracket	\$90.00	2	\$180.00	PH -
38	Front Radiator Air Guide	\$695.00	1	\$695.00	CRA -
39	Front L. & R Duct	\$195.00	2	\$390.00	CRA -
40	Front L. & R Air Vent	\$190.00	2	\$380.00	CR -
41	Front Engine Under Cover	\$480.00	1	\$480.00	? DE -
42	Horn High & Low	\$130.00	2	\$260.00	? CRA -
43	Condenser	\$1,480.00	1	\$1,480.00	PH -
44	Air Intercooler	\$975.00	1	\$975.00	? PH -
45	Radiator	\$1,680.00	1	\$1,680.00	? PH -
46	Radiator Frame	\$390.00	1	\$390.00	? DG -
47	Radiator Upper Bracket	\$210.00	1	\$210.00	? PH -
48	Radiator L. & R Side Mounting	\$60.00	2	\$120.00	? na -
49	Aircon Pipe	\$400.00	4	\$1,600.00	? PH -
50	Front AUX Water Radiator	\$989.00	1	\$989.00	? XSL -
51	Front Electric Fan With Motor	\$1,348.00	1	\$1,348.00	? CRA -
52	Radiator Hose	\$160.00	2	\$320.00	? PH -
53	Radiator Spacer Tank	\$210.00	1	\$210.00	? XSL -
54	Fan Belt	\$160.00	1	\$160.00	? XSL -

21,836

3130

Descriptions	Price	Qty	Total
55 Front Reinforcement Bracket L & R	\$210.00	2	\$420.00
56 Headlamp (HID) Control Unit	\$1,300.00	2	\$2,600.00
57 Front No Plate	\$50.00	1	\$50.00
58 Radiator Coolant	\$60.00	1	\$60.00
59 Accident Towing Charge	\$150.00	1	\$150.00
60 Labour Charge :	\$0.00		\$0.00
61 To Inspect FRT Lighting Water & Leakage Test	\$40.00	1	\$40.00
62 To Remove & Install A/C Condenser Radiator In Order To Replace Support Panel	\$180.00	1	\$180.00
63 To Replace Front Support Panel, Straighten Affected Creas & Renew Damages Parts	\$1,300.00	1	\$1,300.00
64 Spray Paint On Replaced, Repaired Area	\$1,300.00	1	\$1,300.00
65 To Check Wheel Alignment	\$80.00	1	\$80.00
66 To Reprogramming After Repair	\$300.00	1	\$300.00

PA ✓
NW ✓
M13 ✓
M ✓
2131
140
800
900
200

Subtotal \$42,848.00
GST \$2,999.36
Total \$45,847.36

1) Prices quoted herein are as per above descriptions
2) Prices shall change with any changes in the descriptions
Thank you. We looking forward to receiving your confirmation on this job soon.

INLINE AUTO PTE LTD

Accepted by
Customer Name & Signature
Co.Stamp (if applicable)

[Signature]
Rasul
Hp 90010068

[Signature]
5/1/18

37,619
102
33857.10
21301.00
35,987.00
202
28,789.68 413=28,800

9 days
P/P 4/3
21/12/17 @ 1600
EXCESS: 600

Recoat
Resury b & paint
email: rasul@lkkauto.com

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

W/Ls accepted around \$28,000



INLINE AUTO PTE LTD
(COMPANY REG : 201623021G)
PIONEER POINT
5 SOON LEE STREET #01-57
SINGAPORE 627607

MAINTENANCE - REPAIR - AIRCON - DIAGNOSTIC - MOTOR TRADE

Page 1 of 1.

ACCEPTANCE / DISCHARGE FORM

I/ We hereby acknowledge that my vehicle no. SKB 8383 B, make / model:
BMW / F02 has been repaired to my/our satisfaction and collect on
22/01/2018 (Date) and 1400 hrs (Time).

I/We agree the sum of SGD (\$ 22,000.00) to be paid to repairer INLINE AUTO PTE LTD
for such repairs shall be in full discharge of all claims against the insurance company
MSIG Insurance (Singapore) Pte Ltd.

In respect of all claim against the insurance sustained to my said motor vehicle in the
accident which occurred.

Signature of Owner

(Company's Stamp if applicable)

Name : WEE CHIN CHYE

NRIC : S1799049/G

Signature of Witness

(INLINE AUTO PTE LTD)

Name : TAY CHOON CHOON

NRIC : 720527-13-5119



T A X I N V O I C E

UEN / GST Reg. 201623021G

Customer: MSIG INSURANCE (SINGAPORE) PTE LTD
 Address: 16 Raffles Quay, #24-01 Hong Leong Building
 Singapore 048581
 Contact Person: Winnie Chua
 Contact #: 65942556

Vehicle #: SKB8383B.
 Make / Model: BMW / F02/740li
 Chassis: WBAKB420000CY83391
 Mileage: km

Invoice # 154546
 Terms Cash
 CustID 1581
 Status Not paid
 Services Repairs
 StaffID 5.1
 Date 30/1/2018

Item	Descriptions	Parts & Prods	Price	Qty	Total
1	Front Bumper	-	\$0.00	1	\$0.00
2	Front Bumper Fog Lamp Cover L & R	-	\$0.00	2	\$0.00
3	Bumper Front Lower Grille	-	\$0.00	1	\$0.00
4	Front Grille L & R	-	\$0.00	2	\$0.00
5	Front Bumper Parking Sensor	-	\$0.00	4	\$0.00
6	Front Bumper Parking Sensor Holder	-	\$0.00	4	\$0.00
7	Front Headlamp Washer Jet Cover	-	\$0.00	2	\$0.00
8	Headlamp Washer Jet	-	\$0.00	2	\$0.00
9	Front Fog Lamp	-	\$0.00	2	\$0.00
10	Front Bumper Under Spoiler	-	\$0.00	1	\$0.00
11	Front Number Plate Graphics	-	\$0.00	1	\$0.00
12	Front Bumper Sponge	-	\$0.00	1	\$0.00
13	Front Bumper Reinforcement Bar	-	\$0.00	1	\$0.00
14	Front Bumper Lower Support	-	\$0.00	1	\$0.00
15	Front Bumper Both Side Camera + LVDS Line	-	\$0.00	2	\$0.00
16	Bonnet	-	\$0.00	1	\$0.00
17	Bonnet Safety Latch	-	\$0.00	1	\$0.00
18	Bonnet L & R Lock	-	\$0.00	2	\$0.00
19	Bonnet L & R Upper Lock	-	\$0.00	2	\$0.00
20	Bonnet Seal	-	\$0.00	1	\$0.00
21	Bonnet Logo	-	\$0.00	1	\$0.00
22	Bonnet Insulator - Tear	-	\$0.00	1	\$0.00

Item	Descriptions	Parts & Prods	Price	Qty	Total
23	Insulator Clips	-	\$0.00	10	\$0.00
24	Bonnet Lock Cable -(Damaged)	-	\$0.00	1	\$0.00
25	Headlamp (XENON)	-	\$0.00	2	\$0.00
26	Headlamp Bracket	-	\$0.00	2	\$0.00
27	Front Fender Both Side L & R	-	\$0.00	2	\$0.00
28	Front Fender Inner Shield	-	\$0.00	2	\$0.00
29	Front Fender Inner Lip	-	\$0.00	2	\$0.00
30	Front Connecting Support	-	\$0.00	1	\$0.00
31	Front Panel Support L & R	-	\$0.00	2	\$0.00
32	Front Cross Brace L & R	-	\$0.00	2	\$0.00
33	Front Connecting Panel	-	\$0.00	1	\$0.00
34	Front Panel Support L & R	-	\$0.00	2	\$0.00
35	Front Spacer Bracket	-	\$0.00	2	\$0.00
36	Front Radiator Air Guide	-	\$0.00	1	\$0.00
37	Front L & R Duct	-	\$0.00	2	\$0.00
38	Front L & R Air Vent	-	\$0.00	2	\$0.00
39	Front Engine Under Cover -(Missing)	-	\$0.00	1	\$0.00
40	Horn High & Low -(Damaged)	-	\$0.00	2	\$0.00
41	Condenser -(Damaged)	-	\$0.00	1	\$0.00
42	Air Intercooler -(Out Of Shape)	-	\$0.00	1	\$0.00
43	Radiator -(Out Of Shape)	-	\$0.00	1	\$0.00
44	Radiator Frame -(Cracked)	-	\$0.00	1	\$0.00
45	Radiator Upper Bracket -(Damaged)	-	\$0.00	1	\$0.00
46	Radiator L & R Side Mounting -(Damaged)	-	\$0.00	2	\$0.00
47	Aircon Low Pressure Pipe	-	\$0.00	1	\$0.00
48	Front Electric Fan With Motor -(Out Of Shape)	-	\$0.00	1	\$0.00
49	Radiator Hose -(Holder Cracked)	-	\$0.00	2	\$0.00
50	Fan Belt -(Tear, Cut By Sharp Object)	-	\$0.00	1	\$0.00
51	Front Reinforcement Bracket L & R	-	\$0.00	2	\$0.00
52	Headlamp (HID) Control Unit	-	\$0.00	2	\$0.00

Item	Descriptions	Parts & Prods	Price	Qty	Total
53	Front No. Plate		\$0.00	1	\$0.00
54	Radiator Coolant X 2btl	-	\$0.00	2	\$0.00
55	Accident Towing Fee(From Malaysia Yong Peng North South Highway To Workshop)	-	\$0.00	1	\$0.00
56	Labour Charge :	-	\$0.00	1	\$0.00
57	To Inspect FRT Lighting Water & Leakage Test	-	\$0.00	1	\$0.00
58	To Remove & Install A/C Condenser Radiator In Order To Replace Support Panel	-	\$0.00	1	\$0.00
59	To Replace Front Support Panel, Straighten Affected Creas & Renew Damages Parts	-	\$0.00	1	\$0.00
60	Spray Paint On Replaced, Repaired Area	-	\$0.00	1	\$0.00
61	To Check Wheel Alignment	-	\$0.00	1	\$0.00
62	To Reprogramming After Repair	-	\$0.00	1	\$0.00
63	Lump Sum Price For Above Parts	-	\$28,000.00	1	\$28,000.00

Labour descriptions:
Remarks:

Subtotal \$28,000.00
GST \$1,960.00
Total \$29,960.00

Issued by
Name & Signature



Accepted by
Customer Name & Signature

no indicated of: \$600

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	18 Dec 2017		20 Dec 2017 14:17 Edit Adj Rpt	S\$28,000.00 Edit Estimates	S\$28,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured: WEE CHIN CHYE , ID: S1799049G, Tel: +6596932992, Email: NOEMAIL									
Vehicle Reg. No.: SKB8383B		Date of Loss: 14/12/2017 17:00 - :59 [78 Months and 24 Days From LTA Reg Date (Man Yr)]							
Claim Type: OD / 541139		Policy/Cover Note No.: A28744453QMY (Comprehensive) Coverage: 20/05/2017 - 19/05/2018							
		Excess: S\$600.00							
Repairer: Inline Auto Pte Ltd (HQ) 5 Soon Lee Street #01-57, Pioneer Point Singapore 627607, 627607 Pioneer - Tel: 67104876									
Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Winnie Chua Ping Ping - 6594 2556]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Final Rpt due 19/01/2018]									
Driver/Custodian: WEE CHIN CHYE (50 / Male), NRIC: S1799049G, Tel: +6596932992									
Adj Asg. Remarks: Please check whether the tyre and brake system in order. 2 round of maintenance records are in merimen. Please revert. tks.									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- MSIG_SG (29/12/2017): Alert - Adj Mandate Approved (S\$28000.00) - SKB8383B - Claim Handler: Winnie Chu... - MSIG_SG (27/12/2017): Alert - Adj Mandate Approved (S\$0.00) - SKB8383B - Claim Handler: Winnie Chua Pi...									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SKB8383B (541139)**
OD
Dec 14 2017 5:00PM
[WEE CHIN CHYE]
Inline Auto Pte Ltd

Upload Documents

Upload Photos

Compose New Letter

View

View in Browser

Video

1 per page

No

Finalized On

MSIG Insurance (Singapore) Pte. Ltd. (HQ)

Thumbnail

Print

1

19/12/17 11:44

Video - Accident

Load MP4

Assessment Reports

1 per page

No

Finalized On

VAC (Bukit Batok)

Thumbnail

Print

1

15/12/17 16:23

Accident Statement

Load HTM

No

Finalized On

LKK Auto Consultants Pte Ltd (HQ)

Thumbnail

Print

1

22/12/17 16:36

Adjuster Immediate Advice

Load HTM

Photos/Images

3 per page

No

Finalized On

VAC (Bukit Batok)

Thumbnail

Print

1

15/12/17 16:20

Accident Photo

[Linked Accident Report Documents]

Load JPG

2

15/12/17 16:20

Accident Photo

[Linked Accident Report Documents]

Load JPG

3

15/12/17 16:20

Accident Photo

[Linked Accident Report Documents]

Load JPG

4

15/12/17 16:20

Accident Photo

[Linked Accident Report Documents]

Load JPG

5

15/12/17 16:20

Accident Photo

[Linked Accident Report Documents]

Load JPG

6

15/12/17 16:20

Accident Photo

[Linked Accident Report Documents]

Load JPG

No

Relabel/Reorder

LKK Auto Consultants Pte Ltd (HQ)

Thumbnail

Print

1

27/12/17 13:49

Odometer Reading

Load JPG

2

27/12/17 13:49

Chassis Number

Load JPG

3

27/12/17 13:49

General View

Load JPG

4

27/12/17 13:49

General View

Load JPG

5

27/12/17 13:49

General View

Load JPG

6

27/12/17 13:49

General View

Load JPG

7

27/12/17 13:49

General View

Load JPG

8

27/12/17 13:49

General View

Load JPG

9

27/12/17 13:49

General View

Load JPG

10

27/12/17 13:49

General View

Load JPG

11

27/12/17 13:49

General View

Load JPG

12

27/12/17 13:49

General View

Load JPG

13

27/12/17 13:49

General View

Load JPG

14

27/12/17 13:49

General View

Load JPG

15

27/12/17 13:49

General View

Load JPG

16

27/12/17 13:49

General View

Load JPG

17

27/12/17 13:49

General View

Load JPG

18

27/12/17 13:49

General View

Load JPG

19

27/12/17 13:49

General View

Load JPG

20

27/12/17 13:49

General View

Load JPG

21

27/12/17 13:49

General View

Load JPG

Video			1 per page	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
22	27/12/17 13:49	General View	 Load JPG	☒
23	27/12/17 13:49	General View	 Load JPG	☒
24	27/12/17 13:49	General View	 Load JPG	☒
25	27/12/17 13:49	General View	 Load JPG	☒
26	27/12/17 13:49	General View	 Load JPG	☒
27	27/12/17 13:49	General View	 Load JPG	☒
28	27/12/17 13:49	General View	 Load JPG	☒
29	27/12/17 13:49	General View	 Load JPG	☒
30	27/12/17 13:49	General View	 Load JPG	☒
31	27/12/17 13:49	General View	 Load JPG	☒
32	27/12/17 13:49	General View	 Load JPG	☒
33	27/12/17 13:49	General View	 Load JPG	☒
34	27/12/17 13:49	General View	 Load JPG	☒
35	27/12/17 13:49	General View	 Load JPG	☒
36	27/12/17 13:49	General View	 Load JPG	☒
37	27/12/17 13:49	General View	 Load JPG	☒
38	27/12/17 13:49	General View	 Load JPG	☒
39	27/12/17 13:49	General View	 Load JPG	☒
40	27/12/17 13:49	General View	 Load JPG	☒
41	27/12/17 13:49	General View	 Load JPG	☒
42	27/12/17 13:49	General View	 Load JPG	☒
43	27/12/17 13:49	General View	 Load JPG	☒
44	27/12/17 13:49	General View	 Load JPG	☒
45	27/12/17 13:49	General View	 Load JPG	☒
46	27/12/17 13:49	General View	 Load JPG	☒
47	27/12/17 13:49	General View	 Load JPG	☒
48	27/12/17 13:49	General View	 Load JPG	☒
49	27/12/17 13:49	General View	 Load JPG	☒
50	27/12/17 13:49	General View	 Load JPG	☒
51	27/12/17 13:49	General View	 Load JPG	☒
52	27/12/17 13:49	General View	 Load JPG	☒
53	27/12/17 13:49	General View	 Load JPG	☒
54	27/12/17 13:49	General View	 Load JPG	☒
55	27/12/17 13:49	General View	 Load JPG	☒
56	27/12/17 13:49	General View	 Load JPG	☒
57	27/12/17 13:49	General View	 Load JPG	☒
58	27/12/17 13:49	General View	 Load JPG	☒
59	27/12/17 13:49	General View	 Load JPG	☒
60	27/12/17 13:49	General View	 Load JPG	☒
61	27/12/17 13:49	General View	 Load JPG	☒
62	27/12/17 13:49	General View	 Load JPG	☒
63	27/12/17 13:49	General View	 Load JPG	☒
64	27/12/17 13:49	General View	 Load JPG	☒
65	27/12/17 13:49	General View	 Load JPG	☒
66	27/12/17 13:49	General View	 Load JPG	☒
67	27/12/17 13:49	General View	 Load JPG	☒
68	27/12/17 13:49	General View	 Load JPG	☒
69	27/12/17 13:49	General View	 Load JPG	☒
70	27/12/17 13:49	General View	 Load JPG	☒
71	27/12/17 13:49	General View	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
72	27/12/17 13:49	General View	 Load JPG	☒
73	27/12/17 13:49	General View	 Load JPG	☒
74	27/12/17 13:49	General View	 Load JPG	☒
75	27/12/17 13:49	General View	 Load JPG	☒
76	27/12/17 13:49	General View	 Load JPG	☒
77	27/12/17 13:49	General View	 Load JPG	☒
78	27/12/17 13:49	General View	 Load JPG	☒
79	27/12/17 13:49	General View	 Load JPG	☒
80	27/12/17 13:49	General View	 Load JPG	☒
81	27/12/17 13:49	General View	 Load JPG	☒
82	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
83	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
84	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
85	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
86	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
87	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
88	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
89	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
90	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
91	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
92	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
93	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
94	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
95	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
96	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
97	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
98	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
99	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
100	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
101	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
102	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
103	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
104	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
105	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
106	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
107	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
108	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
109	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
110	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
111	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
112	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
113	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
114	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
115	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
116	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
117	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
118	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
119	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
120	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
121	24/04/18 16:17	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
122	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
123	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
124	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
125	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
126	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
127	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
128	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
129	24/04/18 16:17	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	18/12/17 11:13	parf value	 Load PDF	
2	18/12/17 11:14	policy	 Load PDF	
3	20/12/17 09:07	od estimates	 Load PDF	
4	20/12/17 09:07	2 recent maintain records	 Load PDF	
5	20/12/17 09:08	email from workshop	 Load PDF	
6	02/02/18 11:19	dv	 Load PDF	
7	02/02/18 11:19	od final bill	 Load PDF	
8	02/02/18 11:48	PHOTOS AFT REPAIR	 Load PDF	
9	02/02/18 11:48	PHOTOS AFT REPAIR	 Load PDF	
10	02/02/18 11:48	PHOTOS AFT REPAIR	 Load PDF	
11	02/02/18 11:48	PHOTOS AFT REPAIR	 Load PDF	
12	02/02/18 11:48	EMAIL PHOTOS TO LKK	 Load PDF	
13	26/02/18 16:09	email to ask for final report-reminder	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	22/12/17 16:39	WORKSHOP ESTIMATE	 Load PDF	
2	28/12/17 16:31	DISAGREEMENT TO ADOPT 'COST-PLUS' REPAIR FORM	 Load PDF	
3	29/12/17 10:56	TOWING FEE RECEIPT	 Load PDF	

Linked Accident Report Documents

			View	View in Browser
Assessment Reports			1 per page	☒
No	Finalized On	VAC (Bukit Batok)	Thumbnail	Print
1	15/12/17 16:23	Accident Statement	 Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	VAC (Bukit Batok)	Thumbnail	Print
1	15/12/17 16:20	Accident Photo	 Load JPG	☒
2	15/12/17 16:20	Accident Photo	 Load JPG	☒
3	15/12/17 16:20	Accident Photo	 Load JPG	☒
4	15/12/17 16:20	Accident Photo	 Load JPG	☒
5	15/12/17 16:20	Accident Photo	 Load JPG	☒
6	15/12/17 16:20	Accident Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	VAC (Bukit Batok)	Thumbnail	Print
1	15/12/17 16:23	Sketch Plan	 Load TIF	
2	15/12/17 16:23	Sketch Plan #2	 Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**Show Remarks To:** ☐ Handling InsurerNote: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd

(Co. Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way, #21-01 SGX Centre 2
Singapore 068807

Our File No: CS/MSG17024206/R1QD3Q2

Date: 25/04/2018

REFERENCE

Insured/Claimant:	WEE CHIN CHYE	Policy No:	A28744453QMY	
Date of Loss:	14/12/2017	Nature of Claim:	OD	Claim No: 541139

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKB8383B	Engine No:	16797555N54B30A
Make & Model:	BMW 740I, 3.0 (A)	Chassis No:	WBAKB42000CY83391
Reg. Date:	20/05/2011 (Man. Year: 2010)	Odometer:	172089 km
Colour:	Black		
Engine Capacity:	2979 cc		
Market Value/New Car Price:	S\$112,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	245/50 R18	Rear Tyre Size:	245/50 R18
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	39,498.00	33,857.10	5,640.90	14.28
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,350.00	2,310.00	1,040.00	31.04
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	42,848.00	36,167.10	6,680.90	15.59
Approved Total (Overridden) (S\$)		28,000.00		
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	42,248.00	27,400.00	14,848.00	35.14
+ GST 7.00/7.00% (S\$)	2,957.36	1,918.00	1,039.36	35.14
Nett Amount (S\$)	45,205.36	29,318.00	15,887.36	35.14

INSPECTION

Date of Assignment: 20/12/2017
Date Inspected: 21/12/2017 Inspected At:

Inline Auto Pte Ltd (HQ)
5 Soon Lee Street #01-57, Pioneer Point
Singapore 627607
Singapore 627607

Estimated Period of Repair: 9.0 days

Adjuster: MOHD RASUL**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference	
Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 25 Apr 2018)
Parts: 143	BMW 740I 3.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKB8383B)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Missing	1,398.00 F	*1,398.00 FL
2	2		*FRONT BUMPER FOG LAMP COVER L&R	Missing	320.00 F	*320.00 FL
3	1		*BUMPER FRONT LOWER GRILLE	Missing	210.00 F	*210.00 FL
4	2		*FRONT GRILLE L&R	Broken	520.00 F	*520.00 FL
5	4		*FRONT BUMPER PARKING SENSOR	Missing	1,120.00 F	*1,120.00 FL
6	4		*FRONT BUMPER PARKING SENSOR HOLDER	Missing	240.00 F	*240.00 FL
7	2		*FRONT HEADLAMP WASHER JET COVER	Missing	160.00 F	*160.00 FL
8	2		*HEADLAMP WASHER JET	Missing	600.00 F	*600.00 FL
9	2		*FRONT FOG LAMP	Missing	960.00 F	*960.00 FL
10	1		*FRONT BUMPER UNDER SPOILER	Missing	160.00 F	*160.00 FL
11	1		*FRONT NUMBER PLATE GRAPHICS	Missing	75.00 F	*75.00 FL
12	1		*FRONT BUMPER SPONGE	Missing	160.00 F	*160.00 FL
13	1		*FRONT BUMPER REINFORCEMENT BAR	Bent	680.00 F	*680.00 FL
14	1		*FRONT BUMPER LOWER SUPPORT	Bent	480.00 F	*480.00 FL
15	1		*FRONT BUMPER SIDE CAMERA	Not Working	1,960.00 F	*1,960.00 FL
16	1		*BONNET	Torn	2,600.00 F	*2,600.00 FL
17	2		*BONNET HINGES	Serviceable	520.00 F	*- FL
18	1		*BONNET SAGETY LATCH	Bent	210.00 F	*210.00 FL
19	2		*BONNET L&R LOCK	Bent	520.00 F	*520.00 FL
20	2		*BONNET L&R UPPER LOCK	Bent	220.00 F	*220.00 FL
21	1		*BONNET SEAL	Necessary	60.00 F	*60.00 FL
22	1		*BONNET LOGO	Necessary	130.00 F	*130.00 FL
23	1		*BONNET INSULATOR	Deformed	380.00 F	*380.00 FL
24	10		*INSULATOR CLIPS	Necessary	50.00 F	*50.00 FL
25	1		*BONNET LOCK CABLE	Cut	160.00 F	*160.00 FL
26	2		*HEADLAMP(XENON)	Broken	5,960.00 F	*5,960.00 FL
27	2		*HEADLAMP BRACKET	Broken	360.00 F	*360.00 FL
28	2		*FRONT FENDER L&R	Bent	1,978.00 F	*1,978.00 FL
29	2		*FRONT FENDER INNER SHIELD	Cut	320.00 F	*320.00 FL
30	2		*FRONT FENDER INNER LIP	Cut	150.00 F	*150.00 FL
31	1		*FRONT CONNECTING SUPPORT	Bent	290.00 F	*290.00 FL
32	2		*FRONT PANEL SUPPORT L&R	Bent	580.00 F	*580.00 FL
33	2		*FRONT CROSS BRACE L&R	Bent	260.00 F	*260.00 FL
34	1		*FRONT CONNECTING PANEL	Bent	390.00 F	*390.00 FL
35	2		*FRONT PANEL SUPPORT L&R	Bent	320.00 F	*320.00 FL
36	2		*FRONT SPACER BRACKET	Bent	180.00 F	*180.00 FL
37	1		*FRONT RADIATOR AIR GUIDE	Cracked	695.00 F	*695.00 FL
38	2		*FRONT L&R DUCT	Cracked	390.00 F	*390.00 FL
39	2		*FRONT L&R AIR VENT	Cracked	380.00 F	*380.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	1		*FRONT ENGINE UNDER COVER	Deformed	480.00 F	*480.00 FL
41	2		*HORN HIGH & LOW	Cracked	260.00 F	*260.00 FL
42	1		*CONDENSER	Bent	1,480.00 F	*1,480.00 FL
43	1		*AIR INTERCOOLER	Bent	975.00 F	*975.00 FL
44	1		*RADIATOR	Bent	1,680.00 F	*1,680.00 FL
45	1		*RADIATOR FRAME	Deformed	390.00 F	*390.00 FL
46	1		*RADIATOR UPPER BRACKET	Bent	210.00 F	*210.00 FL
47	2		*RADIATOR L&R SIDE MOUNTING	Necessary	120.00 F	*120.00 FL
48	4		*AIRCON PIPE	Bent	1,600.00 F	*1,600.00 FL
49	1		*FRONT AUX WATER RADIATOR	Serviceable	989.00 F	*- FL
50	1		*FRONT ELECTRIC FAN WITH MOTOR	Cracked	1,348.00 F	*1,348.00 FL
51	2		*RADIATOR HOSE	Bent	320.00 F	*320.00 FL
52	1		*RADIATOR SPACER TANK	Serviceable	210.00 F	*- FL
53	1		*FAN BELT	Serviceable	160.00 F	*- FL
54	2		*FRONT REINFORCEMENT BRACKET L&R	Bent	420.00 F	*420.00 FL
55	2		*HEADLAMP (HID) CONTROL UNIT	Necessary	2,600.00 F	*2,600.00 FL
56	1		*FRONT NO.PLATE	Missing	50.00 F	*50.00 FL
57	1		*RADIATOR COOLANT	Necessary	60.00 F	*60.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	39,498.00	37,619.00
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	3,761.90

Total Parts (\$\$)	39,498.00	33,857.10
--------------------	-----------	-----------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	ACCIDENT TOWING CHARGE	New	150.00	150.00
2	TO INSPECT FRT LIGHTING WATER & LEAKAGE TEST	New	40.00	40.00
3	TO REMOVE & INSTALL A/C CONDENSER RADIATOR IN ORDER TO REPLACE SUPPORT PANEL	New	180.00	140.00
4	TO REPLACE FRONT SUPPORT PANEL ,STRAIGHTEN AFFECTED CREAS & RENEW DAMAGES PARTS	New	1,300.00	800.00
5	SPRAY PAINT ON REPLACED ,REPAIRED AREA	New	1,300.00	900.00
6	TO CHECK WHEEL ALIGNMENT	New	80.00	80.00
7	TO REPROGRAMMING AFTER REPAIR	New	300.00	200.00
Gross Labour Cost (S\$)			3,350.00	2,310.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >