

Baru

REF: CS/TP17024653/Agbnz

ASSIGNMENT

26/12/12

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.

/	
N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 24 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Van No: SKH 5913K Yr Regn: 2012 Dec

Type: M/Car M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Camry cc 1998

Colour: Grey, A/C Insured / Std / NI / NA

Sp. Reading: 175273 T.Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: M2053BK S104007610

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60R16

R: 215/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal: 06 mm R/Bal: 06 mm

L/Bal: 06 mm L/Bal: 06 mm

D.O.A. _____ D.O.I. 28/12/17

Survey held at: Premium Carz

Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

TP Malaysian vehicle Independent.

MV: 77K

PV: 63K

Nett: 14K

SKH 5913K - X

LS to 34700 (Red to 29603.10, 46%)

RECEIVED 29 MAR 2013

Date/Time. File Pass to?

: Prel. Report
 : Final Report

Days Of Repair: 24

Resurvey No. of Trip: 2

Survey Fee: _____
Transportation: _____

53x15 = 795

170 + 795

50

30 + 50

80

332

1527

Date/Time. File Return to?

2)

Add Fee: Site Insp (\$)

Interview (\$)

Tech Invs (\$)

Weekend (\$)

S - P - S

Photo: 780

Other: 050

28/3/18

Report Format: TP

Lump Sum / B.I. (\$) 34700

MSME17169560 / SME Motor Pte Ltd - Kaki Bukit
 ENTRY DATE & TIME: 26/12/2017 17:46
 SUBMITTED BY: Pei Ying

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	26/12/2017 17:46
Date Of Accident	25/12/2017 14:30
Exact Location Of Accident	MALACCA TWDS JOHOR BAHRU (147KM) NORTH SOUTH HIGHW
Country/State of Loss	MALAYSIA/JOHOR DARUL TAKZIM

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKH5913K
Insured/Policyholder	
Name Of Registered Owner	CHAN LEI KOK
NRIC No	S0172709E
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97422055
Alternative Phone No	OFFICE-97422055

Vehicle Particulars

Manufacturer	TOYOTA
Model	CAMRY
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	A80341106QMX
Cover Note Number	

Driver

Name of Driver	CHAN LEI KOK
NRIC No	S0172709E
Date Of Birth	25/03/1953
Occupation	INDOOR
Date Of Driving Pass	25/02/1976
Driving Experience	41 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97422055
Fax Number	
Contact Number	OFFICE-97422055
EEmail Address	NOEMAIL

Address BLK 83 WHAMPOA DRIVE #19-294
 Postcode 320083
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OWNER
 Vehicle Registration Number of Driver's Own Vehicle -
 Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident CHAIN COLLISION
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? YES
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 4
 Passenger 1 NAME: : PASSENGER
 GENDER: : MALE

Passenger 2 NAME: : PASSENGER
 GENDER: : FEMALE

Passenger 3 NAME: : PASSENGER
 GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name EUNOS NPP
 Police Station Address ROAD: 629 BEDOK RESERVOIR ROAD #01-1620 , POSTCODE: 470629 ,
 COUNTRY: SINGAPORE
 Police Station Contact TEL NO: - FAX NO:
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

REFER TO POLICE REPORT: G/20171226/2124.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number JPL3695
 Vehicle Make/Model/Colour VEHICLE B
 Details Of Properties

PRIVATE CAR

Vehicle Category
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number JRR8198
 Vehicle Make/Model/Colour
 Details Of Properties VEHICLE C
 Vehicle Category PRIVATE CAR
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number JSC7500
 Vehicle Make/Model/Colour
 Details Of Properties VEHICLE D
 Vehicle Category PRIVATE CAR
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name LIM BEE HEONG
 Approximate Age
 Injuries Sustain
 Injured person in which vehicle? SKH5913K
 Were seat belts worn?
 Was this injured conveyed to hospital by ambulance?
 Address
 Postcode

Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to third parties about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be based outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
- (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time: 26/12/17 13:10 h

Driver's Signature

(If driver is not the policyholder)

Date & Time: 26/12/17 13:10 h

Reporting Centre Personnel's Signature

Name:

NRIC/PIN No.:


GIA/IME SketchPlanForm_V3

PREMIUM ONE

Sketch Plan #2 Pg. 1

SKETCH PLAN

Vehicle A: SKH5913K
B: JPL3695
C: JRR8198
D: JSC7500

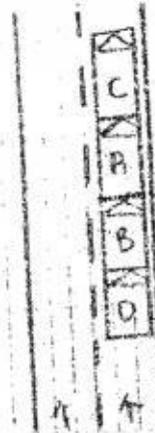

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to Police Report attached. : CA 2017/226/2124

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 26/12/17 13:02

Driver's Signature

(If driver is not the policyholder)

Date & Time: 26/12/17 13:10h.

Reporting Centre Personnel's Signature

Name:

NHRC/FIN No.:

SIARIME SketchPlanForm_V3

Sketch Plan #3 Pg. 1



**SINGAPORE
POLICE FORCE**



G/20171226/2124

1 of 2

Report No. G/20171226/2124

POLICE REPORT (NP299)

Police Station Of Origin
Eunos NPP
629 Bedok Reservoir Road #01-1620
SINGAPORE 470629
Tel No: 1800-4439999

Date/Time Report Made 26/12/2017 16:46	Vide Report No.	Station Diary No. 43
Name Of Informant CHAN LEI KOK	Address APT BLK 83 WHAMPOA DRIVE #19-294 SINGAPORE 320083	
ID Type / ID No. NRIC NO / S0172709E	Contact No. Home/Office	Mobile 97422055
Nationality SINGAPORE CITIZEN	Email Address	
Occupation CONSTRUCTION DIRECTOR	Sex Male	Age 64
Institution/School Name	Date of Birth 25/03/1953	Race Chinese
Date/Time Of Incident 25/12/2017 14:30	Location Of Incident North-South Expressway, 147km mark MALAYSIA	

Brief details.

On the 25/12/2017 at about 1430hrs, I was driving my vehicle SKH5913K, with 3 passengers, along the North-South Expressway in Malaysia, direction from Melaka to Johor Bahru. At the 147km mark, a vehicle JRR8198 stopped in front of me, so I stopped my vehicle as well. Suddenly, I felt an impact from the rear of my vehicle. A vehicle JPL3695 has collided into the rear portion of my vehicle. The impact caused my vehicle to move forward and collide with JRR8198. Moments later, I felt another impact from the rear of my vehicle. I alighted from my car and saw that another vehicle JSC7500 has collided into

Signature Of Officer Recording The Report: G / Sgt 2 LIM-WEI SIANG
Signature Of Interpreter: Not applicable
Officer In-Charge Of Case: G / Bedok Police Divisional Investigation Branch / Insp LIAN WEN YAO, DENNIS Contact No.: 62447200

Signature Of Informant:
Date/Time: 26/12/2017 16:46
Classification Of Case:

Authentication Stamp

<p>SINGAPORE POLICE FORCE</p> <p style="text-align: right;">E</p> <p style="text-align: center;">SIGNATURE</p>
--

Sketch Plan #4 Pg. 1



**SINGAPORE
POLICE FORCE**

POLICE REPORT (NP299)

CONTINUATION OF REPORT



G/20171226/2124

2 of 2

Report No. G/20171226/2124

JPL3695. My wife felt some pain from her back due to the accident.

I have already lodged a police report with the Malaysian police regarding the accident, and has brought my wife to see a doctor at Tan Tock Seng Hospital.

I am lodging a police report regarding this accident in Malaysia for my insurance claim purposes.

Signature Of Officer Recording The Report: G / Sgt 2 LIM WEI SIANG <i>E</i>	Signature Of Informant: <i>[Handwritten Signature]</i>
Signature Of Interpreter: Not applicable	Date/Time: 26/12/2017 16:46
Officer In-Charge Of Case: G / Bedok Police Divisional Investigation Branch / Insp LIAN WEN YAO, DENNIS Contact No.: 62447200	Classification Of Case:

Authentication Stamp

 SINGAPORE POLICE FORCE <i>E</i> _____ SIGNATURE

Sketch Plan #5 Pg. 1

Page 1 of 1

Salinan Repot Polis



POLIS DIRAJA MALAYSIA

REPOT POLIS

Balai : PAGOH
 Daerah : MUAR
 Kontinjen : JOHOR
 No Repot : TRAFIK MUAR/009791/17
 Tarikh : 25/12/2017
 Waktu : 1725 PM
 Bahasa Diterima : B. Malaysia

Pegawai Penyiasat : R85997
 No Repot Bersangkut : TRAFIK MUAR/009789/17

Butir-butir Penerima Repot

Nama : MUHAMMAD YUSRI BIN YUSOF @
 MD. YUSOF

No Personel : R170185

Pangkat : L/KPL

Butir-butir Jurubahasa (Jika Ada)

Nama : ---

No K/P (Baru) : ---

No Polis/Tentera : ---

No Pasport : ---

Bahasa Asal : ---

Alamat : ---

Butir-butir Pengadu

Nama : CHAN LEI KOK

No Polis/Tentera : ---

No Pasport : S0172709E

No K/P (Baru) : ---

No Sijil Beranak : ---

Tarikh Lahir : 25/03/1953

Umur : 64 tahun 9 bulan

Jantina : Lelaki

Warganegara : Malaysia

Keturunan : Singaporean

Pekerjaan : MANAGER

Alamat Tempat Tinggal : APT BLK 83 WHAMPOA DRIVE #19-294, SINGAPORE, 320083

Alamat Ibu/Bapa : ---

Alamat Pejabat : ---

No Tel (Pejabat) : ---

No Tel (HP) : 6587422055

No Tel (Rumah) : ---

Emel : ---

Pengadu Menyatakan:-

PADA 25/12/2017 JAM LEBIH KURANG 2.30 PETANG, SAYA MEMANDU MOTOKAR NOMBOR SKH5913K JENIS TOYOTA CAMRY BERSAMA ISTERI SAYA, SEORANG ANAK PEREMPUAN SAYA DAN ANAK SAUDARA LELAKI SAYA DARI ARAH MELAKA KE JOHOR BAHRU. PADA KETIKA ITU, APABILA SAYA SAMPAI DI KM 147 (S) L/RAYA U/SELATAN, DIHADAPAN MOTOKAR SAYA BERLAKU KESESAKAN, DAN SAYA TELAH BREK UNTUK MEMPERLAHANKAN KENDERAAN SECARA TIBA-TIBA SEBUAH MOTOKAR JENIS KIA FORTE NO PENDAFTARAN JPL 3695 TELAH MELANGGAR BAHAGIAN BELAKANG MOTOKAR SAYA. AKIBAT REMPUHAN TERSEBUT, MOTOKAR SAYA TELAH TELANGGAR BAHAGIAN BELAKANG MOTOKAR JENIS HONDA HRV NO PENDAFTARAN JRR 8198 YANG BERADA DI HADAPAN MOTOKAR SAYA. DALAM KEJADIAN ITU, ISTERI SAYA MENGALAMI KESAKITAN DI TENGGUK, BAHAGIAN BELAKANG BADAN DAN DADA DEPAN KEROSAKAN MOTOKAR SAYA IALAH BUMPER BELAKANG KEMEK, BONET BELAKANG KEMEK, PINTU BAHAGIAN PEMANDU HADAPAN BELAH KANAN KEMEK, PINTU BELAKANG KIRI DAN KANAN ROSAK, LAMPU BESAR KIRI DAN KANAN PECAH, TEMPAT DUDUK MOTOKAR BELAKANG ROSAK, TAYAR KANAN BELAKANG ROSAK, LAIN-LAIN KEROSAKAN BELUM DIPASTIKAN LAGI INILAH REPOT SAYA.

Tandatangan Pengadu:

Tandatangan Jurubahasa (Jika ada):

Tandatangan Penerima Repot:

ID Pencetak | Tarikh @ Masa Cetak

: R170185 | 25/12/2017 05:52:19 PM

KETUA POLIS BALAI

Balai Polis Pagoh
 64000 Muar Johor

Salinan Repot Polis

12/25/17



MSIG Insurance (Singapore) Pte. Ltd.
 4 Shenton Way #21-01 SGX Centre 2 Singapore 068807
 Tel: (65) 6827 7888 Fax: (65) 6827 7800
 Co. Reg. No. 200412212G GST Reg. No. 20-0412212G

Certificate of Insurance

ORIGINAL

ROAD TRANSPORT ACT 1987 (MALAYSIA)
 THE MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (FEDERATION OF MALAYSIA)
 THE MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CAP. 189 OF THE REVISED EDITION)
 (REPUBLIC OF SINGAPORE)
 THE MOTOR VEHICLES (THIRD-PARTY RISK AND COMPENSATION) RULES, 1996 EDITION (REPUBLIC OF SINGAPORE)
 OR ANY AMENDMENT, ACT OR ACTS PASSED IN SUBSTITUTION THEREOF.

Form M.X.1
 Individual Ownership

MOTOR MAX
Comprehensive

Certificate No. A 80341106 QMX

Excess : SGD700
 Windscreen Excess : SGD100

1. Index Mark and Registration Number of Vehicle

SKH5913K

2. Name of Policyholder

Chan Lei Kok

3. Effective Date of the Commencement of Insurance for the purposes of the Act

26/12/2016

4. Date of Expiry of Insurance

25/12/2017

5. Persons or Classes of Persons entitled to drive*

Chan Lei Kok

Any other person provided he is driving on the Policyholder's order or with the Policyholder's permission.

* Provided that the person driving is permitted in accordance with the licensing or other laws or laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6. Limitations as to use*

Use only for social domestic and pleasure purposes and for the Policyholder's business.
 The Policy does not cover use for hire or reward racing pace-making reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

PLEASE NOTE ALL CLAIMS RELATED REPAIR MUST BE CARRIED OUT AT ANY MSIG AUTHORISED WORKSHOP LISTED IN THE ATTACHED.

This Certificate is not transferable to a new owner of the vehicle. If for any reason the Policy is terminated during its currency, the Certificate must be returned to the Insurer within 7 days of the termination or if the Certificate has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189).

I/WE HEREBY CERTIFY that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia) or any Amendment, Act or Acts passed in substitution thereof.

Signature 01/12/2016

Signature / Date

Counter-Signatory:

ACIS Insurance Agency Pte. Ltd.

MSIG Insurance (Singapore) Pte. Ltd.
 Approved Insurers

Signature

Amy Ler
 Senior Vice President, Agencies

This certificate is not valid unless it is signed for & on behalf of the Company and Counter-Signed by a duly authorised representative of the Counter-Signatory.

REPUBLIC OF SINGAPORE
 IDENTITY CARD NO. S0172709E

Name
 CHAN LEI KOK

陈利国

Race
 CHINESE

Date of Birth Sex
 25-03-1953 M

Country of Birth
 SINGAPORE





REPUBLIC OF SINGAPORE DRIVING LICENCE

S0172709E

CHAN LEI KOK

Exp. Date: 25 Mar 1953
 Issue Date: 09 Jan 2009

000097109B




2442073

NRIC No. S0172709E

Blood Group Date of issue
 O+ 03-10-1994

APT. BLK 83 WHAMPOA DRIVE #19-294
 SINGAPORE 320083

NRIC No. S0172709E Date: 01/04/2010 No. 6506728




YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSES

PASS DATE

Class 2B	Motorcycles not exceeding 200 cc	26 Apr 1976
Class 2A	Motorcycles between 201 cc and 400 cc	26 Apr 1976
Class 2	Motorcycles exceeding 400 cc	26 Apr 1976
Class 3	Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms	25 Feb 1976

NP 428A

Licence No: S0172709E

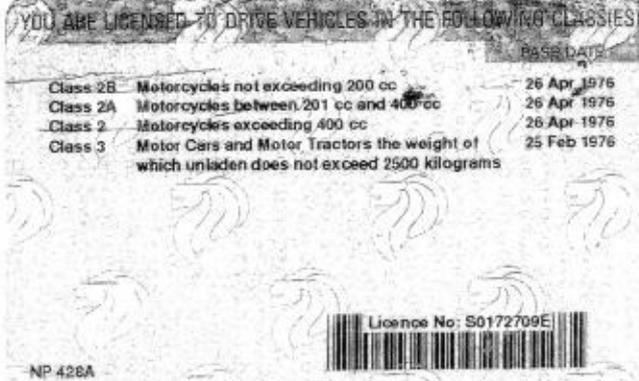

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	2709E
Vehicle Details	
Vehicle No.:	SKH5913K
Vehicle to be Exported:	Yes
Intended De-registration Date:	28 Dec 2017
Vehicle Make:	TOYOTA
Vehicle Model:	CAMRY 2.0 AUTO
Primary Colour:	Grey
Manufacturing Year:	2012
Engine No.:	1AZE258363
Chassis No.:	MR053BK5104007610
Maximum Power Output:	109.0 kW (146 bhp)
Open Market Value:	\$23,232.00
Original Registration Date:	26 Dec 2012
First Registration Date:	26 Dec 2012
Transfer Count:	0
Actual ARF Paid:	\$23,232.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	25 Dec 2022
PARF Rebate Amount:	\$16,262.00
Intended COE Rebate Details	
COE Expiry Date:	25 Dec 2022
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$93,004.00
COE Rebate Amount:	\$46,403.00
Total Rebate Amount:	\$62,665.00

The information contained herein is correct as at 28 Dec 2017

**Toyota Camry 2.5A****\$71,800****\$12,780 /yr**

14-Aug-2012

2,494 cc

136,799 km

Luxury

Available

One Of The Cheapest In Market With Full Agent Maintain. Very Beautiful Condition. High Trade In. In House Loan / Bank Loan. Call Now For Viewing And Test Drive Appointment.

Benefit Auto Enterprise Pte Ltd

Posted: 26-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.5A****\$71,500****\$12,590 /yr**

31-Aug-2012

2,494 cc

111,000 km

Luxury

Available

100% Selling Cheap! Just Did Up Paintworks! Maintained By Borneo Motors! Car Is Accident Free! Low Interest Rate. \$10k To \$13k Drive Away!

Posted: 21-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$74,800****\$13,450 /yr**

05-Sep-2012

1,998 cc

74,000 km

Luxury

Available

Promotion Interest Rate As Low As 1.99%! Extreme Low Mileage! Extremely Reliable Luxurious Sedan And Practical! Boot Space Up To 440L! Humongous Interior, More Than What Is Needed To Fill Up With 5 Ad...

Dickson Automobile

Posted: 29-Oct-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.5A****\$71,888****\$12,500 /yr**

24-Sep-2012

2,494 cc

94,000 km

Luxury

Available

Guaranteed Cheapest In The Market! If Not We Match It! Most Trusted Company In Town! Buy This Sedan That Combines Comfort With Efficiency From Us With A Peace Of Mind. Well Maintained. Pristine Condit...

Euro Performance Asia Pte Ltd

Posted: 27-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$75,500****\$13,260 /yr**

24-Oct-2012

1,998 cc

112,000 km

Luxury

Available

1 Owner. Solely. Luxury Sedan Very Stable And Comfortable Drive. Many Internal Features And Very Functional With Good Space Both Boot And Rear Leg Room Space. Why Wait? Call/SMS To Arrange A Viewing N...

Posted: 25-Nov-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$74,588****\$13,000 /yr**

29-Oct-2012

1,998 cc

88,000 km

Luxury

Available

Guaranteed Cheapest In The Market! If Not We Match It! Most Trusted Company In Town. Extremely Reliable Luxurious Sedan. Boot Space Up To 440L. Humongous Interior, More Than What Is Needed To Fill Up ...

Euro Performance Asia Pte Ltd

Posted: 27-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.5A****\$74,800****\$12,840 /yr**

31-Oct-2012

2,494 cc

110,000 km

Luxury

Available

Most Popular Toyota Luxury Sedan For Your Family. Spacious & Reliable. Well Maintained & Service. No Further Repairs Needed. Beautiful Paintwork With Clean & Neat Interior. Showroom Conditions. Loan A...

Henly Enterprises Co

Posted: 25-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.5A****\$73,800****\$12,500 /yr**

19-Nov-2012

2,494 cc

65,453 km

Luxury

Available

New Model! Fully Serviced By Borneo Motors! Mint Condition And Well Takecare Unit! Call Now For An Viewing Appointment! Consignment Unit!

Prem Roy Motoring

Posted: 21-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$74,800****\$12,860 /yr**

23-Nov-2012

1,998 cc

61,289 km

Luxury

Available

1 Owner With Regular Maintain And Original Condition, Genuine Low Mileage, High COE \$93004, Spacious Interior, Luxury Sedan, Price Negotiable. Trade In Welcome.

Posted: 22-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$76,800****\$13,250 /yr**

30-Nov-2012

1,998 cc

95,000 km

Luxury

Available

Graded B by **STIA**

Interest Rate At 2.78%, Borneo Servicing Done Till Date, The Only STA Certified Accident Free Camry 2.0A, Depreciation At \$13K Plus Only, Average Mileage Done Yearly, New Borneo Selling At \$158K With ...

Posted: 05-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$76,800****\$13,200 /yr**

05-Dec-2012

1,998 cc

42,213 km

Luxury

Available

1 Owner Only! New 2012 Model! Fully Agent Maintained, Super Low Mileage! Road Tax Just Renewed! Period! Don't Miss This Great Unit! Minimum Down Payment With Bank Or In House Loan Available. Call For ...

Posted: 16-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

[Details](#)**Toyota Camry 2.0A****\$76,700****\$13,040 /yr**

26-Dec-2012

1,998 cc

47,000 km

Luxury

Available

Elegant And Sporty Black! Only 1 Owner With Very Low Mileage Of 47000km Done! Very High COE Of \$85400! Very Original Condition! See To



Believe! Buy With A Peace OF Mind From A Company With 30 Years Of...

Posted: 23-Dec-2017 Tags: 2012 Toyota Camry, 2012 Toyota Camry, Toyota Camry, Toyota Camry, Toyota, Camry, Camry, Used Toyota

Save this search criteria, to get email alerts whenever a match is found.

Make

Model

Price

Depreciation

Reg Date

Eng Cap

Mileage

Veh Type

Filter

For old advertisements, view [Expired ads](#)

20 results/page

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, low mileage cars, car brands, carpark rates & car insurance. Find buy used Camry, Camry Singapore, used Camry Singapore, used Camry, used vehicles Singapore or even buy used Camry Singapore. We have new car dealers comprising parallel importers, authorised car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for Singapore jobs, real estate properties for sale, motor, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

- Home
- New Car
- Used Car
- Sell Car
- Motoring Directory
- Products Guide
- Article
- Forum
- Tool & Tip

- About Us
- Careers
- Contact Us
- Sitemap

© 2004-2017 sgCarMart. All rights reserved.

- Terms of Service
- Privacy Policy
- Personal Data Protection Statement

Compare [3]

SKH5913K. 2012 Dec

Date

No.

Toyota Camry 1998 cc
MROS3BK5104007610

Front Number Plate Best	30(SN) ✓
Front Number Plate Holder Deformed	30(SN) ✓
Front Number Plate Garnish	83.50 ✓
Front Bumper Deformed	545 ✓
Front Bumper Clips: New	30 ✓
Front Bumper Side Holder x 02 New	98x2=196 ✓
Front Bumper Low Cover Not New	28.40 X
Front Bumper Fog Lamp x 02 } New	295.2x2=590.40 X
Front Bumper Fog Lamp Cover x 02 } New	74x2=148 X
Front Bumper Lower Grille Deformed	158 ✓
Front Bumper Reinforcement: Best	385.60 ✓
Front Bumper Sponge: Deformed	88.90 ✓
Front Grille: cracked	565.40 ✓
Front Grille Logo New	72.60 ✓
Front Grille Clips: New	20 ✓
Headlamp x 02 cracked.	2597.2x2=5194.40 ✓
Front Brace Panel Best	135 ✓
Front Support Panel Repair	565.10 X
Front Support Panel Top Cover Deformed	230.10 ✓
Front Support Panel Top Cover Clips: New	20 ✓
Air Con Condenser } New	1635 X
Radiator } New	2062.40 X
Bonnet Repair	1211.70 X
Bonnet Lock Not New	128.90 X
Bonnet Chrome Moulding: cracked	168.80 ✓
Bonnet Chrome Moulding Clips: New	15 ✓
Front Fender x 02 Repair	737x2=1474 X
Front Fender Top Garnish x 02 } New	72.2x2=144.40 X
Front Fender Top Garnish Clips } New	20 X
VVTi Emblem x 02: New	49.3x2=98.60 ✓
Radiator Coolant: Not New	40(SN) X

SKH 5913K

Date

No.

	Rear Number Plate } missing	30(SN) ✓
	Rear Number Plate Holder	30(SN) ✓
	Rear Number Plate Lamp x 02 RH cracked	56.2 x 2 = 112.40 56.20
	Rear Bumper Distorted	589.60 ✓
	Rear Bumper Clips New	30 ✓
	Rear Bumper Side Holder x 02 New	70.4 x 2 = 140.80 ✓
	Rear Bumper Reflector x 02 RH cracked	65.5 x 2 = 131 65.50
	Rear Bumper Reinforcement Distorted	391.80 ✓
Rear Bumper Bracket	Reverse Sensor x 04, Distorted	250 x 4 = 1000 ✓
x 02.	Reverse Sensor Wire Harness. Snapped.	358.40 ✓
45 x 6 = 90 ✓	Rear End Panel Distorted	649.60 ✓
Distorted	Rear End Panel Top Garnish Deformed	434.50 ✓
	Rear End Panel Sealant. New	60(SN) ✓
	Tail Lamp x 02 LH out, RH smashed	417 x 2 = 834 ✓
	Tail Lamp Panel x 02 Dented	185.1 x 2 = 370.20 ✓
	Bootlid Distorted.	865.90 ✓
Bootlid	Bootlid Lock Distorted	349.70 ✓
Lock Cover	Bootlid Lock Sensor Smashed	60.40 ✓
20.40 ✓	Bootlid Weatherstripe At	225.40 ✓
Distorted	Bootlid Hinge x 02 Bent	55.4 x 2 = 110.80 ✓
	Bootlid Reflector x 02 Cracked	289.6 x 2 = 579.20 ✓
	Bootlid Chrome Moulding. Cracked.	383.80 ✓
	Bootlid Inner Trim Cover crumpled	490.60 ✓
	Bootlid Inner Trim Cover Clips New	30 ✓
	Bootlid Outer Opener Switch Damaged.	138.40 ✓
	Toyota Logo: }	48.90 ✓
	Camry Emblem. } New	39.40 ✓
	2.0 Emblem. }	35.80 ✓
	Rear Fender x 02 Distorted	999.1 x 2 = 1998.20 ✓
	Rear Fender Inner Trim x 02 Crumpled	386.5 x 2 = 773 ✓
	Rear Fender Inner Trim Clips New	60 ✓
	Rear Fender Inner Shield x 02 RH torn	221.8 x 2 = 443.60 221.80
	Rear Fender Inner Shield Clips. New	60 30

11965.8



SKH 5913K

	Date	No
Rear Fenders Air Vent x 02 RH Deformed	38.1 x 2 = 76.20	38.10
Rear Windscreen Moulding. ? New	87.80	✓
Rear Windscreen Sealant.	60(SN)	✓
Rear Camera. Damaged	580(SN)	480(SN)
Spare Tyre Panel Distorted	798.60	✓
Spare Tyre Panel Under Cover x 02 New	201 x 2 = 402	✓
Spare Tyre Panel Under Cover Clips New	40	✓
Spare Tyre Panel Top Cover. Deformed.	351.40	✓
Spare Tyre Panel Top Sponge Dehd	294.10	✓
Spare Tyre Panel Side Sponge x 02 Dehd	138.1 x 2 = 276.20	✓
Spare Tyre Lock Screw. Best	85.40	✓
Spare Tyre Panel Insulation Pad New	280(SN)	200(SN)
Rear Door x 02 RH Sealed.	1283 x 2 = 2566	1283.
Rear Door Lock x 02 Damaged	385.9 x 2 = 771.80	✓
Rear Door Weatherstripe x 02 RH New	201 x 2 = 402	201.
Rear Exhaust Pipe Best	891.10	✓
Rear Exhaust Tail Pipe Best	140(SN)	✓
Rear Exhaust Mounting torn	38.50	✓
Rear Exhaust Heat Shield crumpled	179.80	✓
Centre Exhaust Pipe Best	971.40	✓
Centre Exhaust Mounting. Not New	38.50	✓
Rear RH Chassis Sub Member. Distorted.	581.80	✓
Rear Seat Back Rest. Damaged	1800(SN)	1500(SN)
Rear Seat Lower Cushion. Not New	1500(SN)	X
Front Driver Safety Belt. Activated	822.60	✓
Front Passenger Safety Belt.	822.60	✓
Air Bag Sensor x 02 Activated.	276.4 x 2 = 552.80	✓
Air Bag ECU. Activated.	941.70	X
Rear Shock Absorber x 02 Best	421.9 x 2 = 843.80	Rear Anti Roll Bar 273.80
Rear Knuckle Arms x 02 Best	491.6 x 2 = 983.20	Rear Anti Roll Bar Hinge x 02
Rear Wheel Hub c/w Bearing x 02 New	758.5 x 2 = 1517	159.8 x 2 = 319.60
Rear Lateral Link (Front) x 02	2137 x 2 = 4274.00	Rear Cross Member. 1347.10
Rear Lateral Link (Rear) x 02 Best	231.4 x 2 = 462.80	Best
Rear Trailing Arm x 02	276.1 x 2 = 552.20	Height Control Sensor 590.60 Damaged

23619.8

SKH5913K

Date:

No.

Panel Beating	4500	3400
Spray Painting	3000	2400
Wiring	150	100
To undersoil	280	200
To remove upholstery and rear seat	380	300
To remove reverse sensor	100	60
To remove rear camera	100	60
To remove rear windscreen	180	120
To remove rear and centre exhaust	350	200
To remove fuel tank	150	100
To remove rear undercarriage	680	550
To perform wheel alignment	150	80
To transfer rear LH and RH door fittings	300	100
To remove roof top inner trim to facilitate repairs	250	X
To position vehicle on chassis alignment bench	380	300
To remove safety belts	280	200
To reset airbag system	250	180
To remove condenser, radiator and to re-gas	180	X

11660

list: 36844 80

ten 25%: 27633.60

S.N: 2560

labour: 8350

totl: 38543.6

1/5 (10%): 34.7K

24 Days

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

63360.80



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
PREMIUM CARZ SERVICES PTE LTD		Ref : CS/TP17024653/Aqbn2	
1 KAKI BUKIT AVE 6 # 01-90 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		Date : 02-04-2018	
ON BEHALF OF CHAN LEI KOK		Code : TP448	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	Veh. Inspected	SKH 5913K	
Policy No.	Coverage (\$)	0.00	
Claim No.	Excess (\$)	0.00	
Assign From	Assign Date	28/12/2017	
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA CAMRY	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2012
Chassis No.	MR053BK5104007610	Colour	GREY
Odometer	175273	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	YOKOHAMA	6 mm
L/H Front Tyre	215/60 R16	YOKOHAMA	6 mm
R/H Rear Tyre	215/60 R16	YOKOHAMA	6 mm
L/H Rear Tyre	215/60 R16	YOKOHAMA	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	25/12/2017	Inspection Date	28/12/2017
Survey held at	PREMIUM CARZ SERVICES PTE LTD 1 KAKI BUKIT AVE 6 # 01-90 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		24 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKH 5913K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT NUMBER PLATE GARNISH	DEFORMED	83.50	83.50
1	FRONT BUMPER	DEFORMED	545.00	545.00
1	FRONT BUMPER CLIPS	NECESSARY	30.00	30.00
2	FRONT BUMPER SIDE HOLDER @\$98.00	NECESSARY	196.00	196.00
1	FRONT BUMPER TOW COVER	NOT NECESSARY	28.40	-
2	FRONT BUMPER FOG LAMP @\$295.20	NOT NECESSARY	590.40	-
2	FRONT BUMPER FOG LAMP COVER @\$74.00	NOT NECESSARY	148.00	-
1	FRONT BUMPER LOWER GRILLE	DEFORMED	158.00	158.00
1	FRONT BUMPER REINFORCEMENT	BENT	385.60	385.60
1	FRONT BUMPER SPONGE	DEFORMED	88.90	88.90
1	FRONT GRILLE	CRACKED	565.40	565.40
1	FRONT GRILLE LOGO	NECESSARY	72.60	72.60
1	FRONT GRILLE CLIPS	NECESSARY	20.00	20.00
2	HEADLAMP @\$2597.20	CRACKED	5,194.40	5,194.40
1	FRONT BRACE PANEL	BENT	135.00	135.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	565.10	-
1	FRONT SUPPORT PANEL TOP COVER	DEFORMED	230.10	230.10
1	FRONT SUPPORT PANEL TOP COVER CLIPS	NECESSARY	20.00	20.00
1	AIR CON CONDENSER	NOT NECESSARY	1,635.00	-
1	RADIATOR	NOT NECESSARY	2,062.40	-
1	BONNET	TO REPAIR SEE LABOUR	1,211.70	-
1	BONNET LOCK	NOT NECESSARY	128.90	-
1	BONNET CHROME MOULDING	CRACKED	168.80	168.80
1	BONNET CHROME MOULDING CLIPS	NECESSARY	15.00	15.00
2	FRONT FENDER @\$737.00	TO REPAIR SEE LABOUR	1,474.00	-
2	FRONT FENDER TOP GARNISH @\$72.20	NOT NECESSARY	144.40	-
1	FRONT FENDER TOP GARNISH CLIPS	NOT NECESSARY	20.00	-
2	VVTI EMBLEM @\$49.30	NECESSARY	98.60	98.60
2	REAR NUMBER PLATE LAMP @\$56.20	O/S CRACKED	112.40	56.20
1	REAR BUMPER	DISTORTED	589.60	589.60
1	REAR BUMPER CLIPS	NECESSARY	30.00	30.00
2	REAR BUMPER SIDE HOLDER @\$70.40	NECESSARY	140.80	140.80

Report Ref No. CS/TP17024653/Aqbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR BUMPER REFLECTOR @\$65.50	O/S CRACKED	131.00	65.50
1	REAR BUMPER REINFORCEMENT	DISTORTED	391.80	391.80
4	REVERSE SENSOR @\$250.00	DISTORTED	1,000.00	1,000.00
1	REVERSE SENSOR WIRE HARNESS	SNAPPED	358.40	358.40
1	REAR END PANEL	DISTORTED	649.60	649.60
1	REAR END PANEL TOP GARNISH	DEFORMED	434.50	434.50
2	TAILLAMP @\$417.00	N/S CUT / O/S SMASHED	834.00	834.00
2	TAILLAMP PANEL @\$185.10	DENTED	370.20	370.20
1	BOOTLID	DISTORTED	865.90	865.90
1	BOOTLID LOCK	DISTORTED	349.70	349.70
1	BOOTLID LOCK SENSOR	SMASHED	60.40	60.40
1	BOOTLID WEATHERSTRIPE	CUT	225.40	225.40
2	BOOTLID HINGE @\$55.40	BENT	110.80	110.80
2	BOOTLID REFLECTOR @\$289.60	CRACKED	579.20	579.20
1	BOOTLID CHROME MOULDING	CRACKED	383.80	383.80
1	BOOTLID INNER TRIM COVER	CRUMPLED	490.60	490.60
1	BOOTLID INNER TRIM COVER CLIPS	NECESSARY	30.00	30.00
1	BOOTLID OUTER OPENER SWITCH	DAMAGED	138.40	138.40
1	TOYOTA LOGO	NECESSARY	48.90	48.90
1	CAMRY EMBLEM	NECESSARY	39.40	39.40
1	2.0 EMBLEM	NECESSARY	35.80	35.80
2	REAR FENDER @\$999.10	DISTORTED	1,998.20	1,998.20
2	REAR FENDER INNER TRIM @\$386.50	CRUMPLED	773.00	773.00
1	REAR FENDER INNER TRIM CLIPS	NECESSARY	60.00	60.00
2	REAR FENDER INNER SHIELD @\$221.80	O/S TORN	443.60	221.80
1	REAR FENDER INNER SHIELD CLIPS	NECESSARY	60.00	30.00
2	REAR BUMPER BRACKET @\$45.00	DISTORTED	90.00	90.00
1	BOOTLID LOCK COVER	DISTORTED	20.40	20.40
2	REAR FENDER AIR VENT @\$38.10	O/S DEFORMED	76.20	38.10
1	REAR WINDSCREEN MOULDING	NECESSARY	87.80	87.80
1	SPARE TYRE PANEL	DISTORTED	798.60	798.60
2	SPARE TYRE PANEL UNDER COVER @\$201.00	TORN	402.00	402.00
1	SPARE TYRE PANEL UNDER COVER CLIPS	NECESSARY	40.00	40.00
1	SPARE TYRE PANEL TOP COVER	DEFORMED	351.40	351.40
1	SPARE TYRE PANEL TOP SPONGE	DEFORMED	294.10	294.10

Report Ref No. CS/TP17024653/Aqbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	SPARE TYRE PANEL SIDE SPONGE @\$138.10	DEFORMED	276.20	276.20
1	SPARE TYRE LOCK SCREW	BENT	35.40	35.40
2	REAR DOOR @\$1283.00	O/S DENTED	2,566.00	1,283.00
2	REAR DOOR LOCK @\$385.90	DAMAGED	771.80	771.80
2	REAR DOOR WEATHERSTRIPE @\$201.00	O/S NECESSARY	402.00	201.00
1	REAR EXHAUST PIPE	BENT	891.10	891.10
1	REAR EXHAUST MOUNTING	TORN	38.50	38.50
1	REAR EXHAUST HEAT SHIELD	CRUMPLED	179.80	179.80
1	CENTRE EXHAUST PIPE	BENT	971.40	971.40
1	CENTRE EXHAUST MOUNTING	NOT NECESSARY	38.50	-
1	REAR RH CHASSIS SUB MEMBER	DISTORTED	581.80	581.80
1	FRONT DRIVER SAFETY BELT	ACTIVATED	822.60	822.60
1	FRONT PASSENGER SAFETY BELT	ACTIVATED	822.60	822.60
2	AIR BAG SENSOR @\$276.40	ACTIVATED	552.80	552.80
1	AIR BAG ECU	ACTIVATED	941.70	941.70
2	REAR SHOCK ABSORBER @\$421.90	BENT	843.80	843.80
2	REAR KNUCKLE ARM @\$491.60	BENT	983.20	983.20
2	REAR WHEEL HUB C/W BEARING @\$758.50	NECESSARY	1,517.00	1,517.00
2	REAR LATERAL LINK (FRONT) @\$213.70	BENT	427.40	427.40
2	REAR LATERAL LINK (REAR) @\$231.40	BENT	462.80	462.80
2	REAR TRAILING ARM @\$276.10	BENT	552.20	552.20
1	REAR ANTI ROLL BAR	NOT NECESSARY	273.80	-
2	REAR ANTI ROLL BAR LINKAGE @\$159.80	BENT	319.60	319.60
1	REAR CROSS MEMBER	BENT	1,347.10	1,347.10
1	HEIGHT CONTROL SENSOR	DAMAGED	590.60	590.60
	LESS 25% DISCOUNT		-	-9,226.15
			47,120.80	27,678.45
<u>SPECIAL NETT ITEMS</u>				
1	FRONT NUMBER PLATE (SN)	BENT	30.00	30.00
1	FRONT NUMBER PLATE HOLDER (SN)	DEFORMED	30.00	30.00
1	RADIATOR COOLANT (SN)	NOT NECESSARY	40.00	-
1	REAR NUMBER PLATE (SN)	MISSING	30.00	30.00
1	REAR NUMBER PLATE HOLDER (SN)	MISSING	30.00	30.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR CAMERA (SN)	DAMAGED	580.00	480.00

Report Ref No. CS/TP17024653/Aqbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SPARE TYRE PANEL INSULATION PAD (SN)	NECESSARY	280.00	200.00
1	REAR EXHAUST TAIL PIPE (SN)	BENT	140.00	140.00
1	REAR SEAT BACK REST (SN)	DAMAGED	1,800.00	1,500.00
1	REAR SEAT LOWER CUSHION (SN)	NOT NECESSARY	1,500.00	-
			4,580.00	2,560.00
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT SUPPORT PANEL,BONNET AND FRONT FENDER.		4,500.00	3,400.00
	SPRAY PAINTING.		3,000.00	2,400.00
	WIRING.		150.00	100.00
	TO UNDERSEAL.		280.00	200.00
	TO REMOVE UPHOLSTERY AND REAR SEAT.		380.00	300.00
	TO REMOVE REVERSE SENSOR.		100.00	60.00
	TO REMOVE REAR CAMERA.		100.00	60.00
	TO REMOVE REAR WINDSCREEN.		180.00	120.00
	TO REMOVE REAR AND CENTRE EXHAUST.		350.00	200.00
	TO REMOVE FUEL TANK.		150.00	100.00
	TO REMOVE REAR UNDERCARRIAGE.		680.00	550.00
	TO PERFORM WHEEL ALIGNMENT.		150.00	80.00
	TO TRANSFER REAR LH AND RH DOOR FITTINGS.		300.00	100.00
	TO REMOVE ROOF TOP INNER TRIM TO FACILITATE REPAIRS.	NOT NECESSARY	250.00	-
	TO POSITION VEHICLE ON CHASSIS ALIGNMENT BENCH.		380.00	300.00
	TO REMOVE SAFETY BELTS.		280.00	200.00
	TO RESET AIRBAG SYSTEM.		250.00	180.00
	TO REMOVE CONDENSER,RADIATOR AND TO RE-GAS.	NOT NECESSARY	180.00	-
			11,660.00	8,350.00
	GRAND TOTAL		63,360.80	38,588.45

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			34,700.00
---	--	--	------------------

Report Ref No. CS/TP17024653/Aqbn2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.