

Signature

REF:

CS / TP18000180 / Aqbn2

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 5 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SKJ7136M Yr Regn: 2013 May
 Type: M.Car M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Toyota Estima CC: 2362
 Colour: Grey A/C: Insured / Std / NI / NA
 Sp. Reading: 147700 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: AcrS00157745
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 225/50R18
 R: 225/50R18
 BS: DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Front	Rear
R/Bal. <u>06</u> mm	R/Bal. <u>06</u> mm
L/Bal. <u>06</u> mm	L/Bal. <u>06</u> mm
D.O.A. _____	D.O.I. <u>03/01/18</u>

Survey held at NHT

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front n/s, u/c

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Independent.

SKJ 7136M - X

LS \$7000, 5 days (Red \$15403.80, 697.)

RECEIVED 29 APR 2018

Date/Time: File Pass to?

11/06/18 TP

Date/Time: File Return to?

2)

Report Format:

Lump Sum / I.B.I.: (\$ 7000)

Days Of Repair: 5

Resurvey No. of Trip: 1

Add Fee:

☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech. Invs (\$)
☐ Weekend (\$)

Survey Fee:

Transportation:

3 + RS \$

Photos

Others

TOTAL

13x15 = 195

170+195
50
50
64
80
609

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	8614Z

Vehicle Details

Vehicle No.:	SKJ7136M
Vehicle to be Exported:	No
Intended De-registration Date:	03 Jan 2018
Vehicle Make:	TOYOTA
Vehicle Model:	ESTIMA AERAS 2.4 A
Primary Colour:	Grey
Manufacturing Year:	2013
Engine No.:	2AZH961631
Chassis No.:	ACR500157745
Maximum Power Output:	125.0 kW (167 bhp)
Open Market Value:	\$33,471.00
Original Registration Date:	03 May 2013
First Registration Date:	03 May 2013
Transfer Count:	1
Actual ARF Paid:	\$33,471.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	02 May 2023
PARF Rebate Amount:	\$25,103.00

Intended COE Rebate Details

COE Expiry Date:	02 May 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$88,002.00
COE Rebate Amount:	\$46,908.00
Total Rebate Amount:	\$72,011.00

The information contained herein is correct as at 03 Jan 2018

OK

MSME13000634 / SME Motor Pte Ltd - Kaki Bukit
 ENTRY DATE & TIME: 02/01/2018 17:17
 SUBMITTED BY: Chia Pei Ying

Adrian Lke -
 Independent

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 02/01/2018 17:17
 Date Of Accident 30/12/2017 13:10
 Exact Location Of Accident JALAN RAJAH
 Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKJ7136M

Insured/Policyholder

Name Of Registered Owner AUTO FLEETLEASE PTE LTD
 Co Reg No 201608614Z
 Email Address NOEMAIL
 Mobile Phone No
 Alternative Phone No OFFICE-64083833

Vehicle Particulars

Manufacturer TOYOTA
 Model ESTIMA

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category PRIVATE CAR

Insurance Company

Name of Insurance Company LIBERTY INSURANCE PTE LTD
 Type Of Coverage COMPREHENSIVE
 Fleet Policy NO
 Policy Number SD17V04577/VPZ/R00
 Cover Note Number

Driver

Name of Driver DYLAN NG KIAN WAH
 NRIC No S7505816J
 Date Of Birth 10/03/1975
 Occupation INDOOR
 Date Of Driving Pass 29/05/1997
 Driving Experience 20 YEARS AND 7 MONTHS
 Gender MALE
 Mobile Number (LOCAL) +65-94780646
 Fax Number
 Contact Number
 Email Address NOEMAIL

Address BLK 52 COMMONWEALTH DRIVE #07-532
 Postcode 142052
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OTHER - -
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - CHANGE/CROSS LANE
 Weather Conditions RAINING
 Road Surface WET

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

I WAS EXITING THE CARPARK TOWARDS JALAN RAJAH. THERE WERE CONSTRUCTION WORK ALONG JALAN RAJAH WITH 3 WORKERS DIRECTING THE TRAFFIC FLOW. ONE OF THE WORKER STANDING NEAREST TO THE CARPARK EXIT DID NOT ASK TO STOP. THUS, I PROCEED TO TURN TOWARDS JALAN RAJAH. SUDDENLY, VEHICLE B CAME FROM MY LEFT AND WE COLLIDED. AFTER THE ACCIDENT, DRIVER B TOLD ME THAT IT WAS A 'GO' SIGNAGE SHOWN BY THE WORKER THUS SHE DID NOT STOP.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SJJ3076R
 Vehicle Make/Model/Colour
 Details Of Properties VEHICLE B
 Vehicle Category PRIVATE CAR
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

Sketch Plan Pg. 1

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to rescind policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


 Policyholder's Signature
 Date & Time:

 Driver's Signature
 (If driver is not the policyholder)
 Date & Time:


 21/1/18 4:15 pm
 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

SINGAPORE MOTOR INSURANCE CO.

NEW HOCK TECH

Sketch Plan #2 Pg. 1

SKETCH PLAN

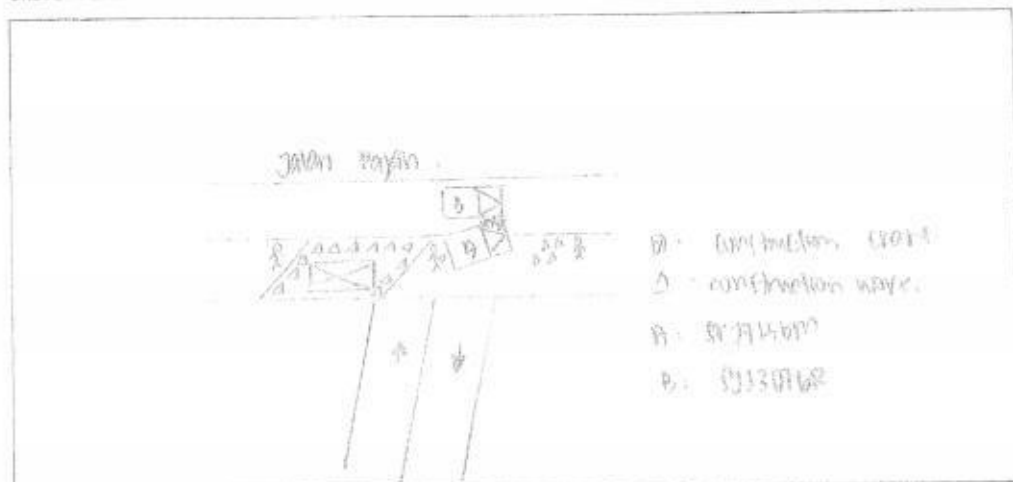

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was exiting the carpark towards Jalan Rajah.
 There were construction work along Jalan Rajah with
 3 workers directing the traffic flow.
 One of the worker standing nearest to the carpark exit
 did not asked to stop thus I proceeded to turn towards
 Jalan Rajah.
 Suddenly, vehicle B came from my left and we collided.
 After the accident, driver B told me that it was a "Go"
 signage shown by the worker thus she did not stop.

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature
 Date & Time:

Driver's Signature
 (If driver is not the policyholder)
 Date & Time:

Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:



Adrian Lkk- Independent
新福德車廠私人有限公司

NEW HOCK TECK MOTOR PTE. LTD.

1 Kaki Bukit Ave 6, Blk C #01-43 Autobay@Kaki Bukit, Singapore 417883

Email: admin@nhtmotor.com Website: www.nhtmotor.com

Tel: 6747 9241 Fax: 6741 7276

UEN: 201718370K

AUTO FLEETLEASE PTE LTD

03/01/2018

Blk 1 Kaki Bukit Ave 6

01-43

Singapore 417883

Xiao Chen

ACR500157745

Accident date: 30/12/2017

Estimated repair cost for vehicle no: SKJ7136M TOYOTA ESTIMA AERAS 2.4 A '13

CHASSIS: ACR500157745

S/n	Qty	Items	U/price	Amount
1	1	Front Bonnet <i>Repair</i>		\$633.90 <i>x</i>
2	2	Front Bonnet Hinge <i>Not New</i>	\$69.90	\$139.80 <i>x</i>
3	1	Front Grille <i>cracked</i>		\$389.90 <i>✓</i>
4	1	Front Grille Emblem Logo <i>new</i>		\$69.90 <i>✓</i>
5	2	Front Head Lamp <i>LH cracked</i>	\$1,981.90	\$3,963.80 <i>1981.90 x</i>
6	2	Front Head Lamp Lower Bracket <i>Not New</i>	\$271.20	\$542.40 <i>x</i>
7	1	Front Bumper <i>Distorted</i>		\$1278.60 <i>✓</i>
8	10	Front Bumper Clip <i>new</i>	\$6.50	\$65.00 <i>30</i>
9	1	Front Bumper Reinforcement <i>2x new</i>		\$367.20 <i>+</i>
10	1	Front Bumper Inner Sponge <i>✓</i>		\$79.90 <i>+</i>
11	1	Front L/H Bumper Side Retainer <i>new</i>		\$85.60 <i>✓</i>
12	1	Front L/H Bumper Fog Lamp <i>cracked</i>		\$277.40 <i>✓</i>
13	1	Front L/H Bumper Fog Lamp Cover <i>cracked</i>		\$99.90 <i>✓</i>
14	1	Front L/H Bumper Fog Lamp Cover Chrome <i>new</i>		\$169.90 <i>x</i>
15	1	Front L/H Fender <i>Dented</i>		\$689.60 <i>✓</i>
16	1	Front L/H Fender Protector <i>Deformed</i>		\$89.90 <i>✓</i>
17	1	Front L/H Fender Cowling <i>Deformed</i>		\$178.90 <i>✓</i>
18	10	Front L/H Fender Cowling Clip <i>new</i>	\$6.50	\$65.00 <i>30</i>
19	1	Front L/H Rim <i>cut</i>		\$680.00 <i>500 (SN)</i>
20	1	Front L/H Tyre <i>Not New</i>		\$350.00 <i>x</i>
21	1	Front L/H Lower Arm <i>Best</i>		\$679.60 <i>442.50</i>
22	1	Front L/H Knuckle Arm <i>Best</i>		\$599.90 <i>✓</i>
23	1	Front L/H Knuckle Arm Bearing <i>new</i>		\$489.90 <i>182.20</i>
24	1	Front L/H Shock Absorber <i>Best</i>		\$498.90 <i>381.90</i>
25	1	Front L/H Stabilizer Bar <i>Not New</i>		\$367.90 <i>x</i>
26	1	Front L/H Drive Shaft <i>new</i>		\$1,098.90 <i>x</i>
27	1	Front Steering Rack <i>Best</i>		\$1,602.90 <i>✓</i>
28	1	Front Crossmember <i>new</i>		\$2,598.90 <i>x</i>

8411 SN: 500
6308.25

Subtotal :- \$17,473.80

Labour charges

To remove & refit front L/H undercarriage	\$380.00 ²²⁰
To remove & refit drive shaft, steering rack & crossmember	\$550.00 ¹⁵⁰
To check wheel alignment	\$150.00 ⁸⁰
To check wiring	\$100.00 ³⁰
Tuff kote	\$150.00 ⁴⁰
Panel beating	\$1,800.00 ⁷⁰⁰
Spray painting	\$1,800.00 ⁷⁰⁰

Subtotal :- \$4,930.00

Total:- \$22,403.80

23083.50

total: 8728.25

L/S: 7K

05 Days

7K



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

NEW HOCK TECK MOTOR WORKSHOP

Ref : CS/TP18000180/Aqbn2

BLK 1, KAKI BUKIT AVE 6
#01-43 SINGAPORE 417883

Date : 06-04-2018



ON BEHALF OF AUTO FLEETLEASE PTE LTD

Code : TP199

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	SKJ 7136M
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	03/01/2018

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ESTIMA	c.c	2362
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	ACR500157745	Colour	GREY
Odometer	147700	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/50 R18	DUNLOP	6 mm
L/H Front Tyre	225/50 R18	DUNLOP	6 mm
R/H Rear Tyre	225/50 R18	DUNLOP	6 mm
L/H Rear Tyre	225/50 R18	DUNLOP	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION AND UNDERCARRIAGE.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	30/12/2017	Inspection Date	03/01/2018
Survey held at	NEW HOCK TECK MOTOR PTE LTD 1 KAKI BUKIT AVENUE 6 #01-43 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	5 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No: 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKJ 7136M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BONNET	TO REPAIR SEE LABOUR	633.90	-
2	FRONT BONNET HINGE @\$69.90	NOT NECESSARY	139.80	-
1	FRONT GRILLE	CRACKED	389.90	389.90
1	FRONT GRILLE EMBLEM LOGO	NECESSARY	69.90	69.90
2	FRONT HEAD LAMP @\$1981.90	N/S CRACKED	3,963.80	1,981.90
2	FRONT HEAD LAMP LOWER BRACKET @\$271.20	NOT NECESSARY	542.40	-
1	FRONT BUMPER	DISTORTED	1,278.60	1,278.60
10	FRONT BUMPER CLIP @\$6.50	NECESSARY	65.00	30.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	367.20	-
1	FRONT BUMPER INNER SPONGE	NOT NECESSARY	79.90	-
1	FRONT L/H BUMPER SIDE RETAINER	NECESSARY	85.60	85.60
1	FRONT L/H BUMPER FOG LAMP	CRACKED	277.40	277.40
1	FRONT L/H BUMPER FOG LAMP COVER	DEFORMED	99.90	99.90
1	FRONT L/H BUMPER FOG LAMP COVER CHROME	NOT NECESSARY	169.90	-
1	FRONT L/H FENDER	DENTED	689.60	689.60
1	FRONT L/H FENDER PROTECTOR	DEFORMED	89.90	89.90
1	FRONT L/H FENDER COWLING	DEFORMED	178.90	178.90
10	FRONT L/H FENDER COWLING CLIP @\$6.50	NECESSARY	65.00	30.00
1	FRONT L/H TYRE	NOT NECESSARY	350.00	-
1	FRONT L/H LOWER ARM	BENT	679.60	442.50
1	FRONT L/H KNUCKLE ARM	BENT	599.90	599.90
1	FRONT L/H KNUCKLE ARM BEARING	NECESSARY	489.90	182.20
1	FRONT L/H SHOCK ABSORBER	BENT	498.90	381.90
1	FRONT L/H STABILIZER BAR	NOT NECESSARY	367.90	-
1	FRONT L/H DRIVE SHAFT	NOT NECESSARY	1,098.90	-
1	FRONT STEERING RACK	BENT	1,602.90	1,602.90
1	FRONT CROSSMEMBER	NOT NECESSARY	2,598.90	-
	LESS 25% DISCOUNT		-	-2,102.75
			17,473.50	6,308.25
<u>SPECIAL NETT ITEMS</u>				
1	FRONT L/H RIM (SN)	CUT	680.00	500.00
			680.00	500.00

Report Ref No. CS/TP18000180/Aqbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REMOVE & REFIT FRONT L/H UNDERCARRIAGE.		380.00	220.00
	TO REMOVE & REFIT DRIVE SHAFT,STEERING RACK & CROSSMEMBER.		550.00	150.00
	TO CHECK WHEEL ALIGNMENT.		150.00	80.00
	TO CHECK WIRING.		100.00	30.00
	TUFF KOTE.		150.00	40.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT BONNET.		1,800.00	700.00
	SPRAY PAINTING.		1,800.00	700.00
			4,930.00	1,920.00
	GRAND TOTAL		23,083.50	8,728.25
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,000.00

Report Ref No. CS/TP18000180/Aqbn2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.