

REF:

NS/INC18000197/Rlgbez

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____


Insured: GBE 7429BPolicy No. 5068035544-03 20.10.2017Claims No. MT/0975474-02

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

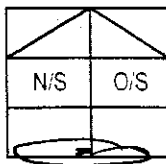Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / FR Seen: _____ Consistent?: Yes or No

Est. Repairs: 4 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No. SHB 152P Yr Regn: 2013 PasType: M.Car / M.Cycle / Bus / Van / Lorry (Taxi) Prime Mover /

Truck / Trailer or

Make: CHEVROLET EPICA cc 1991Colour Maroon A/C Insured / Std / NI / NASp. Reading 767989 T. Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KLI LA6R3BB138241Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/65R15R: 1 -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Pricken

Front _____ Rear _____

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 28/12/17 D.O.I. 29/12/17Survey held at SMARTDes. of Damages: Frt (Rear) / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

SHB 152P - 03/AXA15015335/K120390NA: 30031512/17/2152GBE 7429B - X12/12/17pm Confirmed LS \$3500 and 4 days with Poh Suan.Ched \$2844.44, (5%)NRUCGBE 7429B

RECEIVED 18 JAN 2018

Date/Time. File Pass to?



Preli. Report

12/1/17 12/1/17

Final Report

Date/Time. File Return to?

3)

Days Of Repair: 4Resurvey No. of Trip: 1

Survey Fee:

Transportation

S - PS - S)

Photos

Others

Add Fee: ☐ Site Insp (\$☐ Interview (\$☐ Tech. Ins (\$☐ Weekend (\$Report Format: TP

Lump Sum / I.B. (\$

350016035195



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18000197/R1qb				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 03-01-2018	
			Code: INC4	
1. Policy Particulars - THIRD PARTY CLAIM				
Insured Veh.	GBE 7429B	Veh. Inspected	SHB 152P	
Policy No.	5068035544-03	Coverage (\$)	0.00	
Claim No.		Excess (\$)	0.00	
Assign From		Assign Date	29/12/2017	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	28/12/2017	Inspection Date	29/12/2017	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

Survey Department Check List (Case Handler)

Reference No.: NS/INC18000/971496
 Policy Type: OD (TP) / TP RES / TL / EVA

SMB 152P

Case Handler

Typist

Admin (Cathy): Case handler to make sure all information created by the assignment team are **ACCURATE**.

(1) Office Assign Form

- C Reference No.
- C Customer Code
- N Assign From
- C Assign Date
- C Veh No (Inspected)
- C Veh No (Insured)
- C D.O.A
- C Policy No
- C Claim No
- C Insurance Authorisation (CA /REV/REP)
- C Report Type
- C Weekend Charges
- N Survey held at/Repairer
- C Excess

Y-Date	N-Date	Y-Date	N-Date
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			

Surveyor (Paul): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

- C Vehicle No
- C Regn Month/Year
- N Vehicle Type
- N Make & Model
- C Engine Capacity. (C.C)
- N Colour
- C Odometer. (Sp.Reading)
- C Chassis No
- N General Condition
- N Steering
- N Brake
- N Modification (Modi)
- C Tyre Size
- N Tyre Make
- C Tyre Balance
- C Date of Inspection
- N Survey held
- N Des.of Damages

✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			
✓			

(2) System - (Views/Merimen)

- C Damaged Vehicle Photographs Uploaded

✓		
---	--	--

(3) Workshop Estimate/Assignment Form

- N ALL Parts condition
- C Market Value for OD cases
- C Estimate Repair Cost for PRI (RSI, TMI, MSIG)
- C Days of repair
- C Finalised Amount
- C Re-inspection Cases to Finalize within 5 Days

✓		
✓		

(4) System - (Views/Merimen)

- C Resurvey photo Uploaded

✓		
---	--	--

Check By: [Signature] 19/1/18
 Case Handler Date

TP Claims against NTUC Income: Follow-Through Survey

Date : 12/01/2018

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate	Tentative repair cost
1	MT/0974964-003	CITYCAB PTE LTD	SHC 926T	SKN 4852C	24/12/2017	16:10	\$ 3,231.90	\$ 1,400.00
2	MT/0965594-002	SMRT BUSES LTD	SG 1046A	SJK 9733H	10/10/2017	11:20	\$ 12,108.35	\$ 9,303.66
3	MT/0974611-002	SMRT TAXI PTE LTD	SHB 1023Y	GW 2992U	18/12/2017	7:40	\$ 7,209.04	\$ 1,100.00
4	MT/0974888-002	SMRT TAXI PTE LTD	SHF 466M	PA 8025G	21/12/2017	8:10	\$ 7,656.80	\$ 1,250.00
5	MT/0973641-002	SMRT TAXI PTE LTD	SHD 6318D	FBC 2047M	11/12/2017	6:27	\$ 4,497.17	\$ 2,857.60
6	MT/0976356-002	SMRT TAXI PTE LTD	SHF 301E	SFT 68D	1/1/2018	6:11	\$ 8,472.24	\$ 1,100.00
7	MT/0977899-001	SMRT TAXI PTE LTD	SHB 5827T	SDS 6588J	4/1/2018	10:20	\$ 1,978.61	\$ 924.77
8	MT/0975474-002	SMRT TAXI PTE LTD	SHB 152P	GBE 7429B	28/12/2017	11:00	\$ 6,344.44	\$ 3,500.00
9	MT/0973932-002	SMRT TAXI PTE LTD	SHF 441J	SIL 7917C	15/12/2017	18:10	\$ 9,147.71	\$ 1,850.00
10	MT/0970425-002	SMRT BUSES LTD	SMB 21A	SKH 2771Y	17/11/2017	17:05	\$ 2,929.36	\$ 1,900.00
11	MT/0976470-002	SMRT TAXI PTE LTD	SHC 4700B	SLT 752R	4/1/2018	8:35	\$ 2,057.39	\$ 1,050.00
12	NOT INCOME	SMRT TAXI PTE LTD	SHB 5040X	SDG 1662Z	31/12/2017	21:35	\$ 2,759.80	\$ 1,467.80
13	MT/0974170-002	SMRT TAXI PTE LTD	SHC 4021C	SID 3664A	17/12/2017	18:20	\$ 2,551.82	\$ 550.00

eBaoTech

GeneralClaim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No. Date of Accident
Vehicle No.(For Motor)

Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input type="radio"/>	5068035544-03	JURONG TOWN COLDSTORAGE PTE LTD	201218718C	GFT	Comprehensive	GBE7429B	GBE7429B	20/10/2017	

Celine Fong (LKKAUTO)

From: Celine Fong (LKKAUTO)
Sent: Monday, 15 January, 2018 12:44 PM
To: 'Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)'; Rasul (LKKAUTO)
Subject: RE: SHB152P

Dear Poh Suan,

Confirmed lump sum \$3,500.00, 4 days.

Best Regards,

Celine Fong

LKK Auto Consultants Pte Ltd

phone: 6256-3561 | email: celinefong@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC) [mailto:YeoPohsuan@smrt.com.sg]

Sent: Friday, 5 January, 2018 2:46 PM

To: Rasul (LKKAUTO) <Rasul@lkkauto.com>

Cc: Celine Fong (LKKAUTO) <celinefong@lkkauto.com>; 'Leong Chee kwong' <cheekwongwega@gmail.com>

Subject: SHB152P

Hi Rasul,

Attached herewith the repair estimate of SHB 152P having Case No: TAX/12/17/2152.

There is no change to the approved amount of \$3,500 @ 4 working days under lump sum repair.

Cost of Repair invoice will be generated as approved.

Please finalize with me within 7 working day, thanks.

Aside Kwong,

Please provide the before / after paint photos as per surveyor's request.

Thanks & Regards

Poh Suan

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)

Sent: 05 January 2018 02:29

To: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)

Subject: Scan Data from FX-D421D6

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 5369K

Vehicle Details

Vehicle No.: SHB152P

Vehicle to be Exported: No

Intended De-registration Date: 15 Jan 2018

Vehicle Make: CHEVROLET

Vehicle Model: EPICA 2.0DSL AT ABS/AB
2WD 4DR TURBO

Primary Colour: Maroon

Manufacturing Year: 2012

Engine No.: Z20S1463297K

Chassis No.: KL1LA69RJBB138241

Maximum Power Output: 110.0 kW (147 bhp)

Open Market Value: \$14,189.00

Original Registration Date: 26 Feb 2013

First Registration Date: 26 Feb 2013

Transfer Count: 0

Actual ARF Paid: \$14,189.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 25 Feb 2021

PARF Rebate Amount: \$10,641.00

Intended COE Rebate Details

COE Expiry Date: 25 Feb 2021

COE Category: A - Car (1600cc & below)

COE Period(Years): 8

PQP Paid: \$66,403.00

COE Rebate Amount: \$25,839.00

Total Rebate Amount: \$36,480.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 15 Jan 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	29/12/2017 10:45
Date Of Accident	28/12/2017 11:00
Exact Location Of Accident	SLIP ROAD FROM KJE TOWARDS WOODLANDS ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB152P
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-800000000

Vehicle Particulars

Manufacturer	CHEVROLET
Model	EPICA-2.0 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-17087562MFSH
Cover Note Number	

Driver

Name of Driver	ABDUL RAHMAN BIN SHARIFF
NRIC No	S1242763H
Date Of Birth	31/08/1957
Occupation	OUTDOOR
Date Of Driving Pass	01/01/2000
Driving Experience	17 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
EEmail Address	NOEMAIL

Address	515 JELAPANG ROAD 11-201
Postcode	670515
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I WAS STATIONARY ALONG THE SLIP ROAD FROM KJE TOWARDS WOODLANDS ROAD AS I WAS LOOKING OUT FOR THE ONCOMING TRAFFIC. SUDDENLY I FELT AN IMPACT AT THE REAR OF MY TAXI. A VEHICLE GBE7429B HAD COLLIDED ONTO THE REAR OF MY TAXI.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBE7429B
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	GOODS VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan Pg. 1

SKETCH PLAN

SKETCH PLAN

Woodlands Road

A-SHB152P
B-GBE7429B
KJE

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

[illegible]

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:


SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The Issue and acceptance of this Form by Insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) Investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(Including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

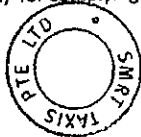


Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Accident Photo

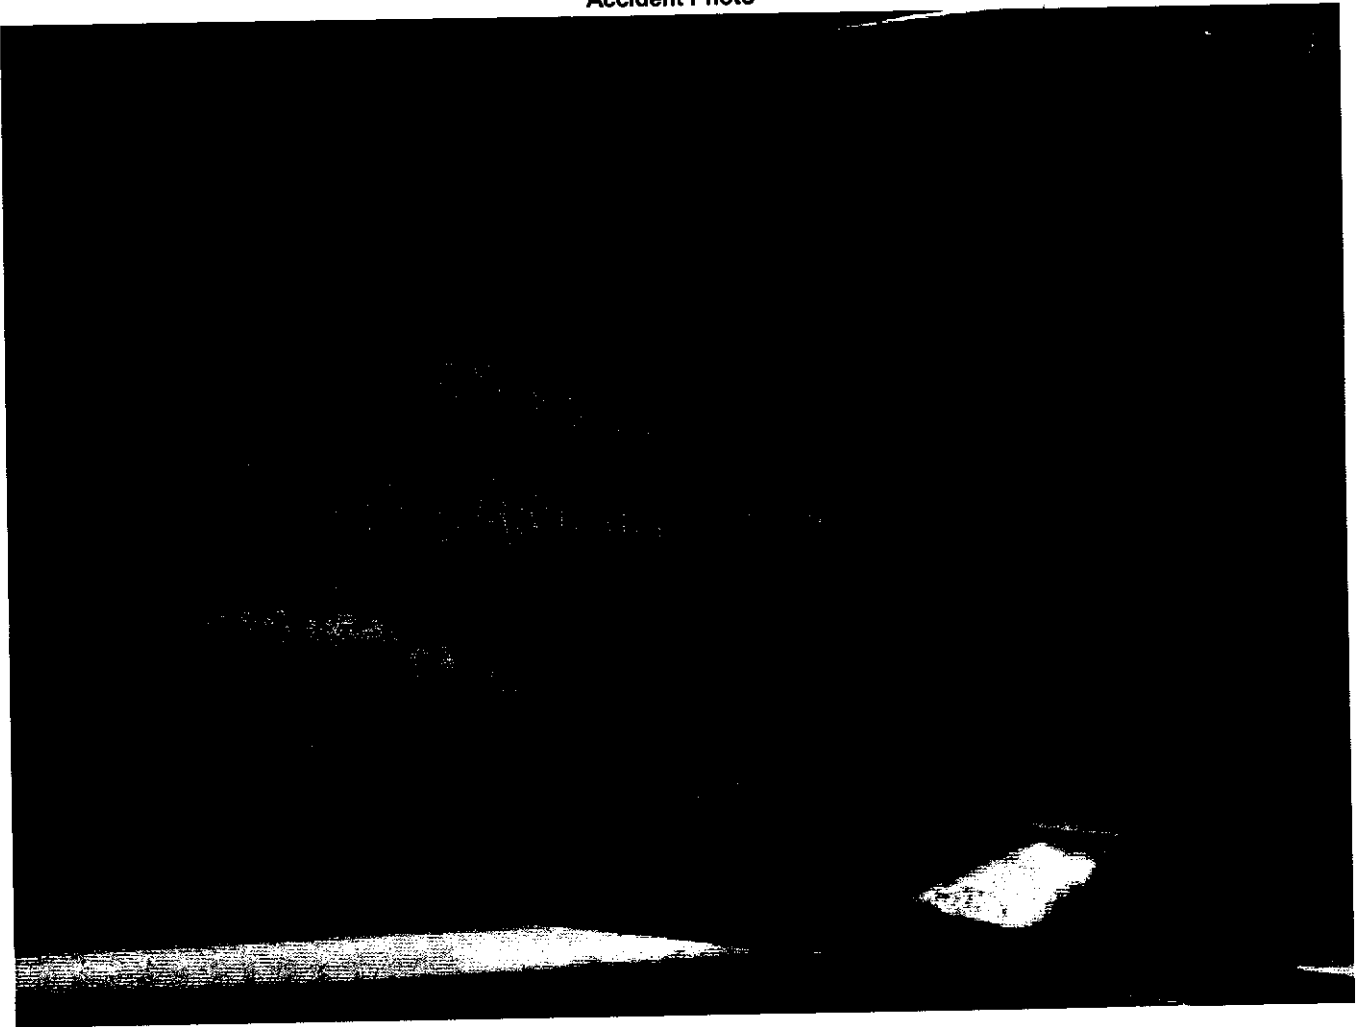

Accident Photo

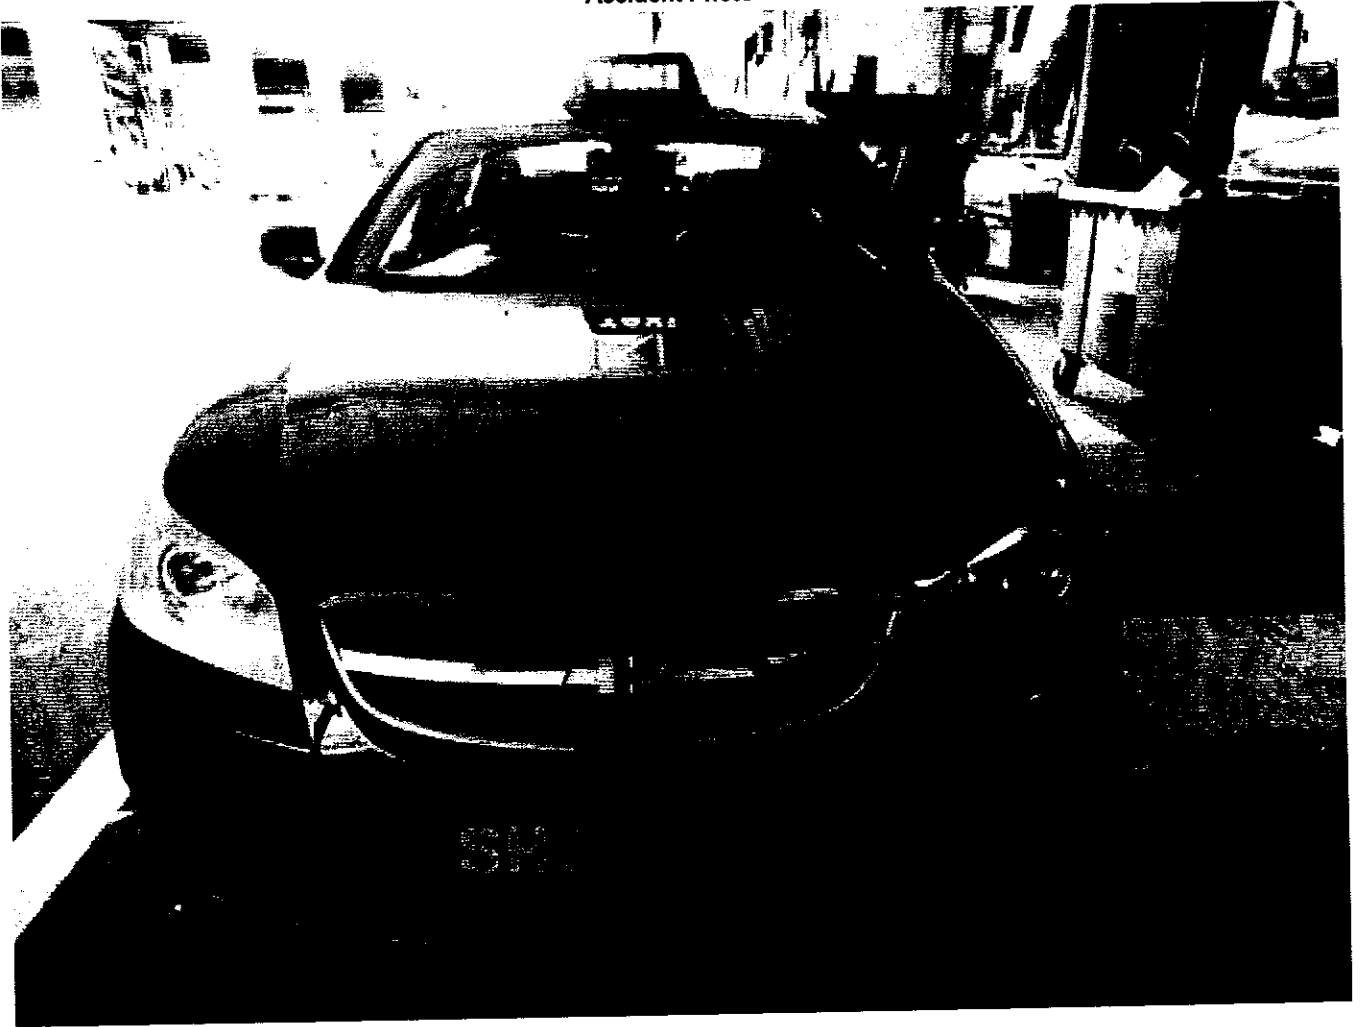

Accident Photo



Accident Photo



Accident Photo




SMRT Accident Vehicle Repair Estimates

CS/11A

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB152P
 Ref. No : TAX/12/17/2152
 Reg. Date : 26/02/2013
 Vehicle Type : TAXI
 Make : CHEVROLET EPICA 2.0 VCDI
 Model : EPICA-2.0
 Name of Driver : ABDUL RAHMAN BIN SHARIFF
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 28/12/2017 11:00:00 AM
 Accident Reported Date / Time : 29/12/2017 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : No
 Towed Back Date/Time :
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024093843
 Special Instruction to ARC, if any :
 GBE7429B - NTUC IDAC / Resurvey after repair
 Prepared Date : 29/12/2017 11:15:05 AM

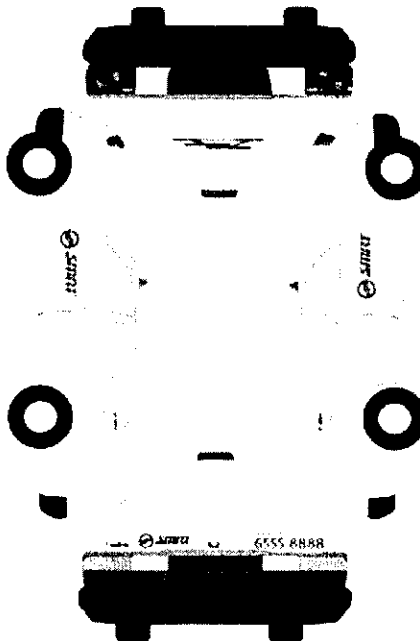

LKK Auto Consultants hence notify
 the Repairer of the following:
 • To resurvey before/after spray painting
 • To display damaged part(s) during resurvey
 • Parts prices are subject to confirmation
 • Third party survey is on a "Without Prejudice" basis
 • No illegal modification(s) is allowed
 • Supplementary item(s) must be resurveyed and
 is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

Chassis No : KL1LA69RJBB138241

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 845.00	0.00
Total Spray Painting Charges	: 936.00	0.00
Total Material Charges	: 3,646.56	3,646.56
Other Charges	: 916.88	0.00
TOTAL	: 6,344.44	0.00
Lum Sum Total	: 6,350.00	0.00
No. of Repair Days	: 5.00	0.00 <i>4 days / Lump</i>
Prepared / Adjusted By	:	
Arc / Surveyor Sign Off Date	: 29/12/2017 02:03:27 PM	01/01/1900 12:00:00 AM

[Signature]

Paul
29/12/17 @ 1420

[Signature]
5/1/18

Prepared / Adjusted Date :

Remarks :

Prepared Date : 29/12/2017 02:02:26 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
REPAIR REAR PORTION	845.00	0.00 400
Total Labour	845.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
REPSRAY REAR BUMPER	378.00	0.00 200
RESPRAY BUMPER BEAM	180.00	0.00 100?
RESPRAY REAR BOOT LID	378.00	0.00 200
Total Spray Painting & Panel Beating	936.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
PROVIDE LABOUR & MATERIAL TO REPLACE FIELD REAR BUMPER (NET)	140.00	0.00 140
PROVIDE LABOUR & MATERIAL FOR OVERTURN STICKER(NET)	296.88	0.00 296.88
TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 60
REPLACE SUNDRY PARTS	100.00	0.00 20
WASH AND VACUUM	60.00	0.00 40
TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 60
Total Other Costs	916.88	0.00

art 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
3745100	REAR	6504569	BUMPER RR	1	1,238.00	10.00	1,114.20	Replace	Replace <i>cat</i>	No
3873838	REAR		ABSORBER ENGY RR BUMPER	1	70.00	10.00	63.00	Replace	Replace <i>?</i>	No
3941154	REAR	6504571	BEAM RR BUMPER IMPACT	1	1,221.00	10.00	1,098.90	Replace	Replace <i>?</i>	No
	REAR		SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace <i>nu</i>	No
	REAR		BRACKET RR BUMPER SIDE LH	1	49.00	10.00	44.10	Replace	Replace <i>X</i>	No
3633534	REAR		BRACKET RR BUMPER SIDE RH	1	49.00	10.00	44.10	Replace	Replace <i>nu</i>	No
3858575		6504584	REFLECTOR REFLEX RR LH	1	264.00	10.00	237.60	Replace	Replace <i>X</i>	No
3858576	REAR	6504586	REFLECTOR REFLEX RR RH	1	264.00	10.00	237.60	Replace	Replace <i>scr</i>	No
3636630	REAR	6504631	REAR BOOT LID	1	974.00	10.00	876.60	Replace	Replace <i>nu</i>	No
3634023	REAR	6504567	EMBLEM REAR	1	44.00	10.00	39.60	Replace	Replace <i>nu</i>	No
3634035	REAR	6504564	LETTERING:"CHEVR OLET"	1	29.00	10.00	26.10	Replace	Replace <i>nu</i>	No
3634897	REAR	6504565	LETTERING:"EPICA LT"	1	28.00	10.00	25.20	Replace	Replace <i>nu</i>	No
3851766	REAR	6504583	LAMP BACK UP RH	1	122.00	10.00	109.80	Replace	Replace <i>nu</i>	No
3851764	REAR	6504511	LAMP RR COMBINATION RH	1	415.00	10.00	373.50	Replace	Replace <i>scr</i>	No
	COMMO N		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace <i>nu</i>	No
	COMMO N		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace <i>nu</i>	No
			LINER RH REAR FENDER (PROTECTOR)	1	65.00	10.00	58.50	Replace	Replace <i>X</i>	No
TOTAL MATERIALS								4,558.20	4,558.20	
TOTAL MATERIALS(Discounted)							3,646.56	3,646.56		

dded Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									



S. 01: 18/11/17
 4. 01.18/11.00 - ADV
 4. 01.18/15.00

60 Woodlands Industrial Park E4, Singapore 757705

FAX Number : 63685592

Estimator Telephone Number : 68662623


Accident Reporting Number : 68662672

SMRT Accident Vehicle Repair Estimates

29.12.17/15.00

Section 2 To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB152P
 Ref. No : TAX/12/17/2152
 Reg. Date : 26/02/2013
 Vehicle Type : TAXI
 Make : CHEVROLET EPICA 2.0 VCDI
 Model : EPICA-2.0
 Name of Driver : ABDUL RAHMAN BIN SHARIFF
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 28/12/2017 11:00:00 AM
 Accident Reported Date / Time : 29/12/2017 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by : Rasul
 Vehicle is Towed Back? : No
 Towed Back Date/Time :
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024093843
 Special Instruction to ARC, if any :
 GBE7429B - NTUC IDAC
 Resurvey After repair photo FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR RASUL / HP : 9001 0068. email: rasul@lkkauto.com
 Prepared Date : 29/12/2017 11:15:05 AM

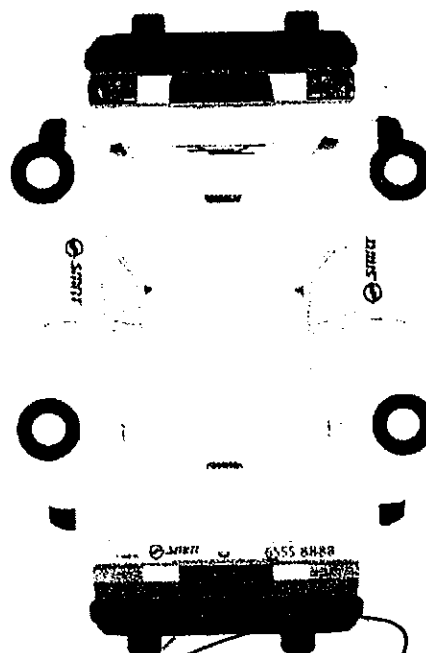

QC 31/1/17 16.20 PASS

Vehicle to Waga Date In: 2/1/18	Towing:
Time In: 14.05	Driver: Rasul
Waga Job No: 14047101	
Vehicle sent to SMRT Date In: 3-1-2018	Towing:
Time In: 3-30	
Inspected by (SMRT):	

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : KL1LA69RJBB138241

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 845.00	400.00
Total Spray Painting Charges	: 936.00	400.00
Total Material Charges	: 1,885.63	2,946.30
Other Charges	: 916.88	-246.30
TOTAL	: 4,583.51	3,500.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 5.00	4.00
Prepared / Adjusted By	:	RASUL
Arc / Surveyor Sing Off Date	: 29/12/2017 02:03:27 AM	29/12/2017 02:40:46 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 29/12/2017 02:02:26 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : QN-801-0092
Quotation Date : 4/1
Invoice Amount : 0.00

Invoice No :
Invoice Date :
Prepared Date : 12/29/2017 2:44:36 PM

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	845.00	400.00
Total Labour	845.00	400.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00
TO RESPRAY BUMPER BEAM	180.00	0.00
TO RESPRAY REAR BOOT LID	378.00	200.00
Total Spray Painting & Panel Beating	936.00	400.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00
TO PROVIDE LABOUR & MATERIAL TO REPLACE SHIELD REAR BUMPER (NET)	140.00	140.00
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	296.88	296.88
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	60.00
TO REPLACE SUNDRY PARTS	100.00	20.00
TO WASH AND VACUUM	60.00	40.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	60.00
ump Sum Adjustment by Surveyor	0.00	-893.18
Total Other Costs	916.88	-246.30

7779.78

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
3745100	REAR	6504569	BUMPER RR	1	1,238.00	10.00	1,114.20	Replace	Replace	No
6873838	REAR		ABSORBER ENGY RR BUMPER	0	70.00	10.00	0.00	Replace	Not given	No
6941154	REAR	6504571	BEAM RR BUMPER IMPACT	0	1,221.00	10.00	0.00	Replace	Not given	No
	REAR		SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No
	REAR		BRACKET RR BUMPER SIDE LH	0	49.00	10.00	0.00	Replace	Not given	No
6633534	REAR		BRACKET RR BUMPER SIDE RH	1	49.00	10.00	44.10	Replace	Replace	No
6858575		6504584	REFLECTOR REFLEX RR LH	0	264.00	10.00	0.00	Replace	Not given	No
6858576	REAR	6504586	REFLECTOR REFLEX RR RH	1	264.00	10.00	237.60	Replace	Replace	No
6636630	REAR	6504631	REAR BOOT LID	1	974.00	10.00	876.60	Replace	Replace	No
6634023	REAR	6504567	EMBLEM REAR	1	44.00	10.00	39.60	Replace	Replace	No
6634035	REAR	6504564	LETTERING:"CHEVR OLET"	1	29.00	10.00	26.10	Replace	Replace	No
6634897	REAR	6504565	LETTERING:"EPICA LT"	1	28.00	10.00	25.20	Replace	Replace	No
6851766	REAR	6504583	LAMP BACK UP RH	0	122.00	10.00	0.00	Replace	Not given	No
6851764	REAR	6504511	LAMP RR COMBINATION RH	1	415.00	10.00	373.50	Replace	Replace	No
	COMMO N		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
	COMMO N		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
			LINER RH REAR FENDER (PROTECTOR)	0	65.00	10.00	0.00	Replace	Not given	No
TOTAL MATERIALS							2,946.30	2,946.30		
TOTAL MATERIALS(Discounted)							1,885.63	2,946.30		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

2946.30
 + 400.00
 + 1046.88

 4393.18
 - 20%

 3514.54
 L/S \$3500/-

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H

Thatcham *escribe*

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18000197/R1qbe2			
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556		Date: 19-01-2018	
		Code: INC4	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBE 7429B	Veh. Inspected	SHB 152P
Policy No.	5068035544-03	Coverage (\$)	0.00
Claim No.	MT/0975474-002	Excess (\$)	0.00
Assign From		Assign Date	29/12/2017
2. Vehicle Particulars & Condition			
Make & Model	CHEVROLET EPICA	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	KL1LA69RJBB138241	Colour	MAROON
Odometer	767989	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/65 R15	FALKEN	6 mm
L/H Front Tyre	205/65 R15	FALKEN	6 mm
R/H Rear Tyre	205/65 R15	FALKEN	6 mm
L/H Rear Tyre	205/65 R15	FALKEN	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	28/12/2017	Inspection Date	29/12/2017
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 152P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER RR (DISC 10%)	CUT	1,238.00	1,114.20
1	BRACKET RR BUMPER SIDE RH (DISC 10%)	NECESSARY	49.00	44.10
1	REFLECTOR REFLEX RR RH (DISC 10%)	SCRATCHED	264.00	237.60
1	REAR BOOT LID (DISC 10%)	BENT	974.00	876.60
1	EMBLEM REAR (DISC 10%)	NECESSARY	44.00	39.60
1	LETTERING:"CHEVROLET" (DISC 10%)	NECESSARY	29.00	26.10
1	LETTERING:"EPICALT" (DISC 10%)	NECESSARY	28.00	25.20
1	LAMP RR COMBINATION RH (DISC 10%)	SCRATCHED	415.00	373.50
1	SENSOR REVERSE (SN)	NOT WORKING	180.00	180.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	REFLECTOR REFLEX RR LH	SERVICEABLE	264.00	-
1	LAMP BACK UP RH	SERVICEABLE	122.00	-
1	LINER RH REAR FENDER (PROTECTOR)	SERVICEABLE	65.00	-
1	ABSORBER ENGY RR BUMPER	NOT NECESSARY	70.00	-
1	BEAM RR BUMPER IMPACT	NOT NECESSARY	1,221.00	-
1	BRACKET RR BUMPER SIDE LH	NOT NECESSARY	49.00	-
			5,041.40	2,946.30
	<u>LABOUR</u>			
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		1,601.88	986.88
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		936.00	400.00
	TO REPLACE SUNDRY PARTS.		100.00	20.00
	TO WASH AND VACUUM.		60.00	40.00
			-	-
			-	-
			2,697.88	1,446.88
	GRAND TOTAL		7,739.28	4,393.18

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)			3,500.00
---	--	--	-----------------

Report Ref No. NS/INC18000197/R1qbe2

Report Ref No. NS/INC18000197/R1qbe2



MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor



K.K.LAU CPT(RET)

**BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE**

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.