

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured: **SJL 2071A**  
 Policy No. **5040339156-08 19.11.17 - 18.11.18**  
 Claims No. **MT/0976348-002**  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)  
 Remark: **The veh had commenced its repair at the time of inspection.**

N/S	O/S

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
 CA / REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: **SHB5501H** Yr Regn: **30/11/2017**  
 Type: **M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /**  
 Truck / Trailer or \_\_\_\_\_  
 Make: **Toyota Prius 4.** cc **1798**  
 Colour: **Maroon.** A/C: **Insured / Std / NI / NA**  
 Sp. Reading: **14778** T/Radio: **Insured / Std / NI / NA**  
 Eng/No: \_\_\_\_\_  
 C/No: **JTDBK3F4903575629.**  
 Gen. Cond: **Good / Fair / Poor / Burnt**  
 Steering: **In order / Jammed / Leaked / Burnt or** \_\_\_\_\_  
 Brake: **In order / Jammed / Leaked / Burnt or** \_\_\_\_\_  
 Modl: **Nil / S/Rim / STD A/Rim or** \_\_\_\_\_  
 Tyre Size: **F: 175/65R15**  
**R: " "**  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or \_\_\_\_\_  
 Front \_\_\_\_\_ Rear \_\_\_\_\_  
 R/Bal. **6** mm R/Bal. **6** mm  
 L/Bal. **6** mm L/Bal. **6** mm  
 D.O.A. **3/1/18.** D.O.I. **4/1/18.**  
 Survey held at **SMART.**  
 Des. of Damages: **Frt / Rear / O/S / N/S / UIC / Rooftop or** \_\_\_\_\_  
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
SHB 5501H	NS / INC16015886 / KHH302
SJL 2071A	X
	DOA: 130216 TAX/01/18/2013
	LK.
	NTUC.
	part by part \$16,347.54 (Red: 5514.79 (25%))
	refinalised \$17,773.01 (Red: 4089.32 (18%))
	RECEIVED 08 MAY 2018

Date/Time, File Pass to?  : Preli. Report  
 1) **2/5 Typist**  : Final Report  
 Date/Time, File Return to?  
 2) \_\_\_\_\_  
 Report Format: **TP**  
 Lump Sum / I.B.I: (\$) **16 347.54**

Days Of Repair: **9**  
 Resurvey No. of Trip: **2**

Add Fee:  Site Insp (\$) )  
 Interview (\$) )  
 Tech. Invs (\$) )  
 Weekend (\$) )

Survey Fee: **160**  
 Transportation: \_\_\_\_\_  
 S+RS. (\$) )  
 Photos )  
 Gibers ) **35**  
 TOTAL **195**



# National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18000301/Stb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 05-01-2018

189556



Code: INC4

## 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJL 2071A	Veh. Inspected	SHB 5501H
Policy No.	5040339156-08	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	04/01/2018

## 2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

## 4. Description of Damages

--

## 5. General Information

Accident Date	03/01/2018	Inspection Date	04/01/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

## 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

**TP Claims against NTUC Income: Follow-Through Survey**

Date : 30/4/2018

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate
1	MT/0976348-002	SMRT TAXIS	SHB 5501H	SJL 2071A	3/1/2018	15:20	\$ 22,836.01
2	MT/0990683-002	SMRT TAXIS	SHC 4711U	SJE 1842K	15/4/2018	18:06	\$ 5,757.27

## Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHB5501H
Vehicle to be Exported:	No
Intended De-registration Date:	05 Jan 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS109766
Chassis No.:	JTDKB3FU903575629
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	30 Nov 2017
First Registration Date:	30 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Nov 2025

PARF Rebate Amount:	\$3,750.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	29 Nov 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$33,596.00
COE Rebate Amount:	\$33,176.00
<b>Total Rebate Amount:</b>	<b>\$36,926.00</b>
<b>Message</b>	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 05 Jan 2018

OK

Hello, NAC\_PAYA\_UBI\_800601

Change Language Change Password Log Out

My Desktop  
Notice of Loss

Policy Query

Policy No.  Date of Accident

Vehicle No.(For Motor)

Search

Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input checked="" type="radio"/>	5040339156-08	KOENITZ MICHAEL GARY	S0225933H	GPC	drivo CLASSIC	SJL2071A	SJL2071A	19/11/2017	18/11/2018

Continue

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	04/01/2018 09:27
Date Of Accident	03/01/2018 15:20
Exact Location Of Accident	T4 BOULEVARD JUNCTION T4 WAY
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB5501H
<b>Insured/Policyholder</b>	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

### Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

### Insurance Company

Name of Insurance Company	FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-17087562MFSH
Cover Note Number	

### Driver

Name of Driver	LEE LIM TIEW
NRIC No	S0184174B
Date Of Birth	22/09/1952
Occupation	OUTDOOR
Date Of Driving Pass	14/06/1973
Driving Experience	44 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
E-Mail Address	NOEMAIL

Address	104 RIVERVALE WALK 12-140
Postcode	540104
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	COLLISION - CROSS JUNCTION
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

I WAS TRAVELLING ALONG T4 BOULEVARD AND UPON REACHING THE JUNCTION WITH T4 WAY, TRAFFIC LIGHT WAS GREEN IN MY FAVOUR AND THUS I PROCEEDED STRAIGHT. SUDDENLY THE VEHICLE FROM T4 WAY BEAT THE RED TRAFFIC LIGHT AND COLLIDED ONTO THE LEFT PORTION OF MY TAXI.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	FILE TOO LARGE
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJL2071A
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	KOENITZ MICHAEL GARY @ISKANDAR BIN ABDULLAH
NRIC/Passport Number	S0225933H
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	1








12-1-18 / 12:26  
12-1-18 / 16:26

4-1-18 / 16:26

# SMRT Accident Vehicle Repair Estimates

## Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre


Reg. No : SHB5501H  
 Ref. No : TAX/01/18/2013  
 Reg. Date : 30/11/2017  
 Vehicle Type : TAXI  
 Make : TOYOTA PRIUS  
 Model : PRIUS4  
 Name of Driver : LEE LIM TIEW  
 Type of Accident : HEAD TO SIDE  
 Date / Time of Accident : 03/01/2018 03:20:00 PM  
 Accident Reported Date / Time : 04/01/2018 12:00:00 AM  
 Surveyor is Required? : Yes  
 Survey by : Sebastian  
 Vehicle is Towed Back? : Yes  
 Towed Back Date/Time : 03/01/2018  
 Replacement Vehicle issued? : No  
 Accident Repair Job Card No : 000024093917  
 Special Instruction to ARC, if any :  
 TOWED \$42.80 / SJL2071A NTUC PLR  
 BEFORE PAINT PHOTO FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR SEBASTIAN (LKK)  
 & Email : sebastianyeang @lkkauto.com HP:90036121  
 Prepared Date : 04/01/2018 09:48:10 AM

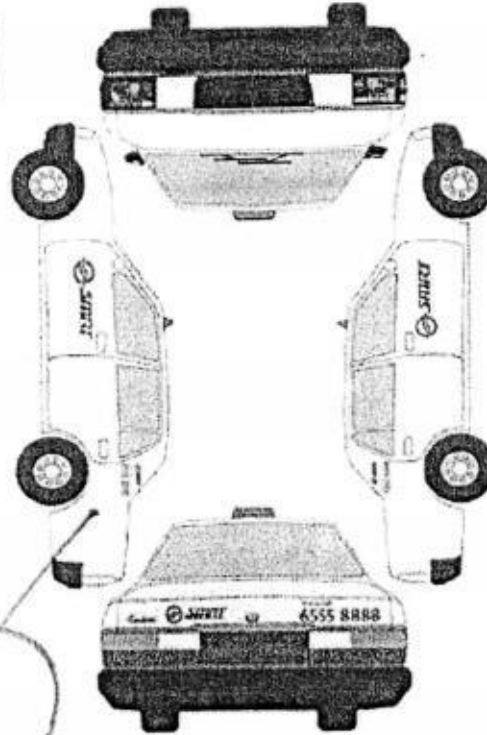

13/1

2

4778 km

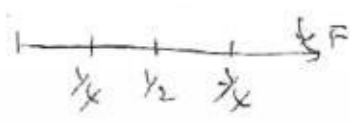

Recording Camera    
 Radio Antenna    
 1<sup>st</sup> witness A Date 4-1-18  
 2<sup>nd</sup> witness \_\_\_\_\_ Date \_\_\_\_\_

Supplementary  
to Refer to the Supplementary part list ✓

10-04-18 9:30 Reject

11/4/18 16:48  
pass

LEE SHENG AUTO PTE LTD

Vehicle Return Date: 9-4-18  
 Vehicle Repair Time: 16:34  
 SMRT Staff Sign: \_\_\_\_\_

**Section B - To be Completed by Service Advisor, Accident Repair Centre**

Chassis No : JTDKB3FU903575629

Mileage : 0

Work Shop :

Repair Completed Date / Time :

**Summary of Repair Estimates**

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	1,352.00	1,000.00
Total Spray Painting Charges	1,674.00	700.00
Total Material Charges	17,316.33	15,283.01
Other Charges	1,520.00	790.00
<b>TOTAL</b>	<b>21,862.33</b>	<b>17,773.01</b>
Lum Sum Total	0.00	0.00
No. of Repair Days	9.00	9.00
Prepared / Adjusted By		SEBASTIAN (LKK)
Arc / Surveyor Sign Off Date	04/01/2018 02:17:15 AM	04/01/2018 03:49:43 AM

M

LKK

Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/01/2018 02:17:15 AM

**Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair**

Quotation No : QN-1804-0420

Invoice No :

Quotation Date : 18/4

Invoice Date :

Invoice Amount :

Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH PORTION	1,352.00	1,000.00 /
<b>Total Labour</b>	<b>1,352.00</b>	<b>1,000.00</b>

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT FENDER LH	378.00	200.00 /
TO RESPRAY FRONT PILLAR LH	180.00	0.00
TO RESPRAY FRONT DOOR LH	378.00	200.00 /
TO RESPRAY CENTER PILLAR LH	180.00	100.00 /
TO RESPRAY REAR DOOR LH	378.00	100.00 /
TO RESPRAY ROCKER PANEL MOULDING	180.00	100.00 /
<b>Total Spray Painting &amp; Panel Beating</b>	<b>1,674.00</b>	<b>700.00</b>

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	40.00 /
TO CHECK & RESET SYSTEM FUNCTION	350.00	200.00 /
TO REMOVE / REFIT SEAT	120.00	80.00 /
TO REMOVE & REFIT ROOF LINING	350.00	200.00 /
TO TRANSFER DOOR MECHANISM	240.00	160.00 /
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO REMOVE AND REFIX AIR BAG SYSTEM	120.00	80.00 /
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
<b>Total Other Costs</b>	<b>1,520.00</b>	<b>790.00</b>

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5380247100			FENDER SUB-ASSY, FR, LH	1	933.10	100.00	0.00	Replace	Repair	No <i>R</i>
7537447140			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	25.00	39.67	Replace	Replace	No <i>/</i>
6101447010			PILLAR, FRONT BODY, LH	1	339.40	25.00	254.55	Replace	Check	No <i>X</i>
6700247162			PANEL SUB-ASSY, FRONT DOOR LH	1	1,249.60	25.00	937.20	Replace	Replace	No <i>/</i>
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No <i>/</i>
6786247050			WEATHERSTRIP, FRONT DOOR LH	1	223.80	25.00	167.85	Replace	Replace	No <i>/</i>
6874012120			HINGE ASSY, FRONT DOOR, LOWER LH	1	92.10	25.00	69.08	Replace	Replace	No <i>/</i>
6872012151			HINGE ASSY, FRONT DOOR, UPPER LH	1	82.10	25.00	61.58	Replace	Replace	No <i>/</i>
6861047040			CHECK ASSY, FRONT DOOR	1	153.50	25.00	115.13	Replace	Check	No <i>X</i>
8572047140			DOOR FRONT MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	768.60	10.00	691.74	Replace	Replace	No <i>/</i>
6980221010			DOOR FRONT WINDOW REGULATOR SUB-ASSY, LH	1	230.80	25.00	173.10	Replace	Replace	No <i>/</i>
6904047100			LOCK ASSY, FRONT DOOR LH	1	544.70	10.00	490.23	Replace	Replace	No <i>/</i>
6762047800C1			PANEL ASSY, FR DOOR LH	1	725.90	25.00	544.43	Replace	Check	No <i>X</i>
8123030200			LAMP ASSY, COURTESY	1	33.00	10.00	29.70	Replace	Check	No <i>X</i>
861600WX80			FRONT DOOR SPEAKER ASSY, RADIO RH & LH	1	767.30	10.00	690.57	Replace	Check	No <i>X</i>
6131247040			PILLAR, CENTER BODY, OUTER LH	1	313.40	25.00	235.05	Replace	Replace	No <i>/</i>
6103847080			REINFORCEMENT SUB-ASSY, CENTER BODY PILLAR, LH	1	643.30	100.00	0.00	Replace	Repair	No <i>R</i>
6110947080			REINFORCEMENT SUB-ASSY FRONT PILLAR, LOWER LH	1	530.00	100.00	0.00	Replace	Repair	No <i>R</i>
6700447210			PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	25.00	932.92	Replace	Replace	No <i>/</i>
			PIXEL STICKER	1	60.00	0.00	60.00	Replace	Replace	No <i>/</i>
6878052031			HINGE ASSY, REAR DOOR, LOWER LH	1	73.30	25.00	54.98	Replace	Replace	No <i>/</i>
6876020122			HINGE ASSY, REAR DOOR, UPPER LH	1	83.30	25.00	62.48	Replace	Replace	No <i>/</i>
6863047050			CHECK ASSY, REAR DOOR	1	153.50	25.00	115.13	Replace	Check	No <i>X</i>
6906052280			DOOR LOCK REAR, LH	0	544.70	10.00	0.00	Replace	Not given	No <i>X</i>
8571047150			DOOR REAR MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	768.60	10.00	691.74	Replace	Replace	No <i>/</i>

422762

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
8980447020			DOOR REAR WINDOW REGULATOR SUB-ASSY, LH	1	200.70	25.00	150.53	Replace	Replace	No ✓ DMG
6140247020			REINFORCEMENT SUB-ASSY, ROCKER PANEL, LH	1	332.30	100.00	0.00	Replace	Repair	No ✓ R
7586047900			MOULDING ASSY, BODY ROCKER PANEL, LH	1	576.00	25.00	432.00	Replace	Replace	No ✓ out
7322047221C2			SEAT BELT ASSY, FRONT SEAT, LH	1	838.20	25.00	628.65	Replace	Replace	No ✓ JM
7321047281C2			SEAT BELT ASSY, FRONT SEAT, RH	1	838.20	25.00	628.65	Replace	Replace	No ✓ JM
8917047630			AIR BAG, COMPUTER ASSY	1	1,083.80	10.00	975.42	Replace	Replace	No ✓
8983128030			SENSOR, SIDE AIR BAG, RH & LH	1	567.80	10.00	511.02	Replace	Replace	No ✓
8983147050			SENSOR, SIDE AIR BAG, RH & LH, NO.2	1	709.30	10.00	638.37	Replace	Replace	No ✓
7227747050			PROTECTOR, SEAT SLIDE POSITION SENSOR	1	19.30	25.00	14.47	Replace	Replace	No ✓
8917833050			SENSOR, SEAT POSITION AIR BAG	1	135.80	10.00	122.22	Replace	Replace	No ✓
8983A47010			SENSOR, DOOR SIDE AIR BAG PRESSURE, RH & LH	1	379.20	10.00	341.28	Replace	Replace	No ✓
6218047070			AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD, LH	1	1,463.80	10.00	1,317.42	Replace	Replace	No ✓ Arrived
6222047140B0			GARNISH ASSY, FRONT PILLAR, LH	1	200.10	25.00	150.07	Replace	Replace	No ✓ DMG
6791447070C0			PLATE, FRONT DOOR SCUFF, LH	1	109.80	25.00	82.35	Replace	Check	No ✓ X NW
6331047160B0			ROOF HEADLINING ASSY	1	2,059.50	25.00	1,544.62	Replace	Replace	No ✓ TW
6789647010			WEATHERSTRIP, REAR DOOR, NO 2, LH	1	33.20	25.00	24.90	Replace	Replace	No ✓ NW
7392047130			AIR BAG ASSY, FRONT SEAT, LH	1	850.00	10.00	765.00	Replace	Replace	No ✓ Arrived
7107247A00C4			COVER SUB-ASSY, FRONT SEAT CUSHION, LH	1	1,180.40	25.00	885.30	Replace	Replace	No ✓ TW
7155247240			PAD, FRONT SEAT BACK, LH	1	268.60	25.00	201.45	Replace	Check	No ✓ X NW
7337047050C0			SEAT BELT ASSY, REAR SEAT, LH	1	838.20	25.00	628.65	Replace	Replace	No ✓
7336047090C0			SEAT BELT ASSY, REAR SEAT, RH	1	828.20	25.00	621.15	Replace	Replace	No ✓ JM
6255247050C0			GARNISH, REAR SEAT SIDE, LH	1	234.30	25.00	175.72	Replace	Replace	No ✓
<b>TOTAL MATERIALS</b>								<b>17,316.36</b>	<b>15,283.01</b>	
<b>TOTAL MATERIALS(Discounted)</b>								<b>17,316.33</b>	<b>15,283.01</b>	

Added Spare Parts / Material Usage After Surveyor Signed off

15,283.01 /  
 + 1,000.00 /  
 = 16,283.01 /  
 - 1,490.00 /  
 = 14,793.01 /

Sebastian  
 7/5/2018

12-1-18 / 12:26


12-1-18 / 16:26

4-1-18 / 16:26

# SMRT Accident Vehicle Repair Estimates


## Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5501H  
 Ref. No : TAX/01/18/2013  
 Reg. Date : 30/11/2017  
 Vehicle Type : TAXI  
 Make : TOYOTA PRIUS  
 Model : PRIUS4  
 Name of Driver : LEE LIM TIEW  
 Type of Accident : HEAD TO SIDE  
 Date / Time of Accident : 03/01/2018 03:20:00 PM  
 Accident Reported Date / Time : 04/01/2018 12:00:00 AM  
 Surveyor is Required? : Yes  
 Survey by : Sebastian  
 Vehicle is Towed Back? : Yes  
 Towed Back Date/Time : 03/01/2018  
 Replacement Vehicle issued? : No  
 Accident Repair Job Card No : 000024093917  
 Special Instruction to ARC, if any :  
 TOWED \$42.80 / SJL2071A NTAC P/R  
 BEFORE PAINT PHOTO, FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR SEBASTIAN (LKK)  
 & Email : sebastianyeang @lkkauto.com HP:90036121  
 Prepared Date : 04/01/2018 09:48:10 AM

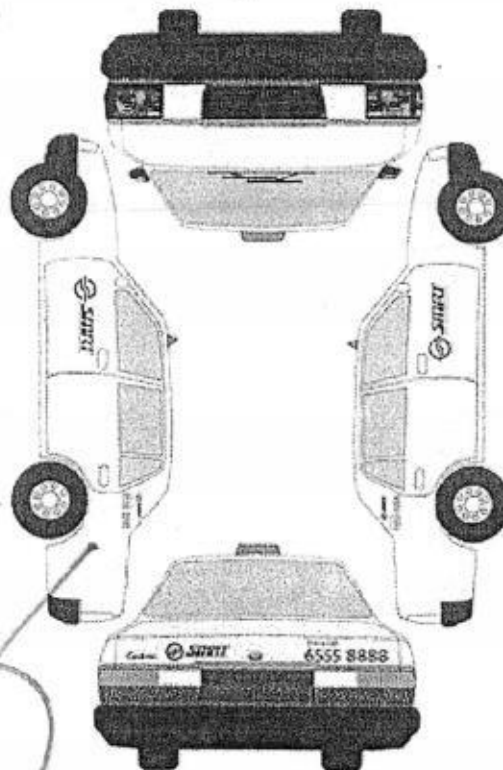

18/11  
 2

Recording Camera    
 Radio Antenna    
 1<sup>st</sup> witness \_\_\_\_\_ Date 4-1-18  
 2<sup>nd</sup> witness \_\_\_\_\_ Date \_\_\_\_\_

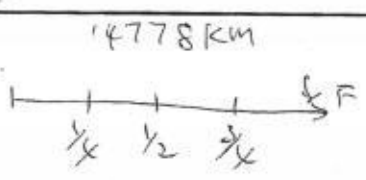

Supplementary  
 to Refer to the Supplementary part list ✓

10-04-18 9:30 Reject  
 11/4/18 16:48  
 pass

LEE SHENG AUTO PTE LTD  
 Vehicle Return Date: 9-4-18  
 Vehicle Return Time: 16:34  
 SMRT staff sign: \_\_\_\_\_



**Section B - To be Completed by Service Advisor, Accident Repair Centre**

Chassis No : JTDKB3FU903575629 Mileage : 0  
Work Shop : Repair Completed Date / Time :

**Summary of Repair Estimates**

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,352.00	1,000.00
Total Spray Painting Charges	: 1,674.00	700.00
Total Material Charges	: 17,316.33	15,283.01
Other Charges	: 1,520.00	790.00
<b>TOTAL</b>	<b>: 21,862.33</b>	<b>17,773.01</b>
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 9.00	9.00
Prepared / Adjusted By	:	SEBASTIAN (LKK)
Arc / Surveyor Sign Off Date	: 04/01/2018 02:17:15 AM	04/01/2018 03:49:43 AM

M

LKK

Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/01/2018 02:17:15 AM

**Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair**

Quotation No : QN-1804-0420 Invoice No :  
Quotation Date : 18/4 Invoice Date :  
Invoice Amount : Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH PORTION	1,352.00	1,000.00 /
<b>Total Labour</b>	<b>1,352.00</b>	<b>1,000.00</b>

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT FENDER LH	378.00	200.00 /
TO RESPRAY FRONT PILLAR LH	180.00	0.00
TO RESPRAY FRONT DOOR LH	378.00	200.00 /
TO RESPRAY CENTER PILLAR LH	180.00	100.00 /
TO RESPRAY REAR DOOR LH	378.00	100.00 /
TO RESPRAY ROCKER PANEL MOULDING	180.00	100.00 /
<b>Total Spray Painting &amp; Panel Beating</b>	<b>1,674.00</b>	<b>700.00</b>

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	40.00 /
TO CHECK & RESET SYSTEM FUNCTION	350.00	200.00 /
TO REMOVE / REFIT SEAT	120.00	80.00 /
TO REMOVE & REFIT ROOF LINING	350.00	200.00 /
TO TRANSFER DOOR MECHANISM	240.00	160.00 /
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO REMOVE AND REFIX AIR BAG SYSTEM	120.00	80.00 /
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
<b>Total Other Costs</b>	<b>1,520.00</b>	<b>790.00</b>

28963.50

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
5380247100			FENDER SUB-ASSY, FR, LH	1	933.10	100.00	0.00	Replace	Repair	No <i>R</i>
7537447140			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	25.00	39.65	Replace	Replace	No <i>/</i>
6101447010			PILLAR, FRONT BODY, LH	1	339.40	25.00	254.55	Replace	Check	No <i>X</i>
6700247162			PANEL SUB-ASSY, FRONT DOOR LH	1	1,249.60	25.00	937.20	Replace	Replace	No <i>/</i>
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No <i>/</i>
6786247050			WEATHERSTRIP, FRONT DOOR LH	1	223.80	25.00	167.85	Replace	Replace	No <i>/</i>
6874012120			HINGE ASSY, FRONT DOOR, LOWER LH	1	92.10	25.00	69.08	Replace	Replace	No <i>/</i>
6872012151			HINGE ASSY, FRONT DOOR, UPPER LH	1	82.10	25.00	61.58	Replace	Replace	No <i>/</i>
6861047040			CHECK ASSY, FRONT DOOR	1	153.50	25.00	115.13	Replace	Check	No <i>X</i>
8572047140			DOOR FRONT MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	768.60	10.00	691.74	Replace	Replace	No <i>/</i>
6980221010			DOOR FRONT WINDOW REGULATOR SUB-ASSY, LH	1	230.80	25.00	173.10	Replace	Replace	No <i>/</i>
6904047100			LOCK ASSY, FRONT DOOR LH	1	544.70	10.00	490.23	Replace	Replace	No <i>/</i>
6762047800C1			PANEL ASSY, FR DOOR LH	1	725.90	25.00	544.43	Replace	Check	No <i>X</i>
8123030200			LAMP ASSY, COURTESY	1	33.00	10.00	29.70	Replace	Check	No <i>X</i>
861600WX80			FRONT DOOR SPEAKER ASSY, RADIO RH & LH	1	767.30	10.00	690.57	Replace	Check	No <i>X</i>
6131247040			PILLAR, CENTER BODY, OUTER LH	1	313.40	25.00	235.05	Replace	Replace	No <i>/</i>
6103847080			REINFORCEMENT SUB-ASSY, CENTER BODY PILLAR, LH	1	643.30	100.00	0.00	Replace	Repair	No <i>R</i>
6110947080			REINFORCEMENT SUB-ASSY FRONT PILLAR, LOWER LH	1	530.00	100.00	0.00	Replace	Repair	No <i>R</i>
6700447210			PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	25.00	932.92	Replace	Replace	No <i>/</i>
			PIXEL STICKER	1	60.00	0.00	60.00	Replace	Replace	No <i>/</i>
6878052031			HINGE ASSY, REAR DOOR, LOWER LH	1	73.30	25.00	54.98	Replace	Replace	No <i>/</i>
6876020122			HINGE ASSY, REAR DOOR, UPPER LH	1	83.30	25.00	62.48	Replace	Replace	No <i>/</i>
6863047050			CHECK ASSY, REAR DOOR	1	153.50	25.00	115.13	Replace	Check	No <i>X</i>
6906052280			DOOR LOCK REAR, LH	0	544.70	10.00	0.00	Replace	Not given	No <i>X</i>
8571047150			DOOR REAR MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	768.60	10.00	691.74	Replace	Replace	No <i>/</i>

*NEC*  
*NW*  
*DT*  
*NEC*  
*NEC*  
*DT*  
*NW*  
*DMG*  
*DMG*  
*Jm*  
*NW*  
*DT*  
*DT*  
*DT*  
*NW*  
*DMG*

4727-62

1067080

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
6980447020			DOOR REAR WINDOW REGULATOR SUB-ASSY, LH	1	200.70	25.00	150.52	Replace	Replace	No
6140247020			REINFORCEMENT SUB-ASSY, ROCKER PANEL, LH	1	332.30	100.00	0.00	Replace	Repair	No
7586047900			MOULDING ASSY, BODY ROCKER PANEL, LH	1	576.00	25.00	432.00	Replace	Replace	No
7322047221C2			SEAT BELT ASSY, FRONT SEAT, LH	1	838.20	25.00	628.65	Replace	Replace	No
7321047281C2			SEAT BELT ASSY, FRONT SEAT, RH	1	838.20	25.00	628.65	Replace	Replace	No
8917047630			AIR BAG, COMPUTER ASSY	1	1,083.80	10.00	975.42	Replace	Replace	No
8983128030			SENSOR, SIDE AIR BAG, RH & LH	1	567.80	10.00	511.02	Replace	Replace	No
8983147050			SENSOR, SIDE AIR BAG, RH & LH, NO.2	1	709.30	10.00	638.37	Replace	Replace	No
7227747050			PROTECTOR, SEAT SLIDE POSITION SENSOR	1	19.30	25.00	14.47	Replace	Replace	No
8917833050			SENSOR, SEAT POSITION AIR BAG	1	135.80	10.00	122.22	Replace	Replace	No
8983A47010			SENSOR, DOOR SIDE AIR BAG PRESSURE, RH & LH	1	379.20	10.00	341.28	Replace	Replace	No
6218047070			AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD, LH	1	1,463.80	10.00	1,317.42	Replace	Replace	No
6222047140B0			GARNISH ASSY, FRONT PILLAR, LH	1	200.10	25.00	150.07	Replace	Replace	No
6791447070C0			PLATE, FRONT DOOR SCUFF, LH	1	109.80	25.00	82.35	Replace	Check	No
6331047160B0			ROOF HEADLINING ASSY	1	2,059.50	25.00	1,544.62	Replace	Replace	No
6789647010			WEATHERSTRIP, REAR DOOR, NO.2, LH	1	33.20	25.00	24.90	Replace	Replace	No
7392047130			AIR BAG ASSY, FRONT SEAT, LH	1	850.00	10.00	765.00	Replace	Replace	No
7107247A00C4			COVER SUB-ASSY, FRONT SEAT CUSHION, LH	1	1,180.40	25.00	885.30	Replace	Replace	No
7155247240			PAD, FRONT SEAT BACK, LH	1	268.60	25.00	201.45	Replace	Check	No
7337047050C0			SEAT BELT ASSY, REAR SEAT, LH	1	838.20	25.00	628.64	Replace	Replace	No
7336047090C0			SEAT BELT ASSY, REAR SEAT, RH	1	828.20	25.00	621.14	Replace	Replace	No
6255247050C0			GARNISH, REAR SEAT SIDE, LH	1	234.30	25.00	175.72	Replace	Replace	No
<b>TOTAL MATERIALS</b>								<b>17,316.36</b>	<b>15,283.01</b>	
<b>TOTAL MATERIALS(Discounted)</b>								<b>17,316.33</b>	<b>15,283.01</b>	

Added Spare Parts / Material Usage After Surveyor Signed off

15,283.01  
+ 1,000.00  
+ 1,490.00  


---

17,773.01

9129.92  
13857.54  
1000.00  
+ 1490.00  


---

16347.54

Remark: Rear seat belt not given.

Sebastian  
30/4/18

## SMRT Accident Vehicle Repair Estimates

NTUC

### Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5501H  
 Ref. No : TAX/01/18/2013  
 Reg. Date : 30/11/2017  
 Vehicle Type : TAXI  
 Make : TOYOTA PRIUS  
 Model : PRIUS4  
 Name of Driver : LEE LIM TIEW  
 Type of Accident : HEAD TO SIDE  
 Date / Time of Accident : 03/01/2018 03:20:00 PM  
 Accident Reported Date / Time : 04/01/2018 12:00:00 AM  
 Surveyor is Required? : Yes  
 Survey by :  
 Vehicle is Towed Back? : Yes  
 Towed Back Date/Time : 03/01/2018  
 Replacement Vehicle issued? : No  
 Accident Repair Job Card No : 000024093917  
 Special Instruction to ARC,if any :  
 TOWED \$42.80 / SJL2071A  
 Prepared Date : 04/01/2018 09:48:10 AM



Sebastian.  
 4/1/18.  
 - Part by part Repair.  
 - Question Mark Item  
 Photo  
 - Photo Before Paint.

#### LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Chassis No : JTDKB3FU903575629

Mileage : 0

Work Shop :

Repair Completed Date / Time :

**Summary of Repair Estimates**

	<b>Quotation from ARC</b>	<b>Adjusted by Surveyor, if applicable</b>
Total Labour Charges :	1,352.00	0.00
Total Spray Painting Charges :	1,674.00	0.00
Total Material Charges :	18,210.01	18,210.01
Other Charges :	1,600.00	0.00
<b>TOTAL :</b>	<b>22,836.01</b>	<b>0.00</b>
<b>Lum Sum Total :</b>	<b>0.00</b>	<b>0.00</b>
No. of Repair Days :	9.00	<del>0.00</del> 7 days
Prepared / Adjusted By :		
Arc / Surveyor Sing Off Date :	04/01/2018 02:17:15 PM	01/01/1900 12:00:00 AM

M

Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/01/2018 02:17:15 PM

**Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair**

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

## Section D - Details of Repair Estimates

## Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR LH PORTION	1,352.00	0.00 1000
<b>Total Labour</b>	<b>1,352.00</b>	<b>0.00</b>

## Part 2 - Spray Painting &amp; Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT FENDER LH	378.00	0.00 200
TO RESPRAY FRONT PILLAR LH	180.00	0.00
TO RESPRAY FRONT DOOR LH	378.00	0.00 200
TO RESPRAY CENTER PILLAR LH	180.00	0.00 100
TO RESPRAY REAR DOOR LH	378.00	0.00 100
TO RESPRAY ROCKER PANEL MOULDING	180.00	0.00 100
<b>Total Spray Painting &amp; Panel Beating</b>	<b>1,674.00</b>	<b>0.00</b>

## Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00 X
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 40
TO CHECK & RESET SYSTEM FUNCTION	350.00	0.00 200
TO REMOVE / REFIT SEAT	120.00	0.00 80
TO REMOVE & REFIT ROOF LINING	350.00	0.00 200
TO TRANSFER DOOR MECHANISM	240.00	0.00 160
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
TO REMOVE AND REFIX AIR BAG SYSTEM	120.00	0.00 80
TO REPLACE SUNDRY PARTS	100.00	0.00 X
TO WASH AND VACUUM	60.00	0.00 X
<b>Total Other Costs</b>	<b>1,600.00</b>	<b>0.00</b>

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5380247100			FENDER SUB-ASSY, FR, LH	1	933.10	25.00	699.82	Replace	Replace R	No
7537447140			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	25.00	39.67	Replace	Replace ✓	No NEC
6101447010			PILLAR, FRONT BODY, LH	1	339.40	25.00	254.55	Replace	Replace ?	No
6700247162			PANEL SUB-ASSY, FRONT DOOR LH	1	1,249.60	25.00	937.20	Replace	Replace ✓	No DT
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace ✓	No NEC
6786247050			WEATHERSTRIP, FRONT DOOR LH	1	223.80	25.00	167.85	Replace	Replace ✓	No NEC
6874012120			HINGE ASSY, FRONT DOOR, LOWER LH	1	92.10	25.00	69.07	Replace	Replace ?	No
6872012151			HINGE ASSY, FRONT DOOR, UPPER LH	1	82.10	25.00	61.57	Replace	Replace ?	No
6861047040			CHECK ASSY, FRONT DOOR	1	153.50	25.00	115.12	Replace	Replace ?	No
8572047140			DOOR FRONT MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	768.60	10.00	691.74	Replace	Replace ?	No
6980221010			DOOR FRONT WINDOW REGULATOR SUB-ASSY, LH	1	230.80	25.00	173.10	Replace	Replace ?	No
6904047100			LOCK ASSY, FRONT DOOR LH	1	544.70	10.00	490.23	Replace	Replace ✓	No Jm.
6762047800C1			PANEL ASSY, FR DOOR LH	1	725.90	25.00	544.42	Replace	Replace ?	No
8123030200			LAMP ASSY, COURTESY	1	33.00	10.00	29.70	Replace	Replace ?	No
861600WX80			FRONT DOOR SPEAKER ASSY, RADIO RH & LH	1	767.30	10.00	690.57	Replace	Replace ?	No
6131247040			PILLAR, CENTER BODY, OUTER LH	1	313.40	25.00	235.05	Replace	Replace R	No
6103847080			REINFORCEMENT SUB-ASSY, CENTER BODY PILLAR, LH	1	643.30	25.00	482.47	Replace	Replace R	No
6110947080			REINFORCEMENT SUB-ASSY FRONT PILLAR, LOWER LH	1	530.00	25.00	397.50	Replace	Replace R	No
6700447210			PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	25.00	932.92	Replace	Replace ✓	No DT
			PIXEL STICKER	1	60.00	0.00	60.00	Replace	Replace ✓	No NEC
6878052031			HINGE ASSY, REAR DOOR, LOWER LH	1	73.30	25.00	54.97	Replace	Replace ?	No
6876020122			HINGE ASSY, REAR DOOR, UPPER LH	1	83.30	25.00	62.47	Replace	Replace ?	No
6863047050			CHECK ASSY, REAR DOOR	1	153.50	25.00	115.12	Replace	Replace ?	No
6906052280			DOOR LOCK REAR, LH	1	544.70	10.00	490.23	Replace	Replace X	No
8571047150			DOOR REAR MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	768.60	10.00	691.74	Replace	Replace ?	No



Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
6980447020			DOOR REAR WINDOW REGULATOR SUB-ASSY, LH	1	200.70	25.00	150.52	Replace	Replace	No
6140247020			REINFORCEMENT SUB-ASSY, ROCKER PANEL, LH	1	332.30	25.00	249.22	Replace	Replace	No
7586047900			MOULDING ASSY, BODY ROCKER PANEL, LH	1	576.00	25.00	432.00	Replace	Replace	No
7322047221C2			SEAT BELT ASSY, FRONT SEAT, LH	1	838.20	25.00	628.65	Replace	Replace	No
7321047281C2			SEAT BELT ASSY, FRONT SEAT, RH	1	838.20	25.00	628.65	Replace	Replace	No
8917047630			AIR BAG, COMPUTER ASSY	1	1,083.80	10.00	975.42	Replace	Replace	No
8983128030			SENSOR, SIDE AIR BAG, RH & LH	1	567.80	10.00	511.02	Replace	Replace	No
8983147050			SENSOR, SIDE AIR BAG, RH & LH, NO.2	1	709.30	10.00	638.37	Replace	Replace	No
7227747050			PROTECTOR, SEAT SLIDE POSITION SENSOR	1	19.30	25.00	14.47	Replace	Replace	No
8917833050			SENSOR, SEAT POSITION AIR BAG	1	135.80	10.00	122.22	Replace	Replace	No
8983A47010			SENSOR, DOOR SIDE AIR BAG PRESSURE, RH & LH	1	379.20	10.00	341.28	Replace	Replace	No
6218047070			AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD, LH	1	1,463.80	10.00	1,317.42	Replace	Replace	No
6222047140B0			GARNISH ASSY, FRONT PILLAR, LH	1	200.10	25.00	150.07	Replace	Replace	No
6791447070C0			PLATE, FRONT DOOR SCUFF, LH	1	109.80	25.00	82.35	Replace	Replace	No
6331047160B0			ROOF HEADLINING ASSY	1	2,059.50	25.00	1,544.62	Replace	Replace	No
6789647010			WEATHERSTRIP, REAR DOOR, NO.2, LH	1	33.20	25.00	24.90	Replace	Replace	No
7392047130			AIR BAG ASSY, FRONT SEAT, LH	1	850.00	10.00	765.00	Replace	Replace	No
7107247A00C4			COVER SUB-ASSY, FRONT SEAT CUSHION, LH	1	1,180.40	25.00	885.30	Replace	Replace	No
7155247240			PAD, FRONT SEAT BACK, LH	1	268.60	25.00	201.45	Replace	Replace	No
<b>TOTAL MATERIALS</b>								<b>18,210.09</b>	<b>18,210.01</b>	
<b>TOTAL MATERIALS(Discounted)</b>								<b>18,210.01</b>	<b>18,210.01</b>	

**Added Spare Parts / Material Usage After Surveyor Signed off**

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
<b>TOTAL SUPPLEMENTARY MATERIALS</b>									



# National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham escribe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18000301/Stbe2

73 BRAS BASAH ROAD  
#05-01 NTUC TRADE UNION HOUSESINGAPORE  
189556

Date: 14-05-2018



Code: INC4

### 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJL 2071A	Veh. Inspected	SHB 5501H
Policy No.	5040339156-08	Coverage (\$)	0.00
Claim No.	MT/0976348-002	Excess (\$)	0.00
Assign From		Assign Date	04/01/2018

### 2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	JTDKB3FU903575629	Colour	MAROON
Odometer	14778	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		

### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.  
DAMAGES SEE DETAILS.

### 5. General Information

Accident Date	03/01/2018	Inspection Date	04/01/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **9 Working Days**



# National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5501H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	EMBLEM, SIDE PANEL (HYBRID) (DISC 25%)	NECESSARY	52.90	39.66
1	PANEL SUB-ASSY, FRONT DOOR LH (DISC 25%)	DENTED	1,249.60	937.20
1	WEATHERSTRIP, FRONT DOOR LH (DISC 25%)	NECESSARY	223.80	167.85
1	HINGE ASSY, FRONT DOOR, LOWER LH (DISC 25%)	BENT	92.10	69.08
1	HINGE ASSY, FRONT DOOR, UPPER LH (DISC 25%)	BENT	82.10	61.58
1	DOOR FRONT WINDOW REGULATOR SUB-ASSY, LH (DISC 25%)	DAMAGED	230.80	173.10
1	PILLAR, CENTER BODY, OUTER LH (DISC 25%)	DENTED	313.40	235.05
1	PANEL SUB-ASSY, REAR DOOR, LH (DISC 25%)	DENTED	1,243.90	932.92
1	HINGE ASSY, REAR DOOR, LOWER LH (DISC 25%)	BENT	73.30	54.98
1	HINGE ASSY, REAR DOOR, UPPER LH (DISC 25%)	BENT	83.30	62.48
1	DOOR REAR WINDOW REGULATOR SUB-ASSY, LH (DISC 25%)	DAMAGED	200.70	150.52
1	MOULDING ASSY, BODY ROCKER PANEL, LH (DISC 25%)	CUT	576.00	432.00
1	SEAT BELT ASSY, FRONT SEAT, LH (DISC 25%)	JAMMED	838.20	628.65
1	SEAT BELT ASSY, FRONT SEAT, RH (DISC 25%)	JAMMED	838.20	628.65
1	PROTECTOR, SEAT SLIDE POSITION SENSOR (DISC 25%)	NECESSARY	19.30	14.47
1	GARNISH ASSY, FRONT PILLAR, LH (DISC 25%)	DEFORMED	200.10	150.07
1	ROOF HEADLINING ASSY (DISC 25%)	TORN	2,059.50	1,544.62
1	WEATHERSTRIP REAR DOOR, NO.2, LH (DISC 25%)	NECESSARY	33.20	24.90
1	COVER SUB -ASSY, FRONT SEAT CUSHION, LH (DISC 25%)	TORN	1,180.40	885.30
1	SEAT BELT ASSY, REAR SEAT, LH (DISC 25%)	JAMMED	838.20	628.64
1	SEAT BELT ASSY, REAR SEAT, RH (DISC 25%)	JAMMED	828.20	621.14
1	GARNISH, REAR SEAT SIDE, LH (DISC 25%)	JAMMED	234.30	175.72
1	DOOR FRONT MOTOR ASSY POWER WINDOW REGULATOR, LH (DISC 10%)	DAMAGED	768.60	691.74
1	LOCK ASSY, FRONT DOOR LH (DISC 10%)	JAMMED	544.70	490.22
1	DOOR REAR MOTOR ASSY, POWER WINDOW REGULATOR, LH (DISC 10%)	DAMAGED	768.60	691.74
1	AIR BAG, COMPUTER ASSY (DISC 10%)	NECESSARY	1,083.80	975.42

Report Ref No. NS/INC18000301/Stbe2



# National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.: 2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SENSOR, SIDE AIR BAG, RH & LH (DISC 10%)	NECESSARY	567.80	511.02
1	SENSOR, SIDE AIR BAG, RH & LH, NO.2 (DISC 10%)	NECESSARY	709.30	638.37
1	SENSOR, SEAT POSITION AIR BAG (DISC 10%)	NECESSARY	135.80	122.22
1	SENSOR, DOOR SIDE AIR BAG PRESSURE, RH & LH (DISC 10%)	NECESSARY	379.20	341.28
1	AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD, LH (DISC 10%)	ACTIVATED	1,463.80	1,317.42
1	AIR BAG ASSY, FRONT SEAT, LH (DISC 10%)	ACTIVATED	850.00	765.00
1	STICKER DECAL SMRT (DOOR) (SN)	NECESSARY	60.00	60.00
1	PIXEL STICKER (SN)	NECESSARY	60.00	60.00
1	PILLAR, FRONT BODY, LH	NOT NECESSARY	339.40	-
1	CHECK ASSY, FRONT DOOR	NOT NECESSARY	153.50	-
1	PANEL ASSY, FR DOOR LH	NOT NECESSARY	725.90	-
1	LAMP ASSY, COURTESY	NOT NECESSARY	33.00	-
1	FRONT DOOR SPEAKER ASSY, RADIO RH & LH	NOT NECESSARY	767.30	-
1	CHECK ASSY, REAR DOOR	NOT NECESSARY	153.50	-
1	DOOR LOCK REAR, LH	NOT NECESSARY	544.70	-
1	PLATE, FRONT DOOR SCUFF, LH	NOT NECESSARY	109.80	-
1	PAD, FRONT SEAT BACK, LH	NOT NECESSARY	268.60	-
1	FENDER SUB-ASSY, FR, LH	TO REPAIR	933.10	-
1	REINFORCEMENT, SUB-ASSY, CENTER BODY PILLAR, LH	TO REPAIR	643.30	-
1	REINFORCEMENT SUB-ASSY FRONT PILLAR, LOWER LH	TO REPAIR	530.00	-
1	REINFORCEMENT SUB-ASSY, ROCKER PANEL, LH	TO REPAIR	332.30	-
			24,417.50	15,283.01
	<b>LABOUR</b>			
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		2,612.00	1,750.00
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		1,774.00	740.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			4,546.00	2,490.00
	<b>GRAND TOTAL</b>		<b>28,963.50</b>	<b>17,773.01</b>

Report Ref No. NS/INC18000301/Stbe2

<b>RECOMMENDED COST OF REPAIRS (CONFIRMED)</b>		<b>17,773.01</b>
--	--	------------------

Report Ref No. NS/INC18000301/Stbe2

**YEANG WAI KEEN**  
Automotive Assessor



**K.K.LAU CPT(RET)**

**BEng(Hons),B.Bus,MBA,PEng,PE,  
MinstAEA,MASME,MIRTE**

**REGD Auto Consultant-SAE, Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.  
**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**