

CL

cc 4, ~~ASA~~ 800 0353, K ja352LKK:
IDAC:SM 8121
24336

ASSIGNMENT

DOI: 5-1-18

Date / Time:

Registered in Merimen:

Pre-assign / CCU / FTE



Insured Vehicle No.:

Name of Insured:

Insured Tel No.:

Excess Sec II : S5

Is driver the owner?

(YES / NO)

Nature of Accident:

If NO, Driver Name / Age:

Driver Tel No.:

(V/L: YES / NO)

OI GIA REPORT: YES / NO ; TP GIA REPORT: YES / NO

Insured Liability:

%

Final ? Yes / No



INSRS:

WSP:

Tel:

Liability:

RMKS:

Trans-Cab



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date/ Time

DATE / PIC

STAGE

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI:

After call ltr to OI:

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice

LTA / GIA :

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD

Payment Breakdown Form:

Post-Repair Photos:

Others:

PRELIMINARY ADVICE

Date/Time:

Sent By:

FINALIZATION

Date/Time:

Confirm with:

Confirm by:

Repair Cost:

S\$

(days) Reduction:

%

Email

Call

FINAL SETTLEMENT

Date/Time:

Confirm with:

Email

Call

Final Liability:

%

(Agreed / Assessed) BOLA S/N No. : 27

If NO or B 28, Ass. Lia :

Repair Cost:

S\$

Loss of Rental (LOR):

S\$

(days) 105.74

Loss of Use (LOU):

S\$

(\$ x days)

Loss of Income (LOI):

S\$

(\$ x days)

LOR only ☐ LOU only ☐LOR + LOU ☐LOR + LOI ☐

(Tick only one)

GIA/LTA Search

S\$

Medical:

S\$

Disbursement:

S\$

(e.g. Tow/ Independent)

Legal Cost

S\$

Total:

S\$

Global Sum S\$:

FINAL PAYMENT

Date/Time:

Confirm with:

Email

Call

Payee 1:

S\$

Name 1:

Payee 2: (Strike if N.A.)

S\$

Name 2:

Payee 3: (Strike if N.A.)

S\$

Name 3:

TRANS-CAB AUTO SERVICES PTE LTD

ASS. REC. BY:

REF:

AM /

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

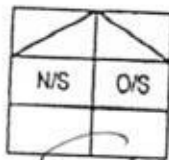

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

1.31 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S11F 761K

Yr Regn:

06, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude

c.c

1995

Colour

M. White / R

A/C:

Insured / Std / NI / NA

Sp. Reading

163565

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VI-1 ABL 15 AUC 283336

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: NII / S/Rim / STD A/Rim or

Tyre Size:

F: 175/14

215/60R16

R: Felkon

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

J

mm

R/Bal.

6

mm

L/Bal.

J

mm

L/Bal.

6

mm

D.O.A.

31/12/17

D.O.I.

3/1/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

8/11 File pass to Catherine

27/11 @ 5856.70 Confirm Tasmia (4+3X105.74+350)

F - (\$32,573.88 / 857)

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS - SI

Photos

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format:

Lump Sum / I.B.I. (\$

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K**AAD1801-032***Not Notional**Recovery B4 part**✓ B4 part.*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHF 761K

VF1ABL15AUC283336

RENAULT

LATITUDE

31.12.2017

AXA**PART****LIST**

1	1	BUMPER COVER REAR	\$	<i>Re</i> 1,108.46 ✓
2	1	BUMPER LOWER REAR	\$	<i>Re</i> 768.84 ✓
3	1	BUMPER BRACKET CTR REAR	\$	<i>Re</i> 113.47 ✓
4	1	BUMEPR BRACKET SIDE RH REAR	\$	<i>Re</i> 135.97 X
5	1	BUMEPR RETAINER RH REAR	\$	<i>Re</i> 44.99 X
6	1	BUMPER REFLECTOR RH	\$	<i>Re</i> 43.61 X
7	1	BUMEPR BRACKET SIDE LH REAR	\$	<i>Re</i> 135.97 X
8	1	BUMEPR RETAINER LH REAR	\$	<i>Re</i> 44.99 X
9	1	BUMPER REFLECTOR LH	\$	<i>Re</i> 43.61 X
10	1	BUMPER BEAM REAR	\$	<i>Re</i> 777.52 ✓
11	1	BUMPER BEAM BRACKET LH REAR	\$	225.95 X <i>Re</i>
12	1	BUMPER BEAM BRACKET RH REAR	\$	225.95 X <i>Re</i>
13	1	BOOT REAR	\$	<i>Re</i> 2,872.68 X
14	1	BOOT FINISHER	\$	<i>Re</i> 470.06 X
15	1	BOOT WHEATERSTRIP	\$	<i>Re</i> 323.05 X
16	1	BOOT REFLECTOR LAMP LH	\$	<i>Re</i> 493.35 X
17	1	BOOT REFLECTOR LAMP RH	\$	<i>Re</i> 493.35 X
18	1	BOOT BADGE 'RENAULT'	\$	<i>Re</i> 225.36 ✓
19	1	BOOT BADGE	\$	<i>Re</i> 225.36 ✓
20	1	BOOT STRUT LH	\$	<i>Re</i> 276.08 X
21	1	BOOT STRUT RH	\$	<i>Re</i> 276.08 X
22	1	BOOT HINGE LH	\$	<i>Re</i> 367.84 X
23	1	BOOT HINGE RH	\$	<i>Re</i> 367.84 X
24	1	BOOT INNER TRIM	\$	<i>Re</i> 586.45 X
25	1	BOOT SWITCH	\$	<i>Re</i> 168.13 X
26	1	BOOT LOCK	\$	<i>Re</i> 202.67 X
27	1	BOOT LOCK CATCH	\$	<i>Re</i> 74.40 X
28	2	LICENCE PLATE LAMP	\$	<i>Re</i> 50.52 X
29	2	BOOT RUBBER PLUG	\$	<i>Re</i> 221.81 X
30	1	FENDER PANEL REAR LH	\$	<i>Re</i> 3,299.13 X

Trans-cab Auto Services Pte Ltd**AAD1801-032**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K

31	1	WHEELARCH REAR LH	\$	543.47	X
32	1	FENDER PANEL REAR RH	\$	3,299.13	X
33	1	WHEELARCH REAR RH	\$	543.47	X
34	1	TAILLAMP RH	\$	552.55	X
35	1	TAILLAMP PANEL RH	\$	986.70	X
36	1	TAILLAMP LH	\$	552.55	X
37	1	TAILLAMP PANEL LH	\$	986.70	X
38	1	OUTER PANEL REAR (End Panel)	\$	1,471.77	X
39	1	OUTER PANEL REAR (End Panel)TRIM	\$	404.56	X
40	1	EXHAUST REAR	\$	7,489.05	X
41	1	EXHAUST CAP REAR	\$	230.49	X

TOTAL	\$	31,723.96
10%	\$	3,172.40
	\$	28,551.56

Special Nett

1	1SET	PARKING AID	\$	700.00	X
2	1SET	REAR BUMPER CLIP	\$	66.00	—
3	1SET	BUMPER BRACKET CTR CLIP	\$	33.00	—
4	1SET	BUMEP R BRACKET SIDE CLIP RH RR	\$	10.00	X
5	1SET	BUMEP R RETAINER RH CLIP RR	\$	20.00	X
6	1SET	BUMEP R BRACKET SIDE CLIP LH RR	\$	10.00	X
7	1SET	BUMEP R RETAINER CLIP LH RR	\$	20.00	X
8	1SET	BUMPER LOWER REAR RIVET	\$	22.00	X
9	1SET	BUMPER LOWER REAR CLIP	\$	66.00	—
10	1	EXHAUST MOUNTING REAR	\$	17.82	X
11	1SET	BOOT FINISHER CLIP	\$	24.20	X
12	1	BOOT STICKER "Trans-cab"	\$	30.00	—
13	1	BOOT STICKER "6555-3333"	\$	30.00	—
14	1	BOOT INNER TRIM CLIP	\$	45.00	X
15	1SET	FENDER WHEELARCH REAR RH CLIP	\$	35.00	X
16	1SET	FENDER WHEELARCH REAR LH CLIP	\$	35.00	X
17	1	TAILLAMP CLIP RH	\$	5.00	X
18	1	TAILLAMP CLIP LH	\$	5.00	X
19	2	REAR WINDSCREEN SELANT	\$	80.00	X
20	1	WINDSCREEN MOULDING	\$	100.00	X
21	1	REAR WINDSCREEN INNER SPONGE SEAL	\$	100.00	X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 761K

TOTAL	\$	2,169.02	1454.62
TOTAL PARTS	\$	30,720.58	

Putty And Spray Painting Of The Affected Portion.	\$	3,000.00	6601
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	2,800.00	6001
To Rust-Proofing Of The Affected Areas.	\$	170.00	301
To reinstall rear bumper parking sensor.	\$	170.00	601
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	~ 170.00 X
To repair and realign rear exhaust pipe.	\$	170.00	~ 170.00 X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00	~ 170.00 X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	170.00	601
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	380.00	~ 380.00 X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	170.00	~ 170.00 X
To check steering geometry and computer wheel alignment	\$	220.00	~ 220.00 X

LKK Auto Consultants hence TOTAL	\$	7,710.00	7590
the Repairer of the following:	Over All Total	\$	38,430.58
(PARTS BY PARTS)			
Repair Days			
* To resurvey before/after spray painting			
* To resurvey before/after part(s) during resurvey			
* Parts prices are subject to confirmation			
* Third party survey is on a "Without Prejudice" basis			
* No illegal modification(s) is allowed			
* Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company			
Acknowledged by Repairer			
Signature:			
Date:			

10 Days
4 days
37545.56



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your ref: S8M006EU
Our ref: CC4/ASM18000353/Kja3

Date: 08.01.2018

The Motor Claims Department
M/s AXA INSURANCE PTE LTD

Dear Sir/Madam,

PRELIMINARY ADVICE OF VEHICLE NO.

SHF 761K


We refer to the above matter.

Please be informed that we had conducted the inspection of the above mentioned vehicle on 05.01.2018 at the premises of M/s Trans-cab Auto Services Pte Ltd - Ang Mo Kio and have the following to report:-

Workshop Estimate Amount	: S\$	38,430.58
Revised Estimate Amount	: S\$	5,856.70
"Check" Items Amount	: S\$	406.71
Market Value	: S\$	-
LTA Reimbursement Value	: S\$	-
Nett Value	: S\$	-

Description of Damage:

The vehicle sustained damages at the
Rear Portion

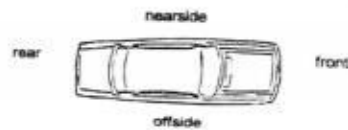

Comments/Present Status:

Damages Consistent

Estimated normal period for repairs: 4.0 days

Yours faithfully,

KENNETH KONG
Licensed Appraiser



Re:REMINDER FOR MANDATE

Type

🔗 Question

Message

APPROVED

Reply



Auto
Consultants
Pte Ltd

Company Registration No. 199607196R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 12/10/2018

Survey Details:

Date of loss	01.01.18
Date of appointment	08.01.18
Date of survey	05.01.18
Location of survey	TRANSCAB

Vehicle Details:

Claim Type:	Third party
Vehicle number	SHF 761K
Make and Model	RENAULT LAT 1995CC
Date of registration	30.06.2016
Excess	
Market Value	
Part Rebate	
Nett Loss	

Repair details:

Initial Estimate	\$	38,430.58
------------------	----	-----------

Proposed/Revised repair cost:

Parts	\$	4,446.70
Check items (estimate)		
Labour	\$	1,410.00
Total	\$	5,856.70
Lump Sum(if applicable)		

Number of days for repair	<u>4</u>
---------------------------	----------



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Remarks:

BOLA 27-HEAD TO REAR

Mandate:

Liability(TP)	100%	
Proposed repair cost	\$ 6,266.67	INC. GST
Loss of use		
Loss of rental	\$ 740.18	7days x 105.74
Loss of income	\$ 350.00	7days x \$50.00
LTA search fees	\$ 7.45	
Others		
Proposed Total	\$ 7,364.30	

THIRD PARTY EXPRESS SETTLEMENT (PAYMENT BREAKDOWN)

Vehicle No:	SFG 6161X (Insd veh)	Model:	RENAULT LATITUDE (A)
	SHF 761K (TP veh)		
Date of Accident:	01/01/2018		

Global Sum Settlement	:	☐ Yes	☒ No	
Repair Estimate	:	\$	40,227.25	
Final Repair Cost	:	\$	6,266.67	
Loss of Token Sum	:	\$	350.00	7 days at \$50.00 per day
Rental (if any)	:	\$	740.18	7 days
LTA / GIA Search Fee	:	\$	7.45	

Others:	:	\$	
---------	---	----	--

	:	\$	
Final Settlement Sum	:	\$	7,364.30

Is Third Party Workshop GIA Registered?		☐ YES	☒ NO	(Kindly indicate below)
A) For Non GIA Registered Workshop:		Agreed Liability _____ 100 (%)		
B) For GIA Registered Workshop:		BOLA Applicable: Yes/ No BOLA Scenario No: _____		
BOLA Liability: _____ (%)		Assessed Liability (*): _____ (%)		
* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.				
Remarks _____ _____				

Payment Instruction: Payee's Breakdown			
1)	TRANS-CAB AUTO SERVICES PTE LTD	:	\$ 7,364.30

NUR SHAQILAH BTE ABDOL
WAHAB

07/02/2019
Date

Please attach all the supporting documents to the form.
(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AXA INSURANCE PTE LTD		Ref : CC4/ASM18000353/Kja3s2	
8 SHENTON WAY #24-01 AXA TOWERS SINGAPORE 068811 ATTN: CYNTHIA LOH		Date : 07-02-2019	
		Code : ASM	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SFG 6161X	Veh. Inspected	SHF 761K
Policy No.	GA005021/1	Coverage (\$)	0.00
Claim No.	S8M006EU	Excess (\$)	0.00
Assign From	CYNTHIA LOH	Assign Date	05/01/2018
2. Vehicle Particulars & Condition			
Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	VF1ABL15AUC283336	Colour	METALLIC WHITE / RED
Odometer	163565	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60R16	WEST LAKE	8 mm
L/H Front Tyre	215/60R16	WEST LAKE	8 mm
R/H Rear Tyre	215/60R16	FALKEN	6 mm
L/H Rear Tyre	215/60R16	FALKEN	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	01/01/2018	Inspection Date	05/01/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 761K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BUMPER COVER REAR (CONSISTENT)	BUCKLED	1,108.46	1,108.46
1	BUMPER LOWER REAR (CONSISTENT)	DENTED	768.84	768.84
1	BUMPER BRACKET CTR REAR (CONSISTENT)	DISTORTED	113.47	113.47
1	BUMPER BRACKET SIDE RH REAR (CONSISTENT)	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR (CONSISTENT)	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH (CONSISTENT)	SERVICEABLE	43.61	-
1	BUMPER BRACKET SIDE LH REAR (CONSISTENT)	SERVICEABLE	135.97	-
1	BUMPER RETAINER LH REAR (CONSISTENT)	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR LH (CONSISTENT)	SERVICEABLE	43.61	-
1	BUMPER BEAM REAR (CONSISTENT)	BENT	777.52	777.52
1	BUMPER BEAM BRACKET LH REAR (CONSISTENT)	SERVICEABLE	225.95	-
1	BUMPER BEAM BRACKET RH REAR (CONSISTENT)	SERVICEABLE	225.95	-
1	BOOT REAR (CONSISTENT)	TO REPAIR SEE LABOUR	2,872.68	-
1	BOOT FINISHER (CONSISTENT)	SERVICEABLE	470.06	-
1	BOOT WEATHERSTRIP (CONSISTENT)	SERVICEABLE	323.05	-
1	BOOT REFLECTOR LAMP LH (CONSISTENT)	SERVICEABLE	493.35	-
1	BOOT REFLECTOR LAMP RH (CONSISTENT)	SERVICEABLE	493.35	-
1	BOOT BADGE 'RENAULT' (CONSISTENT)	NECESSARY	225.36	225.36
1	BOOT BADGE (CONSISTENT)	NECESSARY	225.36	225.36
1	BOOT STRUT LH (CONSISTENT)	SERVICEABLE	276.08	-
1	BOOT STRUT RH (CONSISTENT)	SERVICEABLE	276.08	-
1	BOOT HINGE LH (CONSISTENT)	TO REPAIR SEE LABOUR	367.84	-
1	BOOT HINGE RH (CONSISTENT)	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM (CONSISTENT)	SERVICEABLE	586.45	-
1	BOOT SWITCH (CONSISTENT)	SERVICEABLE	168.13	-
1	BOOT LOCK (CONSISTENT)	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH (CONSISTENT)	TO REPAIR SEE LABOUR	74.40	-

Report Ref No. CC4/ASM18000353/Kja3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	LICENCE PLATE LAMP (CONSISTENT)	SERVICEABLE	50.52	-
2	BOOT RUBBER PLUG (CONSISTENT)	SERVICEABLE	221.81	-
1	FENDER PANEL REAR LH (CONSISTENT)	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR LH (CONSISTENT)	SERVICEABLE	543.47	-
1	FENDER PANEL REAR RH (CONSISTENT)	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR RH (CONSISTENT)	SERVICEABLE	543.47	-
1	TAILLAMP RH (CONSISTENT)	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH (CONSISTENT)	TO REPAIR SEE LABOUR	986.70	-
1	TAILLAMP LH (CONSISTENT)	TO REPAIR SEE LABOUR	552.55	-
1	TAILLAMP PANEL LH (CONSISTENT)	TO REPAIR SEE LABOUR	986.70	-
1	OUTER PANEL REAR (END PANEL) (CONSISTENT)	BENT	1,471.77	1,471.77
1	OUTER PANEL REAR (END PANEL) TRIM (CONSISTENT)	SERVICEABLE	404.56	-
1	EXHAUST REAR (CONSISTENT)	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR (CONSISTENT)	TO REPAIR SEE LABOUR	230.49	-
	LESS 10% DISCOUNT		-3,172.39	-469.08
			28,551.54	4,221.70
	SPECIAL NETT ITEMS			
1	SET PARKING AID (SN) (CONSISTENT)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN) (CONSISTENT)	NECESSARY	33.00	33.00
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN) (CONSISTENT)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN) (CONSISTENT)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN) (CONSISTENT)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN) (CONSISTENT)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN) (CONSISTENT)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN) (CONSISTENT)	SERVICEABLE	17.82	-

Report Ref No. CC4/ASM18000353/Kja3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BOOT FINISHER CLIP (SN) (CONSISTENT)	NOT NECESSARY	24.20	-
1	BOOT STICKER "TRANS-CAB" (SN) (CONSISTENT)	NECESSARY	30.00	30.00
1	BOOT STICKER "6555-3333" (SN) (CONSISTENT)	NECESSARY	30.00	30.00
1	BOOT INNER TRIM CLIP (SN) (CONSISTENT)	NOT NECESSARY	45.00	-
1	SET FENDER WHEELARCH REAR RH CLIP (SN) (CONSISTENT)	NOT NECESSARY	35.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN) (CONSISTENT)	NOT NECESSARY	35.00	-
1	TAILLAMP CLIP RH (SN) (CONSISTENT)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	5.00	-
2	REAR WINDSCREEN SEALANT (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
			1,454.02	225.00
	LABOUR			
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		3,000.00	660.00
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF BOOT REAR, BOOT HINGE LH, BOOT HINGE RH, BOOT LOCK, BOOT LOCK CATCH, FENDER PANEL REAR LH, FENDER PANEL REAR RH, TAILLAMP PANEL RH, TAILLAMP LH, TAILLAMP PANEL LH, EXHAUST REAR AND EXHAUST CAP REAR.		2,800.00	600.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.		170.00	-
	TO TRANSFER OF REAR END PANEL, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		170.00	60.00

Report Ref No. CC4/ASM18000353/Kja3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			7,590.00	1,410.00
GRAND TOTAL			37,595.56	5,856.70
RECOMMENDED COST OF REPAIRS				5,856.70

Report Ref No. CC4/ASM18000353/Kja3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.