

REF:

CC3/ ALG18000497/ ALB 9

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. 2100499510-00000

Claims No. 1083223542SG

Sum Insured: _____ Excess: \$600

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 14516

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 2887 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SL 9990C Yr Regn 2017 Jan.

Type: MCat / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover

Truck / Trailer or

Make: Audi A4 cc 1395

Colour: Black A/C Insured / Std / NI / NA

Sp. Reading 6332 T/Radio: Insured / Std / NI / NA

Eng No: _____

Cr No: WAUZZZF45HA067790

Gen. Cond: Good / Fair / Poor / BurntSteering: Order / Jammed / Leaked / Burnt orBrake: Order / Jammed / Leaked / Burnt orModl: Nil / S/Rim / STD A/Rim or

Tyre Size F: 205/60R16

R: 205/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Continental

Front _____ Rear _____

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 06 mm

D.O.A. _____ D.O.I. 09/01/18

Survey held at: Premium

Des. of Damages: Frt / Rear O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

ODALG

RECEIVED 13 APR 2018

10/1 Report via menimen

11/1 @ 11:31am authorize repair by victor koh

11/1 @ 3:04pm inform premium authorize repair \$600-

Partby Part \$19,206.52 (Red: 3063348: 61%)

Date/Time File Pass to

☐ Prel. Report

12/4 Typist

☒ Final Report

Date/Time File Return to

Days Of Repair: 12

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

Add Fee:

☐ Site Insp \$☐ Interview \$☐ Tech. Insp \$☐ Weekend \$

Report Format:

Lump Sum / I.B.I. \$ 19,206.52

Total:

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 10 Jan 2018

Preliminary Advice

Vehicle No	: SLL9990C	Accident Date	: 05/01/2018
Make	: AUDI A4	Policy No.	: 2100499510-00000
Assignment Date	: 09/01/2018	Excess	: S\$0.00
Date of Inspection	: 10/01/2018	Est. Duration of Repair	: 9.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	46,601.00
Revised Amount	:S\$	18,524.00
Check Items (Estimated)	:S\$	14,182.00
Total	:S\$	32,706.00
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	145,000.00
COE / PARF Rebate	:S\$	68,061.00
Salvage Value	:S\$	
Margin for Repair	:S\$	76,939.00

Remarks

- (x) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

View Received Message

This mail is associated with :

***SLL9990C (10832285425G)**

OD

Jan 5 2018 3:30PM

[TAN PEE HOCK]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on **23/03/2018 13:52 PM**.

To LKK_HQ

Subject Alert - Adj Mandate Maintained - SLL9990C - Claim Handler: Mohd Zawaye, Norsazani

Maintained:upload repairer part requisition form for the LH fender inner trim.

DOCUMENTS SUMMARY

There are no documents.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	9378J
Vehicle Details	
Vehicle No.:	SLL9990C
Vehicle to be Exported:	No
Intended De-registration Date:	10 Jan 2018
Vehicle Make:	AUDI
Vehicle Model:	A4 1.4 TFSI S TRONIC
Primary Colour:	Black
Manufacturing Year:	2016
Engine No.:	CVN024245
Chassis No.:	WAUZZZF45HA067790
Maximum Power Output:	110.0 kW (147 bhp)
Open Market Value:	\$32,212.00
Original Registration Date:	26 Jan 2017
First Registration Date:	26 Jan 2017
Transfer Count:	0
Actual ARF Paid:	\$27,097.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	25 Jan 2027
PARF Rebate Amount:	\$20,322.00
Intended COE Rebate Details	
COE Expiry Date:	25 Jan 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$52,807.00
COE Rebate Amount:	\$47,739.00
Total Rebate Amount:	\$68,061.00

The information contained herein is correct as at 10 Jan 2018

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	05/01/2018 20:25
Date Of Accident	05/01/2018 15:30
Exact Location Of Accident	HOU GANG STREET 21, CARPARK
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLL9990C
Insured/Policyholder	
Name Of Registered Owner	TAN PEE HOCK
NRIC No	S6939378J
Email Address	KHUNANDYTAN@YAHOO.COM
Mobile Phone No	(LOCAL) +65-96304433
Alternative Phone No	OFFICE-96304433

Vehicle Particulars

Manufacturer	AUDI
Model	A4 SEDAN 1.4 TFSI
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100499510-00000
Cover Note Number	

Driver

Name of Driver	TAN PEE HOCK
NRIC No	S6939378J
Date Of Birth	17/10/1969
Occupation	INDOOR
Date Of Driving Pass	09/07/2013
Driving Experience	4 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96304433
Fax Number	
Contact Number	OFFICE-96304433
Email Address	KHUNANDYTAN@YAHOO.COM

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (a) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time:

5/01/2018
1700

Driver's Signature

(If driver is not the policyholder)

Date & Time:

5/01/2018
1700

Reporting Centre Personnel's Signature

Name: LONN ESHONG SENI

NRIC/FIN No: G 298 TH43X



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0033/2018/JT
Date : 8-Jan-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

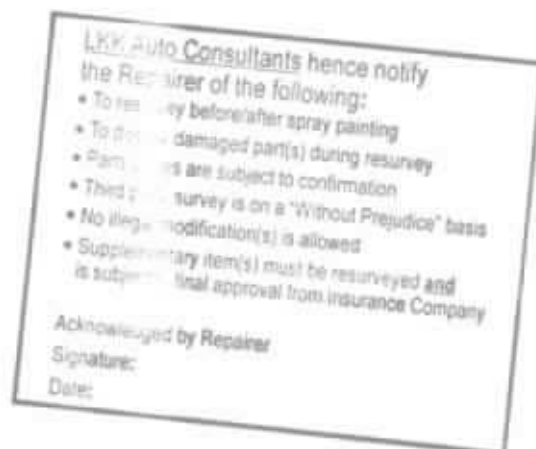
#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Tan Pee Hock
Address : 586 Yio Chu Kang Road
#02-04
Singapore 787071
Telephone : HP +65 96304433
Type of Claim : Own Damage Claims
Policy No. : 2100499510-00000
Vehicle No : **SLL 9990 C**
Model Code : Audi A4 Sedan 1.4 TFSI S-tronic
Model / Year : Jan-17
Engine No : CVN 024245
Chassis No : WAUZZZF45HA067790
Mileage :
Date In : 5-Jan-18
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 5-Jan-18
Place of Accident : Hougang St 21 Carpark



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLL 9990 C

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To set up vehicle on Car-O-Liner for first measurement.	S/N \$	800.00	✓
2	To remove and transfer rear parking aid and rear lid kick auto sensor. Check function and renew accordingly.	S/N \$	360.00	✓
3	To renew RHS 1/4 glass and rear windsreen to facilitate fender renewal.	S/N \$	600.00	✓
4	To remove and reinstall rear lid convenience lock system, wire harness for tail lights and reverse camera.	S/N \$	600.00	✓
5	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damages and renew where necessary.	S/N \$	1,400.00 480	✓
6	To remove and reinstall rear seat, back rest, hat trays, ABCD pillar trims, luggage compartment trims, seat belts. Dislodge roof liner and disengage curtain airbags, etc	S/N \$	1,400.00	✓
7	To suspend engine, remove and reinstall front suspension assy for Car-O-Liner repairs.	S/N \$	2,800.00	✓
TOTAL LABOUR CHARGES		:	\$ 7,960.00	

20144

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLL 9990 C.

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
8	To remov and reinstall rear suspension assy for Car-O-Liner repairs.	S/N \$ 2,800.00	? +
9	To renew damaged exhaust components. Align to position.	S/N \$ 480.00	* +
10	To place vehicle on Car-O-Liner.	S/N \$ 2,400.00	? +
11	To dismantle rear bumper and boot lid. Repair and straighten both rear chassis frames to specification of origin. Cut out and weld end panelling and LHS rear fender. Repair spare wheel housing. Renew rear bumper and boot lid. Re-organize rear crash management components. Reinstall all parts removed.	\$ 8,100.00	3000. ✓ fender repair
12	To respray rear bumper, rear lid, LHS rear fender, LHS sill panel, door entrance, drain panel, roof channel, spare wheel housing, and end panelling. To carry out stone chip treatment and joint sealer works.	\$ 5,500.00	2750 ✓
13	To carry out wheel alignment.	S/N \$ 240.00	? +
14	To carry out diagnostic checks.	S.N \$ 384.00	✓ 384
TOTAL LABOUR CHARGES		: \$ 22,184.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	REAR BUMPER <i>Distorted</i>	\$ 1,844.00	✓ 1435.20
2	REAR BUMPER FIXING PARTS <i>Not New</i>	\$ 61.00	? +
3	REAR BUMPER SECURING PLATE <i>Not New</i>	\$ 53.00	? +
4	REAR BUMPER SECURING STRIP <i>Damaged</i>	\$ 182.00	? 145.20
5	REAR BUMPER SPOILER <i>Deformed</i>	\$ 203.00	✓ 162.40
6	REAR BUMPER LIGHT REFLECTOR - LHS/RHS <i>Not New</i>	\$ 66.00	+ +
7	REAR BUMPER REINFORCEMENT <i>Bent</i>	\$ 756.00	✓ 604.40
8	REAR BUMPER INNER GUIDE - RHS/LHS <i>Not New</i>	\$ 1,872.00	+ +
9	REAR BUMPER OUTER GUIDE - RHS/LHS <i>Damaged</i>	\$ 36.00	? 29.76
10	REAR PARKING AID SENSOR <i>2 pieces damaged</i>	4 \$ 830.00	415.32
11	PARKING AID SENSOR WIRING SET <i>Not New</i>	\$ 580.00	? +
12	REAR LID <i>Distorted</i>	\$ 2,272.00	✓ 1817.60
13	LID ATTACHEMENT PARTS <i>Not New</i>	\$ 122.00	✓ +
14	REAR LID HINGE - LHS/RHS <i>Bent</i>	\$ 388.00	? 320
15	REAR LID LOCK <i>Damaged</i>	\$ 192.00	? +
16	REAR LID LOCK COVER <i>Cut</i>	\$ 16.00	✓ +
17	REAR LID STRIKER <i>Not New</i>	\$ 27.00	+ +
18	REAR LID PUSH BUTTON <i>Not New</i>	\$ 468.00	? +
19	ANTI-THEFT LOCK GUARD <i>Not New</i>	\$ 53.00	+ +
20	REAR LID BUFFER <i>Not New</i>	2 \$ 27.00	✓ 22.40
SUB TOTAL SPARE PARTS CHARGES		\$ 10,048.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	REAR WEATHERSTRIP <i>cut</i>	\$ 165.00	✓ 131.60
22	REAR FENDER STOP GUARD - LHS/RHS <i>LH RH</i>	2 \$ 20.00	✓ 10.76
23	REAR LID STOP GUARD - LHS/RHS <i>new</i>	2 \$ 12.00	✓ 9.28
24	REAR LID STOPPER <i>new</i>	2 \$ 46.00	✓ 36.32
25	PACKING ADHESIVE <i>new</i>	\$ 14.00	✓ 11.12
26	AUDI EMBLEM <i>new</i>	\$ 105.00	✓ 84
27	"A4" EMBLEM <i>new</i>	\$ 81.00	✓ 64.72
28	"TFSI" EMBLEM <i>new</i>	\$ 81.00	✓ 64.72
29	REAR CROSS PANEL <i>Distorted</i>	\$ 222.00	✓ 177.60
30	CROSS PANEL REINFORCEMENT PANEL <i>Distorted</i>	\$ 431.00	✓ 344.80
31	REAR SECTIONAL PIECE - <i>RHS</i> (FENDER) <i>Repair</i>	\$ 2,267.00	✓ 3x
32	REAR FENDER SUPPORT - <i>RHS</i> <i>new</i>	\$ 83.00	✓ 3x
33	REAR FENDER REINFORCEMENT - <i>RHS</i> <i>Buckled</i>	\$ 174.00	✓ 143.60
34	REAR FENDER CONNECTING PLATE - <i>RHS</i> <i>Repair</i>	\$ 47.00	✓ 3x
35	VENT TRIM <i>new</i>	\$ 117.00	✓ 3x
36	REAR FENDER BOTTOM - <i>RHS</i> <i>Repair</i>	\$ 422.00	✓ 3x
37	REAR WHEEL HOUSE LINER - <i>RHS</i> <i>new</i>	\$ 208.00	✓ 3x
38	WHEEL HOUSE LINER ATTACHMENT - <i>RHS</i> <i>new</i>	\$ 76.00	✓ 3x
39	REAR WINDSCREEN - <i>LHS</i> <i>new</i>	\$ 513.00	✓ 3x
40	REAR WINDSCREEN <i>new</i>	\$ 969.00	✓ 3x
SUB TOTAL SPARE PARTS CHARGES		\$ 6,053.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

9325

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
41	PRIMER <i>Not in</i>	2 \$	36.00	x x
42	REAR CROSS PANEL INNER TRIM <i>Defect</i>	\$	141.00	— 112.80
43	LUGGUAGE COMPARTMENT TRIM <i>Defected</i>	\$	601.00	— 480.80
44	INSERT TRIM <i>Not in</i>	\$	229.00	? x
45	SIDE LUGGUAGE COMPARTMENT TRIM - LHS <i>Defect</i>	\$	666.00	— 532.80
46	STOWAGE COMPARTMENT <i>Not in</i>	\$	77.00	? }
47	SPARE WHEEL HOUSING NUT <i>Not in</i>	\$	36.00	+ }
48	CENTRE SILENCER <i>2 Not in</i>	\$	859.00	+ }
49	REAR SILENCER	\$	951.00	+ }
50	DUAL CLIP <i>Not in</i>	\$	42.00	+ }
51	SILENCER BRACKET <i>Not in</i>	\$	26.00	+ }
52	BOOT LID CONTROL UNIT <i>Cancelled</i>	\$	349.00	— 279.20
53	PARKING AID OPEN SENSOR <i>Not in</i>	\$	179.00	+ x
54	INNER LED TAIL LIGHT - LHS <i>Cancelled</i>	\$	784.00	— 626.80
55	INNER TAIL LIGHT TRIM - LHS <i>Defect</i>	\$	24.00	— 18.96
56	OUTER LED TAIL LIGHT - LHS <i>Cancelled</i>	\$	774.00	— 619.20
57	OUTER TAIL LIGHT TRIM - LHS <i>Missing</i>	\$	24.00	— 18.96
58	SOUND ABSORBER <i>Not in</i>	\$	213.00	+ x
59	REAR NUMBER PLATE <i>Best</i>	S/N \$	25.00	— 25
60	REAR WINDSCREEN SEALANT <i>Not in</i>	S/N \$	200.00	+ x
SUB TOTAL SPARE PARTS CHARGES		:	\$ 6,236.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description	<u>Damaged Parts & Prices</u>	
		S/Nett	Remark
61	1/4 GLASS SEALENT <i>Also</i>	S/N \$ 100.00	✓ ✓
62	ACRYLIC SEALER	S/N \$ 360.00	180 ✓
63	CAVITY WAX	S/N \$ 280.00	140 ✓
64	STONE CHIP	S/N \$ 360.00	180 ✓
65	METAL FILLER POWDER <i>Also</i>	S/N \$ 280.00	140 ✓
66	SUNDRIES <i>Nec.</i>	\$ 700.00	1534
TOTAL SPARE PARTS CHARGES		\$ 24,417.00	
TOTAL LABOUR CHARGES		\$ 22,184.00	
GRAND TOTAL		\$ 46,601.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lj
Surveyed Date : 09/01/18
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 09 Days

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0033/2018/JT 23-Jan-18 CHANG 1 of 1 SLL 9990 C Audi A4 SEDAN 1.4 TFSI
Quantity	Description	Unit Price	Amount
Labours			
1	To renew rhs rear fender inner reinforcement.	\$ 900.00	\$ 500.00
2	To respray rhs rear fender.	\$ 900.00	\$ 550.00
TOTAL LABOURS :		\$ 1,800.00	\$ 1,050.00
Parts			
1	REAR LID PUSH BUTTON WITH REVERSE CAM. <i>2nd</i>	\$ 1,181.00	\$ 944.80
2	LED LICENCE PLATE LIGHT - LH <i>2nd</i>	\$ 50.00	\$ 39.68
3	REAR FENDER REINFORCEMENT - RH INNER <i>bullet</i>	\$ 180.00	\$ 143.60
4	REAR LID STOPPER <i>HE m</i>	\$ 28.00	\$
TOTAL PARTS :		\$ 1,439.00	\$ 1,128.08
GRAND TOTAL :		\$ 3,239.00	\$ 2,178.08

Adrian Ling
88/5

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0033/2018/JT
Date	:	8-Jan-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Hi Adrian

you recommended 9 days

We took 12 days exclude 2 Sundays

with additional jobs- JB 19 Mar 18

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr. Tan Pee Hock
Address	:	586 Yio Chu Kang Road #02-04 Singapore 787071
Telephone	:	HP +65 96304433
Type of Claim	:	Own Damage Claims
Policy No.	:	2100499510-00000
Vehicle No	:	SLL 9990 C
Model Code	:	Audi A4 Sedan 1.4 TFSI S-tronic
Model / Year	:	Jan-17
Engine No	:	CVN 024245
Chassis No	:	WAUZZZF45HA067790
Mileage	:	
Date In	:	5-Jan-18
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	5-Jan-18
Place of Accident	:	Hougang St 21 Carpark

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLL 9990 C

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To set up vehicle on Car-O-Liner for first measurement.	S/N	\$ 800.00	nn
2	To remove and transfer rear parking aid and rear lid kick auto sensor. Check function and renew accordingly.	S/N	\$ 360.00	\$ 360.00
3	To renew RHS 1/4 glass and rear windsreen to facilitate fender renewal.	S/N	\$ 600.00	nn
4	To remove and reinstall rear lid convenience lock system, wire harness for tail lights and reverse camera.	S/N	\$ 600.00	\$ 600.00
5	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damages and renew where necessary.	S/N	\$ 1,400.00	\$ 480.00
6	To remove and reinstall rear seat, back rest, hat trays, ABCD pillar trims, luggage compartment trims, seat belts. Dislodge roof liner and disengage curtain airbags, etc	S/N	\$ 1,400.00	nn
7	To suspend engine, remove and reinstall front suspension assy for Car-O-Liner repairs.	S/N	\$ 2,800.00	nn
TOTAL LABOUR CHARGES		:	<u>\$ 7,960.00</u>	<u>\$ 1,440.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLL 9990 C.

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
		<i>c/f</i>		\$ 1,440.00
8	To remov and reinstall rear suspension assy for Car-O-Liner repairs.	S/N	\$ 2,800.00	<i>nn</i>
9	To renew damaged exhaust components. Align to position.	S/N	\$ 480.00	<i>nn</i>
10	To place vehicle on Car-O-Liner.	S/N	\$ 2,400.00	<i>nn</i>
11	To dismantle rear bumper and boot lid. Repair and straighten both rear chassis frames to specification of origin. Cut out and weld end panelling and LHS rear fender. Repair spare wheel housing. Renew rear bumper and boot lid. Re-organize rear crash management components. Reinstall all parts removed.		\$ 8,100.00	\$ 3,000.00
12	To respray rear bumper, rear lid, LHS rear fender, LHS sill panel, door entrance, drain panel, roof channel, spare wheel housing, and end panelling. To carry out stone chip treatment and joint sealer works.		\$ 5,500.00	\$ 2,750.00
13	To carry out wheel alignment.	S/N	\$ 240.00	
14	<i>Added labour - see attached</i>		\$ 1,800.00	\$ 1,050.00
15	To carry out diagnostic checks.	S.N	\$ 384.00	\$ 384.00
TOTAL LABOUR CHARGES		:	<u>\$ 23,984.00</u>	<u>\$ 8,624.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	REAR BUMPER	\$ 1,844.00	\$ 1,475.20
2	REAR BUMPER FIXING PARTS	\$ 61.00	
3	REAR BUMPER SECURING PLATE	\$ 53.00	
4	REAR BUMPER SECURING STRIP	\$ 182.00	\$ 145.20
5	REAR BUMPER SPOILER	\$ 203.00	\$ 162.40
6	REAR BUMPER LIGHT REFLECTOR - LHS/RHS	\$ 66.00	
7	REAR BUMPER REINFORCEMENT	\$ 756.00	\$ 604.40
8	REAR BUMPER INNER GUIDE - RHS/LHS	\$ 1,872.00	
9	REAR BUMPER OUTER GUIDE - RHS/LHS	\$ 36.00	\$ 29.76
10	REAR PARKING AID SENSOR	4 \$ 830.00	\$ 332.00
11	PARKING AID SENSOR WIRING SET	\$ 580.00	
12	REAR LID	\$ 2,272.00	\$ 1,817.60
13	LID ATTACHEMENT PARTS	\$ 122.00	
14	REAR LID HINGE - LHS/RHS	\$ 388.00	\$ 320.00
15	REAR LID LOCK	\$ 192.00	
16	REAR LID LOCK COVER	\$ 16.00	
17	REAR LID STRIKER	\$ 27.00	
18	REAR LID PUSH BUTTON	\$ 468.00	
19	ANTI-THEFT LOCK GUARD	\$ 53.00	
20	REAR LID BUFFER	2 \$ 27.00	\$ 22.40
SUB TOTAL SPARE PARTS CHARGES		\$ 10,048.00	\$ 4,908.96

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
			\$ 4,908.96
21	REAR WEATHERSTRIP	\$ 165.00	\$ 131.60
22	REAR FENDER STOP GUARD - LHS/RHS	2 \$ 20.00	\$ 7.76
23	REAR LID STOP GUARD - LHS/RHS	2 \$ 12.00	\$ 9.28
24	REAR LID STOPPER	2 \$ 46.00	\$ 36.32
25	PACKING ADHESIVE	\$ 14.00	\$ 11.12
26	AUDI EMBLEM	\$ 105.00	\$ 84.00
27	"A4" EMBLEM	\$ 81.00	\$ 64.72
28	"TFSI" EMBLEM	\$ 81.00	\$ 64.72
29	REAR CROSS PANEL	\$ 222.00	\$ 177.60
30	CROSS PANEL REINFORCEMENT PANEL	\$ 431.00	\$ 344.40
31	REAR SECTIONAL PIECE - RHS (FENDER)	\$ 2,267.00	
32	REAR FENDER SUPPORT - RHS	\$ 83.00	
33	REAR FENDER REINFORCEMENT - RHS	\$ 174.00	\$ 143.60
34	REAR FENDER CONNECTING PLATE -RHS	\$ 47.00	
35	VENT TRIM	\$ 117.00	
36	REAR FENDER BOTTOM - RHS	\$ 422.00	
37	REAR WHEEL HOUSE LINER - RHS	\$ 208.00	
38	WHEEL HOUSE LINER ATTACHMENT - RHS	\$ 76.00	
39	REAR WINDSCREEN - RHS	\$ 513.00	
40	REAR WINDSCREEN	\$ 969.00	
SUB TOTAL SPARE PARTS CHARGES		\$ 6,053.00	\$ 5,984.08

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
		c/f	\$	5,984.08
41	PRIMER	2 \$	36.00	
42	REAR CROSS PANEL INNER TRIM	\$	141.00	\$ 112.80
43	LUGGUAGE COMPARTMENT TRIM	\$	601.00	\$ 480.80
44	INSERT TRIM	\$	229.00	
45	SIDE LUGGUAGE COMPARTMENT TRIM - LHS	\$	666.00	\$ 532.80
46	STOWAGE COMPARTMENT	\$	77.00	
47	SPARE WHEEL HOUSING NUT	\$	36.00	
48	CENTRE SILENCER	\$	859.00	
49	REAR SILENCER	\$	951.00	
50	DUAL CLIP	\$	42.00	
51	SILENCER BRACKET	\$	26.00	
52	BOOT LID CONTROL UNIT	\$	349.00	\$ 279.20
53	PARKING AID OPEN SENSOR	\$	179.00	
54	INNER LED TAIL LIGHT - LHS	\$	784.00	\$ 626.80
55	INNER TAIL LIGHT TRIM - LHS	\$	24.00	\$ 18.96
56	OUTER LED TAIL LIGHT - LHS	\$	774.00	\$ 619.20
57	OUTER TAIL LIGHT TRIM - LHS	\$	24.00	\$ 18.96
58	SOUND ABSORBER	\$	213.00	
59	REAR NUMBER PLATE	S/N \$	25.00	\$ 25.00
60	REAR WINDSCREEN SEALENT	S/N \$	200.00	
SUB TOTAL SPARE PARTS CHARGES		:	\$ 6,236.00	\$ 8,698.60

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 9990 C.

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 8,698.60
61	1/4 GLASS SEALENT	S/N	\$ 100.00	\$ 100.00
62	ACRYLIC SEALER	S/N	\$ 360.00	\$ 180.00
63	CAVITY WAX	S/N	\$ 280.00	\$ 140.00
64	STONE CHIP	S/N	\$ 360.00	\$ 180.00
65	METAL FILLER POWDER	S/N	\$ 280.00	\$ 140.00
66	SUPPLEMENTARY		\$ 1,439.00	\$ 1,128.08
67	SUNDRIES		\$ 700.00	\$ 15.84
	TOTAL SPARE PARTS CHARGES		\$ 25,856.00	\$ 10,582.52
	TOTAL LABOUR CHARGES		\$ 23,984.00	\$ 8,624.00
	GRAND TOTAL		\$ 49,840.00	\$ 19,206.52

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant


WIP no. 51233 Mr PH Tan

OP 105 AT 11/01/18 20:38

SLL9990C
A4 Sedan 1.4
ZZ / CHOY

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN. LOCN
ABW5945091C	LED TAIL LIGHT	783.50	1	EACH	1B08-E
ABW5945093B	TAIL LIGHT	774.00	1	EACH	1B08-E
ABW5827025J	LID	2272.00	1	EACH	1D01-E
ABW0807521K 9B9	SPOILER	203.00	1	EACH	1F05-C-5
ABW5863471B 4PK	TRIM PANEL	141.00	1	EACH	1F08-B-6
ABW5813331TA	REINFORCE	430.50	1	EACH	1G07-C-2
ABW0807309	BRACKET	755.50	1	EACH	1G07-E
ABW5813307A	REAR APRON	222.00	1	EACH	1G07-K-2
ABW5807067A GRU	COVER	1844.00	1	EACH	2B07-E
ABW0853741 22Z	INSCRIPTION 'AA'	80.90	1	EACH	AA02-E-2
ABW5853742 22Z	AUDI SIGN	105.00	1	EACH	AA02-F-4
ABW0853737A 22Z	INSCRIPTION 'TFSI'	80.90	1	EACH	AA04-B-4
ABW5827499	BUMPER	22.70	2	EACH	BB04-C-2
ABW0853419F	PACKING	13.90	1	EACH	BB09-B-3
ABW5827520 9B9	CAP	15.90	1	EACH	CC01-D-5
ABT0827310	NUT	1.50	2	EACH	CC07-C-5
ABW5827589	BUMPER	13.40	2	EACH	CC08-C-1
ABW5827377	STOP	9.70	1	EACH	CC10-D-6
ABW5827373	STOP	5.00	2	EACH	CC11-C-5
A3AA962243H	CONTR. UNIT	349.00	1	EACH	FF04-F-2
ABW5945253	TRIM	23.70	1	EACH	FF12-C-5
ABW5945255	TRIM	23.70	1	EACH	GG03-C-6
ASG0919275B GRU	SENSOR	207.50	2	EACH	GG10-C-3
ABW5827705D	WTHRSTRIP	164.50	1	EACH	J12-6


 Issued by


 Received in good condition by

RECEIVED IN GOOD CONDITION BY

WIP no. 51233 Mr PH Tan

OP 105 AT 18/01/18 16:15

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN.LOCH
ABW5827301A	HINGE	193.50	1	EACH	AA08-F-3
ABW5827302A	HINGE	193.50	1	EACH	AA08-F-3
A460943021A	LIC PL LIG	49.60	1	EACH	GG01-C-3

SL29990C
A4 Sedan 1.4
ZZ

Issued by



Received in good condition by

WIP no. 51233 Mr PH Tan

OP 105 AT 19/01/18 09:24

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN. LOCN
ABW5807889	GUIDE	18.60	1	EACH	AA01-C-2
ABW5807890	GUIDE	18.60	1	EACH	AA05-B-5
A3V0827566L	BUTTON	1181.00	1	EACH	DD12-A

SLL9990C
All Sedan 14
ZZ

Issued by



Received in good condition by

Premium Automobiles Pte Ltd

PARTS REQUISTION 415090

Page 1
Dept U

WIP no. 51233 Mr PH Tan

DP 105 AT 24/01/18 08:41

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN. LOCN
ASH0007900	STRIP	181.50	1	EACH	AA12-F
AWHT007374	PIN	1.50	1	EACH	K07-D-4

SLL 9990

A4 Sedan 1.4iFS

ZZ



Issued by



Received in good condition by

Premium Automobiles Pte Ltd

PARTS REQUISITION 415259

Page 1
Dept U

WIP no. 51233 Mr PH Tan

DP 106 AT 25/01/18 09:49

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN.LOCN
AN 01713113	FUSE(20A)	1.80	3	EACH	K04-E-1
AN 01713125	FUSE(30A)	2.00	2	EACH	K04-E-1

650g-B

LL 99402

A4 Sedan 1.4

ZZ



WIP no. 51233 Mr PH Tan

OP 105 AT 18/01/18 13:49

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN.LOCN
ABW5863879N CAG	LINING (A)	689.00	1	EACH	
ABW5810613	REINFORCEM	179.50	1	EACH	AA09-D-2
ABW5810614	REINFORCEM	179.50	1	EACH	AA09-D-2

SLL9990C
A4 sedan 1.4
ZZ

Issued by



Received in good condition by

WIP no. 51233 Mr PH Tan

DP 105 AT 11/01/18 20:38

SLL9990C
A4 Sedan 1.4
ZZ / CHOY

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN.LOCN
ABW5945091C	LED TAIL LIGHT	783.50	1	EACH	1B08-E
ABW5945093B	TAIL LIGHT	774.00	1	EACH	1B08-E
ABW5827025J	LID	2272.00	1	EACH	1D01-E
ABW0807521K 989	SPOILER	203.00	1	EACH	1F05-C-5
ABW5863471B 4PK	TRIM PANEL	141.00	1	EACH	1F08-B-6
ABW5813331TA	REINFORCE	438.50	1	EACH	1G07-C-2
ABW0807309	BRACKET	755.50	1	EACH	1G07-E
ABW5813307A	REAR APRON	222.00	1	EACH	1G07-K-2
ABW5807067A GRU	COVER	1844.00	1	EACH	2B07-E
ABW0853741 222	INSCRIPTION 'A4'	80.90	1	EACH	AA02-E-2
ABW5853742 222	AUDI SIGN	105.00	1	EACH	AA02-F-4
ABW0853737A 222	INSCRIPTION 'TFS1'	80.90	1	EACH	AA04-B-4
ABW5827499	BUMPER	22.70	2	EACH	BB04-C-2
ABW0853419F	PACKING	13.90	1	EACH	BB09-B-3
ABW5827520 989	CAP	15.90	1	EACH	CC01-D-5
ABW0827310	NUT	1.50	2	EACH	CC07-C-5
ABW5827509	BUMPER	13.40	2	EACH	CC08-C-1
ABW5827377	STOP	9.70	1	EACH	CC10-D-6
ABW5827373	STOP	5.80	2	EACH	CC11-C-5
A3AA962243H	CONTR. UNIT	349.00	1	EACH	FF04-F-2
ABW5945253	TRIM	23.70	1	EACH	FF12-C-5
ABW5945255	TRIM	23.70	1	EACH	GG03-C-6
ASG0919275B GRU	SENSOR	207.50	2	EACH	GG10-C-3
ABW5827705D	WTHRSTRIP	164.50	1	EACH	J12-G



Issued by



Received in good condition by

Premium Automobiles Pte Ltd

PARTS REQUISTION 415108

Page 1
Dept U

WIP no. 51233 Mr PH Tan

OP 105 AT 24/01/18 09:09

PART NUMBER	DESCRIPTION	PRICE	QTY	UNIT	BIN. LOCK
ABWS863463D C49	PLATFORM (B) (A)	601.00	1	EACH	

SLL9990C.

A4 Sedan 1.4TFS

ZZ



Issued by



Received in good condition by

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLL 9990 C

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0033/2017/MAS

12 April 2018

Dear Sir,

RE: INSURANCE CLAIM FOR SLL 9990 C, Audi A4 Sedan 1.4 TFSI S-Tro

With reference to the above-mentioned vehicle, no. **SLL 9990 C**, claimant, **Mr. Tan Pee Hock**, please find the related document per attached.

1. A copy of the Original invoice no. 85012324 – S\$19,908.98
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encls

AIG – SLL 9990 C

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

REPUBLIC OF SINGAPORE DRIVING LICENCE

Portrait of **TAN PEE HOCK**

Licence Number: **S6939378J**

Name: **TAN PEE HOCK**

Birth Date: **17 Oct 1969**

Issue Date: **09 Jul 2013**

Barcode: 002200254K

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S6939378J

Portrait of **TAN PEE HOCK**

Name: **TAN PEE HOCK**

Race: **CHINESE**

Date of Birth: **17-10-1969**

Country of Birth: **SINGAPORE**

Sex: **M**

Barcode: 0190722

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

Class 3A Motor cars without clutch pedals (Auto) <= 3000kg with <= 7 passengers, exclusive of the driver, and other motor vehicles without clutch pedals <= 2500kg **09 Jul 2013**

NP 428A

Licence No: S6939378J

Barcode: 0190722

NRIC No: **S6939378J**

Portrait of **TAN PEE HOCK**

Blood Group: **O+**

Date of Issue: **16-12-1991**

586 YIO CHU KANG ROAD #02-04 SINGAPORE 787071

NRIC No: **S6939378J**

Date: **09/04/2017**



HOURLINE 111 (65) 6479 3000
FAX: (65) 6415-3725

CERTIFICATE OF INSURANCE

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1980
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

RLX1

AUDI AUTO PROTECTOR

CERTIFICATE NO. 2100490510-00000

OWN DAMAGE EXCESS S\$600.00 (1)
WINDSCREEN EXCESS S\$100.00

(for policies with effect from 1st November 2002)

SUM INSURED Market Value
INSURING WITH COE/PARF Yes

1) VEHICLE REGISTRATION NO.

SLL9990C

2) NAME OF INSURED

TAN PEE HOCK

3) EFFECTIVE DATE OF THE COMMENCEMENT
OF INSURANCE FOR THE PURPOSES OF THE ACT

26 Jan 2017

4) DATE OF EXPIRY OF INSURANCE

25 Jan 2018

5) PERSON OR CLASSES OF PERSONS ENTITLED TO DRIVE *
SUBJECT TO AGE CONDITION :All Age Condition

a) The Insured.

b) Any other person who is driving on the Insured's order or with his permission.

This policy will indemnify the insured or any authorised driver only if he/she meets the age conditions.

A Young and/or Inexperienced Driver Excess ("YIDER") of S\$3,000.00, in addition to the

Policy Excess, applies to You and any Authorised Driver (named or unnamed) if You are or the said
Authorised Driver is below the age of 23 and/or has less than 2 years' driving experience.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or
has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf
from driving the Motor Vehicle

6) LIMITATION AS TO USE *

Use only for social, domestic and pleasure purposes and for the Insured's business.

The Policy does not cover use for hire or rewards, tuition, driving test, racing, pace-making, reliability trial speed-testing,
the carriage of goods other than samples in connection with any trade or business or use for any purpose in
connection with the Motor Trade.

APPROVED REPORTING CENTRES / AUDI AUTHORISED REPAIRERS

1. Audi Customer Service Center - 55 Ubi Road 1 (Tel: 63662323)

APPROVED REPORTING CENTRES / AIG AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

2. ComfortDelgro Engrg - 205 Braddell Rd (Tel: 63837118) 3. DPS Body & Paint Workshop - 209 Pandan Gardens (Tel: 65684501)

4. Ethaz - 30 Bukit Batok Crest Tel: 66547777 5. Glass-Fix - 52 Ubi Ave 3 (Tel: 62780887) - For windscreen only

6. Kan Fook Sing Motor - 61 Delu Lane 12 (Tel: 67479560) 7. Lai Hui (Meng Kac) Motor - 21 Sin Ming Ind (Tel: 64538110)

8. Mova Automotive - 1008 Bukit Merah Lane 3 (Tel: 62723892) 9. Progressive Automotive - 3022A Ubi Rd 1 (Tel: 67415336)

10. SME Motor - 1 Kaki Bukit Ave 6 Blk D (Tel: 67476106)

LOSS OF USE Loss Of Use 15 days Replacement Car only for repairs at Audi Customer Service Centre

NAMED DRIVER NA

HIRE PURCHASE COMPANY / EMPLOYER'S LOAN HONG LEONG FINANCE LTD

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and
Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings

I / We hereby Certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-
Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Issued At Singapore 1 Feb 2017

AIG Asia Pacific Insurance Pte. Ltd.

304125-206
PREMIUM LEASING - SLOH
281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE
CENTRE SINGAPORE 159938

AUTHORISED REPRESENTATIVE

ORIGINAL

DUPLICATE

AIG Building 78 Robinson Road #07-10 Singapore 068920

Covered by 2013 AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 119938
Main Telephone: 6836 2223
Main Telefax: 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 119938
Telephone: 6888 2223
Telefax: 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408649
Telephone: 6388 2223

Customer Service
Service Appointment: 6388 2323
24-hour Breakdown Service: 9828 1233
Email: customer.care@premiumauto.com.sg

INS TAX INVOICE

Company Reg. No. 199902271W

GST Reg. No. 199902271W

Page 1 16:59

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85812324 Date : 09/04/2018 Order : SLL9990C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLL9990C (V 31780) Regn Date: 26/01/2017 Mileage: 7621 WIP No.: 51233

Model: A4 SEDAN 1.4 TFSI S tronic Chassis: WAUZZZF45HA067790 Engine: CVN 024245 Dept: U

USB No.:

You have been assisted by :- UB-Carrine ()

		Details	Qty	Unit Price	Amount
S	BODYWORK	M: TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK AUTO SENSOR. CHECK FUNCTION AND RENEW ACCORDINGLY.	360.00	1.00	360.00
S	SUBLET	M: TO SUPPLY VEHICLE NUMBER PLATE.	25.00	1.00	25.00
Q	EXC	M: 8888 Insurance Excess/Liability	-600.00	1.00	-600.00
S	BODYWORK	M: TO REMOVE AND REINSTALL REAR LID CONVENIENCE LOCK SYSTEM, WIRE HARNESS FOR TAIL LIGHTS AND REVERSE CAMERA.	600.00	1.00	600.00
S	BODYWORK	M: TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY.	480.00	1.00	480.00
S	BODYWORK	M:	3000.00	1.00	3,000.00
Sub-Total					
7% GST					
Grand Total					



Premium Automobiles Pte Ltd

Audi Centre Singapore
261 Alexandra Road
Singapore 119908
Main Telephone: 6386 2223
Main Telefax: 6471 3733

Alexandra Service Centre
261 Alexandra Road
Singapore 119908
Telephone: 6386 2223
Telefax: 6475 1022

Ubi Service Centre
55 Ubi Road 1
Singapore 408869
Telephone: 6386 2223

Customer Service
Service Appointment: 6386 2223
Hour Breakdown Service: 9628 1233
Email: customer.care@premiumauto.com.sg

INS TAX INVOICE

Company Reg. No. 199902271W

BST Reg. No. 199902271W

Page 2 16:59

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012324 Date : 09/04/2018 Order : SLL9990C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLL9990C (V 31780) Regn Date: 26/01/2017 Mileage: 7621 WIP No.: 51233

Model: A4 SEDAN 1.4 TFSI S tronic Chassis: WAUZZZF45HA067790 Engine: CVN 024245 Dept: U

USB No.:

You have been assisted by :- UB-Carrine ()

		Details	Qty	Unit Price	Amount
S	BODYWORK	TO DISMANTLE REAR BUMPER AND BOOT LID. REPAIR AND STRAIGHTEN BOTH REAR CHASSIS FRAMES TO SPECIFICATI OF ORIGIN. CUT OUT AND WELD END PANELLING AND LHS REAR FENDER. REPAIR SPARE WHEEL HOUSING. RENEW REA BUMPER AND BOOT LID. RE-ORGANIZE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED M:	2750.00	1.00	2,750.00
S	BODYWORK	TO RESPRAY REAR BUMPER, REAR LID, LHS REAR FENDER, SPARE WHEEL HOUSING AND END PANELLING. TO CARRY OU STONE CHIP TREATMENT AND JOINT SEALER WORKS. M:	384.00	1.00	384.00
S	BODYWORK	TO CARRY OUT DIAGNOSTIC CHECKS. M:	740.00	1.00	740.00
S	BODYWORK	TO SUPPLY 1/4 GLASS SEALANT, ACRYLIC SEALANT, CAVI WAX, STONE CHIP AND METAL FILLER POWDER. M:	500.00	1.00	500.00
S	BODYWORK	TO RENEW RHS REAR FENDER INNER REINFORCEMENT. M:	550.00	1.00	550.00

Sub-Total

7% GST

Grand Total



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone: 6836 2223
Main Telefax: 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Telephone: 6886 2223
Telefax: 6475 1823

Ubi Service Centre
55 Ubi Road 1
Singapore 408721
Telephone: 4388 7333

Customer Service
Service Appointment: 6886 2223
24 Hour Breakdown Service: 9628 1233
Email: customer.care@premiumaudis.com.sg

INS TAX INVOICE

Company Reg. No. SLL9990C

GST Reg. No. 199902271W

Page 3 16:59

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012324 Date : 09/04/2018 Order : SLL9990C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLL9990C (V 31780) Regn Date: 26/01/2017 Mileage: 7621 WIP No.: 51233

Model: A4 SEDAN 1.4 TFSI S tronic Chassis: WAUZZZF4SHA067790 Engine: CVN 024245 Dept: U

VSS No.:

You have been assisted by :- UB-Carrine ()

		Details	Qty	Unit Price	Amount
		TO RESPRAY RHS REAR FENDER.			
X	ABW5863463D C09	PLATFORM (G) (A)	1.00	501.00	480.80
X	ABW5863879N C09	LINING (A)	1.00	666.00	532.80
X	ABW5945091C	LED TAIL LIGHT	1.00	783.50	626.80
X	ABW5945093B	TAIL LIGHT	1.00	774.00	619.20
X	ABW5827025J	LID	1.00	2272.00	1,817.60
X	ABW0007521K 9B9	SPOILER	1.00	203.00	162.40
X	ABW5863471B 4PK	TRIM PANEL	1.00	141.00	112.80
X	ABW5813331TA	REINFORCE	1.00	430.50	344.40
X	ABW0007309	BRACKET	1.00	755.50	604.40
X	ABW5813307A	REAR APRON	1.00	222.00	177.60
X	ABW5807067A GRU	COVER	1.00	1844.00	1,475.20
X	ABW5807889	GUIDE	1.00	18.60	14.88
X	ABW0853741 2Z2	INSCRIPTION 'A4'	1.00	80.90	64.72
X	ABW5853742 2Z2	AUDI SIGN	1.00	105.00	84.00
X	ABW0853737A 2Z2	INSCRIPTION 'TFSI'	1.00	80.90	64.72
X	ABW5807890	GUIDE	1.00	18.60	14.88
X	ABW5827301A	HINGE	1.00	200.00	160.00

Sub-Total

7% GST

Grand Total



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone: 6436 2222
Main Telefax: 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Telephone: 6388 2223
Telefax: 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408808
Telephone: 6388 2223

Customer Service
Service Appointment
Hour Breakdown Service
Email: customer.care@premiumauto.com.sg
6388 2223
6828 1233

INS TAX INVOICE

Company Reg. No. S9902271W
GST Reg. No. 199902271W

Page 4 16:59

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012324 Date : 09/04/2018 Order : SLL9990C Term : 30	Account: A0006 (T 01) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	---

Regn No.: SLL9990C (V 31780) Regn Date: 26/01/2017 Mileage: 7621 WIP No.: 51233

Model: A4 SEDAN 1.4 TFSI S tronic Chassis: WAUZZZF45H067790 Engine: CVN 024245 Dept: U

VS8 No.:

You have been assisted by :- UB-Carrine ()

		Details		Qty	Unit Price	Amount
X	ABW5827302A	HINGE	Less 020%	1.00	200.00	160.00
X	ABW5810613	REINFORCEN	Less 020%	1.00	179.50	143.60
X	ABW5810614	REINFORCEN	Less 020%	1.00	179.50	143.60
X	ABW0007900	STRIP	Less 020%	1.00	181.50	145.20
X	ABW5827499	BUMPER	Less 020%	2.00	22.70	36.32
X	ABD00853419F	PACKING	Less 020%	1.00	13.90	11.12
X	ABW5827520 9B9	CAP	Less 020%	1.00	6.10	4.88
X	ABT0827310	NUT	Less 020%	2.00	1.40	2.24
X	ABW5827589	BUMPER	Less 020%	2.00	14.00	22.40
X	ABW5827377	STOP	Less 020%	1.00	9.70	7.76
X	ABW5827373	STOP	Less 020%	2.00	5.80	9.28
X	A3V0827566L	BUTTON	Less 020%	1.00	1181.00	944.80
X	A3AA962243H	CONTR.UNIT	Less 020%	1.00	349.00	279.20
X	ABW5945253	TRIM	Less 020%	1.00	23.70	18.96
X	A4G0943021A	LIC PL L16	Less 020%	1.00	49.60	39.68
X	ABW5945255	TRIM	Less 020%	1.00	23.70	18.96
X	A5D0919275B GRU	SENSOR	Less 020%	2.00	207.50	332.00
X	ABW5827705D	WTHRSTRIP	Less 020%	1.00	164.50	131.60

Sub-Total

7% GST

Grand Total



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 119938
Main Telephone: 6836 2223
Main Telefax: 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 119938
Telephone: 6188 2223
Telefax: 6475 1023

UBI Service Centre
55 Ubi Road 1
Singapore 408721
Telephone: 6187 2123

Customer Service
Service Appointment
24-hour Breakdown Service
Email: customer.care@premiumauto.com.sg
6186 2223
6826 1233

INS TAX INVOICE

Company Reg. No. 199902271W

GST Reg. No. 199902271W

Page 5 16:59

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012324 Date : 09/04/2018 Order : SLL9990C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLL9990C (V 31780) Regn Date: 26/01/2017 Mileage: 7621 WIP No.: 51233

Model: A4 SEDAN 1.4 TFSI S tronic Chassis: WAUZZZF45HA067790 Engine: CVN 024245 Dept: U

VSB No.:

You have been assisted by :- UB-Carrine ()

		Details	Qty	Unit Price	Amount
X	AN 01713113	FUSE(20A)	3.00	1.00	4.32
X	AN 01713125	FUSE(30A)	2.00	2.00	3.20
X	AWHT007374	PIN	1.00	1.50	1.20

Parts 9,817.52
Labour 0.00
Sublet 9,389.00
Menus 0.00
Lubricant 0.00

Sub-Total 18,606.52

7% GST 1,382.46

Grand Total 19,988.98



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Customer

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SLL 9990 C

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0033/2018/KS
26 January 2018

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1

total pages

RE : CLAIM – OWNER’S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A4 SEDAN 1.4 TFSI S-tronic

Vehicle Chassis No. : WAUZZZF45HA067790

Vehicle Regn No. : **SLL 9990 C**

Vehicle Mileage : 7621 KM

Vehicle Owner : Mr. Tan Pee Hock

Certificate No : **2100499510-00000**

Policy Excess : **S\$642.00** (inclusive 7% GST)

Accident Date : 05/01/2018

Place : HOU GANG STREET 21, CARPARK

Repair Cost : \$ 19,908.98

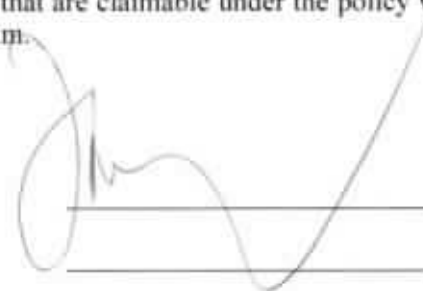
WIP No. : **51233**

Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 

Time :

Date :

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	10 Jan 2018 10:08		09 Jan 2018 14:09 Edit Adj Rpt	S\$19,206.52 Edit Estimates	S\$19,206.52 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	TAN PEE HOCK, ID: S6939378J, Tel: +6596304433, Email: KHUNANDYTAN@YAHOO.COM								
Vehicle Reg. No.:	SLL9990C	Date of Loss:	05/01/2018 15:00 - :59 [11 Months and 10 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 1083228542SG	Policy/Cover Note No.:	2100499510-00000 (Comprehensive)						
		Excess:	S\$600.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689628/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Mohd Zawaye, Norsazani] Norsazani.Zawaye@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 18/01/2018]								
Driver/Custodian:	TAN PEE HOCK (48 / Male), NRIC: S6939378J, Tel: +6596304433								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (29/03/2018): Alert - Adj Mandate Approved (S\$19206.52) - SLL9990C - Claim Handler: Mohd Zawaye... - AIG_SG (26/03/2018): Alert - Adj Mandate Maintained - SLL9990C - Claim Handler: Mohd Zawaye, Norsazan... - AIG_SG (23/03/2018): Alert - Adj Mandate Maintained - SLL9990C - Claim Handler: Mohd Zawaye, Norsazan... - AIG_SG (20/03/2018): Alert - Adj Mandate Maintained - SLL9990C - Claim Handler: Mohd Zawaye, Norsazan... - AIG_SG (11/01/2018): Alert - Adj Mandate Approved (S\$18524.00) - SLL9990C - Claim Handler: Mohd Zawaye... - AIG_SG (10/01/2018): SLL9990C / OD / 05/01/2018 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLL9990C (1083228542SG)
OD
Jan 5 2018 3:30PM
[TAN PEE HOCK]
Premium Automobiles Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser	
Assessment Reports			1 per page ☐ ☒	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		
1	10/01/18 12:58	Adjuster Immediate Advice		
			1 Load HTM	
Photos/Images			3 per page ☐ ☒	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		
1	10/01/18 11:35	General View		
2	10/01/18 11:35	General View		
3	10/01/18 11:35	General View		
4	10/01/18 11:35	General View		
5	10/01/18 11:35	General View		
6	10/01/18 11:35	General View		
7	10/01/18 11:35	General View		
8	10/01/18 11:35	General View		
9	10/01/18 11:35	General View		
10	10/01/18 11:35	General View		
11	10/01/18 11:35	General View		
12	10/01/18 11:35	General View		
13	10/01/18 11:35	General View		
14	10/01/18 11:35	General View		
15	10/01/18 11:35	General View		
16	10/01/18 11:35	General View		
17	10/01/18 11:35	General View		
18	10/01/18 11:35	General View		
19	10/01/18 11:35	General View		
20	10/01/18 11:35	General View		
21	10/01/18 11:35	General View		
22	10/01/18 11:35	General View		
23	10/01/18 11:35	General View		
24	10/01/18 11:35	General View		
25	10/01/18 11:35	General View		
26	10/01/18 11:35	General View		
27	10/01/18 11:35	General View		
28	10/01/18 11:35	General View		
29	10/01/18 11:35	General View		
30	10/01/18 11:35	General View		
31	10/01/18 11:35	General View		
32	10/01/18 11:35	General View		
33	10/01/18 11:35	General View		
34	10/01/18 11:35	General View		
35	10/01/18 11:35	General View		

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
36	10/01/18 11:35	General View	 Load JPG	☒
37	10/01/18 11:35	General View	 Load JPG	☒
38	10/01/18 11:35	General View	 Load JPG	☒
39	10/01/18 11:35	General View	 Load JPG	☒
40	10/01/18 11:35	General View	 Load JPG	☒
41	10/01/18 11:35	General View	 Load JPG	☒
42	10/01/18 11:35	General View	 Load JPG	☒
43	10/01/18 11:35	General View	 Load JPG	☒
44	10/01/18 11:35	General View	 Load JPG	☒
45	10/01/18 11:35	General View	 Load JPG	☒
46	10/01/18 11:35	General View	 Load JPG	☒
47	10/01/18 11:35	General View	 Load JPG	☒
48	10/01/18 11:35	General View	 Load JPG	☒
49	10/01/18 11:35	General View	 Load JPG	☒
50	10/01/18 11:35	General View	 Load JPG	☒
51	10/01/18 11:35	General View	 Load JPG	☒
52	10/01/18 11:35	General View	 Load JPG	☒
53	10/01/18 11:35	General View	 Load JPG	☒
54	10/01/18 11:35	General View	 Load JPG	☒
55	10/01/18 11:35	General View	 Load JPG	☒
56	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
57	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
58	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
59	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
60	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
61	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
62	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
63	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
64	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
65	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
66	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
67	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
68	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
69	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
70	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
71	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
72	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
73	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
74	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
75	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
76	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
77	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
78	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
79	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
80	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
81	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
82	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
83	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
84	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
85	19/03/18 18:31	Reinspection Photo	 Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
86	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
87	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
88	19/03/18 18:31	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/01/18 11:36	ESTIMATE	 Load PDF	
2	10/01/18 11:36	Singapore Accident Statement	 Load PDF	
3	10/01/18 11:36	NIRC/DRIVING LICENSE/CI	 Load PDF	
4	20/03/18 12:03	Estimate 2nd	 Load PDF	
5	20/03/18 12:03	Supplementary	 Load PDF	
6	23/03/18 17:44	part requisition	 Load PDF	
7	29/03/18 09:21	FULL SET OF PART REQUISITION	 Load PDF	
8	20/04/18 09:48	DISCHARGE VOUCHER	 Load PDF	
9	20/04/18 09:48	WORKSHOP INVOICE	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	05/01/18 21:14	Accident Statement	 Load HTML	
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	05/01/18 21:01	Accident Photo	 Load JPG	☒
2	05/01/18 21:01	Accident Photo	 Load JPG	☒
3	05/01/18 21:01	Accident Photo	 Load JPG	☒
4	05/01/18 21:01	Accident Photo	 Load JPG	☒
5	05/01/18 21:01	Accident Photo	 Load JPG	☒
6	05/01/18 21:01	Accident Photo	 Load JPG	☒
7	05/01/18 21:01	Accident Photo	 Load JPG	☒
8	05/01/18 21:01	Accident Photo	 Load JPG	☒
9	05/01/18 21:01	Accident Photo	 Load JPG	☒
10	05/01/18 21:01	Accident Photo	 Load JPG	☒
11	05/01/18 21:01	Accident Photo	 Load JPG	☒
12	05/01/18 21:01	Accident Photo	 Load JPG	☒
13	05/01/18 21:01	Accident Photo	 Load JPG	☒
14	05/01/18 21:01	Accident Photo	 Load JPG	☒
15	05/01/18 21:01	Accident Photo	 Load JPG	☒
16	05/01/18 21:01	Accident Photo	 Load JPG	☒
17	05/01/18 21:01	Accident Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	05/01/18 21:13	Sketch Plan	 Load JPG	☒
2	05/01/18 21:13	Sketch Plan #2	 Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**Show Remarks To:** ☐ Handling InsurerNote: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CC3/AIG18000497/ATBQ2

Date: 20/04/2018

REFERENCE

Insured/Claimant: TAN PEE HOCK Policy No: 2100499510-00000
Date of Loss: 05/01/2018 Nature of Claim: OD Claim No: 1083228542SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLL9990C**
Make & Model: AUDI A4, 1.4 T (A) Engine No: CVN024245
Reg. Date: 26/01/2017 (Man. Year: 2016) Chassis No: WAUZZZF45HA067790
Colour: Black Odometer: 6332 km
Engine Capacity: 1395 cc
Market Value/New Car Price: S\$145,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/60 R16 Rear Tyre Size: 205/60 R16
Front Left Side: Continental 6 mm Rear Left Side: Continental 6 mm
Front Right Side: Continental 6 mm Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	25,545.08	10,582.52	14,962.56	58.57
Miscellaneous Items	0.00	0.00	0.00	
Labour	29,664.00	8,624.00	21,040.00	70.93
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	55,209.08	19,206.52	36,002.56	65.21
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	54,609.08	18,606.52	36,002.56	65.93
+ GST 7.00/7.00% (S\$)	3,822.64	1,302.46	2,520.18	65.93
Nett Amount (S\$)	58,431.72	19,908.98	38,522.74	65.93

INSPECTION

Date of Assignment: 09/01/2018
Date Inspected: 09/01/2018 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 12.0 days

Adjuster: ADRIAN LING

Manager: DENISE TAY KWEE CHENG

Adjuster Report

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Distorted	1,844.00 FS	*1,475.20 FS
2	1		*REAR BUMPER FIXING PARTS	Not Necessary	61.00 FS	*- FS
3	1		*REAR BUMPER SECURING PLATE	Not Necessary	53.00 FS	*- FS
4	1		*REAR BUMPER SECURING STRIP	Damaged	182.00 FS	*145.20 FS
5	1		*REAR BUMPER SPOILER	Deformed	203.00 FS	*162.40 FS
6	2		*REAR BUMPER LIGHT REFLECTOR -LHS/RHS	Not Necessary	66.00 FS	*- FS
7	1		*REAR BUMPER REINFORCEMENT	Bent	756.00 FS	*604.40 FS
8	2		*REAR BUMPER INNER GUIDE -RHS/LHS	Not Necessary	1,872.00 FS	*- FS
9	1		*REAR BUMPER OUTER GUIDE -RHS/LHS	Damaged	36.00 FS	*29.76 FS
10	4		*REAR PARKING AID SENSOR	Damaged (2 PCS ONLY)	830.00 FS	*332.00 FS
11	1		*SET PARKING AID SENSOR WIRING	Not Necessary	580.00 FS	*- FS
12	1		*REAR LID	Distorted	2,272.00 FS	*1,817.60 FS
13	1		*LID ATTACHMENT PARTS	Not Necessary	122.00 FS	*- FS
14	2		*REAR LID HINGE -LHS/RHS	Bent	388.00 FS	*320.00 FS
15	1		*REAR LID LOCK	Not Necessary	192.00 FS	*- FS
16	1		*REAR LID LOCK COVER	Not Necessary	16.00 FS	*- FS
17	1		*REAR LID STRIKER	Not Necessary	27.00 FS	*- FS
18	1		*REAR LID PUSH BUTTON	Not Necessary	468.00 FS	*- FS
19	1		*ANTI-THEFT LOCK GUARD	Not Necessary	53.00 FS	*- FS
20	2		*REAR LID BUFFER	Necessary	27.00 FS	*22.40 FS
21	1		*REAR WEATHERSTRIP	Cut	165.00 FS	*131.60 FS
22	1		*REAR FENDER STOP GUARD -LHS/RHS	N/S Necessary	20.00 FS	*7.76 FS
23	2		*REAR LID STOP GUARD -LHS/RHS	Necessary	12.00 FS	*9.28 FS
24	2		*REAR LID STOPPER	Necessary	46.00 FS	*36.32 FS
25	1		*PACKING ADHESIVE	Necessary	14.00 FS	*11.12 FS
26	1		*AUDI EMBLEM	Necessary	105.00 FS	*84.00 FS
27	1		*A4 EMBLEM	Necessary	81.00 FS	*64.72 FS
28	1		*TFSI EMBLEM	Necessary	81.00 FS	*64.72 FS
29	1		*REAR CROSS PANEL	Distorted	222.00 FS	*177.60 FS
30	1		*CROSS PANEL REINFORCEMENT PANEL	Distorted	431.00 FS	*344.40 FS
31	1		*REAR SECTIONAL PIECE -LHS (FENDER)	Repair	2,267.00 FS	*- FS
32	1		*REAR FENDER SUPPORT -LHS	Not Necessary	83.00 FS	*- FS
33	1		*REAR FENDER REINFORCEMENT -LHS	Buckled	174.00 FS	*143.60 FS
34	1		*REAR FENDER CONNECTING PLATE -LHS	Repair	47.00 FS	*- FS
35	1		*VENT TRIM	Not Necessary	117.00 FS	*- FS
36	1		*REAR FENDER BOTTOM -LHS	Repair	422.00 FS	*- FS
37	1		*REAR WHEEL HOUSE LINER -LHS	Not Necessary	208.00 FS	*- FS
38	1		*WHEEL HOUSE LINER ATTACHMENT -LHS	Not Necessary	76.00 FS	*- FS
39	1		*REAR WINDSCREEN -LHS	Not Necessary	513.00 FS	*- FS
40	1		*REAR WINDSCREEN	Not Necessary	969.00 FS	*- FS
41	2		*PRIMER	Not Necessary	36.00 FS	*- FS
42	1		*REAR CROSS PANEL INNER TRIM	Deformed	141.00 FS	*112.80 FS
43	1		*LUGGAGE COMPARTMENT TRIM	Deformed	601.00 FS	*480.80 FS
44	1		*INSERT TRIM	Not Necessary	229.00 FS	*- FS
45	1		*SIDE LUGGAGE COMPARTMENT TRIM -LHS	Deformed	666.00 FS	*532.80 FS
46	1		*STOWAGE COMPARTMENT	Not Necessary	77.00 FS	*- FS
47	1		*SPARE WHEEL HOUSING NUT	Not Necessary	36.00 FS	*- FS

Report was unsubmitted during this print-out.

Adjuster Report

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
48	1		*CENTRE SILENCER	Not Necessary	859.00 FS	*. FS
49	1		*REAR SILENCER	Not Necessary	951.00 FS	*. FS
50	1		*DUAL CLIP	Not Necessary	42.00 FS	*. FS
51	1		*SILENCER BRACKET	Not Necessary	26.00 FS	*. FS
52	1		*BOOT LID CONTROL UNIT	Cracked	349.00 FS	*279.20 FS
53	1		*PARKING AID OPEN SENSOR	Cracked	179.00 FS	*. FS
54	1		*INNER LED TAIL LIGHT -LHS	Not Necessary	784.00 FS	*626.80 FS
55	1		*INNER TAIL LIGHT TRIM -LHS	Damaged	24.00 FS	*18.96 FS
56	1		*OUTER LED TAIL LIGHT -LHS	Cracked	774.00 FS	*619.20 FS
57	1		*OUTER TAIL LIGHT TRIM -LHS	Missing	24.00 FS	*18.96 FS
58	1		*SOUND ABSORBER	Not Necessary	213.00 FS	*. FS
59	1		*REAR NUMBER PLATE	Bent	25.00 FS	*25.00 FS
60	1		*REAR WINDSCREEN SEALANT	Not Necessary	200.00 FS	*. FS
61	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
62	1		*ACRYLIC SEALER	Necessary	360.00 FS	*180.00 FS
63	1		*CAVITY WAX	Necessary	280.00 FS	*140.00 FS
64	1		*STONE CHIP	Necessary	360.00 FS	*180.00 FS
65	1		*METAL FILLER POWDER	Necessary	280.00 FS	*140.00 FS
66	1		*SUNDRIES	Necessary	700.00 FS	*15.84 FS
67	1		*REAR LID PUSH BUTTON WITH REVERSE CAM	Damaged	944.80 FS	*944.80 FS
68	1		*LED LICENCE PLATE LIGHT -LH	Damaged	39.68 FS	*39.68 FS
69	1		*REAR FENDER REINFORCEMENT -RH INNER	Buckled	143.60 FS	*143.60 FS
70	2		*REAR LID STOPPER (NPA)	Not Necessary	0.00 FS	*. FS
Total Parts (S\$)					25,545.08	10,582.52

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO SET UP VEHICLE ON CAR-O-LINER FOR FIRST MEASUREMENT	New	800.00	0.00
2	TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK AUTO SENSOR ,CHECK FUNCTION AND RENEW ACCORDINGLY	New	360.00	360.00
3	TO RENEW RHS 1/4 GLASS AND REAR WINDSCREEN TO FACILITATE FENDER RENEWAL	New	600.00	0.00
4	TO REMOVE AND REINSTALL REAR LID CONVENIENCE LOCK SYSTEM,WIRE HARNESS FOR TAIL LIGHTS AND REVERSE CAMERA	New	600.00	600.00
5	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS ,BATTERY MANAGER ,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT .INSPECT FOR DAMAGES AND RENEW WHERE NECESSARY	New	1,400.00	480.00
6	TO REMOVE AND REINSTALL REAR SEAT ,BACK TEST ,HAT TRAYS ,ABCD PILLAR TRIMS ,LUGGAGE COMPARTMENT TRIMS ,SEAT BELTS .DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAGS ,ETC	New	1,400.00	0.00
7	TO SUSPEND ENGINE ,REMOVE AND REINSTALL FRONT SUSPENSION ASSY FOR CAR-O-LINER REPAIRS	New	2,800.00	0.00
8	TO REMOVE AND REINSTALL REAR SUSPENSION ASSY FOR CAR-O-LINER REPAIRS	New	2,800.00	0.00
9	TO RENEW DAMAGED EXHAUST COMPONENTS .ALIGN TO POSITION	New	480.00	0.00
10	TO PLACE VEHICLE ON CAR-O-LINER	New	2,400.00	0.00
11	TO DISMANTLE REAR BUMPER AND BOOT LID ,REPAIR AND STRAIGHTEN BOTH REAR CHASSIS FRAMES TO SPECIFICATION OF ORIGIN .CUT OUT AND WELD END PANELLING AND LHS REAR FENDER .REPAIR SPARE WHEEL HOUSING .RENEW REAR BUMPER AND BOOT LID .RE-ORGANIZE REAR CRASH MANAGEMENT COMPONENTS .REINSTALL ALL PARTS REMOVED	New	8,100.00	3,000.00
12	TO RESPRAY REAR BUMPER ,REAR LID ,LHS REAR FENDER,LHS SILL PANEL ,DOOR ENTRANCE ,DRAIN PANEL ,ROOF CHANNEL ,SPARE WHEEL HOUSING AND END PANELLING.TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	5,500.00	2,750.00
13	TO CARRY OUT WHEEL ALIGNMENT	New	240.00	0.00
14	TO CARRY OUT DIAGNOSTIC CHECKS	New	384.00	384.00
15	RENEW RHS REAR FENDER INNER REINFORCEMENT	New	900.00	500.00
16	TO RESPRAY RHS REAR FENDER	New	900.00	550.00
Gross Labour Cost (S\$)			29,664.00	8,624.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >