


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHC4230R
 Ref. No : TAX/01/18/2059
 Reg. Date : 22/11/2013
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS
 Name of Driver : CHIA CHAN KONG
 Type of Accident : CHAIN COLLISION
 Date / Time of Accident : 11/01/2018 07:25:00 AM
 Accident Reported Date / Time : 11/01/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : No
 Towed Back Date/Time :
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024094040
 Special Instruction to ARC, if any :
 SFJ9955L
 Prepared Date : 11/01/2018 09:57:19 AM

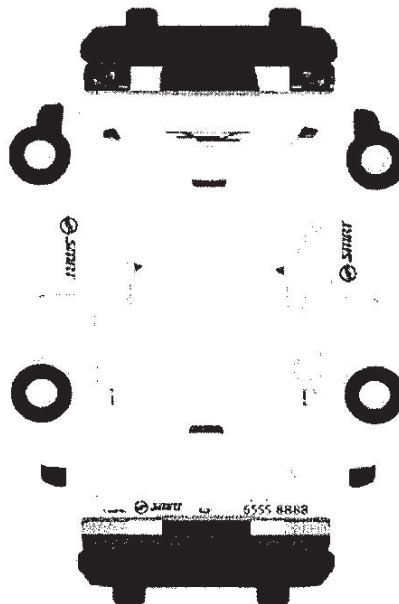

LKK Auto Consultants hence notify the Repairer of the following:
 • To resurvey before/after repainting
 • To display damaged part(s) during resurvey
 • Parts prices are subject to confirmation
 • Third party survey is on a "Without Prejudice" basis
 • No illegal modifications are allowed
 • Supplementary items must be surveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Taufik 97495749
WP

12/1/18 @ 1515

8 days

Impressum
Resurvey after repair

sur @ lkkauto.com
taufik @ lkkauto.com

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U50-5704820

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,859.00	0.00
Total Spray Painting Charges :	2,430.00	0.00
Total Material Charges :	10,690.63	10,690.63
Other Charges :	1,180.00	0.00
TOTAL :	16,159.63	0.00
Lum Sum Total :	16,150.00	0.00
No. of Repair Days :	9.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sing Off Date :	11/01/2018 04:41:40 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 11/01/2018 04:35:54 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount : 0.00	Prepared Date : 1/11/2018 4:41:31 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR FRONT PORTION	1,014.00	0.00 600
TO REPAIR REAR PORTION	845.00	0.00 600
Total Labour	1,859.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00 200
TO RESPRAY FRONT SUPPORT PANEL	180.00	0.00 150
TO RESPRAY FRONT FENDER LH	378.00	0.00 200
TO RESPRAY FRONT DOOR LH	378.00	0.00 200
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY BUMPER BEAM	180.00	0.00 100 ? photo
TO RESPRAY TAIL GATE	378.00	0.00 200
TO RESPRAY REAR PANEL	180.00	0.00 200 ? photo
Total Spray Painting & Panel Beating	2,430.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 40
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 60
TO TOP UP A/C GAS	120.00	0.00 100 ?
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 X
TO REMOVE AND REFIX REAR WINDSCREEN	240.00	0.00 X
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 30
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00 60
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00 40 ?
TO REPLACE SUNDRY PARTS	100.00	0.00 30
TO WASH AND VACUUM	60.00	0.00 X
Total Other Costs	1,180.00	0.00

Part 4 --Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52119-47930		6505517	BUMPER FRT	1	482.00	25.00	361.50	Replace	Replace <i>de ✓</i>	No
52021-47023		6505539	BUMPER REINFORCEMENT FRT	1	498.40	25.00	373.80	Replace	Replace <i>?</i>	No
52611-47080		6505518	BUMPER ENERGY ABSORBER FRT	1	78.80	25.00	59.10	Replace	Replace <i>?</i>	No
57014-47030			ARM SUB-ASSY, FR BUMPER LH	1	250.40	25.00	187.80	Replace	Replace <i>?</i>	No
52114-47140			BRACKET, FR BUMPER	1	110.40	25.00	82.80	Replace	Replace <i>?</i>	No
			NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace <i>mis ✓</i>	No
			NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace <i>de ✓</i>	No
53102-47020		6505541	BUMPER GRILLE SUB-ASSY, LOWER	1	311.10	25.00	233.32	Replace	Replace <i>on ✓</i>	No
75310-47010		6505638	EMBLEM FRONT	1	86.50	25.00	64.87	Replace	Replace <i>de ✓</i>	No
53111-47040		6505573	GRILLE, RADIATOR	1	310.60	25.00	232.95	Replace	Replace <i>de ✓</i>	No
52161-16010			BUMPER CLIPS	10	1.61	25.00	12.07	Replace	Replace <i>de ✓</i>	No
76851-47020		6505616	BUMPER LIP FRT	1	139.60	25.00	104.70	Replace	Replace <i>?</i>	No
52618-47050		6505540	BUMPER FRT ABSORBER LOWER	1	127.70	25.00	95.77	Replace	Replace <i>?</i>	No
52116-47040		6505516	BUMPER SUPPORT F/LH	1	76.40	25.00	57.30	Replace	Replace <i>de ✓</i>	No
53201-47902			SUPPORT SUB-ASSY	1	1,460.40	25.00	1,095.30	Replace	Replace <i>?</i>	No
81170-47500		6505436	HEAD LAMP LH	1	945.20	10.00	850.68	Replace	Replace <i>de ✓</i>	No
16400-37230		6505302	RADIATOR ASSY	1	1,496.90	25.00	1,122.67	Replace	Replace <i>?</i>	No
G9010-47031			RADIATOR ASSY, UPPER	1	679.60	25.00	509.70	Replace	Replace <i>?</i>	No
57104-47020		6505507	RADIATOR LOWER SUPPORT	1	876.30	25.00	657.22	Replace	Replace <i>?</i>	No
G9225-47021			HOSE, INVERTER NO.1	1	80.00	25.00	60.00	Replace	Replace <i>?</i>	No
G9214-47060			BRACKET, INVERTER, NO.1	1	31.40	25.00	23.55	Replace	Replace <i>?</i>	No
16267-37030			RADIATOR HOSE, BYPASS NO.3	1	37.20	25.00	27.90	Replace	Replace <i>?</i>	No
16571-37140		6505303	RADIATOR TOP HOSE NO 1	1	42.40	25.00	31.80	Replace	Replace <i>?</i>	No
16523-21050			CUSHION, RADIATOR	2	11.30	25.00	16.95	Replace	Replace <i>?</i>	No
16534-37010			SUPPORT, RADIATOR, LH	1	17.70	25.00	13.27	Replace	Replace <i>?</i>	No
16535-20030			SUPPORT, RADIATOR,	1	18.50	25.00	13.87	Replace	Replace <i>?</i>	No
16711-37040			FAN SHROUD	1	244.50	25.00	183.37	Replace	Replace <i>?</i>	No
16712-37030			FAN SHROUD TOP	1	99.60	25.00	74.70	Replace	Replace <i>?</i>	No
88460-47150			A/C CONDENSER	1	1,181.90	25.00	886.42	Replace	Replace <i>?</i>	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
53802-47050		6505558	FENDER FRT/LH	1	723.40	25.00	542.55	Replace	bt Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	hu Replace	No
53876-47030		6505554	FENDER LINER FRT/LH	1	171.70	25.00	128.77	Replace	Replace ?	No
67002-47070		6505529	DOOR FRT/LH	1	894.40	25.00	670.80	Replace	Ry Replace	No
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	neu Replace	No
	COMMO N		COOLANT	1	12.32	0.00	12.32	Replace	Replace ?	No
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	de Replace	No
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace ?	No
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace ?	No
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace ?	No
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace ?	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	mis Replace	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	neu Replace	No
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace ?	No
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	neu Replace	No
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Ry Replace	No
75574-47020			TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	x Replace	No
75573-47080			TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	x Replace	No
64821-47030			TAILGATE LOWER WINDOW GLASS	1	721.30	25.00	540.97	Replace	x Replace	No
	COMMO N		SEALANT W/SCREEN	3	37.00	0.00	111.00	Replace	y Replace	No
69350-47030			TAILGATE DOOR LOCK	1	444.10	25.00	333.07	Replace	x Replace	No
69415-47020			TAILGATE LOCK, COVER	1	15.70	25.00	11.77	Replace	x Replace	No
67881-47022			TAILGATE DOOR WEATHER STRIP	1	353.40	25.00	265.05	Replace	x Replace	No
69431-47010			STRIKER, BACK DOOR	1	48.90	25.00	36.67	Replace	x Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	neu Replace	No
81551-47180		6505462	TAIL LAMP RH	1	557.80	10.00	502.02	Replace	3 ? Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	x Repair Replace	No
	COMMO N	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	x Replace	No
TOTAL MATERIALS								13,363.40	13,363.29	
TOTAL MATERIALS(Discounted)								10,690.63	10,690.63	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									