

ACC. REC. BY:

REF:

CS/CT118001298/Kgd362

Special Instruction:

SURVEYOR

Kenneth
Meinen

ASSIGNMENT (Office)

From (Person):

Irene Tay

of

CTI

Date/Time:

22/01/18 @ 9:18am

Estimated Cost:

Bill to:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKT 3136 L

Insured:

at Workshop n/s

Cheng Hor Motor

Tel:

6755 6142

of

Bik 1019 # 01-374/382 Yishun Ind. Prk A

Policy No:

DMPCS N153 1181702

Claim No:

SNM18D00355C01

Sum Insured:

Excess:

NIL

Make of Veh:

(Client's Record)

D.O.A.

18/01/2018

CA / ☒ REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

10:31am @ 22/1/18

Person Contacted:

Wendy

Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction (✓) Estimate
	SKT 3136 L - X
23/1/18 @ 11.10 am	revert to Irene Tay via Meinen.
23/1/18 @ 5.25pm	Susan Tco informed C/A at \$6652.98 via Meinen.
24/1/18 @ 9.42am	Informed Wendy C/A & tx: \$ of by email.
08/5/18 @ 10.57am	2nd revert to Irene Tay via Meinen. (supplementary).
10/5/18 @ 9.07am	Arfred informed C/A at \$6743.58 via Meinen.

ASS. REC. BY:

REF: C121

Kinneeth

ASSIGNMENT

From:

Date:

Estimated Cost:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

 Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

5 days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Type: ☒ M. Car

M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading:

Eng/No:

C/No:

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Rear

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

11 File sent to Carhome
13/5/18 @ 3:40 pm confirmed with Epaeda final fig of 6709.08, 5 days.
(Red 494, 70%)
no lump sum.

RECEIVED 1 MAY 2018

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: 5

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

Photos

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format:

MER-01

Lump Sum / I.B.I. (\$

6709.08

220

220



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD		Ref : CS/CTI18001298/Kqd3		
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Date : 22-01-2018		
		Code : CTI		
1. Policy Particulars - OWN DAMAGE				
Insured Veh.		Veh. Inspected	SKT 3136L	
Policy No.	DMPCSN1531181702	Coverage (\$)	0.00	
Claim No.	SNM18D00355C01	Excess (\$)	0.00	
Assign From	IRENE TAY (MERIMEN)	Assign Date	22/01/2018	
2. Vehicle Particulars & Condition				
Make & Model	c.c			
Engine No.	Year of Reg.			
Chassis No.	Colour			
Odometer	Steering			
Brakes	Modification			
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	18/01/2018	Inspection Date		
Survey held at				
5a. General Remarks				

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	19 Jan 2018 Sendback Est	20 Jan 2018 18:00 \$6,962.63	22 Jan 2018 09:18 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

Insured:	LAU BOON CHENG, ID: S7408689F		
Vehicle Reg. No.:	SKT3136L	Date of Loss:	18/01/2018 19:00 - :59
Claim Type:	OD / SNM18D00355C01	Policy/Cover Note No.:	DMPCSN1531181702 (Comprehensive) Coverage: 24/09/2017 - 23/09/2018
		Excess:	\$50.00
Repairer:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Irene Tay Hui Ping - 638986192]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 31/01/2018]		
Driver/Custodian:	LAU BOON CHENG (/ Female), NRIC: S7408689F		
Adj Asg. Remarks:	PLEASE SURVEY AND REVERT		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Shiau Chan (LKKAUTO)

From: Efeeda (Cheng Hoe -Yishun) <chmotor@singnet.com.sg>
Sent: Tuesday, 15 May 2018 3:40 PM
To: Shiau Chan (LKKAUTO)
Subject: Re: FINALISE OF VEHICLE SKT 3136L (DOA: 18/01/2018)

Hi Shiau Chan,

confirm thank u.

Rgds
Efeeda
Cheng Hoe Motor PL

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, May 15, 2018 3:33 PM
To: Cheng Hoe Motor Pte Ltd (Yishun-June)
Cc: SUR
Subject: RE: FINALISE OF VEHICLE SKT 3136L (DOA: 18/01/2018)

Dear Efida,

Offer final fig \$6,709.08 before GST and 5 repair days.

Kindly confirm.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	19 Jan 2018 18:44	Clim Veh Model Changed	(203605) MERCEDES-BENZ C200 KOMPRESSOR 2.0 (A).	[R] JUNE PHUA LIAN HUA
2	19 Jan 2018 18:44	Clim Created	Reg No: SKT3136L. Policy No: DMPCSN1531181702. Acct Date: 2018/01/18. Claim Type: OD. Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ). Workshop: Cheng Hoe Motor Pte Ltd (Yishun)	[R] JUNE PHUA LIAN HUA
3	20 Jan 2018 18:00	Clim Submitted	6962.63.	[R] JUNE PHUA LIAN HUA
4	22 Jan 2018 09:18	Clim Registration Modified	Excess: -> 0.00.	[I] Irene Tay Hui Ping
5	22 Jan 2018 09:18	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):PLEASE SURVEY AND REVERT	[I] Irene Tay Hui Ping
6	22 Jan 2018 09:18	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2018/01/31	[I] Irene Tay Hui Ping
7	22 Jan 2018 09:18	Adj Mandate Set	Approved:0.00.	[I] Irene Tay Hui Ping
8	22 Jan 2018 10:27	Assignment 1st Accessed		[A] Nivitha Govindasamy
9	23 Jan 2018 10:54	Adj Adjuster Assigned	[None] -> KENNETH KONG	[A] SHIAU CHAN
10	23 Jan 2018 10:57	Adj Rpt Initiated		[A] SHIAU CHAN
11	23 Jan 2018 11:07	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2018/01/31	[A] SHIAU CHAN
12	23 Jan 2018 11:10	Adj Mandate Request	Cur.Req:6836.63:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL. THE VEHICLE REPAIR ON PART BY PART BASIS DUE TO NO SECOND HAND PARTS AVAILABLE. WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
13	23 Jan 2018 17:25	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2018/01/31	[I] Susan Teo
14	23 Jan 2018 17:25	Adj Mandate Set	Approved:6652.98.	[I] Susan Teo
15	09 Apr 2018 15:27	Clim Supp Created (S:698798)		[R] Efeeda Binte Mohamed Othman
16	09 Apr 2018 15:29	Clim Submitted (S:698798)	240.45.	[R] Efeeda Binte Mohamed Othman
17	09 Apr 2018 15:29	Adj Co Assigned (S:698798)	LKK Auto Consultants Pte Ltd (HQ):	[I] Merimen Administrator
18	10 Apr 2018 11:26	Supp Combined (S:698798)		[A] SHIAU CHAN
19	08 May 2018 10:56	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2018/01/31	[A] SHIAU CHAN
20	08 May 2018 10:57	Adj Mandate Request	Cur.Req:6743.58:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL. KINDLY APPROVE ON SUPPLEMENTARY.	[A] SHIAU CHAN
21	10 May 2018 09:07	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2018/01/31. Mandate Remarks: PROCEED TO AUTHORIZE REPAIRS AT \$6,743.58.	[I] Alfred Toh
22	10 May 2018 09:07	Adj Mandate Set	Approved:6743.58:PROCEED TO AUTHORIZE REPAIRS AT \$6,743.58.Reinsp:Adj de cides.	[I] Alfred Toh

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1700597	19/01/2018 18:44	Motor	Cheng Hoe Motor Pte Ltd	Cheng Hoe Motor Pte Ltd (Yishun)	SKT3136L		xx.xx
1702658	23/01/2018 10:57	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SKT3136L		10.70

Note: This document has not been finalised.
LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Irene Tay Hui Ping

Date: 08 May 2018

Preliminary Advice

Vehicle No	: SKT3136L	Accident Date	: 18/01/2018
Make	: MERCEDES-BENZ C200 KOMPRESSOR	Policy No.	: DMPCSN1531181702
Assignment Date	: 22/01/2018	Excess	: S\$0.00
Date of Inspection	: 22/01/2018	Est. Duration of Repair	: 5.00
Inspection At	: CHENG HOE MOTOR PTE LTD (YISHUN) BLK 1019 #01-374/382, YISHUN INDUSTRIAL PARK A SINGAPORE 768761		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	7,203.08	(ESTIMATE \$6,962.63 + SUPPLEMENTARY \$240.45)
Revised Amount	:S\$	6,743.58	(INCLUSIVE OF SUPPLEMENTARY)
Check Items (Estimated)	:S\$	0.00	
Total	:S\$	6,743.58	
Lump Sum Repair	:S\$		

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	42,000.00
COE / PARF Rebate	:S\$	26,873.00
Salvage Value	:S\$	
Margin for Repair	:S\$	15,127.00
Braking System	:	In Order
Steering System	:	In Order
Tyre Condition (Front)	:	7/7mm
Tyre Condition (Rear)	:	7/7mm

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : KINDLY APPROVE ON SUPPLEMENTARY.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Wednesday, 24 January 2018 9:42 AM
To: Cheng Hoe Motor Pte Ltd (Yishun-June)
Cc: SUR
Subject: VEHICLE SKT 3136L (DOA: 18/01/2018)
Attachments: index (1).pdf

Dear June,

As spoken with Wendy.

As instructed by our client, please proceed to repair the insured vehicle **SKT 3136L (Excess \$0/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	19 Jan 2018 18:44	Clim Veh Model Changed	(203605) MERCEDES-BENZ C200 KOMPRESSOR 2.0 (A).	[R] JUNE PHUA LIAN HUA
2	19 Jan 2018 18:44	Clim Created	Reg No: SKT3136L. Policy No: DMPCSN1531181702. Acct Date: 2018/01/18. Claim Type: OD. Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ). Workshop: Cheng Hoe Motor Pte Ltd (Yishun)	[R] JUNE PHUA LIAN HUA
3	20 Jan 2018 18:00	Clim Submitted	6962.63.	[R] JUNE PHUA LIAN HUA
4	22 Jan 2018 09:18	Clim Registration Modified	Excess: -> 0.00.	[I] Irene Tay Hui Ping
5	22 Jan 2018 09:18	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):PLEASE SURVEY AND REVERT	[I] Irene Tay Hui Ping
6	22 Jan 2018 09:18	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2018/01/31	[I] Irene Tay Hui Ping
7	22 Jan 2018 09:18	Adj Mandate Set	Approved:0.00.	[I] Irene Tay Hui Ping
8	22 Jan 2018 10:27	Assignment 1st Accessed		[A] Nivitha Govindasamy
9	23 Jan 2018 10:54	Adj Adjuster Assigned	[None] -> KENNETH KONG	[A] SHIAU CHAN
10	23 Jan 2018 10:57	Adj Rpt Initiated		[A] SHIAU CHAN
11	23 Jan 2018 11:07	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2018/01/31	[A] SHIAU CHAN
12	23 Jan 2018 11:10	Adj Mandate Request	Cur.Req:6836.63:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL. THE VEHICLE REPAIR ON PART BY PART BASIS DUE TO NO SECOND HAND PARTS AVAILABLE. WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
13	23 Jan 2018 17:25	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2018/01/31	[I] Susan Teo
14	23 Jan 2018 17:25	Adj Mandate Set	Approved:6652.98.	[I] Susan Teo

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1700597	19/01/2018 18:44	Motor	Cheng Hoe Motor Pte Ltd	Cheng Hoe Motor Pte Ltd (Yishun)	SKT3136L		xx.xx
1702658	23/01/2018 10:57	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SKT3136L		10.70

Note: This document has not been finalised.**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Irene Tay Hui Ping

Date: 23 Jan 2018

Preliminary Advice

Vehicle No	: SKT3136L	Accident Date	: 18/01/2018
Make	: MERCEDES-BENZ C200 KOMPRESSOR	Policy No.	: DMPCSN1531181702
Assignment Date	: 22/01/2018	Excess	: S\$0.00
Date of Inspection	: 22/01/2018	Est. Duration of Repair	: 5.00
Inspection At	: CHENG HOE MOTOR PTE LTD (YISHUN) BLK 1019 #01-374/382, YISHUN INDUSTRIAL PARK A SINGAPORE 768761		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	6,962.63
Revised Amount	:S\$	4,780.43
Check Items (Estimated)	:S\$	2,056.20
Total	:S\$	6,836.63

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	42,000.00
COE / PARF Rebate	:S\$	26,873.00
Salvage Value	:S\$	
Margin for Repair	:S\$	15,127

Braking System	:	In Order
Steering System	:	In Order
Tyre Condition (Front)	:	7/7mm
Tyre Condition (Rear)	:	7/7mm

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : THE VEHICLE REPAIR ON PART BY PART BASIS DUE TO NO SECOND HAND PARTS AVAILABLE.
WE HAVE NOT AUTHORISE REPAIR.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 8689F

Vehicle Details

Vehicle No.: SKT3136L

Vehicle to be Exported: Yes

Intended De-registration
Date: 19 Jan 2018

Vehicle Make: MERCEDES BENZ

Vehicle Model: C 200 KOMPRESSOR

Primary Colour: Silver

Manufacturing Year: 2009

Engine No.: 27195031248524

Chassis No.: WDD2040412A304721

Maximum Power Output: 135.0 kW (181 bhp)

Open Market Value: \$43,099.00

Original Registration Date: 24 Sep 2009

First Registration Date: 24 Sep 2009

Transfer Count: 1

Actual ARF Paid: \$43,099.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry
Date: 23 Sep 2019

PARF Rebate Amount: \$23,704.00

Intended COE Rebate Details

COE Expiry Date: 23 Sep 2019

COE Category: B - Car (1601cc & above)

COE Period(Years): 10

QP Paid: \$18,890.00

COE Rebate Amount: \$3,169.00

Total Rebate Amount: \$26,873.00

The information contained herein is correct as at 19 Jan 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	19/01/2018 10:47
Date Of Accident	18/01/2018 19:15
Exact Location Of Accident	ALONG EAN KIAM PLACE PARALLEL PARKING
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKT3136L
Insured/Policyholder	
Name Of Registered Owner	LAU BOON CHENG(LIU WENQING)
NRIC No	S7408689F
Email Address	JASMINE.LBC@GMAIL.COM
Mobile Phone No	(LOCAL) +65-90237223
Alternative Phone No	OFFICE-90237223
Vehicle Particulars	
Manufacturer	MERCEDES-BENZ
Model	C 200 KOMPRESSOR
Exact Purpose for which vehicle was being used at time of accident	PTE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company	
Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN1531181702
Cover Note Number	24/09/17 - 23/09/18

Driver	
Name of Driver	LAU BOON CHENG(LIU WENQING)
NRIC No	S7408689F
Date Of Birth	16/03/1974
Occupation	INDOOR
Date Of Driving Pass	19/11/1998
Driving Experience	19 YEARS AND 1 MONTH
Gender	FEMALE
Mobile Number	(LOCAL) +65-90237223
Fax Number	
Contact Number	OFFICE-90237223
Email Address	JASMINE.LBC@GMAIL.COM

SKETCH PLAN

Building

A = SKT3136L
B = SLN5191H
Lim Thiam Huat
S0223544G
HP - 81818366
(Pte Hire Car)

* parking lots fully occupied

Ean Kiam Place

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

There was an unknown car stopping along the road and I horn to alert the said driver as I was exiting slowly from the lot after checking traffic was clear. The unknown car moved forward and out of sudden car B from opposite direction came and encroached into my lane thus causing its front right collided onto the front right of my car. I came out of my car to check the damage and wanted to take photo. However, the Grab driver moved his car before I could take any photos of the exact scenario. No one was injured.

Note : Please note that your insurer may have 14days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: (YS)
NRIC/FIN No.:

**CHENG HOE MOTOR PTE
LTD
BLK 1019, YISHUN
INDUSTRIAL PARK A
#01-374/382
SINGAPORE 768761**

SKT3136L
CD/CHINA
DoA: 18/1/18

Claim Reference:
Assessment Number: CSKT3136
Version: CHENGHOE/3
Date Calculated: 20/01/2018 09:46

Full Report - V1
Registration: SKT3136L
Printed: 20/01/2018 18:13

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	18/01/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	5 day(s) ✓
Policy Number:	DMPCSN1531181702	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 COMPRESSOR
Model Sheet Number:	304 01
Registration:	SKT3136L
Registration Month:	September
Registration Year:	2009
VIN Number:	WDD2040412A304721
Manufacture Year:	2009
Odometer:	Not Known
Colour:	Silver
Engine Number:	
Fuel Level:	%

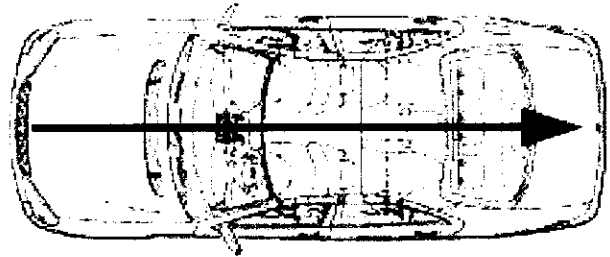
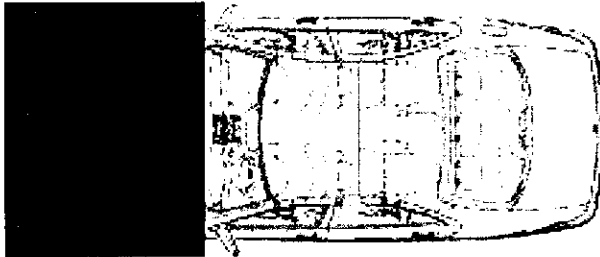
Model Specs

FR A301./F359./R089.	MODEL 2010
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	19/01/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

CHENG HOE MOTOR PTE LTD**Claim Reference:****Assessment Number: CSKT3136****Version: CHENGHOE/3****Date Calculated: 20/01/2018 09:46****Full Report - V1****Registration: SKT3136L****Printed: 20/01/2018 18:13****Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD

Address :

BLK 1019, YISHUN IND PK A

01-374/382

Post Code : 768761

Cost Summary

Total Labour	\$1,320.20
Total Paint/Material	\$227.93
Total Parts	\$5,087.50
Total of Additional Costs	\$327.00
Excess:	TBA
Grand Total Exc GST:	\$6,962.63
7 % GST:	\$487.38
Grand Total Inc GST:	\$7,450.01

Repair Information**LABOUR****Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR****Price/Dent = \$46.00/HR****Repair /****Guide Number Repair Details**

		WU	Cost Price (\$)
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
54-7940 ZAX	RENEW FRONT PARKING AID WIRING HARNESS	4.0	18.40
82-4730 01)	R + R BOTH HEADLAMP UNITS (BUMPER REMOVED)	3.0	13.80
88-9678 01	R + R R/F WING MOULDING	3.0	13.80
88-4666 01)	DETACH + REFIT L/F PARTITION PANEL	3.0	13.80
88-3954 01	R + R R/F WING (FRONT BUMPER REMOVED)	6.0	27.60
88-3956 01)	RENEW R/F WING (REMOVED)	2.0	9.20
88-3511 01	FIT R/WING BADGE	3.0	13.80

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSKT3136

Version: CHENGHOE/3

Date Calculated: 20/01/2018 09:46

Full Report - V1

Registration: SKT3136L

Printed: 20/01/2018 18:13

NO NUMBER	R + R FRONT AIR GUIDE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE	12.0	55.20
	INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION		
62-1308 01	R + R R/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT COVER	3.0	13.80
09-6820 01)	R + R AIR INTERCOOLER	5.0	23.00
0471	REPAIR BONNET	10.0*	46.00
0930	REPAIR CTR FRT REINF	10.0*	46.00
1112	REPAIR R/F WHEELHOUSE ASSY	10.0*	46.00
1000	REPAIR FRH FENDER INNR PANE	10.0*	46.00
1000	REPAIR SUPPORT PANEL	10.0*	46.00

LABOUR COST

Total Work Units	138.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	13.8HRS	\$634.80
Paint Labour	14.9HRS	\$685.40
Total Labour	28.7HRS	\$1,320.20

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
742	R/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
405	FRONT GRILLE NEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	43.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	23.0	
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
741	L/F WING SURFACE PAINT	5.0	
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0	

LABOUR COST - PAINT

TIME(PAINT)	119.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	149.0	
Total Paintwork Labour	14.9HRS	\$685.40

MATERIAL COST - PAINT

New Part Painting		\$14.45
-------------------	--	---------

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSKT3136

Version: CHENGHOE/3

Date Calculated: 20/01/2018 09:46

Full Report - V1

Registration: SKT3136L

Printed: 20/01/2018 18:13

New Part Painting - Plastic K1R	\$50.18
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$21.91
Surface Paint Plastic	\$1.48
Repair Painting	\$102.31
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$227.93
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$227.93

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)	
258	1	FRT NO PLATE REINF	KNPL0	garnish	0%	CM 78.00*	✓
283	1	FRONT BUMPER COVER	204 880 0940 9999		0%	Tn 753.00*	✓
304	1	R/F BUMPER COVER	204 885 2323	fog lamp garnish	0%	BTS 24.00*	✓
305	1	FRONT BUMPER GRILLE	204 885 2123	inner garnish	0%	CM 49.00*	✓
308	1	R/F COVER	204 885 1274	fog lamp chrome	0%	CRA 58.00*	✓
311	1	L/F BUMPER MOULDING	204 885 0721		0%	Mc 52.00*	✓
312	1	R/F BUMPER MOULDING	204 885 0821		0%	CM 52.00*	✓
336	1	FRONT IMPACT DAMPER	204 885 0065	centre lower grille	0%	D.I 49.00*	✓
349	1	FRT/CTR IMPACT DAMP	204 885 0037	Sponge	0%	CM 86.00*	✓
362	1	R/F OUTER SENSOR	000 905 2402		0%	hij 145.00*	✓
366	1	R/F INNER SENSOR	000 905 2402		0%	hij 145.00*	✓
377	1	PARKTRONIC WIRING	204 540 0608	Sensor wire	0%	CUT 120.00*	✓
405	1	FRONT GRILLE	204 880 0023 9744		0%	CRA 315.00*	✓
562	1	RIGHT HEADLAMP ASSY	204 906 5403	mg	0%	CM 595.00*	✓
578	1	R/HEADLAMP COVER	204 826 1424	top cover	0%	Bu 14.00*	✓
638	1	R/F FOG LAMP	251 820 0856		0%	pucl 150.00*	✓
742	1	R/F WING	204 880 1418		0%	Bu 480.00*	✓
766	1	R/F RAIL	204 881 0206	side retainer	0%	D.I 12.00*	✓
786	1	R/F WING MOULDING	204 690 3262		0%	Mc 23.00*	✓
812	1	R/F WING BADGE	204 817 2720		0%	Mc 36.00*	✓
840	1	R/F W-HOUSE CVR FRT	204 690 5630	inner shield	0%	CRA 88.00*	✓
1001	1	FRT LWR CROSSMEMBER	207 620 1600	reinforcement bumper	0%	B 163.00*	✓
1180	1	R/F UPP REINF	204 620 1091	rlt head lamp panel	0%	bt 135.00*	✓
7751	1	UPPER AIR GUIDE	204 505 0530	support inner rubber	0%	CRA 36.00*	✓
7752	1	LOWER AIR GUIDE	204 505 3430	air-inter cooler rubber	0%	SVC 90.00*	✓
7753	1	FAN SHROUD	204 500 0155	support top garnish	0%	CRA 70.00*	✓
8730	1	INTERCOOLER	204 500 0500		0%	pucl 588.00*	✓
8779	1	FRONT GRILLE PANEL	204 520 0723	engine under cover	0%	CM 97.00*	✓
9645	1	LOW TONE HORN	006 542 9220		0%	CRA 105.00*	✓
1000	1	BUMPER CTR LWR TRIM	Renew	fit bumper centr lwr garnish	0%	SVC CM 48.00*	✓
1000	1	FRT BUPER TOW COVER	Renew		0%	SVC 29.00*	✓
1000	1	FRT GRILLE LOGO	Renew		0%	SVC 65.00*	✓
f: OEM Parts			Sub Total			\$4,750.00	
g: Original			Mark Up From Cost	(5 %)		\$237.50	
h: Secondhand			Sundry Parts	(Fixed)		\$100.00	
p: Parallel			Total Parts			\$5,087.50	
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
-------------	------------	-------

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSKT3136

Version: CHENGHOE/3

Date Calculated: 20/01/2018 09:46

Full Report - V1

Registration: SKT3136L

Printed: 20/01/2018 18:13

AIRCON GAS	SPECIALIST	0%	\$50.00	✓
FRT NO PLATE	SPECIALIST		CM \$35.00	✓
COMP WHEEL	SPECIALIST	0%	nn \$80.00	X
ALIGNMENT				
TOWING	SPECIALIST		60 \$120.00	7
AUDATEX FEE	SPECIALIST	0%	\$42.00	✓
Total Extras			\$327.00	

Final Calculation

Total Parts	\$5,087.50
Labour	
Total Panel/Mechanical	\$634.80
Total Paintwork	\$685.40
Total Labour	\$1,320.20
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$327.00
Total of Additional Costs	\$327.00
Total Paint/Material Costs	\$227.93
Grand Total Excludes GST	\$6,962.63
GST @ 7 %	\$487.38
Grand Total Includes GST	\$7,450.01

Assessment Notes

Not Authorized
Ex NIC

FT1 d/s

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from the insurer.

Acknowledged by Repairer

Signature: _____

Date: _____

**CHENG HOE MOTOR PTE LTD**

Blk 1019, Yishun Industrial Park A, #01-374/382, Singapore 768761

Tel : 67556142 Fax : 67557719

Email: chrmotor@singnet.com.sg

INSURER: China Taiping Insurance (Singapore) Pte. Ltd. (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	OD CHINA
Policy No:	DMPCSN1531181702	Date of Loss:	18/01/2018
Vehicle Reg. No.:	SKT3136L	Driveable?	
Driver Age/Info:	/ FEMALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	LAU BOON CHENG		
Driver:	LAU BOON CHENG		
Make/Model:	MERCEDES-BENZ C200 KOMPRESSOR, 2.0 (A)	Vehicle Reg. Date:	24/09/2009
Vehicle Colour:	SILVER		
Engine No:	27195031248524	Chassis No:	WDD2040412A304721
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	8		
Description of Accident/Loss	PLS REFER EFILE REPORT		
Present Location:	CHENG HOE MOTOR PTE LTD (YISHUN)		

COST OF CLAIMS	Amount
Parts	4,987.50
Miscellaneous Items	427.00
Labour	1,548.13
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	6,962.63
+ GST 7.00% (\$)	487.38
Nett Amount (\$)	7,450.01

This claim is handled by: JUNE PHUA LIAN HUA

Generated using Merimen e-Claims Internet Estimation & Adjusting System

7203.08

REPAIR DETAILS**Reference****Part Source:** MRM-SG **Version:** 1.0 (Last Synchronised: 20 Jan 2018)**Parts:** 143 **MERCEDES-BENZ C200 KOMPRESSOR 2.0 (A) (Catalogue:Merimen Singapore 1.0)****Labour:** Repairer's **(Price-denominated Standard List)****Print Code:** Cheng Hoe Motor Pte Ltd/SKT3136L/20/01/2018 18:00**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr		Amount
1	1	NA	*BUMPER CTR LWR TRIM	0.00	0.00	SVC	*48.00 F
2	1	NA	*FAN SHROUD	0.00	0.00	CRA	*70.00 F
3	1	NA	*FRONT BUMPER COVER	0.00	0.00	TA	*753.00 F
4	1	NA	*FRONT BUMPER GRILLE	0.00	0.00	CRA	*49.00 F
5	1	NA	*FRONT GRILLE	0.00	0.00	CRA	*315.00 F
6	1	NA	*FRONT GRILLE PANEL	0.00	0.00	CRA	*97.00 F
7	1	NA	*FRONT IMPACT DAMPER	0.00	0.00	DIS	*49.00 F
8	1	NA	*FRT BUPER TOW COVER	0.00	0.00	SVC	*29.00 F
9	1	NA	*FRT GRILLE LOGO	0.00	0.00	SVC	*65.00 F
10	1	NA	*FRT LWR CROSSMEMBER	0.00	0.00	BT	*163.00 F
11	1	NA	*FRT NO PLATE REINF	0.00	0.00	CRA	*78.00 F
12	1	NA	*FRT/CTR IMPACT DAMP	0.00	0.00	CRA	*86.00 F
13	1	NA	*INTERCOOLER	0.00	0.00	PUC	*588.00 F
14	1	NA	*L/F BUMPER MOULDING	0.00	0.00	PUC	*52.00 F
15	1	NA	*LOW TONE HORN	0.00	0.00	CRA	*105.00 F
16	1	NA	*LOWER AIR GUIDE	0.00	0.00	SVC	*90.00 F
17	1	NA	*PARKTRONIC WIRING	0.00	0.00	UNT	*120.00 F
18	1	NA	*R/F BUMPER COVER	0.00	0.00	DIS	*24.00 F
19	1	NA	*R/F BUMPER MOULDING	0.00	0.00	CRA	*52.00 F
20	1	NA	*R/F COVER	0.00	0.00	CRA	*58.00 F
21	1	NA	*R/F FOG LAMP	0.00	0.00	BUC	*150.00 F
22	1	NA	*R/F INNER SENSOR	0.00	0.00	MIS	*145.00 F
23	1	NA	*R/F OUTER SENSOR	0.00	0.00	MIS	*145.00 F
24	1	NA	*R/F RAIL	0.00	0.00	DIS	*12.00 F
25	1	NA	*R/F UPP REINF	0.00	0.00	BT	*135.00 F
26	1	NA	*R/F W-HOUSE CVR FRT	0.00	0.00	CRA	*88.00 F
27	1	NA	*R/F WING	0.00	0.00	BUC	*480.00 F
28	1	NA	*R/F WING BADGE	0.00	0.00	PUC	*36.00 F
29	1	NA	*R/F WING MOULDING	0.00	0.00	PUC	*23.00 F
30	1	NA	*R/HEADLAMP COVER	0.00	0.00	BUC	*14.00 F
31	1	NA	*RIGHT HEADLAMP ASSY	0.00	0.00	CRA	*595.00 F
32	1	NA	*UPPER AIR GUIDE	0.00	0.00	CRA	*36.00 F

F=Franchise part.

Sub Total (S\$)	4,750.00
+ Margin on L,N Items 5.00% (S\$)	237.50
Total Parts (S\$)	4,987.50

Cheng Hoe Motor Pte Ltd/SKT3136L/20/01/2018 18:00. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
Miscellaneous Items			
1	1	SPECIALIST AIRCON GAS	50.00 ✓
2	1	SPECIALIST AUDATEX FEE	42.00
3	1	SPECIALIST COMP WHEEL ALIGNMENT	80.00 ✓
4	1	SPECIALIST FRT NO PLATE	CRA 35.00

No	Qty	Particulars	Amount
5	1	SPECIALIST TOWING	60 120.00
6	1	SUNDRY PARTS	re 100.00 ✓
Sub Total (S\$)			427.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	Total Paint Labour	New	685.40 ✓
2	Total Paint Materials	New	227.93 ✓
3	Total Panel/Mechanical Labour	New	574.40 634.80
Gross Labour Cost (S\$)			1,548.13

Cheng Hoe Motor Pte Ltd/SKT3136L/20/01/2018 18:00. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

張建福 (機件) 拖車服務
TEO KIAN HOCK (CHEE CHEN) TOWING SERVICES

Mailing Address: 40 Cactus Road, Singapore 809597

Tel: 6858 4067 Fax: 6854 0407

廿四小時服務 24 HOURS SERVICE

Reg. No. 413736/00L

CASH SALE / WORK ORDER

No. 18507

Date: 18.01.2018

寶號
Messrs: Cheng Hoe motor 01-374
車號
Vehicle No: SKT3136L 車型
Model No: Mercedes
由
From: Ean Kiam 到
To: Yishun
時間 (日/夜)
Time (day/night): 1000 pm
其他
Others: Dolly
CASH \$: 120 CHEQUE:

經手人
Authorised by: I 收貨人
Received by:

注意: 本公司對所拖之車輛, 在進行中如有任何損失或破壞, 一概由車主自行負責。

NOTE: Vehicle is towed at owner's risk. The Company accepts no responsibility for damages or other misdemeanour to your vehicle whilst being towed.

Supp 1

REPAIR DETAILS**Reference****Part Source:** MRM-SG **Version:** 1.0 (Last Synchronised: 09 Apr 2018)**Parts:** 143 **MERCEDES-BENZ C200 KOMPRESSOR 2.0 (A)** (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** Cheng Hoe Motor Pte Ltd/SKT3136L/09/04/2018 15:29**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BONNET SPRING	0.00	0.00	*12.00 F
2	1		*PARKING SENSOR (NO.3)	0.00	0.00	*145.00 F
3	1		*ELECTRICAL WARNING HORN	0.00	0.00	*72.00 F

F=Franchise part.

Sub Total (S\$) **229.00**+ Margin on L,N Items 5.00% (S\$) **11.45**Total Parts (S\$) **240.45**

Cheng Hoe Motor Pte Ltd/SKT3136L/09/04/2018 15:29. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

There are no labour items selected.

Cheng Hoe Motor Pte Ltd/SKT3136L/09/04/2018 15:29. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference:
Assessment Number: CSKT3136
Version: CHENGHOE/3
Date Calculated: 23/01/2018 02:45

Full Report - V1
Registration: SKT3136L
Printed: 23/01/2018 10:45

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	MR LAU	Date of Incident:	18/01/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	5 day(s)
Policy Number:	DMPCSN1531181702	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 COMPRESSOR
Model Sheet Number:	304 01
Registration:	SKT3136L
Registration Month:	September
Registration Year:	2009
VIN Number:	WDD2040412A304721
Manufacture Year:	2009
Odometer:	Not Known
Colour:	Silver
Engine Number:	
Fuel Level:	%

Model Specs

FR A301./F359./R089.	MODEL 2010
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	19/01/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

Claim Reference:

Full Report - V1

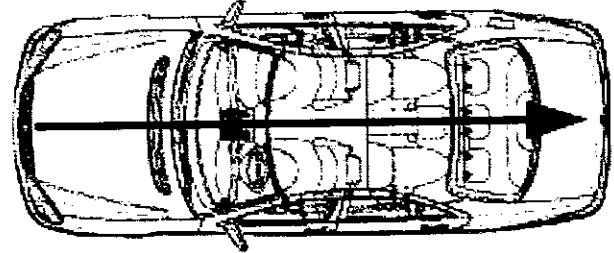
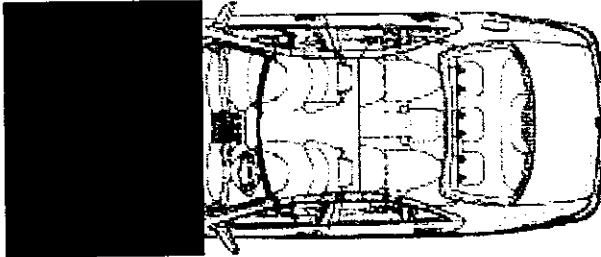
Assessment Number: CSKT3136

Registration: SKT3136L

Version: CHENGHOE/3

Printed: 23/01/2018 10:45

Date Calculated: 23/01/2018 02:45

**Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD

Address :

BLK 1019, YISHUN IND PK A

01-374/382

Post Code : 768761

Cost Summary

Total Labour	\$1,274.20
Total Paint/Material	\$227.93
Total Parts	\$5,087.50
Total of Additional Costs	\$247.00
Excess:	TBA
Grand Total Exc GST:	\$6,836.63
7 % GST:	\$478.56
Grand Total Inc GST:	\$7,315.19

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
54-7940 ZAX	RENEW FRONT PARKING AID WIRING HARNESS	4.0	18.40
82-4730 01)	R + R BOTH HEADLAMP UNITS (BUMPER REMOVED)	3.0	13.80
88-9678 01	R + R R/F WING MOULDING	3.0	13.80
88-4666 01)	DETACH + REFIT L/F PARTITION PANEL	3.0	13.80
88-3954 01	R + R R/F WING (FRONT BUMPER REMOVED)	6.0	27.60
88-3956 01)	RENEW R/F WING (REMOVED)	2.0	9.20
88-3511 01	FIT R/WING BADGE	3.0	13.80

Claim Reference:

Full Report - V1

Assessment Number: CSKT3136

Registration: SKT3136L

Version: CHENGHOE/3

Printed: 23/01/2018 10:45

Date Calculated: 23/01/2018 02:45

NO NUMBER	R + R FRONT AIR GUIDE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	12.0	55.20
62-1308 01	R + R R/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT COVER	3.0	13.80
09-6820 01)	R + R AIR INTERCOOLER	5.0	23.00
0471	REPAIR BONNET	10.0*	46.00
0930	REPAIR CTR FRT REINF	10.0*	46.00
1112	REPAIR R/F WHEELHOUSE ASSY	5.0*	23.00
1000	REPAIR FRH FENDER INNR PANE	5.0*	23.00
1000	REPAIR SUPPORT PANEL	10.0*	46.00
LABOUR COST		128.0	
Total Work Units			
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		12.8HRS	\$588.80
Paint Labour		14.9HRS	\$685.40
Total Labour		27.7HRS	\$1,274.20

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
742	R/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
405	FRONT GRILLE NEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	43.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	23.0	
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
741	L/F WING SURFACE PAINT	5.0	
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
LABOUR COST - PAINT		119.0	
TIME(PAINT)			
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		149.0	
Total Paintwork Labour		14.9HRS	\$685.40
MATERIAL COST - PAINT			
New Part Painting			\$14.45

Claim Reference:

Full Report - VI

Assessment Number: CSKT3136

Registration: SKT3136L

Version: CHENGHOE/3

Printed: 23/01/2018 10:45

Date Calculated: 23/01/2018 02:45

New Part Painting - Plastic K1R	\$50.18
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$21.91
Surface Paint Plastic	\$1.48
Repair Painting	\$102.31
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$227.93
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$227.93

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
258	1	FRT NO PLATE REINF	KNPLO		0%	78.00*
283	1	FRONT BUMPER COVER	204 880 0940 9999		0%	753.00*
304	1	R/F BUMPER COVER	204 885 2323		0%	24.00*
305	1	FRONT BUMPER GRILLE	204 885 2123		0%	49.00*
308	1	R/F COVER	204 885 1274		0%	58.00*
311	1	L/F BUMPER MOULDING	204 885 0721		0%	52.00*
312	1	R/F BUMPER MOULDING	204 885 0821		0%	52.00*
336	1	FRONT IMPACT DAMPER	204 885 0065		0%	49.00*
349	1	FRT/CTR IMPACT DAMP	204 885 0037		0%	86.00*
362	1	R/F OUTER SENSOR	000 905 2402		0%	145.00*
366	1	R/F INNER SENSOR	000 905 2402		0%	145.00*
377	1	PARKTRONIC WIRING	204 540 0608		0%	120.00*
405	1	FRONT GRILLE	204 880 0023 9744		0%	315.00*
562	1	RIGHT HEADLAMP ASSY	204 906 5403		0%	595.00*
578	1	R/HEADLAMP COVER	204 826 1424		0%	14.00*
638	1	R/F FOG LAMP	251 820 0856		0%	150.00*
742	1	R/F WING	204 880 1418		0%	480.00*
766	1	R/F RAIL	204 881 0206		0%	12.00*
786	1	R/F WING MOULDING	204 690 3262		0%	23.00*
812	1	R/F WING BADGE	204 817 2720		0%	36.00*
840	1	R/F W-HOUSE CVR FRT	204 690 5630		0%	88.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600		0%	163.00*
1180	1	R/F UPP REINF	204 620 1091		0%	135.00*
7751	1	UPPER AIR GUIDE	204 505 0530		0%	36.00*
7752	1	LOWER AIR GUIDE	204 505 3430		0%	90.00*
7753	1	FAN SHROUD	204 500 0155		0%	70.00*
8730	1	INTERCOOLER	204 500 0500		0%	588.00*
8779	1	FRONT GRILLE PANEL	204 520 0723		0%	97.00*
9645	1	LOW TONE HORN	006 542 9220		0%	105.00*
1000	1	BUMPER CTR LWR TRIM	Renew		0%	48.00*
1000	1	FRT BUPER TOW COVER	Renew		0%	29.00*
1000	1	FRT GRILLE LOGO	Renew		0%	65.00*
f: OEM Parts		Sub Total				\$4,750.00
g: Original		Mark Up From Cost		(5 %)		\$237.50
h: Secondhand		Sundry Parts		(Fixed)		\$100.00
p: Parallel		Total Parts				\$5,087.50
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description

Betterment

Price

Claim Reference:

Assessment Number: CSKT3136

Version: CHENGHOE/3

Date Calculated: 23/01/2018 02:45

Registration: SKT3136L
Printed: 23/01/2018 10:45

AIRCON GAS	SPECIALIST	0%	\$50.00
FRT NO PLATE	SPECIALIST		\$35.00
TOWING	SPECIALIST	0%	\$120.00
AUDATEX FEE	SPECIALIST		\$42.00
Total Extras			\$247.00

Final Calculation**Total Parts** **\$5,087.50****Labour**

Total Panel/Mechanical	\$588.80
Total Paintwork	\$685.40
Total Labour	\$1,274.20

Additional Costs

Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$247.00
Total of Additional Costs	\$247.00

Total of Additional Costs**\$227.93****Total Paint/Material Costs****\$6,836.63****Grand Total Excludes GST****\$478.56**

GST @ 7 %

\$7,315.19**Grand Total Includes GST****Assessment Notes**

Kg

Arthur Bennett

CHM (18 GST)

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSKT3136

Version: CHENGHOE/3

Date Calculated: 20/01/2018 09:46

Full Report - V1

Registration: SKT3136L

Printed: 20/01/2018 18:13

New Part Painting - Plastic K1R	\$50.18
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$21.91
Surface Paint Plastic	\$1.48
Repair Painting	\$102.31
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$227.93
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$227.93

PARTS		PARTS		Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
258	1	FRT NO PLATE REINF	KNPL0	garnish	0% ✓ CM 78.00* ✓
283	1	FRONT BUMPER COVER	204 880 0940 9999		0% ✓ Th 753.00* ✓
304	1	R/F BUMPER COVER	204 885 2323	fog lamp garnish	0% ✓ 24.00* ?
305	1	FRONT BUMPER GRILLE	204 885 2123	inner garnish	0% ✓ CM 49.00* ✓
308	1	R/F COVER	204 885 1274	fog lamp chrome	0% ✓ 58.00* ?
311	1	L/F BUMPER MOULDING	204 885 0721		0% ✓ M 52.00* ✓
312	1	R/F BUMPER MOULDING	204 885 0821		0% ✓ CM 52.00* ✓
336	1	FRONT IMPACT DAMPER	204 885 0065	centre lower grille	0% ✓ D.I 49.00* ✓
349	1	FRT/CTR IMPACT DAMP	204 885 0037	Sponge	0% ✓ CM 86.00* ✓
362	1	R/F OUTER SENSOR	000 905 2402		0% ✓ M 145.00* ✓
366	1	R/F INNER SENSOR	000 905 2402		0% ✓ M 145.00* ✓
377	1	PARKTRONIC WIRING	204 540 0608	Sensor wire	0% ✓ 120.00* ?
405	1	FRONT GRILLE	204 880 0023 9744		0% ✓ 315.00* ?
562	1	RIGHT HEADLAMP ASSY	204 906 5403		0% ✓ CM 595.00* ✓
578	1	R/HEADLAMP COVER	204 826 1424	top cover	0% ✓ Bn 14.00* ✓
638	1	R/F FOG LAMP	251 820 0856		0% ✓ 150.00* ?
742	1	R/F WING	204 880 1418		0% ✓ Bn 480.00* ✓
766	1	R/F RAIL	204 881 0206	side retainer	0% ✓ D.I 12.00* ✓
786	1	R/F WING MOULDING	204 690 3262		0% ✓ M 23.00* ✓
812	1	R/F WING BADGE	204 817 2720		0% ✓ M 36.00* ✓
840	1	R/F W-HOUSE CVR FRT	204 690 5630	inner shield	0% ✓ 88.00* ?
1001	1	FRT LWR CROSSMEMBER	207 620 1600	reinforcement bumper	0% ✓ Bn 163.00* ✓
1180	1	R/F UPP REINF	204 620 1091	rlt head lamp panel	0% ✓ 135.00* ?
7751	1	UPPER AIR GUIDE	204 505 0530	support inner rubber	0% ✓ 36.00* ?
7752	1	LOWER AIR GUIDE	204 505 3430	air-inter cooler rubber	0% X 90.00* ?
7753	1	FAN SHROUD	204 500 0155	support top garnish	0% ✓ 70.00* ?
8730	1	INTERCOOLER	204 500 0500		0% ✓ 588.00* ?
8779	1	FRONT GRILLE PANEL	204 520 0723	engine under cover	0% ✓ CM 97.00* ✓
9645	1	LOW TONE HORN	006 542 9220		0% ✓ 105.00* ✓
1000	1	BUMPER CTR LWR TRIM	Renew	fit bumper centre lwr garnish	0% X CM 48.00* ✓
1000	1	FRT BUMPER TOW COVER	Renew		0% X M 29.00* ✓
1000	1	FRT GRILLE LOGO	Renew	(Come with grille?)	0% X 65.00* ?
f: OEM Parts			Sub Total		\$4,750.00
g: Original			Mark Up From Cost (5 %)		\$237.50
h: Secondhand			Sundry Parts (Fixed)		\$100.00
p: Parallel			Total Parts		\$5,087.50
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description

Betterment

Price

Audatex System Using Manufacturer Times

→ Authorised by CHINA
on 20/1/18 @ 9am

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSKT3136

Version: CHENGHOE/3

Date Calculated: 20/01/2018 09:46

Full Report - V1

Registration: SKT3136L

Printed: 20/01/2018 18:13

Panel Beating

NO NUMBER	R + R FRONT AIR GUIDE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE	12.0	55.20
	INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION		
62-1308 01	R + R R/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT COVER	3.0	13.80
09-6820 01)	R + R AIR INTERCOOLER	5.0	23.00
0471	REPAIR BONNET	10.0*	46.00
0930	REPAIR CTR FRT REINF	10.0*	46.00
1112	REPAIR R/F WHEELHOUSE ASSY	10.0*	46.00
1000	REPAIR FRH FENDER INNR PANE	10.0*	46.00
1000	REPAIR SUPPORT PANEL <i>top panel</i>	10.0*	46.00

LABOUR COST

Total Work Units	138.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	13.8HRS	\$634.80
Paint Labour	14.9HRS	\$685.40
Total Labour	28.7HRS	\$1,320.20

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
742	R/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
405	FRONT GRILLE NEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	43.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	23.0	
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
741	L/F WING SURFACE PAINT	5.0	
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0	

LABOUR COST - PAINT

TIME(PAINT)	119.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	149.0	
Total Paintwork Labour	14.9HRS	\$685.40

MATERIAL COST - PAINT

New Part Painting		\$14.45
-------------------	--	---------

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference:
Assessment Number: CSKT3136
Version: LKKAUTOC/4
Date Calculated: 15/05/2018 08:31

Full Report - V1
Registration: SKT3136L
Printed: 15/05/2018 15:32

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	18/01/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	5 day(s)
Policy Number:	DMPCSN1531181702	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 COMPRESSOR
Model Sheet Number:	304 01
Registration:	SKT3136L
Registration Month:	September
Registration Year:	2009
VIN Number:	WDD2040412A304721
Manufacture Year:	2009
Odometer:	Not Known
Colour:	Silver
Engine Number:	
Fuel Level:	%

Model Specs

FR A301./F359./R089.	MODEL 2010
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	19/01/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

Claim Reference:

Full Report - V1

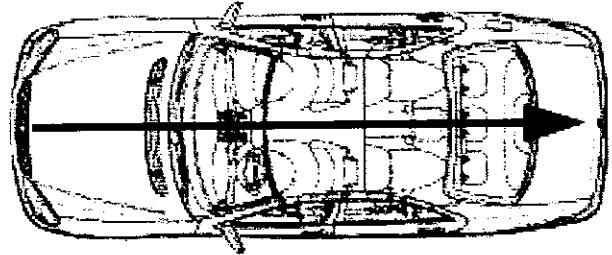
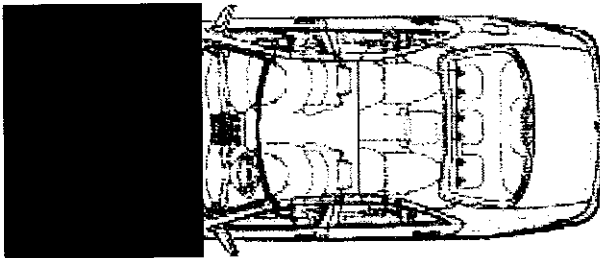
Assessment Number: CSKT3136

Registration: SKT3136L

Version: LKKAUTOC/4

Printed: 15/05/2018 15:32

Date Calculated: 15/05/2018 08:31



Addresses

Repairer

Name : CHENG HOE MOTOR PTE LTD

Address :

BLK 1019, YISHUN IND PK A

01-374/382

Post Code : 768761

Cost Summary

Total Labour	\$1,209.80
Total Paint/Material	\$227.93
Total Parts	\$5,084.35
Total of Additional Costs	\$187.00
Excess:	TBA
Grand Total Exc GST:	\$6,709.08
7 % GST:	\$469.64
Grand Total Inc GST:	\$7,178.72

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
54-7940 ZAX	RENEW FRONT PARKING AID WIRING HARNESS	4.0	18.40
82-4730 01)	R + R BOTH HEADLAMP UNITS (BUMPER REMOVED)	3.0	13.80
88-9678 01	R + R R/F WING MOULDING	3.0	13.80
88-4666 01)	DETACH + REFIT L/F PARTITION PANEL	3.0	13.80
88-3954 01	R + R R/F WING (FRONT BUMPER REMOVED)	6.0	27.60
88-3956 01)	RENEW R/F WING (REMOVED)	2.0	9.20
88-3511 01	FIT R/WING BADGE	3.0	13.80

Claim Reference:

Full Report - V1

Assessment Number: CSKT3136

Registration: SKT3136L

Version: LKKAUTOC/4

Printed: 15/05/2018 15:32

Date Calculated: 15/05/2018 08:31

NO NUMBER	R + R FRONT AIR GUIDE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	12.0	55.20
62-1308 01	R + R R/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT COVER	3.0	13.80
09-6820 01)	R + R AIR INTERCOOLER	5.0	23.00
0432	REMOVE&REFIT STAR EMBLEM	1.0*	4.60
0471	REPAIR BONNET	10.0*	46.00
1112	REPAIR R/F WHEELHOUSE ASSY	5.0*	23.00
1000	REPAIR FRH FENDER INNR PANE	5.0*	23.00
1000	REPAIR SUPPORT PANEL	5.0*	23.00
LABOUR COST			
	Total Work Units	114.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	11.4HRS	\$524.40
	Paint Labour	14.9HRS	\$685.40
	Total Labour	26.3HRS	\$1,209.80

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
742	R/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
362	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
366	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
405	FRONT GRILLE NEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	43.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	23.0	
361	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
363	L/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
364	R/F CTR PARKING SENS SURFACE PAINT PLAST.	3.0	
365	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
741	L/F WING SURFACE PAINT	5.0	
1112	R/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
LABOUR COST - PAINT			
	TIME(PAINT)	119.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	149.0	
	Total Paintwork Labour	14.9HRS	\$685.40
MATERIAL COST - PAINT			Cost Price
	New Part Painting		\$14.45

Claim Reference:

Full Report - V1

Assessment Number: CSKT3136

Registration: SKT3136L

Version: LKKAUTOC/4

Printed: 15/05/2018 15:32

Date Calculated: 15/05/2018 08:31

New Part Painting - Plastic K1R	\$50.18
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$21.91
Surface Paint Plastic	\$1.48
Repair Painting	\$102.31
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$227.93
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$227.93

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
258	1	FRT NO PLATE REINF	KNPLO		0%	78.00*
283	1	FRONT BUMPER COVER	204 880 0940 9999		0%	753.00*
304	1	R/F BUMPER COVER	204 885 2323		0%	24.00*
305	1	FRONT BUMPER GRILLE	204 885 2123		0%	49.00*
308	1	R/F COVER	204 885 1274		0%	58.00*
311	1	L/F BUMPER MOULDING	204 885 0721		0%	52.00*
312	1	R/F BUMPER MOULDING	204 885 0821		0%	52.00*
336	1	FRONT IMPACT DAMPER	204 885 0065		0%	49.00*
349	1	FRT/CTR IMPACT DAMP	204 885 0037		0%	86.00*
362	1	R/F OUTER SENSOR	000 905 2402		0%	145.00*
366	1	R/F INNER SENSOR	000 905 2402		0%	145.00*
377	1	PARKTRONIC WIRING	204 540 0608		0%	120.00*
405	1	FRONT GRILLE	204 880 0023 9744		0%	315.00*
562	1	RIGHT HEADLAMP ASSY	204 906 5403		0%	595.00*
578	1	R/HEADLAMP COVER	204 826 1424		0%	14.00*
638	1	R/F FOG LAMP	251 820 0856		0%	150.00*
742	1	R/F WING	204 880 1418		0%	480.00*
766	1	R/F RAIL	204 881 0206		0%	12.00*
786	1	R/F WING MOULDING	204 690 3262		0%	23.00*
812	1	R/F WING BADGE	204 817 2720		0%	36.00*
840	1	R/F W-HOUSE CVR FRT	204 690 5630		0%	88.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600		0%	163.00*
1180	1	R/F UPP REINF	204 620 1091		0%	135.00*
7751	1	UPPER AIR GUIDE	204 505 0530		0%	36.00*
7753	1	FAN SHROUD	204 500 0155		0%	70.00*
8730	1	INTERCOOLER	204 500 0500		0%	588.00*
8779	1	FRONT GRILLE PANEL	204 520 0723		0%	97.00*
9645	1	LOW TONE HORN	006 542 9220		0%	105.00*
1000	1	BONNET SPRING	Renew		0%	12.00*
1000	1	PARKING SENSOR(NO.3)	Renew		0%	145.00*
1000	1	ELEC WARNING HORN	Renew		0%	72.00*
f: OEM Parts			Sub Total			\$4,747.00
g: Original			Mark Up From Cost	(5 %)		\$237.35
h: Secondhand			Sundry Parts	(Fixed)		\$100.00
p: Parallel			Total Parts			\$5,084.35
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AIRCON GAS	0%	\$50.00
SPECIALIST		

Claim Reference:

Full Report - V1

Assessment Number: CSKT3136

Registration: SKT3136L

Version: LKKAUTOC/4

Printed: 15/05/2018 15:32

Date Calculated: 15/05/2018 08:31

FRT NO PLATE	SPECIALIST		\$35.00
TOWING	SPECIALIST	0%	\$60.00
AUDATEX FEE	SPECIALIST		\$42.00
Total Extras			\$187.00

Final Calculation

Total Parts		\$5,084.35
Labour		
Total Panel/Mechanical	\$524.40	
Total Paintwork	\$685.40	
Total Labour		\$1,209.80
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$187.00	
Total of Additional Costs		\$187.00
Total Paint/Material Costs		\$227.93
Grand Total Excludes GST		\$6,709.08
GST @ 7 %		\$469.64
Grand Total Includes GST		\$7,178.72

Assessment Notes

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	19 Jan 2018 Sendback Est	20 Jan 2018 18:00 S\$6,962.63	22 Jan 2018 09:18 Edit Adj Rpt	S\$6,709.08 Edit Estimates	S\$6,709.08 View Rpt		Pending for Survey Report Cancel Case
Supp #1	09 Apr 2018 15:27	09 Apr 2018 15:29 S\$240.45	09 Apr 2018 15:29			(Combined)	Combined with Main Uncombine Suppl.

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	--------------------------

CLAIM SUBFOLDER DETAILS

Insured:	LAU BOON CHENG, ID: S7408689F		
Vehicle Reg. No.:	SKT3136L	Date of Loss:	18/01/2018 19:00 - :59 [99 Months and 25 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD / SNM18D00355C01	Policy/Cover Note No.:	DMPCSN1531181702 (Comprehensive) Coverage: 24/09/2017 - 23/09/2018
		Excess:	S\$0.00
Repairer:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Irene Tay Hui Ping - 638986192]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 31/01/2018]		
Driver/Custodian:	LAU BOON CHENG (/ Female), NRIC: S7408689F		
Adj Asg. Remarks:	PLEASE SURVEY AND REVERT		

ASSOCIATED MAIL RECEIVED

[View All](#)
[Compose Case Mail](#)

- CHINA_TAIPING (10/05/2018): Alert - Adj Mandate Approved (S\$6743.58) - SKT3136L - Claim Handler: Irene Tay H...
- CHINA_TAIPING (23/01/2018): Alert - Adj Mandate Approved (S\$6652.98) - SKT3136L - Claim Handler: Irene Tay H...

ALL ASSOCIATED TASKS

[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SKT3136L (SNM18D00355C01)

OD

Jan 18 2018 7:00PM

[LAU BOON CHENG]

Cheng Hoe Motor Pte Ltd

Upload Documents			Upload Photos		Compose New Letter		View		View in Browser		
Assessment Reports							1 per page		☒		
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)		Thumbnail	Print						
1	20/01/18 18:00	Repairer Estimates	1	Load HTM							
2	09/04/18 15:29	Repairer Estimates Suppl. #1	1	Load HTM							
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print						
1	23/01/18 11:07	Adjuster Immediate Advice	1	Load HTM							
2	08/05/18 10:56	Adjuster Immediate Advice	1	Load HTM							
Documentation							1 per page		☒		
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)		Thumbnail	Print						
1	20/01/18 17:59	E-filed GIA report	1	Load PDF							
2	20/01/18 17:59	Driver's Driving License	1	Load JPG	☒						
No	Finalized On	China Taiping Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print						
1	23/01/18 16:08	Revised Estimate	1	Load PDF							
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print						
1	23/01/18 11:09	ESTIMATE	1	Load PDF							
2	23/01/18 11:09	REVISED AUDATEX	1	Load PDF							
3	23/01/18 11:09	INSPECTION PHOTO	1	Load PDF							
4	15/05/18 17:40	RESURVEY PHOTO	1	Load PDF							
5	23/05/18 10:18	Supplementary	1	Load PDF							

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CTI18001298/KQD3E2

Date: 23/05/2018

REFERENCE

Insured/Claimant: LAU BOON CHENG Policy No: DMPCSN1531181702
Date of Loss: 18/01/2018 Nature of Claim: OD Claim No: SNM18D00355C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKT3136L
Make & Model: MERCEDES-BENZ C200 KOMPRESSION, 2.0 (A) Engine No: 27195031248524
Reg. Date: 24/09/2009 (Man. Year: 2009) Chassis No: WDD2040412A304721
Colour: Metallic Silver Odometer: 125807 km
Engine Capacity: 1796 cc
Market Value/New Car Price: S\$42,000.00
Sum Insured (\$\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 225/45 R17 Rear Tyre Size: 225/45 R17
Front Left Side: Bridgestone 7 mm Rear Left Side: Bridgestone 7 mm
Front Right Side: Bridgestone 7 mm Rear Right Side: Bridgestone 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,227.95	4,984.35	243.60	4.66
Miscellaneous Items	427.00	287.00	140.00	32.79
Labour	1,548.13	1,437.73	110.40	7.13
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	7,203.08	6,709.08	494.00	6.86
+ GST 7.00/7.00% (\$\$)	504.21	469.64	34.57	6.86
Nett Amount (\$\$)	7,707.29	7,178.72	528.57	6.86

INSPECTION

Date of Assignment: 22/01/2018 Present Location: Cheng Hoe Motor Pte Ltd (Yishun)
Date Inspected: 22/01/2018 Inspected At: Blk 1019 #01-374/382, Yishun Industrial Park A
Singapore 768761

Estimated Period of Repair: 5.0 days

Adjuster: KENNETH KONG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG **Version:** 1.0 (Last Synchronised: 23 May 2018)
Parts: 143 **MERCEDES-BENZ C200 KOMPRESSOR 2.0 (A)** (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SKT3136L)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BUMPER CTR LWR TRIM (WCP)	Serviceable	48.00 F	*- F
2	1	NA	*FAN SHROUD (WCP)	Cracked	70.00 F	*70.00 F
3	1	NA	*FRONT BUMPER COVER (WCP)	Torn	753.00 F	*753.00 F
4	1	NA	*FRONT BUMPER GRILLE (WCP)	Cracked	49.00 F	*49.00 F
5	1	NA	*FRONT GRILLE (WCP)	Cracked	315.00 F	*315.00 F
6	1	NA	*FRONT GRILLE PANEL (WCP)	Cracked	97.00 F	*97.00 F
7	1	NA	*FRONT IMPACT DAMPER (WCP)	Distorted	49.00 F	*49.00 F
8	1	NA	*FRT BUPER TOW COVER (WCP)	Serviceable	29.00 F	*- F
9	1	NA	*FRT GRILLE LOGO (WCP)	Serviceable	65.00 F	*- F
10	1	NA	*FRT LWR CROSSMEMBER (WCP)	Bent	163.00 F	*163.00 F
11	1	NA	*FRT NO PLATE REINF (WCP)	Cracked	78.00 F	*78.00 F
12	1	NA	*FRT/CTR IMPACT DAMP (WCP)	Cracked	86.00 F	*86.00 F
13	1	NA	*INTERCOOLER (WCP)	Punctured	588.00 F	*588.00 F
14	1	NA	*L/F BUMPER MOULDING (WCP)	Necessary	52.00 F	*52.00 F
15	1	NA	*LOW TONE HORN (WCP)	Cracked	105.00 F	*105.00 F
16	1	NA	*LOWER AIR GUIDE (WCP)	Serviceable	90.00 F	*- F
17	1	NA	*PARKTRONIC WIRING (WCP)	Cut	120.00 F	*120.00 F
18	1	NA	*R/F BUMPER COVER (WCP)	Distorted	24.00 F	*24.00 F
19	1	NA	*R/F BUMPER MOULDING (WCP)	Cracked	52.00 F	*52.00 F
20	1	NA	*R/F COVER (WCP)	Cracked	58.00 F	*58.00 F
21	1	NA	*R/F FOG LAMP (WCP)	Buckled	150.00 F	*150.00 F
22	1	NA	*R/F INNER SENSOR (WCP)	Missing	145.00 F	*145.00 F
23	1	NA	*R/F OUTER SENSOR (WCP)	Missing	145.00 F	*145.00 F
24	1	NA		Distorted	12.00 F	*12.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
25	1	NA	*R/F RAIL (WCP) *R/F UPP REINF (WCP)	Bent	135.00 F	*135.00 F
26	1	NA	*R/F W-HOUSE CVR FRT (WCP)	Cracked	88.00 F	*88.00 F
27	1	NA	*R/F WING (WCP)	Buckled	480.00 F	*480.00 F
28	1	NA	*R/F WING BADGE (WCP)	Necessary	36.00 F	*36.00 F
29	1	NA	*R/F WING MOULDING (WCP)	Necessary	23.00 F	*23.00 F
30	1	NA	*R/HEADLAMP COVER (WCP)	Buckled	14.00 F	*14.00 F
31	1	NA	*RIGHT HEADLAMP ASSY (WCP)	Cracked	595.00 F	*595.00 F
32	1	NA	*UPPER AIR GUIDE (WCP)	Cracked	36.00 F	*36.00 F
Supplementary #1						
33	1		*BONNET SPRING (WCP)	Distorted	12.00 F	*12.00 F
34	1		*PARKING SENSOR (NO.3) (WCP)	Shorted	145.00 F	*145.00 F
35	1		*ELECTRICAL WARNING HORN (WCP)	Cracked	72.00 F	*72.00 F
					Sub Total (S\$)	4,979.00
					+ Margin on L,N Items 5.00/5.00% (S\$)	248.95
					Total Parts (S\$)	5,227.95
						4,984.35

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	SPECIALIST AIRCON GAS	50.00	50.00
2	1	SPECIALIST AUDATEX FEE	42.00	42.00
3	1	SPECIALIST COMP WHEEL ALIGNMENT (NOT NECESSARY)	80.00	0.00
4	1	SPECIALIST FRT NO PLATE (CRACKED)	35.00	35.00
5	1	SPECIALIST TOWING	120.00	60.00
6	1	SUNDRY PARTS (NECESSARY)	100.00	100.00
Sub Total (S\$)			427.00	287.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	685.40	685.40
2	Total Paint Materials	New	227.93	227.93
3	Total Panel/Mechanical Labour	New	634.80	524.40
Gross Labour Cost (S\$)			1,548.13	1,437.73

Report was unsubmitted during this print-out.

< END OF ESTIMATES >