



## Auto Insure Pte. Ltd.

Blk 3, 391A Woodlands Road  
Yew Tee Industrial Estate  
Singapore (677964)  
E: claims@autoinsure.com.sg  
W: www.autoinsure.com.sg  
T: 6368 2788 F: 6368 0081  
GST No.: 201437380M

Page No. 1

### AUTOMOBILE ASSESSMENT REPORT

Our Ref: SLQ8185R

Your Ref: SFV555D

Date: 5-Feb-18

BY EMAIL ONLY  
(claims@autoinsure.com.sg)

### ATTENTION: MOTOR CLAIMS DEPT

email: geraldph@lonpac.com

Lonpac Insurance BHD  
100 Beach Rd,  
Singapore 189702

Assessed Vehicle No	: SLQ8185R
Car Make and Model	: HONDA VEZEL-1.5 HYBRID (A)
Date of Accident	: 2-Feb-18
Date of Assessment	: 5-Feb-18

We have carried out a physical assessment of SLQ8185R at our workshop Auto Insure Pte Ltd sustained damages to the REAR portion of the vehicle.


### 4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount	: P/P
Adjusted Amount	: \$ 10,500.00
Est. Repair Days	: 7

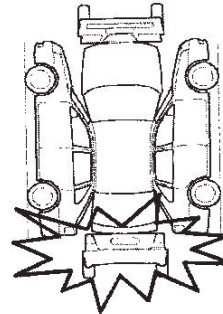

\*\* Considering that our vehicle is less than 6 months old.  
We will not agree to any repair of parts, only replacement will be done. \*\*

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.  
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

**Disclaimer**  
This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.  
No liability or responsibility whatsoever shall be held by  
**AUTO INSURE PTE. LTD.** For any reliance on this report by any third party.

Our Ref: SLQ8185R

Your Ref: SFV555D

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
<b>PARTS REPLACEMENT - LIST ITEMS</b>				
1	1	REAR BUMPER ✓ Deform.		\$ 1,326.80
2	2	REAR BUMPER SIDE RETAINERS ?		\$ 118.00
3	1	REAR END PANEL ? ✓ 07		\$ 785.00
4	1	REAR END PANEL TOP GARNISH ? ✓ Deform		\$ 425.00
5	1	REAR PANEL LOCK CATCH LOWER ? X NW		\$ 62.50
6	1	REAR FLOOR COMPARTMENT PANEL ? ✓ Deform.		\$ 1,265.90
7	1	REAR TAIL GATE ✓		\$ 1,456.00
8	1	REAR TAIL GATE WEATHERSTRIP ? X NW		\$ 190.00
9	1	REAR BOOT INNER TRIMBOARD ?		\$ 405.90
10	1	REAR BOOT LOCK UPPER ✓ JM.		\$ 288.50
11	2	REAR BUMPER REFLECTOR ? X LH CRK.		\$ 118.00
12	1	REAR LOWER FENDER LH ?		\$ 388.70
13	1	REAR LOWER FENDER RH ?		\$ 388.70
			SUB TOTAL	\$ 7,219.00
			LESS 20%	\$ 1,443.80
			TOTAL AMOUNT	\$ 5,775.20
<b>SPECIAL NETT ITEMS</b>				
1	1	REAR REVERSE SENSOR ✓ DMG		\$ 280.00
2	1SET	REAR BUMPER CLIPS ✓ DEC		\$ 60.00
3	1	REAR LICENCE PLATE WITH HOLDER X NW		\$ 75.00
4	1	REAR END PANEL SEALANT ✓ DEC		\$ 80.00
5	1 SET	REAR FLOOR PANEL SOUND INSULATOR ?		\$ 120.00
			SUB TOTAL	\$ 615.00
			TOTAL PARTS COST	\$ 6,390.20

200  
30  
50

Our Ref: SLQ8185R

Your Ref: SFV555D

S/NO	DESCRIPTION	EST. BY WORKSHOP
<b>LABOUR &amp; PAINTWORK</b>		
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 1,000.00 900

2	TOWING CHARGE	\$	<del>100.00</del>	80 .
3	TO CONDUCT HEADLAMP FOCUS	\$	-	
4	TO REMOVE/INSTALL REAR WINDSCREEN	\$	<del>200.00</del>	120
5	TO DIAGNOSE ERASE FAULT MEMORY AFTER REPAIR	\$	<del>250.00</del>	200 .
6	TO REMOVE / REFIX WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$	<del>200.00</del>	40 .
7	TO REMOVE / INSTALL REAR REVERSE SENSOR	\$	<del>200.00</del>	30
8	TO REMOVE / INSTALL REAR BOOT MACHANISM	\$	<del>200.00</del>	50
9	TO REMOVE / REFIX UPHOSTERY. GARNISH AND ATTACHMENT PARTS	\$	-	
11	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$	<del>1,000.00</del>	800 .
12	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$	<del>150.00</del>	50
13	TO VACUUM, WAXING & CLEAN	\$	100.00	X
14	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$	<del>100.00</del>	30 .
TOTAL BEFORE GST		\$	9,890.20	
GST 7%		\$	692.31	
TOTAL (PARTS & LABOUR):		\$	10,582.51	

#### Adjustments / Recommendations

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$10,500.00 for direct settlement with the third party insurance.

Yours Faithfully,

Jason Heng  
Claims Director

Sebastian .  
7/2/2013 .

- Part by part repair .
- Question Mark Item Photo
- Photo Before Paint .

90036121

sebastianyeang@lkkauto.com .

9 days.

#### **LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: