


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5816A
Ref. No : TAX/02/18/2035
Reg. Date : 27/02/2013
Vehicle Type : TAXI
Make : CHEVROLET EPICA 2.0 VCDI
Model : EPICA-2.0
Name of Driver : TEOH PAK SUN
Type of Accident : HEAD TO SIDE
Date / Time of Accident : 05/02/2018 09:30:00 PM
Accident Reported Date / Time : 06/02/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024094506
Special Instruction to ARC,if any :
TOWED \$40 / SJA9852A - AXA
Prepared Date : 06/02/2018 02:08:02 PM

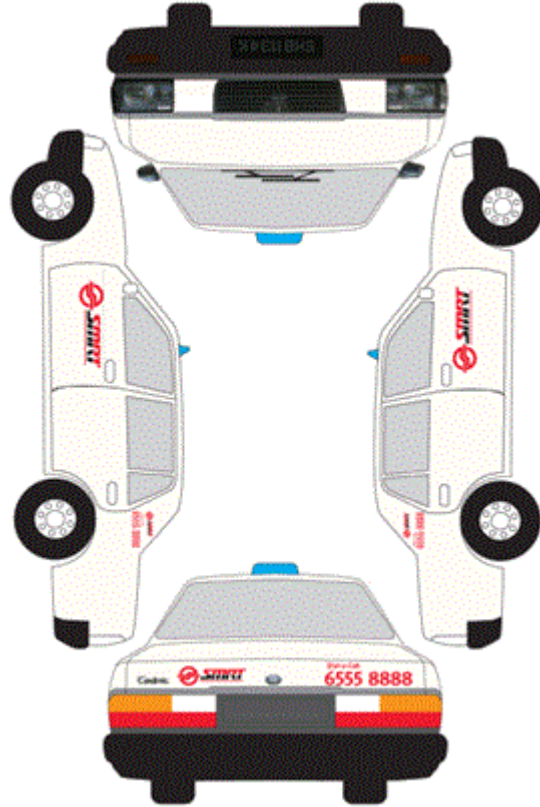

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : KL1LA69RJBB134851

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labout Charges :	1,690.00	0.00
Total Spray Painting Charges :	2,772.00	0.00
Total Material Charges :	9,507.96	9,507.96
Other Charges :	1,120.00	0.00
TOTAL :	15,089.96	0.00
Lum Sum Total :	15,100.00	0.00
No. of Repair Days :	10.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sing Off Date :	07/02/2018 09:21:51 AM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 07/02/2018 09:21:51 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	1,690.00	0.00
Total Labour	1,690.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00
TO RESPRAY REAR FENDER RH	378.00	0.00
TO RESPRAY RH REAR WHEEL HOUSE	180.00	0.00
TO RESPRAY REAR DOOR RH	378.00	0.00
TO RESPRAY ROCKER PANEL MOULDING	180.00	0.00
TO RESPRAY ROCKER PANEL	180.00	0.00
TO RESPRAY SILL MEMBER PANEL RH	180.00	0.00
TO RESPRAY RIM	180.00	0.00
TO RESPRAY FRONT DOOR RH	378.00	0.00
TO RESPRAY CENTER PILLAR RH	180.00	0.00
TO RESPRAY PANEL SIDE ROOF RH	180.00	0.00
Total Spray Painting & Panel Beating	2,772.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	0.00
TO TRANSFER DOOR MECHANISM	240.00	0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
TO REMOVE AND REFIT TYRE	120.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,120.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
93745100	REAR	6504569	BUMPER RR	1	1,238.00	10.00	1,114.20	Replace	Replace	No
96633534	REAR		BRACKET RR BUMPER SIDE RH	1	49.00	10.00	44.10	Replace	Replace	No
96632800	REAR	6504638	FENDER RH REAR	1	1,467.00	10.00	1,320.30	Replace	Replace	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
			LINER RH REAR FENDER (PROTECTOR)	1	65.00	10.00	58.50	Replace	Replace	No
96632584	BODY		WHEEL HOUSE INNER RH	1	734.27	10.00	660.84	Replace	Replace	No
96635656	DOOR	6504604	PANEL RH REAR DOOR	1	1,863.00	10.00	1,676.70	Replace	Replace	No
	COMMON		STICKER DECAL 6555 8888 (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No
96635362	DOOR		REGULATOR W/GLASS RR RH	1	94.00	10.00	84.60	Replace	Replace	No
			MOTOR POWER WINDOW RH REAR	1	294.85	10.00	265.36	Replace	Replace	No
	DOOR		HINGE RR DOOR LOWER RH	1	24.00	10.00	21.60	Replace	Replace	No
	DOOR		HINGE RR DOOR UPPER RH	1	30.00	10.00	27.00	Replace	Replace	No
96635999	DOOR	6504605	CHECK REAR DOOR RH	1	22.00	10.00	19.80	Replace	Replace	No
96851985	DOOR		LATCH REAR DOOR RH	1	539.00	10.00	485.10	Replace	Replace	No
	COMMON		HANDLE DOOR OUTER RH	1	60.00	10.00	54.00	Replace	Replace	No
			RH REAR, DOOR TOP BELT	1	85.87	10.00	77.28	Replace	Replace	No
96836524	DOOR		GLASS RUN RR DOOR RH	1	81.00	10.00	72.90	Replace	Replace	No
96635862	DOOR	6504556	W/STRIP QUARTER GLASS RH	1	23.00	10.00	20.70	Replace	Replace	No
96635890	DOOR		W/STRIP RR DOOR RH	1	71.00	10.00	63.90	Replace	Replace	No
96635878	DOOR		RH REAR DOOR GARNISH	1	36.00	10.00	32.40	Replace	Replace	No
96483050	DOOR		W/STRIP RR DOOR LOWER RH	1	5.00	10.00	4.50	Replace	Replace	No
96862916			W/STRIP A-DR OPG,RR RH	1	43.00	10.00	38.70	Replace	Replace	No
96862740	DOOR		TRIM RR DOOR RH	1	474.00	10.00	426.60	Replace	Replace	No
96466369			COVER A-ROCKER PNL,RR	1	23.00	10.00	20.70	Replace	Replace	No
96637805	INTER RM		GARNISH LOWER CENTRE PILLAR RH	1	54.00	10.00	48.60	Replace	Replace	No
96632796			PANEL-ROCKER RH	1	597.00	10.00	537.30	Replace	Replace	No
96397252			SILLMEMBER RH (ROCKER PNL)	1	503.00	10.00	452.70	Replace	Replace	No
96634088	RIGHT	6504610	MOLDING PANEL RH ROCKER	1	304.00	10.00	273.60	Replace	Replace	No
	COMMON	6504666	TYRE RIM	1	328.99	0.00	328.99	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
	COMMON	6503708	TYRE	1	126.74	0.00	126.74	Replace	Replace	No
96452311	COMMON		CAP HUB	1	21.95	10.00	19.75	Replace	Replace	No
96635578	DOOR	6504597	PANEL RH FRONT DOOR	1	2,020.00	10.00	1,818.00	Replace	Replace	No
	DOOR		SMRT LOGO DOOR	1	60.00	0.00	60.00	Replace	Replace	No
96635812	DOOR		GARNISH FRT DOOR CTR RH	1	36.00	10.00	32.40	Replace	Replace	No
96836522	DOOR		GLASS RUN FRT DOOR RH	1	80.00	10.00	72.00	Replace	Replace	No
96635832	DOOR		W/STRIP FRT DOOR RH	1	144.00	10.00	129.60	Replace	Replace	No
96326749	DOOR	6504600	HINGE DOOR LOWER RH FRT	1	75.00	10.00	67.50	Replace	Replace	No
96326750	DOOR	6504602	HINGE DOOR UPPER RH FRT	1	75.00	10.00	67.50	Replace	Replace	No
96326817	DOOR	6504598	CHECK FRONT DOOR RH	1	25.00	10.00	22.50	Replace	Replace	No
96632590			REINF A-RR PILLAR RH	1	105.00	10.00	94.50	Replace	Replace	No
			PILLAR CTR RH	1	574.21	10.00	516.79	Replace	Replace	No
96632794	RIGHT		PANEL-SIDE, ROOF RH	1	597.00	10.00	537.30	Replace	Replace	No
TOTAL MATERIALS							11,884.97	11,884.95		
TOTAL MATERIALS(Discounted)							9,507.96	9,507.96		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									