



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2101702

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 17/03/2021
Reference CC4/LPC18002755/T1ea3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJH 4500L
Insured Veh. SLM 8967Y
Claim No. 17/18/18/VP05/020384
Policy No. Z17VP05013945
Accident Date 06/02/2018
Inspection Date 09/02/2018

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC18002755/T1ea3q2 Date: 17/03/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLM 8967Y	Veh. Inspected	SJH 4500L	
Policy No.	Z17VP05013945	Coverage (\$)	0.00	
Claim No.	17/18/18/VP05/020384	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	09/02/2018	
2. Vehicle Particulars & Condition				
Make & Model	SUZUKI SWIFT	c.c	1328	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	ZC11S402337	Colour	SILVER	
Odometer	109028 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/45 R16	PIRELLI	6 mm	
L/H Front Tyre	205/45 R16	PIRELLI	6 mm	
R/H Rear Tyre	205/45 R16	PIRELLI	6 mm	
L/H Rear Tyre	205/45 R16	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/02/2018	Inspection Date	09/02/2018	
Survey held at	WILLIAM'S AUTO PTE LTD BLK 3 WOODLANDS ROAD 391-B YEW TEE INDUSTRIAL EST. SINGAPORE 677965			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJH 4500L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BONNET	TO REPAIR SEE LABOUR	798.20	-
1	FRONT BONNET LOCK	TO REPAIR SEE LABOUR	102.60	-
1	FRONT BONNET COVER SEAL	NOT NECESSARY	65.50	-
1	FRONT BONNET COVER INSULATOR	NOT NECESSARY	255.00	-
2	FRONT BONNET HINGES @\$81.00	TO REPAIR SEE LABOUR	162.00	-
1	FRONT FENDER -RH	BENT	198.70	198.70
1	FRONT FENDER INNER SHIELD -RH	DEFORMED	96.20	96.20
1	FRONT BUMPER	DEFORMED	680.20	680.20
1	FOG LAMP COVER -RH	MISSING	83.10	83.10
1	FRONT BUMPER TOW COVER	DEFORMED	28.10	28.10
1	FRONT BUMPER TOP REINFORCEMENT	BENT	243.00	243.00
1	FRONT BUMPER REINFORCEMENT GARNISH	CRACKED	132.40	132.40
1	FRONT BUMPER LOWER REINFORCEMENT	NOT NECESSARY	223.00	-
2	FRONT BUMPER SIDE RETAINERS LH/RH @\$43.00	O/S NECESSARY	86.00	43.00
2	FRONT BUMPER BRACKETS LH/RH @\$83.00	O/S NECESSARY	166.00	83.00
1	WIPER WATER TANK	DEFORMED	128.30	128.30
1	FRONT GRILLE	CRACKED	376.00	376.00
1	FRONT GRILLE LOGO	NECESSARY	65.00	65.00
1	HEAD LAMP -RH	CRACKED	478.00	478.00
1	FRONT SUPPORT PANEL	BENT	685.00	685.00
1	AIRCON CONDENSER	* CHECK	1,098.00	-
1	FRONT WHEEL HOUSING OUTER PANEL -RH	TO REPAIR SEE LABOUR	485.20	-
	LESS 15% DISCOUNT		-	-498.00
			6,635.50	2,822.00
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BONNET COVER INSULATOR CLIPS (SN)	NOT NECESSARY	65.00	-
1	SET FRONT FENDER INNER SHIELD CLIPS -RH (SN)	NECESSARY	45.00	30.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	45.00	45.00

Report Ref No. CC4/LPC18002755/T1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET FRONT GRILLE CLIPS (SN)	NECESSARY	35.00	35.00
1	SET FRONT NUMBER PLATE /HOLDER (SMART) OPC (SN)	BENT	65.00	45.00
			255.00	155.00
	LABOUR			
	LABOUR TO REMOVE DAMAGED PARTS & ATTACHMENTS ,JACK ,STRAIGHTEN ,CUT ,WELD,REPAIR AND RESHAPE DENTED PANELS RENEW DAMAGED PANELS AND PARTS ALIGN AND REFIT ATTACHMENTS THE SAME.INCLUSIVE OF THE REPAIR OF FRONT BONNET ,FRONT BONNET LOCK ,FRONT BONNET HINGES AND FRONT WHEEL HOUSING OUTER PANEL -RH .		1,000.00	700.00
	TO APPLY BREAK AND RESEAL ,RENEW FRONT WEEK END CAR/OPC NUMBER PLATE AND SEND VEHICLE TO VICOM TO RESEAL WEEK END CAR/OPC NUMBER PLATE .		200.00	80.00
	LABOUR TO PLACE DAMAGED VEHICLE ON CHASSIS ALIGNMENT BENCH ENABLE FOR THE NECESSARY REPAIRS WORKS.		250.00	200.00
	TO RESPRAY PAINTING ON REPLACEMENT PARTS AND OTHER AFFECTED .		1,200.00	900.00
	LABOUR TO AIRCON JOB,RADIATOR ,CHECK,COOLANT PARTS.		180.00	120.00
	LABOUR TO REMOVE LOCKER PANEL GARNISH -RH ENABLE TO REPAIR REPLACE FRONT FENDER RH AND DOOR .		100.00	50.00
	WIRING JOB AND FOCUS HEADLAMP .		30.00	30.00
			2,960.00	2,080.00
GRAND TOTAL			9,850.50	5,057.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$933.30 NETT)				3,000.00

Report Ref No. CC4/LPC18002755/T1ea3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJH 4500L

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

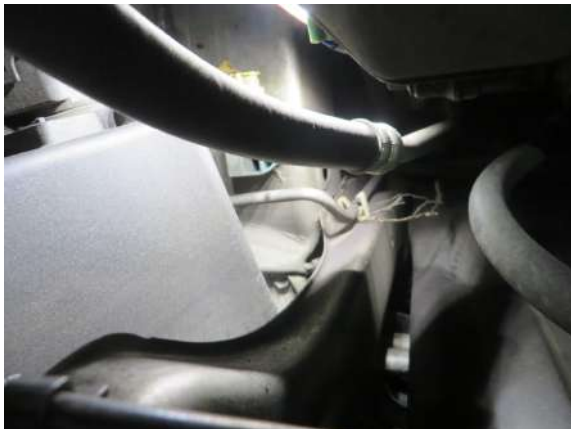



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

