

Job Reference No : 16/001129



Job Reference No : 16/001129



Job Reference No : 16/001129



Job Reference No : 16/001129




Job Reference No : 16/001129



Job Reference No : 16/001129



Job Reference No : 16/001129

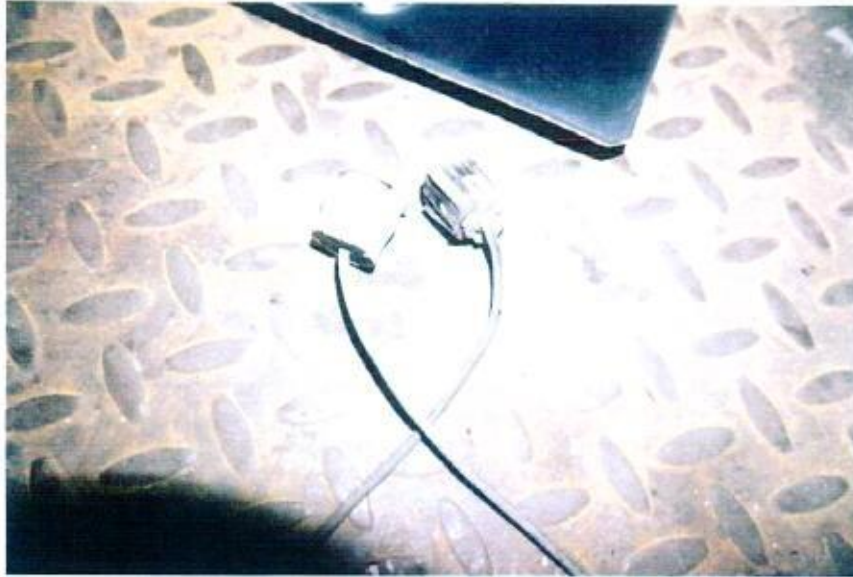


☒ Singapore Government

[General Info](#) | [Application Help](#) | [Feedback](#) | [Contact Info](#)

 Session Date: 4 Aug 2017
 User Name: Lim Hwee Peng

[Logout](#)
[My Account](#) | [Vehicle Hub](#) | [Finance](#)

Text size + -

Enquire Vehicle & Owner Information (Vehicle No. SJL2382C As At 09 Jul 2016 / 15:55:00)

Law Firm Search Details

Search Reason: Insurance claim in relation to traffic accident
 Law Firm Case No.: MN.IG.T2.1611032A

Current Owner Details

Owner ID Type: Singapore NRIC
 Owner ID: S8125873B
 Owner Name: THIO TZE YUAN, DESMOND
 Registered Address Type: HDB / HUDC
 Registered Block/House No.: 805D
 Registered Street Name: KEAT HONG CLOSE
 Registered Unit No.: # 09 - 82
 Registered Building Name: -
 Registered Postal Code: 684805

Current Vehicle Details

Vehicle No.: SJL2382C
 Make Description/Model: TOYOTA / VIOS E AUTO
 Insurance Company Name: NTUC INCOME INS CO-OP LTD

[Print](#)
[OK](#)

Land Transport Authority

Please read through the [Privacy Statement](#), [Terms of Use](#) and [Disclaimer](#).
 Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.
 Best viewed with IE 6.0 SP3 and above, 1024 X 768 resolution
 Copyright © 2017 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#)
 Last updated on 30 Jul 2017 at 12:58 AM

FormTeam Consultancy Pte Ltd

No.33, Ubi Ave 3
#02-15, Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: motorsurvey@fta.com.sg

Co.Reg No: 200819280D

GST Reg No: 200819280D

Our Reference : RRX16-072474/PRS/AL/RI/AL/cg

Your Reference: C0391366MC/RC

Date : 21-Sep-2016

Motor Claims Department
AXA Insurance Singapore Pte Ltd
8 Shenton Way
#27-01 AXA Tower
Singapore 068811

Attention : Ms Ruth Chua

Dear Sir/Mdm,

RE-INSPECTION OF VEHICLE NO . SJL 2382C

Pursuant to your instructions on 15 Aug 2016 , we have conducted a reinspection of the above vehicle at Blk 5035 Ang Mo Kio Ind Park 2 #01-357 S'569538 on 09 Sep 2016.

We recommend a repair cost of \$6,800.00 (see report) based on lump sum repair and the estimated duration of repairs would take 8 days .

We also enclosed our note of charges for your consideration.

Thank you for this assignment.

Your faithfully

FormTeam Consultancy Pte Ltd
Adjusters & Surveyors (Licensed Appraiser)



Axel Lee
Automobile Appraiser

(Email : axellee@fta.com.sg)

Encl. Re-inspection Report

FormTeam Consultancy Pte Ltd

AUTOMOBILE ASSESSMENT REPORT

PAGE : 1

Our Reference : RRX16-072474/PRS/AL/RI/AL/cg

Your Reference : C0391366MC/RC

Date : 21-Sep-2016

Attention : Ms Ruth Chua

TO : Motor Claims Department
AXA Insurance Singapore Pte Ltd
8 Shenton Way
#27-01 AXA Tower
Singapore 068811

Dear Sir/Madam,

Vehicle No : SJL 2382C
Model : Toyota Vios E Auto
Mileage : 280756 km
Chassis No : MR053HY9305080454
Workshop : M/S T & S Motor Service

Pursuant to your instructions on 15 Aug 2016, we have conducted a reinspection of the above vehicle at Blk 5035 Ang Mo Kio Ind Park 2 #01-357 S'569538 on 09 Sep 2016.

We are pleased to submit hereunder our adjustment which we trust should serve your purpose: -

QTY	DESCRIPTION	CONDITION	REMARKS	SUBMITTED	REVISED
	<u>PARTS REPLACEMENT-LIST ITEMS</u>				
1	Front Bumper	Deformed/Broken		447.25	447.25
2	Front Bumper Fog Lamp Cover	Reuse		-	-
1	Front Bumper 'Toyota' Logo	Necessary		47.67	47.67
2	Front Bumper Side Retainer	Broken		107.80	107.80
1	Front Bumper Reinforcement	Buckled		361.00	361.00
1	Front Bumper Inner Top Garnish	Deformed		169.70	169.70
1 set	Front Bumper Clips	Broken/Necessary		30.00	30.00
1	Front Bonnet	To Repair		-	-
1	Front Support Panel Assy	To Repair		-	-
2	Front Headlamp	Broken/Cut		767.00	767.00
1	Rear Bumper	Deformed/Torn		451.60	451.60
2	Rear Bumper Reflector	Broken/Cut		185.80	185.80
2	Rear Bumper Side Bracket	Bent		112.60	112.60
2	Rear Bumper Side Retainer	Broken		171.20	171.20
1 set	Rear Bumper Clips	Broken		30.00	30.00
1	Rear Boot Lid	Bent/Dented		589.10	589.10
1	Rear Boot Lid Outer Handle Garnish	Deformed		175.00	175.00

FormTeam Consultancy Pte Ltd

PAGE : 2

Our Reference : RRX16-072474/PRS/AL/RI/AL/cg

Your Reference : C0391366MC/RC

QTY	DESCRIPTION	CONDITION	REMARKS	SUBMITTED	REVISED
1	Rear Boot Centre 'Toyota' Logo	Necessary		48.10	48.10
1	Rear Boot 'Vios' Emblem	Necessary		55.60	55.60
1	Rear Boot 'E' Emblem	Necessary		45.30	45.30
2	Rear Boot Hinge	Repair		128.00	-
1	Rear Boot Top Lock	Bent/Jammed		121.35	121.35
1	Rear Boot Lower Lock Catch	Bent		41.40	41.40
1	Rear Boot Weatherstrip	Cut		176.80	176.80
2	Rear Tail Lamp Panel	Repair		257.00	-
	Rear Tail Lamp	Broken/Cracked		665.20	665.20
1	Rear End Panel	Buckled		575.00	575.00
1	Rear End Panel Top Garnish	Deformed		211.40	211.40
1	Rear Spare Tyre Top Board	Deformed/Cut		139.50	139.50
1	Rear Spare Tyre Compartment	Buckled		682.50	682.50
2	Rear Floor Side Panel	To Repair		-	-
1	Rear Compartment Centre Sponge Tray	Dented/Cut		167.50	167.50
1	Rear Compartment RH Sponge Tray	Dented/Cut		192.36	192.36
1	Rear Compartment LH Sponge Tray	Dented/Cut		154.35	154.35
2	Rear Fender	Repair		695.75	-
2	Rear Fender Inner Side Trim	Deformed/Cut		451.00	451.00
1 set	Rear Fender Inner Side Trim Clips	Necessary		50.00	50.00
2	Rear Fender Under Shield	Reuse		112.00	-
1 set	Rear Fender Under Shield Clips	Necessary		30.00	30.00
1	Rear Windscreen Moulding	Not Necessary		102.00	-
1	Rear RH Chassis Member	To Repair		-	-
1	Rear Exhaust Silencer	Repair		811.30	-
3	Rear Exhaust Silencer Mounting	Reuse		111.00	-
	List Items Sub-Total			9,670.13	7,453.08
	Original Less 25%			2,417.53	1,863.27
	Revised Less 25%				
	Discounted Sub-Total			7,252.60	5,589.81

FormTeam Consultancy Pte Ltd

PAGE : 3

Our Reference : RRX16-072474/PRS/AL/RI/AL/cg

Your Reference : C0391366MC/RC

QTY	DESCRIPTION	CONDITION	REMARKS	SUBMITTED	REVISED
	<u>PARTS REPLACEMENT</u>				
	<u>SPECIAL NETT ITEMS</u>				
1	Front Number Plate	Bent/Cut		45.00	45.00
1	Rear Number Plate	Bent/Cut		45.00	45.00
1 set	Reverse Sensors	Broken		250.00	200.00
1	Rear Windscreen Sealant	Necessary		50.00	40.00
1	Rear End Panel/Floor Panel Sealant	Necessary		50.00	50.00
	Special Nett Sub-Total			440.00	380.00
	Total Parts Amount			7,692.60	5,969.81

FormTeam Consultancy Pte Ltd

PAGE : 4

Our Reference : RRX16-072474/PRS/AL/RI/AL/cg

Your Reference: C0391366MC/RC

QTY	DESCRIPTION	SUBMITTED	REVISED
	<u>LABOUR & MISC</u>		
1	To tow vehicle to workshop.	60.00	60.00
2	To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts. (including all repair parts)	1,800.00	900.00
3	To putty and respray painting on affected areas.	2,000.00	900.00
4	To remove, refix aircon condenser, pipes, drier vacuum and recharge gas.	120.00	120.00
5	To remove, refix rear windscreen glass.	120.00	-
6	To rewire check lightings for front and rear portion.	60.00	60.00
7	To remove, refix reverse sensor.	50.00	50.00
8	To remove, refix rear upholstery, garnish and attachments.	80.00	} 120.00
9	To remove, refix roof linings, rear seats, carpet and trims.	150.00	
10	To remove, refix rear boot fittings to facilitate repair.	50.00	-
11	To remove, refix rear exhaust silencer.	50.00	-
12	To check, adjust, align chassis alignment back into its original specifications.	250.00	250.00
13	To apply undersealing.	90.00	90.00
	Total Labour Amount	4,880.00	2,550.00
	Total Parts and Labour	12,572.60	8,519.81

FormTeam Consultancy Pte Ltd

Our Reference : RRX16-072474/PRS/AL/RI/AL/cg

PAGE : 5

Your Reference: C0391366MC/RC

QTY	DESCRIPTION	SUBMITTED	REVISED
	Our Recommended Repair Cost (see remarks)	\$10,050.00	\$6,800.00


REMARKS :

Our recommended Lump Sum Repair Cost is **\$6,800.00** (instead of the submitted repair cost of **\$10,050.00** .In normal circumstances, repairs to the vehicle would take approximately **8 days** to complete. Please find enclosed our note of charges for your kind attention.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by FormTeam Consultancy Pte Ltd for any reliance on this report by any third party, unless with the permission of the addressee.

Yours faithfully,
FormTeam Consultancy Pte Ltd

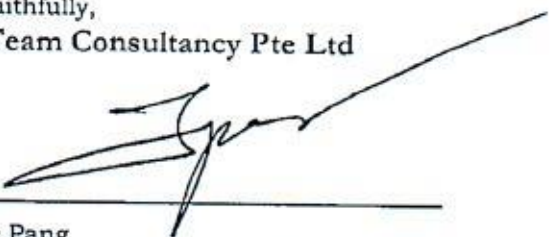
Frankie Pang
AMSAE(AUST), AMIRTE, AMSOE,
MASPACI, MSAAA
Licensed Appraiser


Axel Lee
Automobile Appraiser

FormTeam Consultancy Pte Ltd

Vehicle No: SJL 2382C

Workshop: T & S Motor Service

Accident Date: 09 July 2016

No. 33 Ubi Ave 3
#02-15 Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: motorsurvey@fta.com.sg
www.fta.com.sg

Co. Reg No: 200819280D

GST Reg. No: 200819280D







