

Signature

REF:

NS/INC18004360/Svb

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

Insured:

Policy No.

Claims No.

Sum Insured:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time / Action / Instruction

13/3/18 Sebastian Confirmed LS \$ 2350 (Red 2658.30, 537)

RECEIVED

Date/Time, File Pass to?

☐

Proll. Report

☐

Final Report

1)

Date/Time, File Return to?

2)

Report Format:

Lump Sum / I.B.I. (\$) TP

Days Of Repair: 2

Resurvey No. of Trip:

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Insp (\$

☐

Weekend (\$

Survey Fee:

Transportation:

) \$ + RS \$

) Phone

) Others

TOTAL

Veh No:

Svb 1153

Yr Regn:

13/8/2017

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading:

Eng/No:

C/No:

Gen. Cond. Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: N/A / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

(mm)

L/Bal.

mm

L/Bal.

(mm)

D.O.A.

23/2/18

D.O.A.

5/3/2018

Survey held at

Svb

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

C/S 1.

The U/C / Chassis frame / Body Structure affected due to collision.



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18004360/Svb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 07-03-2018

189556



Code: INC4

1. Policy Particulars - THIRD PARTY CLAIM

Insured Veh.	SHD 2286M	Veh. Inspected	SMB 108J
Policy No.	5068045737-03	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	05/03/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	23/02/2018	Inspection Date	05/03/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

Survey Department Check List (Case Handler)

Reference No.: NS / NIC / 8004364 / SVB

Policy Type: OD / TP / TP RES / TL / EVA

Case Handler

Typist

Admin (): Case handler to make sure all information created by the assignment team are ACCURATE.

(1) Office Assign Form		Y-Date	N-Date	Y-Date	N-Date
C	Reference No.	✓			
C	Customer Code				
N	Assign From				
C	Assign Date	✓			
C	Veh No (Inspected)	✓			
C	Veh No (Insured)	✓			
C	D.O.A	✓			
C	Policy No	✓			
C	Claim No	✓			
C	Insurance Authorisation (CA /REV/REP)				
C	Report Type	✓			
C	Weekend Charges				
N	Survey held at/Repairer	✓			
C	Excess				

Surveyor (): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form		Y-Date	N-Date	Y-Date	N-Date
C	Vehicle No	✓			
C	Regn Month/Year	✓			
N	Vehicle Type	✓			
N	Make & Model	✓			
C	Engine Capacity. (C.C)	✓			
N	Colour	✓			
C	Odometer. (Sp.Reading)	✓			
C	Chassis No	✓			
N	General Condition	✓			
N	Steering	✓			
N	Brake	✓			
N	Modification (Modi)	✓			
C	Tyre Size	✓			
N	Tyre Make	✓			
C	Tyre Balance	✓			
C	Date of Inspection	✓			
N	Survey held	✓			
N	Des.of Damages	✓			

(2) System - (Views/Merimen)

C	Damaged Vehicle Photographs Uploaded	✓			
---	--------------------------------------	---	--	--	--

(3) Workshop Estimate/Assignment Form

N	ALL Parts condition	✓			
C	Market Value for OD cases				
C	Estimate Repair Cost for PRI (RSI, TMI, MSIG)				
C	Days of repair	✓			
C	Finalised Amount	✓			
C	Re-inspection Cases to Finalize within 5 Days				

(4) System - (Views/Merimen)

C	Resurvey photo Uploaded				
---	-------------------------	--	--	--	--

Check By: VERON 15/3/16
Case Handler Date

*C: Critical *N: Non-Critical

21/05/2016

eBaoTech

GeneralClaim

Hello, NAC_PAYA_UBI_800601

[Change Language](#) [Change Password](#) [Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No. Date of Accident
Vehicle No. (For Motor)

Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input checked="" type="radio"/>	5068045737-03	PRIME CAR RENTAL & TAXI SERVICES PTE. LTD.	199606293Z	GFT	Third Party, Fire & Theft	SHD2286M	SHD2286M	09/10/2017	

Veron Chen (LKKAuto)

From: mtreg <mtreg@income.com.sg>
Sent: Thursday, 15 March 2018 11:45 AM
To: Veron Chen (LKKAuto)
Subject: FW: REQUEST FOR CLAIM NUMBER

Follow Up Flag: Follow up
Flag Status: Flagged

Hi,

Claim created.

With Regards

Samsia
Senior Admin Assistant, Motor Insurance
www.income.com.sg



From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Thursday, March 15, 2018 10:11 AM
To: mtreg <mtreg@income.com.sg>
Subject: REQUEST FOR CLAIM NUMBER

Dear Sir/Madam,

Kindly provides us the claim number.

S/NO	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle
1	MT/0983406-002	SMRT BUSES LTD	SMB 108J	SHD 2286M

D.O.A	Time of Accident	Estimate	Tentative repair cost
23/2/2018	9:00	\$5,008.30	\$2,350.00

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 2292D

Vehicle Details

Vehicle No.: SMB108J

Vehicle to be Exported: No

Intended De-registration Date: 07 Mar 2018

Vehicle Make: MERCEDES BENZ

Vehicle Model: OC500LE1830H

Primary Colour: Black

Manufacturing Year: 2009

Engine No.: 45796600172802

Chassis No.: WEB63442021000238

Maximum Power Output: -

Open Market Value: \$328,053.00

Original Registration Date: 13 Aug 2009

First Registration Date: 13 Aug 2009

Transfer Count: 0

Actual ARF Paid: \$16,403.00

Intended PARF Rebate Details

PARF Eligibility: No

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Rebate Amount: \$0.00

Total Rebate Amount: \$0.00

The information contained herein is correct as at 07 Mar 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by Insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	27/02/2018 10:38
Date Of Accident	23/02/2018 09:00
Exact Location Of Accident	SIGNALISED JUNCTION OF SHENTON WAY
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMB108J
Insured/Policyholder	
Name Of Registered Owner	SMRT BUSES LTD
Co Reg No	198202292D
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-64823888

Vehicle Particulars

Manufacturer	MERCEDES-BENZ
Model	BUS

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category BUS

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	D-17087563MFBP
Cover Note Number	

Driver

Name of Driver	MOHD HASZREEN BIN RAZALI
NRIC No	G2780597W
Date Of Birth	18/03/1989
Occupation	OUTDOOR
Date Of Driving Pass	01/05/2016
Driving Experience	1 YEAR AND 9 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address NOADDRESS

Postcode

Was driver an employee of the Insured's Company YES

If No, Relationship of the Driver with the Insured

Vehicle Registration Number of Driver's Own Vehicle -

Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident SIDE SWIPE

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Number of vehicles involved in the accident

Was any body injured in the Accident? NO

Was any injured conveyed to hospital by ambulance? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

Bus was crossing the junction of Shenton Way, one taxi that exited from Parsi Rd failed to observe for oncoming traffic had collided into the right front of the bus. For the alleged accident nobody was injured.

Attachment(s)

Are accident photos available for attachment? NOT AVAILABLE DUE TO CIRCUMSTANCES OF ACCIDENT

Was there any video captured by Car Camera? NO

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHD2286M

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category TAXI

Name of Driver ANDREW YEO TIONG NG

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Sketch Plan Pg. 1

SKETCH PLAN


IMPORTANT NOTICE

B40/02/18/5028 -

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

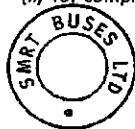


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan Pg. 2

SKETCH PLAN

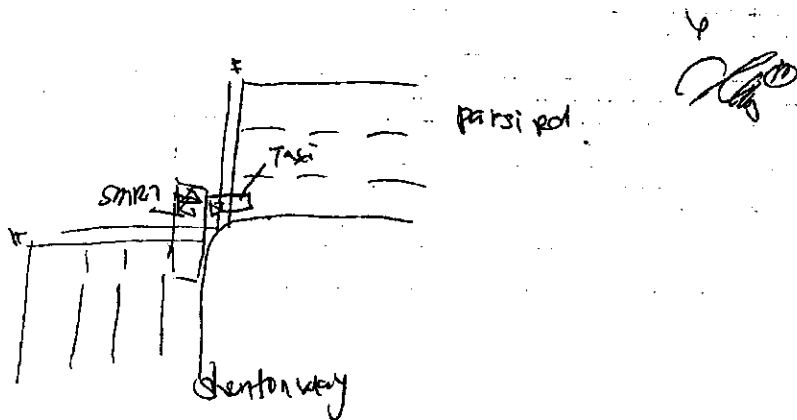

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

As per the bus report.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Policyholder's Signature

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SMRT Accident Vehicle Repair Estimates**Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre**

Reg. No : SMB108J
Ref No : BUS/02/18/5028
Reg. Date : 01/03/2018
Vehicle Type : BUS -12M
Make : MBOC500 (MERCEDES)
Model : MERCEDES MBOC500
Name of Driver : Mohd Haszreen Bin Razali
Type of Accident : SIDE SWIPE
Date / Time of Accident : 23/02/2018 09:00:00 AM
Accident Reported Date / Time : 26/02/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by : IDAC
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No :
Special Instruction to ARC,if any :

SMB108J - RIGHT FRONT PORTION
SHD2286M (TP) - PRIME TAXI INSURED WITH NTUC

Prepared Date : 01/03/2018 09:40:40 AM

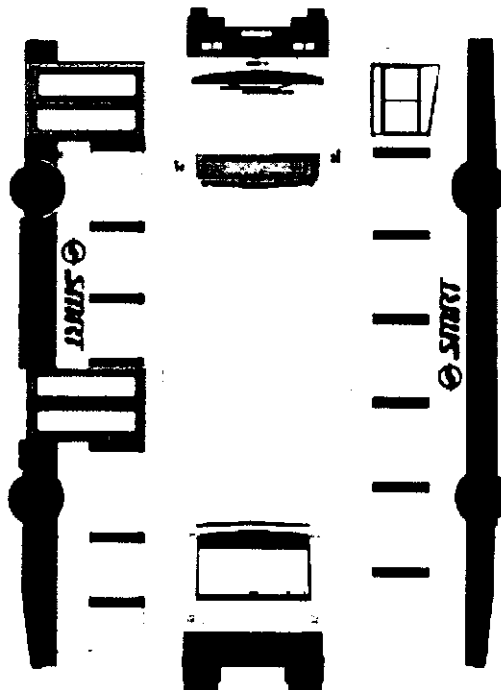

Long Sun Repair

0

Repair Completed Date / Time

Summary of Repair Estimates

Quotation from ARC

Adjusted by Surveyor, If applicable

Total Labour Charges	1,325.00	795.00
Total Spray Painting Charges	616.00	528.00
Total Material Charges	1,150.55	702.00
Other Charges	0.00	0.00
TOTAL	3,091.55	2,025.00
Lum Sum Total	3,100.00	2,025.00
No. of Repair Days	3.00	2.00

Prepared / Adjusted By

Arc / Surveyor Sing Off Date

06/03/2018 02 09:55 PM

06/03/2018 02:11:03 PM

L k k

Prepared / Adjusted Date

Remarks

Prepared Date : 02/03/2018 07:59:48 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No

Invoice No

Quotation Date :

Invoice Date**Invoice Amount****Prepared Date**

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.	1,325.00	795.00
Total Labour	1,325.00	795.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS	616.00	528.00
Total Spray Painting & Panel Beating	616.00	528.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Other Costs		

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5017	RIGHT	6010225	RH SKIRT PANEL R2	1	975.00	10.00	877.50	Replace	Replace	No
	FRONT	6009362	FRONT BUMPER RH	1	621.00	100.00	0.00	Repair	Repair	No
		6010415	HINGE, COMPARTMENT: LHS	1	327.80	10.00	295.02	Replace	Check	No
		6010416	HINGE, COMPARTMENT: RHS	1	327.80	10.00	295.02	Replace	Check	No
TOTAL MATERIALS							1,467.54	877.50		
TOTAL MATERIALS(Discounted)							1,150.55	702.00		

Added Spare Parts / Material Usage After Surveyor Signed off


Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SMB108J
Ref. No : BUS/02/18/5028
Reg. Date : 13/08/2009
Vehicle Type : BUS -12M
Make : MBOC500 (MERCEDES)
Model : MERCEDES MBOC500
Name of Driver : Mohd Haszreen Bin Razali
Type of Accident : SIDE SWIPE
Date / Time of Accident : 23/02/2018 09:00:00 AM
Accident Reported Date / Time : 26/02/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by : IDAC
Vehicle is Towed Back? : No
Towed Back Date/Time : 01/01/2000
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024094886
Special Instruction to ARC,if any :

SMB108J - RIGHT FRONT PORTION
SHD2286M (TP) - PRIME TAXI. INSURED WITH NTUC
Prepared Date : 01/03/2018 09:40:40 AM

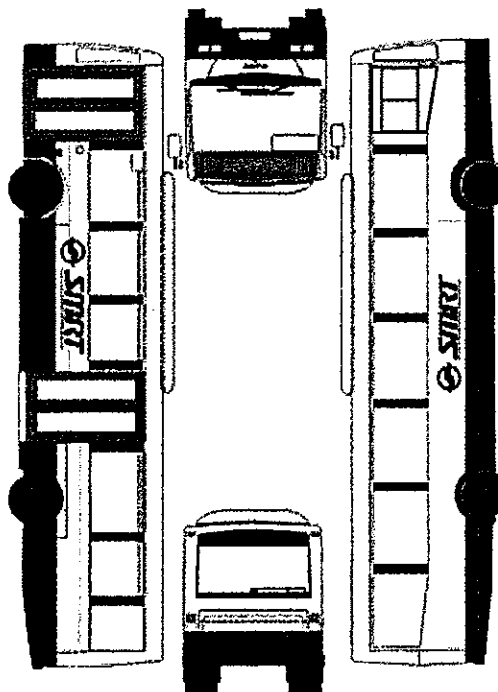

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : Mileage : 0
Work Shop : Repair Completed Date / Time : 01/01/2000

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,325.00	795.00
Total Spray Painting Charges	: 616.00	528.00
Total Material Charges	: 1,770.22	1,298.18
Other Charges	: 0.00	-250.00
TOTAL	: 3,711.22 <i>5008-30</i>	2,371.18
Lum Sum Total	: 3,700.00	2,350.00
No. of Repair Days	: 3.00	2.00 /
Prepared / Adjusted By	:	Sebastian Yeang
Arc / Surveyor Sign Off Date	: 06/03/2018 02:09:55 PM	06/03/2018 02:11:03 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 02/03/2018 07:59:48 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.	1,325.00	795.00 /
Total Labour	1,325.00	795.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS	616.00	528.00 /
Total Spray Painting & Panel Beating	616.00	528.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
Lump Sum Adjustment by Surveyor	0.00	-250.00
Total Other Costs	0.00	-250.00

5008.30

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5017	RIGHT	6010225	RH SKIRT PANEL R2	1	975.00	10.00	877.50	Replace	Replace	No <i>✓ BT</i>
	FRONT	6009362	FRONT BUMPER RH	1	621.00	100.00	0.00	Repair	Repair	No <i>R</i>
		6010415	HINGE, COMPARTMENT: LHS,	1	327.80	10.00	295.02	Replace	Check	No <i>X</i>
		6010416	HINGE, COMPARTMENT: RHS	1	327.80	10.00	295.02	Replace	Check	No <i>X</i>
0007501250		6010189	LOCK: FRT BUMPER, FOR MB CITARO BUS	2	66.00 <i>132</i>	10.00	118.80	Replace	Replace	No <i>✓ DMG</i>
5035	RIGHT	6010241	FRAME RH SKIRT PANEL R2	1	572.70	10.00	515.43	Replace	Replace	No <i>✓ BT</i>
	COMMON	4006314	SEALANT SIKAFLEX	3	37.00 <i>111</i>	0.00	111.00	Replace	Replace	No <i>✓ MC</i>
TOTAL MATERIALS							2,212.77	1,622.73		
TOTAL MATERIALS (Discounted)							1,770.22	1,298.18		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
5035	RIGHT	FRAME RH SKIRT PANEL R2	1	572.70	10.00	515.43	Replace	Replace	No
	COMMON	SEALANT SIKAFLEX	3	37.00	0.00	111.00	Replace	Replace	No
TOTAL SUPPLEMENTARY MATERIALS						626.43			

$$\begin{array}{r}
 1622.73 \\
 + 795.00 \\
 + 528.00 \\
 \hline
 2945.73 \\
 - 20\% \\
 \hline
 2356.58
 \end{array}$$


$$L/S : \$ 2350$$


Sebastian
13/3/18

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SMB108J
 Ref. No : BUS/02/18/5028
 Reg. Date : 01/03/2018
 Vehicle Type : BUS -12M
 Make : MBOC500 (MERCEDES)
 Model : MERCEDES MBOC500
 Name of Driver : Mohd Haszreen Bin Razali
 Type of Accident : SIDE SWIPE
 Date / Time of Accident : 23/02/2018 09:00:00 AM
 Accident Reported Date / Time : 26/02/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by : IDAC
 Vehicle is Towed Back? : No
 Towed Back Date/Time :
 Replacement Vehicle issued? : No
 Accident Repair Job Card No :
 Special Instruction to ARC,if any :
 SMB108J - RIGHT FRONT PORTION
 SHD2286M (TP) - PRIME TAXI. INSURED WITH NTUC
 Prepared Date : 01/03/2018 09:40:40 AM

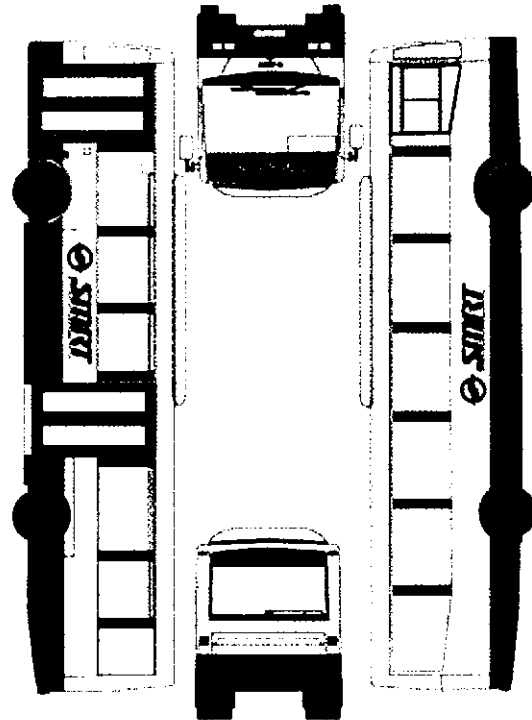

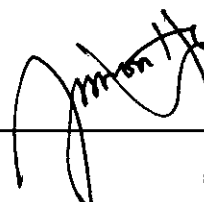 8/3/18
 Larp Sun Repair

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.	1,325.00	795.00
Total Labour	1,325.00	795.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS	616.00	528.00
Total Spray Painting & Panel Beating	616.00	528.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Other Costs		




National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18004360/Svbe2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 20-03-2018	
Code: INC4				
1. Policy Particulars : THIRD PARTY CLAIM				
Insured Veh.	SHD 2286M	Veh. Inspected	SMB 108J	
Policy No.	5068045737-03	Coverage (\$)	0.00	
Claim No.	MT/0983406-002	Excess (\$)	0.00	
Assign From		Assign Date	05/03/2018	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ OC500LE1830H	c.c	11967	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	WEB63442021000238	Colour	MULTI COLOUR	
Odometer	738071	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	275/70 R22.5	FIRENZA	6 mm	
L/H Front Tyre	275/70 R22.5	FIRENZA	6 mm	
R/H Rear Tyre	275/70 R22.5 (D)	FIRENZA	6/6 mm	
L/H Rear Tyre	275/70 R22.5 (D)	FIRENZA	6/6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/02/2018	Inspection Date	05/03/2018	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days		



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMB 108J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	RH SKIRT PANEL R2 (DISC 10%)	BENT	975.00	877.50
2	LOCK: FRT BUMPER, FOR MB CITARO BUS @ \$66.00 (DISC 10%)	DAMAGED	132.00	118.80
1	FRAME RH SKIRT PANEL R2 (DISC 10%)	BENT	572.70	515.43
3	SEALANT SIKAFLEX @ \$37.00 (SN)	NECESSARY	111.00	111.00
1	HINGE, COMPARTMENT:LHS,	NOT NECESSARY	327.80	-
1	HINGE,COMPARTMENT:RHS	NOT NECESSARY	327.80	-
1	FRONT BUMPER RH	TO REPAIR	621.00	-
			3,067.30	1,622.73
LABOUR				
TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.			1,325.00	795.00
PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS.			616.00	528.00
			1,941.00	1,323.00
GRAND TOTAL			5,008.30	2,945.73
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				2,350.00

Report Ref No. NS/INC18004360/Svbe2

YEANG WAI KEEN

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.