

ASS. REC. BY:

REF:

CS/EGT18004377/Srd3

72

Special Instructions:

Surveyor:

Sebastian

ASSIGNMENT (Office)

From (Person):

Yee Pei Li

of

EGI

Date/Time:

07/03/18 @ 8.54am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHF177Y

Insured:

GZ9181G

at Workshop m/s

SMRT Automotive

Tel:

G8662672

of

60 Woodlands Ind Prk E 4

Policy No:

Claim No:

GZ9181G/RH/p1

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

06/03/2018

CA / REV / REP. / REV 24 HRS

wp

H.O.D. Endorsement:

Date/Time:

9.5am @ 7/3/18

Person Contacted:

Shanti

Vehicle IN/OUT

Date/Time

Action/Instruction (→) Estimate

SHF177Y - NSI/MNC16020309/Klvb32

D.O.A: 24/10/16

GZ9181G-X

Confirm \$5614.55 @ 6 days

ded: \$10,887.05, 66%.

REF EGI

ASSIGNMENT

Date: 07/03/18

SHF177Y

28/11/17

Estimated Cost:

OD TP / NS TP RES / OD RES / EVA / INV / W.

To Insured Vehicle No:

SHF177Y
SMRT

at Workshop no:

VIN

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:

Client's Record:

Make of Van:

Policy Condition:

Remark: The van had commenced its
repair at the time of inspection.

Ball or Market Value:

IDAC Accident Report: Consistent? : Yes or No

GIA PR Seen: Consistent? : Yes or No

Est. Repairs: days Pass: Yes or No

Lift Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS (up)

Date: Person Contacted:

Vehicle IN / OUT

Date Time Action Instruction

Make:

Toyota Prius 4

1778

Colour:

Maroon

Insured: Std. N/A

So Reading:

25271

Radio Insured: Std. N/A

Eng No:

Chassis:

J70K63141205575357

Gen. Cond. Good: Poor: Burnt:

Steering: In order: Jammed: Leaked: Burnt: or

Brake: In order: Jammed: Leaked: Burnt: or

Mod: STD 4 Rim or

Tyre Size:

195/65R15

Rim

BS: DUN EXNOVA 3: PS LIZA MIO CHTSU PR SUM

TOYO (YOKO)

Front:

Rear:

R.Ba:

6

R.Ba:

6

L.Ba:

6

L.Ba:

6

D.O.A:

6/3/18

D.O.A:

7/3/18

Survey report:

SMRT

Des. of Damages: Fr: Pass: OS: NS: UO: Roofed: or

The UO / Chassis frame Body Structure affected due to collision

TAX/03/18/2031

LKK

Ergo

929/1819

RECEIVED 6 JUN 2018

Date Time File Pass in:

typed



Prell. Report

Final Report

Date Time File Return:

Days Of Repair:

6

Resurvey No. of Trip:

1

Dune Fee

Transportation

Fuel

Toll

Other

Total

Add Fee:

Site fee:

Machine:

Tool:

Access:

Record Format:

tp

Lift Fee:

5614.55

350

Nivitha (LKK Auto)

From: Survey Report (ERGO Insurance Pte. Ltd.) <Survey.Report@ergo.com.sg>
Sent: Wednesday, 7 March 2018 8:54 AM
To: 'admin-d@lkkauto.com'
Subject: OI : GZ9181G/ TP : SHF177Y/LKK / DOA : 06/03/2018
Attachments: GZ9181G - SAS.pdf; SHF177Y - SAS.pdf; SHF177Y - ESTIMATE.pdf; SHF177Y - PRS FORM.pdf; RE: SHF177Y - Survey (Ergo) (1.71 MB)

Dear Catherine,

In compliance with "State Courts Practice Directions Amendment No.1 of 2016" in regards to the Pre Repair Survey, both TP repairer and ERGO Insurance Pte Ltd have agreed on your company **LKK AUTO CONSULTANTS PTE LTD** to be the "Single Joint Expert".

Please assist to conduct this survey from **SMRT AUTOMOTIVE SERVICES PTE LTD,**

ADDRESS : WOODLANDS SMRT DEPOT
60 WOODLANDS INDUSTRIAL PARK E4
SINGAPORE 757705

PERSON TO CONTACT : SHANTI @ 6866 2671/2

ERGO OFFICER-IN-CHARGE : ROHAINI

Note: To survey on without prejudice basis. Please advise the consistency of damages to third party vehicle that you are require to conduct a re-survey before vehicle is returned to claimant. They are to contact your office directly. Please do keep us in the loop.

Please fill up the necessary on ERGO PRS Form from workshop and return to us together on your update of the survey status via Survey.Report@ergo.com.sg.

Attached are estimate, insured and third party SAS (note: reports not to be released to any Third Party).

Kindly acknowledge receipt of this email.

Thank you

Yee Pei Li

Claims Assistant (Motor)
ERGO Insurance Pte. Ltd.
5 Temasek Boulevard
#04-01 Suntec Tower Five
Singapore 038985
Tel: 65 6829 9199 DID: 65 6829 9194
Website: www.ergo.com.sg

ERGO is one of the major insurance groups in Germany and Europe. Worldwide, ERGO is represented in more than 30 countries and concentrates on Europe and Asia. ERGO is part of Munich Re (Group), one of the world's leading risk carriers.

ERGO

Date: 07.03.2018
Our Reference: GZ 9181G/RH/pl
Your Reference: SHF 177Y

Sent via Fax

or

Email

BThaiyaIN@smrt.com.sg

To: SMRT AUTOMOTIVE SERVICES PTE LTD

Pre-Repair Survey (PRS) Acknowledgement

Vehicle For Inspection: SHF 177Y
Insured's Vehicle: GZ 9181G
Date Of Accident: 06.03.2018

We acknowledge receipt of your request for PRS on: 07.03.2018

In compliance with "State Courts Practice Directions Amendment No.1 of 2016", do select an assessor from the list below and indicate your selection in the box marked *.

* **LKK**

AIS	Automobile Inspection Services Pte Ltd	LBS	L.B.S Auto Consultants Pte Ltd
FTA	FormTeam Consultancy Pte Ltd	LKK	LKK Auto Consultants Pte Ltd
IAS	Infiniti Appraisal Service	PS	Priority Services
JPK	JP Knights Pte Ltd	VAC	Vicom Ltd

- ☐ Your request for inspection does not have your client's cost of repair estimate, kindly forward a copy.
- ☐ Your request for inspection does not have your client's GIA report, kindly forward a copy.
- ☐ We acknowledge your interest for direct settlement, we will assess & revert soon upon receipt of estimate.
- ☐ Our Insured's driver has not reported the accident to us to date.
- ☒ Others: OFFICER-IN-CHARGE - ROHAINI

Prepared by:		Pei Li	6829 9194	claims@ergo.com.sg
Signature:				FAX : 6829 9247

Assessor use only:

Assignment Date: _____
Assignment Time: _____

Remarks:

Workshop use only:

Assessor attended workshop on:

Date: _____
Time: _____
Inspector: _____

☐ Vehicle not available at the appointed date and time.

Kindly acknowledge our Assessor presence for the above job .

Workshop Acknowledgement & Stamp.

Note: Our Inspection is on a without admission to liability basis.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
ERGO INSURANCE PTE LTD		Ref : CS/EGI18004377/Srd3		
5 TEMASEK BOULEVARD #04-01 SUNTEC TOWER FIVE SINGAPORE 038985		Date : 07-03-2018		
		Code : EGI		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GZ 9181G	Veh. Inspected	SHF 177Y	
Policy No.		Coverage (\$)	0.00	
Claim No.	GZ 9181H/RH/pl	Excess (\$)	0.00	
Assign From	YEE PEI LI	Assign Date	07/03/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	06/03/2018	Inspection Date	07/03/2018	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHF177Y
Vehicle to be Exported:	No
Intended De-registration Date:	09 Mar 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS108765
Chassis No.:	JTDKB3FU203575357
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	28 Nov 2017
First Registration Date:	28 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Nov 2025

PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	27 Nov 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$33,596.00
COE Rebate Amount:	\$32,406.00
Total Rebate Amount:	\$36,156.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 09 Mar 2018

OK

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF177Y
 Ref. No : TAX/03/18/2031
 Reg. Date : 28/11/2017
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS4
 Name of Driver : VASU THEVAN S/O
 PAKIRISAMY
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 06/03/2018 09:50:00 AM
 Accident Reported Date / Time : 06/03/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : No
 Towed Back Date/Time :
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024094894
 Special Instruction to ARC, if any :
 GZ9181G - ERGO
 Prepared Date : 06/03/2018 11:38:25 AM



LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Sebastian.

7/5/18.

- Part by part repair.
- Question Mark Iron Photo.
- Photo Before Paint.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU203575357

Mileage :

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,521.00	0.00
Total Spray Painting Charges	: 2,754.00	0.00
Total Material Charges	: 8,279.79	8,279.79
Other Charges	: 1,650.00	0.00
TOTAL	: 14,204.79 16501.60	0.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 10.00	0.00
Prepared / Adjusted By	:	6 days
Arc / Surveyor Sign Off Date	: 06/03/2018 06:45:51 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 06/03/2018 06:01:38 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount : 0.00	Prepared Date : 3/6/2018 6:01:41 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	1,521.00	0.00 800
Total Labour	1,521.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY ROCKER PANEL MOULDING	180.00	0.00 X
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY FILLER RR BUMPER RH	180.00	0.00 100
TO RESPRAY BUMPER BEAM	180.00	0.00 100
TO RESPRAY TAIL GATE	378.00	0.00 200 X
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	0.00 100
TO RESPRAY REAR PANEL	180.00	? 0.00
TO RESPRAY REAR SPARE TYRE PANEL	180.00	? 0.00
TO RESPRAY REAR MEMBER, RH	180.00	? 0.00
TO RESPRAY FLOOR CORNER PANEL RH	180.00	? 0.00
TO RESPRAY REAR FENDER RH	378.00	0.00 200
TO RESPRAY RH RAIL ROOF SIDE	180.00	? 0.00
Total Spray Painting & Panel Beating	2,754.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 30
TO REMOVE / REFIT SEAT	120.00	0.00 X
TO ALIGN CHASSIS	350.00	? 0.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 X
TO REMOVE AND REFIX REAR WINDSCREEN	240.00	0.00 X
TO REMOVE AND REFIT WIRE HARDESS	120.00	0.00 30
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 30
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00 50
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00 30
TO REPLACE SUNDRY PARTS	100.00	0.00 X
TO WASH AND VACUUM	60.00	0.00 X
Total Other Costs	1,650.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
7586047900			MOULDING ASSY, BODY ROCKER PANEL, LH	1	576.00	25.00	432.00	Replace	Replace X	No
5215947913			COVER, RR BUMPER ASSY	1	423.90	25.00	317.92	Replace	Replace ✓ CRK	No
5216116010			CLIPS PIECE, FRT & RR BUMPER	10	1.50	25.00	11.25	Replace	Replace ✓ NRC	No
5256547900			FILLER, RR BUMPER, RH	1	119.90	25.00	89.92	Replace	Replace ✓ Defam	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace ?	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace ✓ NRC	No
5259968030			STOPPER, RR BUMPER, RH & LH	1	4.30	25.00	3.22	Replace	Replace ✓ NRC	No
5257547040			RETAINER, RR BUMPER, RH	1	112.70	25.00	84.52	Replace	Replace X	No
8158147010			LENS & BODY ASSY, RR BUMPER, RH	1	486.80	10.00	438.12	Replace	Replace ✓ CRK	No
5246247030			PAD, RR BUMPER, RH & LH, 1	1	3.80	25.00	2.85	Replace	Replace ?	No
5246247020			PAD, RR BUMPER, RH & LH, 2	1	3.80	25.00	2.85	Replace	Replace ?	No
5246247010			PAD, RR BUMPER, RH & LH, 3	1	3.80	25.00	2.85	Replace	Replace ?	No
5219147030			SEAL, RR BUMPER ARM, RH & LH	1	11.00	25.00	8.25	Replace	Replace ?	No
5259147050			SEAL, RR BUMPER, RH	1	85.20	25.00	63.90	Replace	Replace ?	No
5245347010			GUARD, RR BUMPER, LOWER	1	558.30	25.00	418.72	Replace	Replace ?	No
5216947020			COVER, GUARD RR BUMPER LOWER	1	14.80	25.00	11.10	Replace	Replace ✓ CRK	No
5246147010			PAD, RR BUMPER, CTR	3	2.20	25.00	4.95	Replace	Replace ?	No
5202347030			REAR BUMPER REINFORCEMENT	1	318.80	25.00	239.10	Replace	Replace ✓ BT	No
8218347020			WIRE, LUGGAGE ROOM	1	143.50	10.00	129.15	Replace	Replace ?	No
6700547440			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	929.60	25.00	697.20	Replace	Replace X	No
7680147110A1			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	891.20	25.00	668.40	Replace	Replace R	No
6935047050			TAIL GATE LOCK ASSY, BACK DOOR	1	452.10	10.00	406.89	Replace	Replace ✓ JM	No
6932147010			TAIL GATE LOCK COVER, BACK DOOR	1	25.30	25.00	18.97	Replace	Replace ?	No
6943052050			TAIL GATE STRIKER ASSY, BACK DOOR	1	24.90	25.00	18.67	Replace	Replace X	No
6788147050			TAIL GATE WEATHERSTRIP, BACK DOOR	1	360.70	25.00	270.52	Replace	Replace X	No
7557147010			TAIL GATE MOULDING GLASS, BACK DOOR	1	29.70	25.00	22.27	Replace	Replace X	No
7557547051			TAIL GATE MOULDING LOWER GLASS, BACK DOOR	1	19.70	25.00	14.77	Replace	Replace X	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
5611750140			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	2	27.90	25.00	41.85	Replace	Replace X	No
	COMMON		SEALANT W/SCREEN	3	37.00	0.00	111.00	Replace	Replace X	No
7540348010			EMBLEM SUB-ASSY REAR	1	46.30	25.00	34.72	Replace	Replace ✓ NCC	No
7544147090			NAME PLATE (HYBRID) , LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace ✓ NCC	No
7544247130			NAME PLATE (PRIUS) , LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace ✓ NCC	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace ✓ NCC	No
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace ✓ NCC	No
5839847050			COVER, REAR FLOOR UNDER , RH	1	169.50	25.00	127.12	Replace	Replace ?	No
5830747090			END PANEL SUB-ASSY, BODY LOWER BACK	1	629.80	25.00	472.35	Replace	Replace ?	No
5835047010			REINFORCEMENT ASSY, REAR FLOOR END PANEL , RH & LH	1	56.70	25.00	42.52	Replace	Replace ?	No
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace ?	No
5831147130			SPARE TYRE PANEL , PAN, REAR FLOOR	1	564.80	25.00	423.60	Replace	Replace ?	No
5830547050			EXTENSION REAR FLOOR PAN TO QUARTER PANEL , RH	1	190.10	25.00	142.57	Replace	Replace ?	No
6473047240C2			PANEL ASSY, DECK TRIM SIDE, RH	1	344.70	25.00	258.52	Replace	Replace ?	No
6499547050			BOX, DECK FLOOR, RH	1	304.00	25.00	228.00	Replace	Replace ?	No
5760347060			MEMBER SUB-ASSY, REAR FLOOR SIDE , REAR RH	1	268.60	25.00	201.45	Replace	Replace ?	No
8155147281			LENS & BODY, REAR COMBINATION LAMP , RH	1	438.10	10.00	394.29	Replace	Replace ?	No
6160147150			PANEL SUB-ASSY, FENDER REAR RH	1	824.80	25.00	618.60	Replace	Replace ✓ DT	No
6294047010			DUCT ASSY, QUARTER VENT , RH & LH	1	65.00	25.00	48.75	Replace	Replace ✓ BT	No
6563747060			LINER, REAR FENDER , RH	1	135.80	25.00	101.85	Replace	Replace ?	No
6101747010			MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH	1	279.20	25.00	209.40	Replace	Replace ?	No
TOTAL MATERIALS								8,279.88	8,279.79	
TOTAL MATERIALS(Discounted)								8,279.79	8,279.79	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
-------------	---------	-----------	-----	-----------------	--------------	------------------	-----------	----------------	----------


18-3-18 / 11:53
14-3-18 / 15:53

SMRT Accident Vehicle Repair Estimates

7-3-18 / 15:53

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF177Y
Ref. No : TAX/03/18/2031
Reg. Date : 28/11/2017
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS4
Name of Driver : VASU THEVAN S/O PAKIRISAMY
Type of Accident : HEAD TO REAR
Date / Time of Accident : 06/03/2018 09:50:00 AM
Accident Reported Date / Time : 06/03/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by : Sebastian
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024094894
Special Instruction to ARC, if any :
GZ9181G - ERGO
BEFORE PAINT PHOTO, FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR SEBASTIAN (LKK)
& Email : sebastianyeang@lkkauto.com HP: 90036121
Prepared Date : 06/03/2018 11:38:25 AM

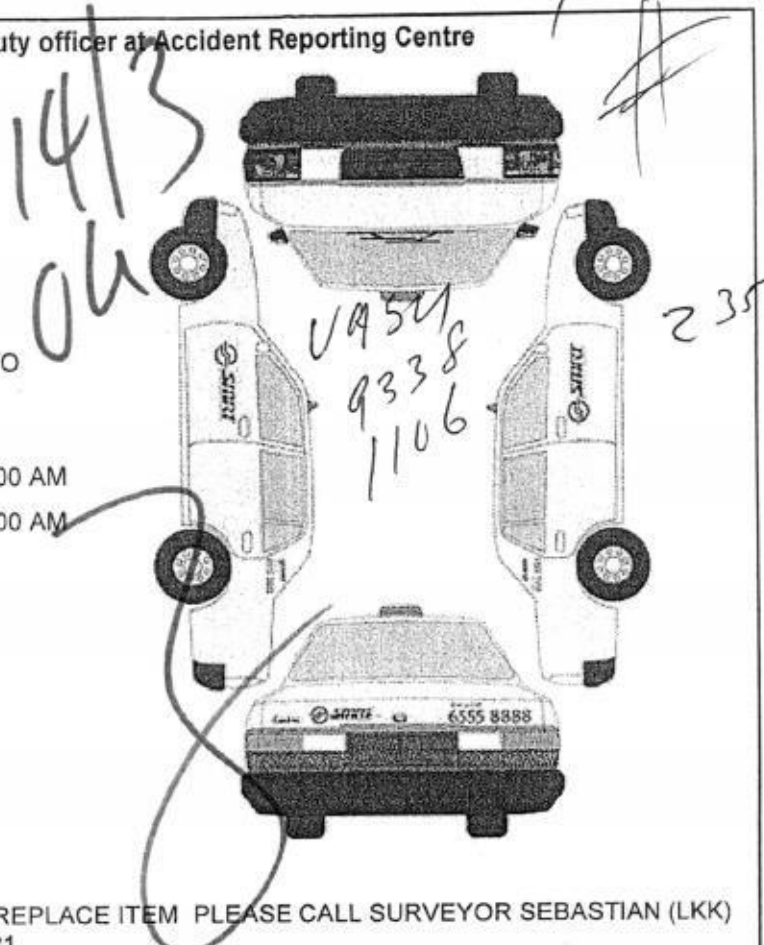

Recording Camera ☐ ☒
Radio Antenna ☐ ☒
1st witness _____ Date _____
2nd witness _____ Date _____

25271
1/4 1/2 3/4 1

QC 13/3/18 12:00 Reject

RR Emblem old dent

14/3/18 14:11 pss

LEE SHENG AUTO PTE LTD

Vehicle Return Date: 13-3-18

Vehicle Return Time: 10:43

SMRT staff sign:

Supplementary
to Refer to the Supplementary part list ✓

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU203575357

Mileage

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,521.00	900.00
Total Spray Painting Charges	: 2,754.00	800.00
Total Material Charges	: 6,587.02	3,714.55
Other Charges	: 1,650.00	200.00
TOTAL	: 12,512.02	5,614.55
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 10.00	6.00
Prepared / Adjusted By	:	SEBASTIAN (LKK)
Arc / Surveyor Sign Off Date	: 06/03/2018 06:45:51 PM	07/03/2018 03:53:06 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 06/03/2018 06:01:38 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : QN-1803-0445

Invoice No :

Quotation Date : 18/3

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 3/6/2018 6:01:41 PM

3714.55 /
+ 900.00 /
+ 1000.00 /

5614.55 /

Sebastian
21/3/18

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	1,521.00	900.00 /
Total Labour	1,521.00	900.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY ROCKER PANEL MOULDING	180.00	0.00
TO REPSRAY REAR BUMPER	378.00	200.00 /
TO RESPRAY FILLER RR BUMPER RH	180.00	100.00 /
TO RESPRAY BUMPER BEAM	180.00	100.00 /
TO RESPRAY TAIL GATE	378.00	0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100.00 /
TO RESPRAY REAR PANEL	180.00	100.00 /
TO RESPRAY REAR SPARE TYRE PANEL	180.00	0.00
TO RESPRAY REAR MEMBER,RH	180.00	0.00
TO RESPRAY FLOOR CORNER PANEL RH	180.00	0.00
TO RESPRAY REAR FENDER RH	378.00	200.00 /
TO RESPRAY RH RAIL ROOF SIDE	180.00	0.00
Total Spray Painting & Panel Beating	2,754.00	800.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	30.00 /
TO REMOVE / REFIT SEAT	120.00	0.00
TO ALIGN CHASSIS	350.00	0.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00
TO REMOVE AND REFIX REAR WINDSCREEN	240.00	0.00
TO REMOVE AND REFIT WIRE HARDESS	120.00	30.00 /
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30.00 /
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	50.00 /
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30.00 /
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,650.00	200.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
7586047900			MOULDING ASSY, BODY ROCKER PANEL, LH	0	576.00	25.00	0.00	Replace	Not given	No	X NN
5215947913			COVER, RR BUMPER ASSY	1	423.90	25.00	317.92	Replace	Replace	No	/ CRK
5216116010			CLIPS PIECE, FRT & RR BUMPER	10	1.50	25.00	11.25	Replace	Replace	No	/ NTC
5256547900			FILLER, RR BUMPER, RH	1	119.90	25.00	89.92	Replace	Replace	No	/ Defan
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace S	No	/ DMG
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No	/ NTC
5259968030			STOPPER, RR BUMPER, RH & LH	1	4.30	25.00	3.22	Replace	Replace	No	/ NTC
5257547040			RETAINER, RR BUMPER, RH	0	112.70	25.00	0.00	Replace	Not given	No	X NN
8158147010			LENS & BODY ASSY, RR BUMPER, RH	1	486.80	10.00	438.12	Replace	Replace	No	/ CRK
5246247030			PAD, RR BUMPER, RH & LH, 1	1	3.80	25.00	2.85	Replace	Check	No	X
5246247020			PAD, RR BUMPER, RH & LH, 2	1	3.80	25.00	2.85	Replace	Check	No	X
5246247010			PAD, RR BUMPER, RH & LH, 3	1	3.80	25.00	2.85	Replace	Check	No	X
5219147030			SEAL, RR BUMPER ARM, RH & LH	1	11.00	25.00	8.25	Replace	Check	No	X NN
5259147050			SEAL, RR BUMPER, RH	1	85.20	25.00	63.90	Replace	Check	No	X
5245347010			GUARD, RR BUMPER, LOWER	1	558.30	25.00	418.72	Replace	Replace S	No	/ Defan
5216947020			COVER, GUARD RR BUMPER LOWER	1	14.80	25.00	11.10	Replace	Replace	No	/ CRK
5246147010			PAD, RR BUMPER, CTR	3	2.20	25.00	4.95	Replace	Check	No	X NN
5202347030			REAR BUMPER REINFORCEMENT	1	318.80	25.00	239.10	Replace	Replace	No	/ BT
8218347020			WIRE, LUGGAGE ROOM	1	143.50	10.00	129.15	Replace	Check	No	X NN
6700547440			TAIL GATE PANEL SUB-ASSY, BACK DOOR	0	929.60	25.00	0.00	Replace	Not given	No	X
768014710A1			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	891.20	25.00	668.40	Replace	Replace S	No	/ CRK
6935047050			TAIL GATE LOCK ASSY, BACK DOOR	1	452.10	10.00	406.89	Replace	Replace	No	/ Jny
6932147010			TAIL GATE LOCK COVER, BACK DOOR	1	25.30	25.00	18.98	Replace	Check	No	X
6943052050			TAIL GATE STRIKER ASSY, BACK DOOR	0	24.90	25.00	0.00	Replace	Not given	No	X
6788147050			TAIL GATE WEATHERSTRIP, BACK DOOR	0	360.70	25.00	0.00	Replace	Not given	No	X
7557147010			TAIL GATE MOULDING GLASS, BACK DOOR	0	29.70	25.00	0.00	Replace	Not given	No	X NN
7557547051			TAIL GATE MOULDING LOWER GLASS, BACK DOOR	0	19.70	25.00	0.00	Replace	Not given	No	X

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5611750140			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	0	27.90	25.00	0.00	Replace	Not given	No ☒
	COMMON		SEALANT W/SCREEN	0	37.00	0.00	0.00	Replace	Not given	No ☒
7540348010			EMBLEM SUB-ASSY REAR	1	46.30	25.00	34.72	Replace	Replace	No ☒
7544147090			NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace	No ☒
7544247130			NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace	No ☒
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No ☒
	COMMON		STICKER DECAL 65558888	1	21.60	0.00	21.60	Replace	Replace	No ☒
5839847050			COVER, REAR FLOOR UNDER, RH	1	169.50	25.00	127.13	Replace	Check	No ☒
5830747090			END PANEL SUB-ASSY, BODY LOWER BACK	1	629.80	25.00	472.35	Replace	Check	No ☒
5835047010			REINFORCEMENT ASSY, REAR FLOOR END PANEL, RH & LH	1	56.70	25.00	42.53	Replace	Check	No ☒
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Check	No ☒
5831147130			SPARE TYRE PANEL, PAN, REAR FLOOR	1	564.80	25.00	423.60	Replace	Check	No ☒
5830547050			EXTENSION REAR FLOOR PAN TO QUARTER PANEL, RH	1	190.10	25.00	142.58	Replace	Check	No ☒
6473047240C2			PANEL ASSY, DECK TRIM SIDE, RH	1	344.70	25.00	258.53	Replace	Check	No ☒
6499547050			BOX, DECK FLOOR, RH	1	304.00	25.00	228.00	Replace	Check	No ☒
5760347060			MEMBER SUB-ASSY, REAR FLOOR SIDE, REAR RH	1	268.60	25.00	201.45	Replace	Check	No ☒
8155147281			LENS & BODY, REAR COMBINATION LAMP, RH	1	438.10	10.00	394.29	Replace	Check	No ☒
6160147150			PANEL SUB-ASSY, FENDER REAR RH	1	824.80	25.00	618.60	Replace	Replace	No ☒
6294047010			DUCT ASSY, QUARTER VENT, RH & LH	1	65.00	25.00	48.75	Replace	Replace	No ☒
6563747060			LINER, REAR FENDER, RH	1	135.80	25.00	101.85	Replace	Check	No ☒
6101747010			MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH	1	279.20	25.00	209.40	Replace	Check	No ☒
TOTAL MATERIALS							6,587.05	3,714.56		
TOTAL MATERIALS(Discounted)							6,587.02	3,714.55		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
-------------	---------	-----------	-----	-----------------	--------------	------------------	-----------	----------------	----------

16399.70
4553.3



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
ERGO INSURANCE PTE LTD			Ref : CS/EGI18004377/Srd3n2	
5 TEMASEK BOULEVARD #04-01 SUNTEC TOWER FIVE SINGAPORE 038985			Date : 08-06-2018	
			Code : EGI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GZ 9181G	Veh. Inspected	SHF 177Y	
Policy No.		Coverage (\$)	0.00	
Claim No.	GZ 9181G/RH/pl	Excess (\$)	0.00	
Assign From	YEE PEI LI	Assign Date	07/03/2018	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS 4	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTDKB3FU203575357	Colour	MAROON	
Odometer	25271	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm	
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/03/2018	Inspection Date	07/03/2018	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 177Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	COVER,RR BUMPER ASSY (DISC 25%)	CRACKED	423.90	317.92
10	CLIPS PIECE,FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
1	FILLER,RR BUMPER RH (DISC 25%)	DEFORMED	119.90	89.92
1	STOPPER,RR BUMPER,RH & LH (DISC 25%)	NECESSARY	4.30	3.22
1	GUARD,RR BUMPER LOWER (DISC 25%)	DEFORMED	558.30	418.72
1	COVER,GUARD RR BUMPER LOWER (DISC 25%)	CRACKED	14.80	11.10
1	REAR BUMPER REINFORCEMENT (DISC 25%)	BENT	318.80	239.10
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY (DISC 25%)	CRACKED	891.20	668.40
1	EMBLEM SUB-ASSY REAR (DISC 25%)	NECESSARY	46.30	34.72
1	NAME PLATE (HYBRID),LUGGAGE COMPARTMENT DOOR (DISC 25%)	NECESSARY	52.30	39.22
1	NAME PLATE (PRIUS),LUGGAGE COMPARTMENT DOOR (DISC 25%)	NECESSARY	52.30	39.22
1	PANEL SUB-ASSY FENDER REAR RH (DISC 25%)	BENT	824.80	618.60
1	DUCT ASSY,QUARTER VENT,RH & LH (DISC 25%)	BENT	65.00	48.75
1	LENS & BODY ASSY RR BUMPER,RH (DISC 10%)	CRACKED	486.80	438.12
1	TAIL GATE LOCK ASSY,BACK DOOR (DISC 10%)	JAMMED	452.10	406.89
1	SENSOR REVERSE (SN)	DAMAGED	180.00	180.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 65558888 (SN)	NECESSARY	21.60	21.60
1	MOULDING ASSY,BODY ROCKER PANEL,LH	NOT NECESSARY	576.00	-
1	RETAINER,RR BUMPER,RH	NOT NECESSARY	112.70	-
1	PAD,RR BUMPER RH & LH,1	NOT NECESSARY	3.80	-
1	PAD,RR BUMPER RH & LH,2	NOT NECESSARY	3.80	-
1	PAD,RR BUMPER RH & LH,3	NOT NECESSARY	3.80	-
1	SEAL,RR BUMPER ARM,RH & LH	NOT NECESSARY	11.00	-
1	SEAL,RR BUMPER,RH	NOT NECESSARY	85.20	-
3	PAD,RR BUMPER,CTR @\$2.20	NOT NECESSARY	6.60	-
1	WIRE,LUGGAGE ROOM	NOT NECESSARY	143.50	-
1	TAIL GATE PANEL SUB-ASSY,BACK DOOR	NOT NECESSARY	929.60	-

Report Ref No. CS/EG18004377/Srd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL GATE LOCK COVER,BACK DOOR	NOT NECESSARY	25.30	-
1	TAIL GATE STRIKER ASSY,BACK DOOR	NOT NECESSARY	24.90	-
1	TAIL GATE WEATHERSTRIP,BACK DOOR	NOT NECESSARY	360.70	-
1	TAIL GATE MOULDING GLASS,BACK DOOR	NOT NECESSARY	29.70	-
1	TAIL GATE MOULDING LOWER GLASS,BACK DOOR	NOT NECESSARY	19.70	-
1	TAIL GATE DAM,BACK DOOR GLASS UPPER ADHESIVE	NOT NECESSARY	27.90	-
1	SEALANT W/SCREEN	NOT NECESSARY	37.00	-
1	COVER,REAR FLOOR UNDER,RH	NOT NECESSARY	169.50	-
1	END PANEL SUB-ASSY,BODY LOWER BACK	NOT NECESSARY	629.80	-
1	REINFORCEMENT ASSY,REAR FLOOR END PANE,LH & RH	NOT NECESSARY	56.70	-
1	SEALANT SIKAFLEX	NOT NECESSARY	37.00	-
1	SPARE TYRE PANEL,PAN,REAR FLOOR	NOT NECESSARY	564.80	-
1	EXTENSION REAR FLOOR PAN TO QUARTER PANEL,RH	NOT NECESSARY	190.10	-
1	PANEL ASSY,DECK TRIM SIDE,RH	NOT NECESSARY	344.70	-
1	BOX,DECK FLOOR,RH	NOT NECESSARY	304.00	-
1	MEMBER SUB-ASSY,REAR FLOOR SIDE,REAR RH	NOT NECESSARY	268.60	-
1	LENS & BODY,REAR COMBINATION LAMP,RH	NOT NECESSARY	438.10	-
1	LINER,REAR FENDER,RH	NOT NECESSARY	135.80	-
1	MEMBER SUB-ASSY RAIL ROOT SIDE REAR RH	NOT NECESSARY	279.20	-
			10,474.70	3,714.55
	LABOUR			
	PANEL BEATING & BODY WORK.		1,521.00	900.00
	SPRAY PAINT.		2,754.00	800.00
	TO CHECK WIRING AND SYSTEM FUNCTION.		80.00	30.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	30.00
	TO REMOVE/REFIT SEAT.	NOT NECESSARY	120.00	-
	TO ALIGN CHASSIS.	NOT NECESSARY	350.00	-
	TO TRANSFER REAR TAILGATE MECHANISM.	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIX REAR WINDSCREEN.	NOT NECESSARY	240.00	-
	TO REMOVE AND REFIT WIRE HARDNESS.		120.00	30.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	30.00

Report Ref No. CS/EG18004377/Srd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.		120.00	50.00
	TO INSPECT RR LIGHTING,MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE.		120.00	30.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			5,925.00	1,900.00
GRAND TOTAL			16,399.70	5,614.55
RECOMMENDED COST OF REPAIRS				5,614.55

Report Ref No. CS/EGI18004377/Srd3n2

YEANG WAI KEEN

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.