

ASS. REC. BY:

REF:

TM1 / CC3/TMU 800 4810 / Ktb72

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: SKQ 1191E

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

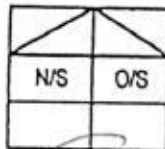Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 02 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHC 5190R Yr Regn: 01, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or _____

Make: Renault Latitude c.c. 1995

Colour: N. White / R. A/C: Insured / Std / NI / NA

Sp. Reading: 411160 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VI-1 ABL 154UC 276707

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: N/A / S/Rim / STD A/Rim or

Tyre Size: F: 205/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Giti

Front

R/Bal. 9 mm

L/Bal. 9 mm

D.O.A. 9/3/18

Survey held at

Des. of Damages: Frit / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

14/3 File pass to Corbin

C1 Log 818501 (Red: 36580.58 : 95%)

SHC 5190R - CC3/AYA / 3009254 / Kpb3W2

SKQ 1191E - x

Date: 18/5/18

RECEIVED 10 MAR 2019

Date/Time, File Pass to?

1) 15/3 Typist

Date/Time, File Return to?

2)

☐ : Prell. Report☒ : Final Report

Days Of Repair: 2

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S + RS \$

Photos

Others

TOTAL

250

10

260

Report Format :

Lump Sum / I.B.I. (\$

1850/-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
TOKIO MARINE INSURANCE SINGAPORE LTD		Ref : CC3/TMI18004810/Ktb		
20 MCCALLUM STREET #09-01 TOKIO MARINE CENTRESINGAPORE 069046		Date : 14-03-2018		
		Code : TMI		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKQ 1191E	Veh. Inspected	SHC 5190R	
Policy No.		Coverage (\$)	0.00	
Claim No.		Excess (\$)	0.00	
Assign From		Assign Date	13/03/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	09/03/2018	Inspection Date	13/03/2018	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

Denise Tay (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Wednesday, 14 March 2018 12:05 PM
To: Too Joon Hwa
Cc: 'priscilla@tokiomarine.com.sg'; SUR
Subject: DIRECT SURVEY INSPECTION ON WORKSHOP - TRANS-CAB AUTO SERVICES PTE LTD, DOA: 09/03/2018, SHC 5190R (TP Vehicle), SKQ 1191E (OI Vehicle)
Attachments: est SHC 5190R.pdf; GIA REPORT SHC 5190R.pdf

Dear Shirley,

Please be informed that we had inspected the vehicle **SHC 5190R** M/s: TRANS-CAB AUTO SERVICES PTE LTD, NO.2 ANG MO KIO ST 63 SINGAPORE 569111 on 31/01/2018.

Enclosed herewith a copy of TP's GIA report and estimated cost of repair.

Meanwhile, kindly create claim in merimen for our necessary action.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	12/03/2018 14:00
Date Of Accident	09/03/2018 18:40
Exact Location Of Accident	AYE AFTER CLEMENTI ROAD EXIT
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC5190R
Insured/Policyholder	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62876666
Vehicle Particulars	
Manufacturer	RENAULT
Model	LATITUDE-2.0 DCI AUTO D/AB 4DR (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

Driver

Name of Driver	TAN KEE HENG
NRIC No	S7534258F
Date Of Birth	17/11/1975
Occupation	OUTDOOR
Date Of Driving Pass	18/11/2008
Driving Experience	9 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98178833
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 816 YISHUN ST 81 #03-698
Postcode	760816
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

On the 09.03.2018 at about 1840hours, i was travelling straight on the extreme right lane of AYE after Clementi Rd. When vehicle in front of me slow down and made a stop and i followed suit. Moment later while stationary, suddenly i felt an impact from the rear. I alighted to check and realized that Vehicle B(SKQ1191E) front portion had hit onto my taxi's rear portion.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKQ1191E
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	NG YI LI
NRIC/Passport Number	S8806364C
Contact Number	96969750
Address	
Postcode	
Insurance Company Name	

Nature Of Damage

No. Of Passenger (Including Driver)

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2 Pg. 1

SKETCH PLAN

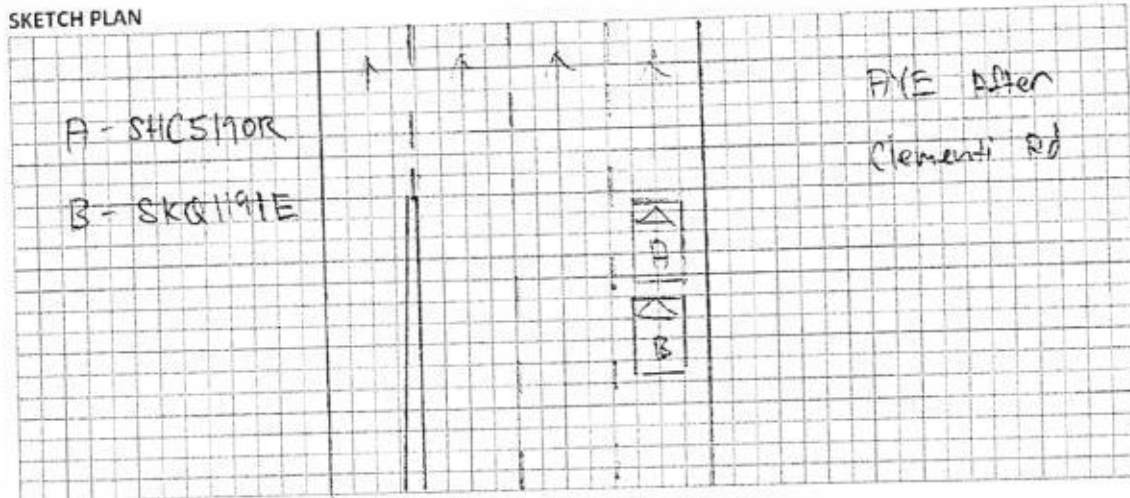

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Please refer to the report.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 3878K

Vehicle Details

Vehicle No.: SHC5190R

Vehicle to be Exported: Yes

Intended De-registration Date: 13 Mar 2018

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2013

Engine No.: M9R8839C000803

Chassis No.: VF1ABL15AUC276727

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 24 Jan 2014

First Registration Date: 24 Jan 2014

Transfer Count: 0

Actual ARF Paid: \$12,498.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 23 Jan 2022

PARF Rebate Amount: \$9,373.00

Intended COE Rebate Details

COE Expiry Date:	23 Jan 2022
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
PQP Paid:	\$60,888.00
COE Rebate Amount:	\$29,380.00
Total Rebate Amount:	\$38,753.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 13 Mar 2018

OK

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHC5190R -*Not Authored
1/1/2018*

Vehicle No.:
Chassis No.:
Vehicle Make:
Vehicle Model:
Date of Accident :
Third Party Insurer :

SHC5190R - JHOW

VF1ABL15AUC276727

RENAULT

LATITUDE

09.03.2018

TOKIO**PART****LIST**

1	1	BUMPER COVER REAR	\$	<i>N/Bu</i> 1,108.46	—
2	1	BUMPER LOWER REAR	\$	<i>Od/W</i> 768.84	—
3	1	BUMPER BRACKET CTR REAR	\$	<i>Sn</i> 113.47	}
4	1	BUMEPR BRACKET SIDE RH REAR	\$	<i>Sn</i> 135.97	
5	1	BUMEPR RETAINER RH REAR	\$	<i>Sn</i> 44.99	
6	1	BUMPER REFLECTOR RH	\$	<i>Sn</i> 43.61	
7	1	BUMEPR BRACKET SIDE LH REAR	\$	<i>Sn</i> 135.97	
8	1	BUMEPR RETAINER LH REAR	\$	<i>Sn</i> 44.99	
9	1	BUMPER REFLECTOR LH	\$	<i>Sn</i> 43.61	
10	1	BUMPER BEAM REAR	\$	<i>R</i> 777.52	
11	1	BUMPER BEAM BRACKET LH REAR	\$	<i>R</i> 225.95	
12	1	BUMPER BEAM BRACKET RH REAR	\$	<i>R</i> 225.95	
13	1	BOOT REAR	\$	<i>R</i> 2,872.68	
14	1	BOOT FINISHER	\$	<i>Sn</i> 470.06	
15	1	BOOT WHEATERSTRIP	\$	<i>Sn</i> 323.05	
16	1	BOOT REFLECTOR LAMP LH	\$	<i>Sn</i> 493.35	
17	1	BOOT REFLECTOR LAMP RH	\$	<i>Sn</i> 493.35	
18	1	BOOT BADGE 'RENAULT'	\$	<i>Nu</i> 225.36	
19	1	BOOT BADGE	\$	<i>Nu</i> 225.36	
20	1	BOOT STRUT LH	\$	<i>Sn</i> 276.08	
21	1	BOOT STRUT RH	\$	<i>Sn</i> 276.08	
22	1	BOOT HINGE LH	\$	<i>R</i> 367.84	
23	1	BOOT HINGE RH	\$	<i>R</i> 367.84	
24	1	BOOT INNER TRIM	\$	<i>Sn</i> 586.45	
25	1	BOOT SWITCH	\$	<i>Sn</i> 168.13	
26	1	BOOT LOCK	\$	<i>R</i> 202.67	
27	1	BOOT LOCK CATCH	\$	<i>R</i> 74.40	
28	2	LICENCE PLATE LAMP	\$	<i>Sn</i> 50.52	
29	2	BOOT RUBBER PLUG	\$	<i>Sn</i> 221.81	
30	1	FENDER PANEL REAR LH	\$	<i>R</i> 3,299.13	
31	1	WHEELARCH REAR LH	\$	<i>Sn</i> 543.47	
32	1	FENDER PANEL REAR RH	\$	<i>R</i> 3,299.13	
33	1	WHEELARCH REAR RH	\$	<i>Sn</i> 543.47	
34	1	TAILLAMP RH	\$	<i>Sn</i> 552.55	

X

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHC5190R -

35	1	TAILLAMP PANEL RH	\$	R	986.70	}
36	1	TAILLAMP LH	\$	Sn	552.55	
37	1	TAILLAMP PANEL LH	\$	R	986.70	
38	1	OUTER PANEL REAR (End Panel)	\$	R	1,471.77	
39	1	OUTER PANEL REAR (End Panel)TRIM	\$	Sn	404.56	
40	1	EXHAUST REAR	\$	R	7,489.05	
41	1	EXHAUST CAP REAR	\$	R	230.49	}

TOTAL	\$	31,723.96
10%	\$	3,172.40
	\$	28,551.56

Special Nett

1	1SET	PARKING AID	\$	<i>Sn</i>	700.00	X
2	1SET	REAR BUMPER CLIP	\$	<i>R</i>	66.00	✓
3	1SET	BUMPER BRACKET CTR CLIP	\$	<i>R</i>	33.00	✓
4	1SET	BUMEP R BRACKET SIDE CLIP RH RR	\$	<i>nn</i>	10.00	X
5	1SET	BUMEP R RETAINER RH CLIP RR	\$	<i>nn</i>	20.00	X
6	1SET	BUMEP R BRACKET SIDE CLIP LH RR	\$	<i>nn</i>	10.00	X
7	1SET	BUMEP R RETAINER CLIP LH RR	\$	<i>nn</i>	20.00	X
8	1SET	BUMPER LOWER REAR RIVET	\$	<i>nn</i>	22.00	X
9	1SET	BUMPER LOWER REAR CLIP	\$	<i>nn</i>	66.00	✓
10	1	EXHAUST MOUNTING REAR	\$	<i>Sn</i>	17.82	}
11	1SET	BOOT FINISHER CLIP	\$	<i>nn</i>	24.20	
12	1	BOOT STICKER "Trans-cab"	\$	<i>nn</i>	30.00	
13	1	BOOT STICKER "6555-3333"	\$	<i>nn</i>	30.00	
14	1	BOOT INNER TRIM CLIP	\$	<i>nn</i>	45.00	
15	1SET	FENDER WHEELARCH REAR RH CLIP	\$	<i>nn</i>	35.00	
16	1SET	FENDER WHEELARCH REAR LH CLIP	\$	<i>nn</i>	35.00	}
17	1	TAILLAMP CLIP RH	\$	<i>nn</i>	5.00	
18	1	TAILLAMP CLIP LH	\$	<i>nn</i>	5.00	}
19	2	REAR WINDSCREEN SELANT	\$	<i>nn</i>	80.00	
20	1	WINDSCREEN MOULDING	\$	<i>nn</i>	100.00	}
21	1	REAR WINDSCREEN INNER SPONGE SEAL	\$	<i>nn</i>	100.00	
22	1	SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	<i>Sn</i>	385.00	}
23	1	SPARE TYRE	\$	<i>Sn</i>	330.00	

TOTAL	\$	2,169.02
TOTAL PARTS	\$	30,720.58

Putty And Spray Painting Of The Affected Portion.

\$ 3,000.00 *2200*

Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	2,800.00 ²⁰⁰¹
To Rust-Proofing Of The Affected Areas.	\$	~ 170.00 X
To reinstall rear bumper parking sensor.	\$	170.00 ⁶⁰¹
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	~ 170.00 X
To repair and realign rear exhaust pipe.	\$	~ 170.00 X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	~ 170.00 X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	~ 170.00 X
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	~ 380.00 X
Towing Fees	\$	~ 120.00 X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	~ 170.00 X
To check steering geometry and computer wheel alignment	\$	~ 220.00X

TOTAL	\$	7,710.00
Over All Total	\$	38,430.58

**(PARTS BY PARTS)
Repair Days**

10 Days

2 days

56

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI18004810/KTBN2

Date: 19/03/2018

REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MX011797
Claimant:	SHC5190R	Insured Vehicle No:	SKQ1191E
Vehicle No:		Nature of Claim:	TP
Date of Loss:	09/03/2018	Claim No:	M1801383

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHC5190R	Engine No:	M9R8839C000803
Make & Model:	RENAULT LATITUDE, 2.0 DCI AUTO D/AB 4DR (A)	Chassis No:	VF1ABL15AUC276727
Reg. Date:	24/01/2014 (Man. Year: 2013)	Odometer:	411160 km
Colour:	Metallic White/Red		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Giti 9 mm	Rear Left Side:	Giti 9 mm
Front Right Side:	Giti 9 mm	Rear Right Side:	Giti 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	30,720.56	1,854.57	28,865.99	93.96
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,710.00	480.00	7,230.00	93.77
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	38,430.56	2,334.57	36,095.99	93.93
Approved Total (Overridden) (S\$)		1,850.00		
(S\$)	38,430.56	1,850.00	36,580.56	95.19
+ GST 7.00/7.00% (S\$)	2,690.14	129.50	2,560.64	95.19
Nett Amount (S\$)	41,120.70	1,979.50	39,141.20	95.19

INSPECTION

Date of Assignment:	14/03/2018
Date Inspected:	13/03/2018 Inspected At:

Trans-cab Auto Services Pte Ltd (Ang Mo Kio)
2, Ang Mo Kio Street 63
Singapore 569111

Estimated Period of Repair: 2.0 days

Adjuster: KENNETH KONG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 19 Mar 2018)
 Parts: 143 RENAULT LATITUDE 2.0 DCI AUTO D/AB 4DR (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: (Unsubmitted, no print-code for SHC5190R)
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER COVER REAR	Dented/Buckled	1,108.46 FL	*1,108.46 FL
2	1		*BUMPER LOWER REAR	Dented/Cut	768.84 FL	*768.84 FL
3	1		*BUMPER BRACKET CTR REAR	Serviceable	113.47 FL	*- FL
4	1		*BUMPER BRACKET SIDE RH REAR	Serviceable	135.97 FL	*- FL
5	1		*BUMPER RETAINER RH REAR	Serviceable	44.99 FL	*- FL
6	1		*BUMPER REFLECTOR RH	Serviceable	43.61 FL	*- FL
7	1		*BUMPER BRACKET SIDE LH REAR	Serviceable	135.97 FL	*- FL
8	1		*BUMPER RETAINER LH REAR	Serviceable	44.99 FL	*- FL
9	1		*BUMPER REFLECTOR LH	Serviceable	43.61 FL	*- FL
10	1		*BUMPER BEAM REAR	Repair	777.52 FL	*- FL
11	1		*BUMPER BEAM BRACKET LH REAR	Repair	225.95 FL	*- FL
12	1		*BUMPER BEAM BRACKET RH REAR	Repair	225.95 FL	*- FL
13	1		*BOOT REAR	Repair	2,872.68 FL	*- FL
14	1		*BOOT FINISHER	Serviceable	470.06 FL	*- FL
15	1		*BOOT WEATHERSTRIP	Serviceable	323.05 FL	*- FL
16	1		*BOOT REFLECTOR LAMP LH	Serviceable	493.35 FL	*- FL
17	1		*BOOT REFLECTOR LAMP RH	Serviceable	493.35 FL	*- FL
18	1		*BOOT BADGE RENAULT	Not Necessary	225.36 FL	*- FL
19	1		*BOOT BADGE	Not Necessary	225.36 FL	*- FL
20	1		*BOOT STRUT LH	Serviceable	276.08 FL	*- FL
21	1		*BOOT STRUT RH	Serviceable	276.08 FL	*- FL
22	1		*BOOT HINGE LH	Repair	367.84 FL	*- FL
23	1		*BOOT HINGE RH	Repair	367.84 FL	*- FL
24	1		*BOOT INNER TRIM	Serviceable	586.45 FL	*- FL
25	1		*BOOT SWITCH	Serviceable	168.13 FL	*- FL
26	1		*BOOT LOCK	Repair	202.67 FL	*- FL
27	1		*BOOT LOCK CATCH	Repair	74.40 FL	*- FL
28	2		*LICENCE PLATE LAMP	Serviceable	50.52 FL	*- FL
29	2		*BOOT RUBBER PLUG	Serviceable	221.81 FL	*- FL
30	1		*FENDER PANEL REAR LH	Repair	3,299.13 FL	*- FL
31	1		*WHEELARCH REAR LH	Serviceable	543.47 FL	*- FL
32	1		*FENDER PANEL REAR RH	Repair	3,299.13 FL	*- FL
33	1		*WHEELARCH REAR RH	Serviceable	543.47 FL	*- FL
34	1		*TAILLAMP RH	Serviceable	552.55 FL	*- FL
35	1		*TAILLAMP PANEL RH	Repair	986.70 FL	*- FL
36	1		*TAILLAMP LH	Serviceable	552.55 FL	*- FL
37	1		*TAILLAMP PANEL LH	Repair	986.70 FL	*- FL
38	1		*OUTER PANEL REAR (END PANEL)	Repair	1,471.77 FL	*- FL
39	1		*OUTER PANEL REAR (END PANEL) TRIM	Serviceable	404.56 FL	*- FL
40	1		*EXHAUST REAR	Repair	7,489.05 FL	*- FL
41	1		*EXHAUST CAP REAR	Repair	230.49 FL	*- FL
42	1		*SET PARKING AID	Serviceable	700.00 FS	*- FS
43	1		*SET REAR BUMPER CLIP	Necessary	66.00 FS	*66.00 FS
44	1		*SET BUMPER BRACKET CTR CLIP	Necessary	33.00 FS	*33.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*SET BUMPER BRACKET SIDE CLIP RH RR	Not Necessary	10.00 FS	*- FS
46	1		*SET BUMPER RETAINER RH CLIP RR	Not Necessary	20.00 FS	*- FS
47	1		*SET BUMPER BRACKET SIDE CLIP LH RR	Not Necessary	10.00 FS	*- FS
48	1		*SET BUMPER RETAINER CLIP LH RR	Not Necessary	20.00 FS	*- FS
49	1		*SET BUMPER LOWER REAR RIVET	Not Necessary	22.00 FS	*- FS
50	1		*SET BUMPER LOWER REAR CLIP	Necessary	66.00 FS	*66.00 FS
51	1		*EXHAUST MOUNTING REAR	Serviceable	17.82 FS	*- FS
52	1		*SET BOOT FINISHER CLIP	Not Necessary	24.20 FS	*- FS
53	1		*BOOT STICKER TRANS-CAB	Not Necessary	30.00 FS	*- FS
54	1		*BOOT STICKER 6555-3333	Not Necessary	30.00 FS	*- FS
55	1		*BOOT INNER TRIM CLIP	Not Necessary	45.00 FS	*- FS
56	1		*SET FENDER WHEELARCH REAR RH CLIP	Not Necessary	35.00 FS	*- FS
57	1		*SET FENDER WHEELARCH REAR LH CLIP	Not Necessary	35.00 FS	*- FS
58	1		*TAILLAMP CLIP RH	Not Necessary	5.00 FS	*- FS
59	1		*TAILLAMP CLIP LH	Not Necessary	5.00 FS	*- FS
60	2		*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*- FS
61	1		*WINDSCREEN MOULDING	Not Necessary	100.00 FS	*- FS
62	1		*REAR WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*- FS
63	1		*SPARE TRYE RIM (ROUE 7J 16H 2547)	Serviceable	385.00 FS	*- FS
64	1		*SPARE TYRE	Serviceable	330.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	33,892.95	2,042.30
- List Item Discount on L Items 10.00/10.00% (\$\$)	3,172.39	187.73
Total Parts (\$\$)	30,720.56	1,854.57

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	3,000.00	220.00
2	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	2,800.00	200.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	-
4	TO REINSTALL REAR BUMPER PARKING SENSOR	New	170.00	60.00
5	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	-
6	TO REPAIR AND REALIGN REAR EXHAUST PIPE	New	170.00	-
7	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE	New	170.00	-
8	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	170.00	-
9	TO TRANSFER OF REAR FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	380.00	-
10	TOWING FEES	New	120.00	-
11	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST	New	170.00	-
12	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	-
Gross Labour Cost (S\$)			7,710.00	480.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >