

**CHENG HOE MOTOR PTE  
LTD  
BLK 1019, YISHUN  
INDUSTRIAL PARK A  
#01-374/382  
SINGAPORE 768761**

**Claim Reference:**  
**Assessment Number: CSLK5079**  
**Version: CHENGHOE/1**  
**Date Calculated: 20/03/2018 06:21**

**Full Report - V1**  
**Registration: SLK5079R**  
**Printed: 20/03/2018 15:57**

**Summary Information**

**Claim**

Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	19/03/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	8 day(s)
Policy Number:	DMHCSN1708051801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

**Vehicle**

Manufacturer:	MAZDA
Model:	2
Sub Model:	BASE MODEL
Model Sheet Number:	I2M 01
Registration:	SLK5079R
Registration Month:	January
Registration Year:	2017
VIN Number:	MM6DL2SAAGW191588
Manufacture Year:	2016
Odometer:	Not Known
Colour:	White
Engine Number:	
Fuel Level:	%

**Model Specs**

FROM 04/2015	AIR CONDITIONING
COOLANT R134A	REAR ELECT WINDOWS
CENTRAL LOCKING	ELECT FOLDING MIRROR
TOE ASSISTANCE	FOG LAMPS
AUTO HEADLAMP LEVEL	PAINTED DOOR MIRRORS
ANTI-THEFT ALARM	REARVIEW CAMERA
1.5 LTR 85KW	AUTO GEARBOX 6 SPEED
STABILITY PROGRAM	TYRES 185/65 TR 15
WHEELS 5.5J X 15 ALU	I-STOP SYSTEM
PASS AIRBAG SWITCH	HEAD AIRBAG
SIDE AIRBAGS	5-DOOR
PREPARE OFF VEHICLE	TWO COAT PEARL/MICA

**Vehicle Condition**

**Vehicle Status**

Pre-Accident Condition:  
Steering:

Brakes Pedal Travel:  
Place of Inspection:  
Pre-Accident Damage:

Tyres Condition:  
Tread Depth LHF:  
Tread Depth LHR:  
Damage Areas:

Severity of Impact:  
Vehicle Status on  
Inspection:

Date of Inspection: 20/03/2018

Tread Depth RHF:  
Tread Depth RHR:  
Direction of Impact:

LKK Auto Consultants hence notify  
the Repairer of the following:

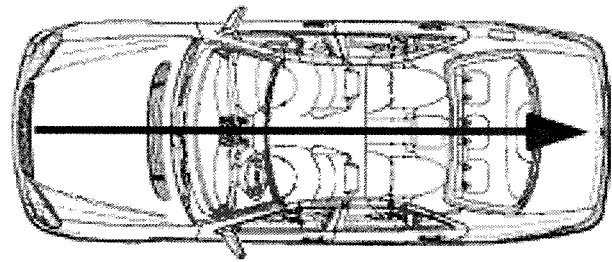
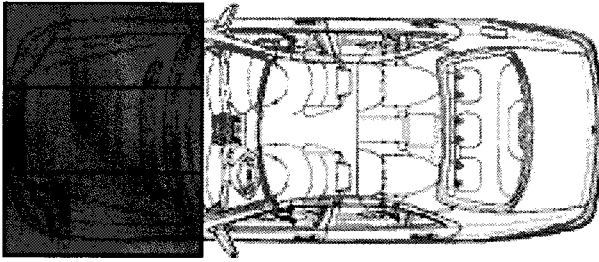
- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

PAGE 1 OF 5

**CHENG HOE MOTOR PTE LTD****Claim Reference:****Assessment Number: CSLK5079****Version: CHENGHOE/1****Date Calculated: 20/03/2018 06:21****Full Report - V1****Registration: SLK5079R****Printed: 20/03/2018 15:57****Addresses****Repairer**

Name : CHENG HOE MOTOR PTE LTD (AMK)

Address :

10. ANG MO KIO IND PK 2A

01-04

Post Code : 568047

**Cost Summary**

Total Labour	\$1,012.20
Total Paint/Material	\$277.09
Total Parts	\$6,023.00
Total of Additional Costs	\$105.00
Excess:	TBA
Grand Total Exc GST:	\$7,417.29
7 % GST:	\$519.21
Grand Total Inc GST:	\$7,936.50

**Repair Information****LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR  
Price/Dent = \$42.00/HR

**Repair /****Guide Number Repair Details**

		<b>WU</b>	<b>Cost Price (\$)</b>
E0201A-R-X	R + R RADIATOR	12.0	50.40
	INCLUDES: R + R FAN		
S0612X-R-X)	R + R FRONT PANEL	9.0	37.80
S0601B-R-X)	R + R LEFT FRONT WING	2.0	8.40
S0601B-R-X)	R + R RIGHT FRONT WING	2.0	8.40
S0201G-R-X	RENEW FRONT BUMPER	9.0	37.80
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS		
T0301C-R-X)	R + R BOTH HEADLAMPS	2.0	8.40
S0503X-R-X	RENEW BONNET	5.0	21.00
	INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE		
S0504B-R-X)	RENEW BONNET HINGE/S	3.0	12.60
F0105X-R-X	R + R AIR CLEANER	3.0	12.60
U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	29.40
U0707X-R-X)	R + R CONDENSER	1.0	4.20
0245	PANEL WORK FRONT	10 20.0*	84.00
1111	REPAIR L/F SIDE MEMBER CPL	10 20.0*	84.00
1112	REPAIR R/F SIDE MEMBER CPL	10 20.0*	84.00

**LABOUR COST**

# CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 20/03/2018 06:21

Full Report - V1

Registration: SLK5079R

Printed: 20/03/2018 15:57

Total Work Units	115.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	11.5HRS	\$483.00
Paint Labour	12.6HRS	\$529.20
Total Labour	24.1HRS	\$1,012.20

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	22.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
1018	LOCK CARR CTR SUPP SURFACE PAINT	4.0	
281	FRONT BUMPER NEW PART PAINT K1R	11.0	
410	GRILLE NEW PART PAINT K1R	4.0	
343	FRT TOWING EYE COVERSURFACE PAINT PLAST.	3.0	
1111	L/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1112	R/F SIDE MEMBER CPL SURFACE PAINT	6.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	
<b>LABOUR COST - PAINT</b>			
<b>TIME(PAINT)</b>		<b>96.0</b>	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		126.0	
Total Paintwork Labour		12.6HRS	\$529.20
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
New Part Painting			\$109.90
New Part Painting - Plastic K1R			\$61.99
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$67.23
Surface Paint Plastic			\$0.37
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$277.09
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$277.09

## PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
8402	1	AIR DUCT HOUSING	P53T133AY		0% 42.00* ✓
8403	1	AIR FILTER RESONATOR	P53N13195		0% 70.00* ✓
8401	1	AIR FILTER UPPER HSG	P53T133AX		0% 45.00* ✓
471	1	BONNET	DAY05231X		0% 380.00* ✓
493	1	BONNET LOCK	D09K56620		0% 80.00* ✓
974	1	BONNET LOCK COVER	DA6T56627		0% 18.00* ✓
4465	1	CONDENSER	DF7B61480A		0% 420.00* ✓
7787	1	EXPANSION TANK	P53W15351A		0% 35.00* ✓
7788	1	EXPANSION TANK CAP	P53W15355		0% 15.00* ✓

# CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSLK5079

Version: CHENGHOE/1

Date Calculated: 20/03/2018 06:21

Full Report - V1

Registration: SLK5079R

Printed: 20/03/2018 15:57

530	1	FRONT BONNET SEAL	DA6T56770	0%	LM	40.00*	✓
281	1	FRONT BUMPER	DA6J50031GBB	0%	B	450.00*	✓
431	1	FRONT MANUFACT BADGE	LD4751731	0%	CM	18.00*	✓
1009	1	FRONT PANEL	DA6V53110C	0%	CM	210.00*	✓
293	1	FRT BUMPER ABSORBER	DA6V50111	0%		60.00*	?
340	1	FRT BUMPER SUPPORT	D09H50070	0%		230.00*	?
336	1	FRT CTR BUMPER REINF	DA6V500S0C	0%		60.00*	?
529	1	FRT ENGINE COMP SEAL	DA6T56750A	0%	LM	50.00*	✓
410	1	GRILLE	DA6B50712A	0%	CM	150.00*	✓
1000	1	H/LAMP LWR BRKTS X 2	Renew	0%		20.00*	?
9645	1	HORN	D09W6679Y	0%		80.00*	?
475	1	L/BONNET HINGE	D09H52420	0%	D1	28.00*	✓
355	1	L/F BUMPER BRACKET	DA6J500U1B	0%	CM	14.00*	?
317	1	L/F BUMPER GUIDE	DA6J50132A	0%	CM	18.00*	?
561	1	L/F HEADLAMP	DA6J510L0A	0%	mgcm	920.00*	✓
741	1	L/F WING	DA6V52211	0%	Bm	145.00*	✓
365	1	L/GRILLE MOULDING	DA6B507K0	0%	CM	90.00*	✓
1018	1	LOCK CARR CTR SUPP	DA6V5215Y	0%	B	25.00*	✓
476	1	R/BONNET HINGE	D09H52410	0%	D1	28.00*	✓
356	1	R/F BUMPER BRACKET	DA6J500T1B	0%		14.00*	?
318	1	R/F BUMPER GUIDE	DA6J50122A	0%		18.00*	?
562	1	R/F HEADLAMP	DA6J510K0A	0%	mgcm	920.00*	✓
742	1	R/F WING	DA6V52111	0%	Bm	145.00*	✓
366	1	R/GRILLE MOULDING	DA6B507J0	0%	CM	90.00*	✓
425	1	RAD GRILLE BRACKET	DA6B50717A	0%		55.00*	?
7761	1	RADIATOR	P53W15200	0%		430.00*	?
7764	1	RADIATOR SHROUD CPL	P53W15025	0%		490.00*	?
1021	1	UPP FRT PANEL COVER	DA6V53175	0%	CM	20.00*	✓

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Sub Total

Sundry Parts

Total Parts

(Fixed)

\$5,923.00

\$100.00

\$6,023.00

## NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

### Extras

Description	Betterment	Price
COOLANT	0%	\$20.00
AC GAS		\$50.00
FRT NO PLATE	0%	\$35.00
<b>Total Extras</b>		<b>\$105.00</b>

### Final Calculation

<b>Total Parts</b>	<b>\$6,023.00</b>
<b>Labour</b>	
Total Panel/Mechanical	\$483.00
Total Paintwork	\$529.20
<b>Total Labour</b>	<b>\$1,012.20</b>
<b>Additional Costs</b>	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$105.00
<b>Total of Additional Costs</b>	<b>\$105.00</b>
<b>Total Paint/Material Costs</b>	<b>\$277.09</b>

**CHENG HOE MOTOR PTE LTD**

**Claim Reference:**

**Assessment Number: CSLK5079**

**Version: CHENGHOE/1**

**Date Calculated: 20/03/2018 06:21**

**Full Report - V1**

**Registration: SLK5079R**

**Printed: 20/03/2018 15:57**

---

**Grand Total Excludes GST**

**\$7,417.29**

GST @ 7 %

**\$519.21**

**Grand Total Includes GST**

**\$7,936.50**

---

**Assessment Notes**

---