

22/03/2018

AS REC. BY:

REF: CS/SPF/18005320/Kgbst Special Instruction:

Surveyor:

ASSIGNMENT (Office)

From (Person): Abdul Rahman of SPF Date/Time: 21/03/2018

Estimated Cost: Bill to:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV7CS

To Inspect Vehicle No: SDE 1666Z Insured: QX 319D

at Workshop m/s Leong Auto Tel: 6266 6448

of 160 Sin Ming Drive #02-13

Policy No: Claim No: AEMD/105/009/2018/027

Sum Insured: Excess:

Make of Veh: D.O.A. 19-03-2018

(Client's Record)

CA / REV / REP. / REV 24 HRS Wp

Date/Time: 21/03/2018 9:35 AM Person Contacted: Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate	Not Finalise
	SDE 1666Z - x	
	QX 319D - CS/SPF/18005320/103	Est: 120218
	Submit LS #1650, 14 days, (Red B 31675.56, 692)	

REF: SPF

ASSIGNMENT

From: Date: 21/03/2018

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SDE 1666Z

at Workshop m/s: Wong Auto

of 160 Sim Mong Drive #02-13

Insured

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: \$ 78k

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 14 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SDE 1666Z Yr Regn: 05 16

Type: ☒ M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda Vezel 1496

Colour:

M.P. White A/C Insured / Std / NI / NA

Sp. Reading:

037312 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

RUI 1117133

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: Nil / ☒ STD A/Rim or

Tyre Size: F:

225/45R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6 mm

R/Bal. 6 mm

L/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 19/3 118

D.O.A. 21/3/18

Survey held at

Des. of Damages: Fnt / ☒ Rear / O/S / N/S / U/C / Rooftop or

4 PM

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

22/3 File pass to Catherine

RECEIVED 11 JUN 2018

Date/Time, File Pass to?

☐

Preli. Report

11/6 twist

☐

Final Report

Date/Time, File Return to?

Days Of Repair: 14

Resurvey No. of Trip: 2

Survey Fee:

280

Transportation:

1. S + RS 9

2. Photo

3. Other

4. Other

5. Other

21

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech Insp (\$)

☐

Weekend (\$)

Report Format: 70

Lump Sum / B.T. (\$)

15600



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION

Ref : CS/SPF18005320/Kqb

ACCIDENT CLAIM SECTION
(SINGAPORE POLICE FORCE)

1 MOUNT PLEASANT ROAD

BLK 8 OLD POLICE ACADEMY SINGAPORE 298333

Date : 21-03-2018



Code : SPF

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	QX 319D	Veh. Inspected	SDE 1666Z
Policy No.		Coverage (\$)	0.00
Claim No.	AEMD/105/009/2018/027	Excess (\$)	0.00
Assign From	ABDUL RAHMAN	Assign Date	21/03/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	12/02/2018	Inspection Date	21/03/2018
Survey held at	LEONG AUTO PTE LTD 160 SIN MING DRIVE #02-13 SIN MING AUTOCITY SINGAPORE 575722		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.



SINGAPORE POLICE FORCE

SPF Accidents Claims Section
Automotive Engg & Mgmt Div
Police Logistics Department
No. 1 Mount Pleasant Road
Block 8 Old Police Academy
#02-12 Singapore 298333

Your Ref : SDE1666Z

Our Ref : AEMD/105/009/2018/027

Date : 20 March 2018

Tel: 64784840

Fax: 64784848

M/s LKK Auto Consultants Pte Ltd
Paya Ubi Industrial Park
51 Ubi Avenue 1 #01/02-25
Singapore 408933

Via Fax Only: 62564315

Dear Sir,

**RTA ON 12 FEBRUARY 2018 INVOLVING GOVT VEHICLE QX319D AND OTHER VEHICLE
SDE1666Z**

We refer to the above matter.

- 2 Please arrange for a Pre- Repair Inspection of vehicle no. **SDE1666Z** at **M/s Leong Auto Pte Ltd** of **160 Sin Ming Dr #02-13 Sin Ming AutoCity, Singapore 575722.**
- 3 For appointment kindly contact Shawn/Emellene at Tel: 62666448.
- 4 Estimates were not provided by the workshop.
- 5 Thank you.

Yours faithfully,

Abdul Rahman
Accident Claims Officer
for ASST DIRECTOR

A FORCE FOR THE NATION

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	19/03/2018 14:52
Date Of Accident	19/03/2018 09:25
Exact Location Of Accident	93 TOA PAYOH CENTRAL COMMUNITY BUILD BASEMENT CP
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SDE1666Z
Insured/Policyholder	
Name Of Registered Owner	NG PENG HONG
NRIC No	S7510743I
Email Address	SIMONNG99@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-98366776
Alternative Phone No	OFFICE-63546246

Vehicle Particulars

Manufacturer	HONDA
Model	VEZEL-1.5 (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category PRIVATE CAR

Insurance Company

Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	5089379541
Cover Note Number	

Driver

Name of Driver	NG PENG HONG
NRIC No	S7510743I
Date Of Birth	08/04/1975
Occupation	INDOOR
Date Of Driving Pass	16/06/1997
Driving Experience	20 YEARS AND 9 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98366776
Fax Number	
Contact Number	OFFICE-63546246
EMail Address	SIMONNG99@HOTMAIL.COM

Address	BLK 700C #08-324 ANG MO KIO AVENUE 6
Postcode	563700
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLIDED INTO PARKED VEHICLE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	0

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	TOA PAYOH NEIGHBOURHOOD POLICE CENTRE
Police Station Address	ROAD: 93 TOA PAYOH CENTRAL TOA PAYOH COMMUNITY BUILDING , POSTCODE: 319194 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-2519999 - FAX NO: 63548749
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

AS PER POLICE REPORT No.E/20180319/2015

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	QX587X
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	GOVERNMENT
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

Accident Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE

1. Please do not collectible data and do not submit to speed up the claims process
2. The sketch plan is completed by the Policyholder and/or the Authorised Driver
3. All information provided must be truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow the insurer(s) to repudiate policy liability.
4. The collection of information in this form by insurance companies is not an admission of policy liability on the part of the insurance company(s).
5. Any false reporting may be referred to the Police for investigation
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I/We/Us/You acknowledge, agree and consent that:
 - (a) My/our/s, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Strata Management Authority of Singapore and any relevant government agency/authority (such as the police), for the purposes of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiry by me;
 - (iv) administering my claims including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external carrier of envelopes/mail packages; and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes");
 - (b) all insurers who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
 - (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
 - (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud;
 - (ii) regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (iii) for compliance with requirements under my regulations, laws or court orders;

Policyholder's Signature
Date & Time:

Driver's Signature
(If Driver is not the policyholder)
Date & Time:


IBAC WORKING WITH YOU
23 JANUARY 2024
Reporting Centre Personnel's Signature
Name: NRIC No: Email:

Accident Sketch Plan Pg. 1

SKETCH PLAN

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Police report 1/20150319/215

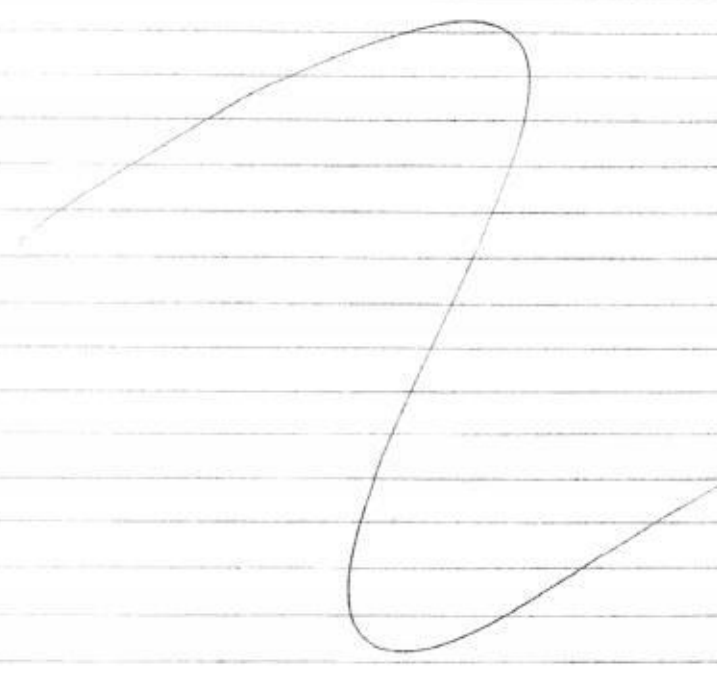

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time

Driver's Signature

(If driver is not the policyholder)

Date & Time

TDAC RACI SURVEILLANCE

23 KAHLEKIT AVE 4

Surrey BC V4A 1S9

Reporting Centre Person's Signature

Name: Date: 07/07/2015

(Signature) (Date) (Signature)



**SINGAPORE
POLICE FORCE**



E/20180319/2015

1 of 1

POLICE REPORT (NP299)

Report No. E/20180319/2015

Police Station Of Origin
Toa Payoh N.P.C
93 Toa Payoh Central #01-02 Toa Payoh
Community Building SINGAPORE 319194
Tel No: 1800-2519999

Date/Time Report Made 19/03/2018 10:50	Vide Report No. E/20180319/0053	Station Diary No.	
Name Of Informant NG PENG HONG	Address 93 Toa Payoh Central #01-02 Toa Payoh Community Building SINGAPORE 319194		
ID Type / ID No. NRIC NO / S75107431	Contact No. Home/Office 63546246	Mobile 98366776	
Nationality SINGAPORE CITIZEN	Email Address NG Peng Hong@spf.gov.sg		
Occupation Police officer	Sex Male	Age 42	Date of Birth 08/04/1975
Institution/School Name	Language English	Race Chinese	
Date/Time Of Incident 19/03/2018 09:25 - 19/03/2018 09:25	Location Of Incident 93 TOA PAYOH CENTRAL TOA PAYOH CTRL COMMUNITY BLDG* SINGAPORE 319194 Basement carpark		

Brief details.

On 19 Mar 2018, at about 0920hrs, I was informed by my colleague SI Tan Chung Sin that a Police car: QX 587X had accidentally reserved into my stationary vehicle: SDE 1666Z. The location of the incident is at 93 Toa Payoh Central, Toa Payoh Community Building basement car park. The front and rear of my car are badly damaged due to the impact. I am lodging this report for insurance claim.

Signature Of Officer Recording The Report: E / ASP NG PENG HONG	Signature Of Informant:
Signature Of Interpreter: Not applicable	Date/Time: 19/03/2018 10:50
Officer In-Charge Of Case: E / Tanglin Police Divisional Investigation Branch / ASP SHAUN LIM YUNG SHEN Contact No.:	Classification Of Case:

Authentication Stamp

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	0743I
Vehicle Details	
Vehicle No.:	SDE1666Z
Vehicle to be Exported:	No
Intended De-registration Date:	22 Mar 2018
Vehicle Make:	HONDA
Vehicle Model:	VEZEL 1.5X CVT ABS D/AIRBAG 2WD 5DR
Primary Colour:	White
Manufacturing Year:	2016
Engine No.:	L15B4037145
Chassis No.:	RU11117133
Maximum Power Output:	96.0 kW (128 bhp)
Open Market Value:	\$20,132.00
Original Registration Date:	16 May 2016
First Registration Date:	16 May 2016
Transfer Count:	1
Actual ARF Paid:	\$10,185.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	15 May 2026
PARF Rebate Amount:	\$7,638.00
Intended COE Rebate Details	
COE Expiry Date:	15 May 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$47,300.00
COE Rebate Amount:	\$38,530.00
Total Rebate Amount:	\$46,168.00

The information contained herein is correct as at 22 Mar 2018

OK

SGCARMART.COM

Login Sign up

New Cars

Used Cars

Sell My Car

Directory

Products

Insurance

Articles

Forum

Resources

SELL YOUR CAR YOURSELF

Get listed until it's sold + we will handle all the paperwork!



POST AN AD NOW!

Post an Advertisement

Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

New 5 Year Coe Renewal Honda Stream 1.8A RSZ



\$2800 Downpayment Monthly
From \$738 Onwards, Lowest
3.68% P.A. @ GV Cars Financing
GV Credit Pte Ltd StarAd

KA-HUP

**VALUE FOR MONEY
VALUE FOR TIME
A PEACE OF MIND**

HOTLINE: 6741 9997

VIEW OUR CARS

Browse by Category

◀ Back (1 2 3 4 5 6) Next ▶

Sort by Date Posted

20 results/page

112 vehicles

honda vezel

Advanced Search

Submit

Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
honda vezel		Any	Any	2016	Any	Any	Any	Available



Honda Vezel 1.5A X

\$79,800

\$9,140 /yr

18-May-2016

1,496 cc

12,000 km

SUV

Available

Well Maintained By Previous Owner, Accident Free. Most Popular Compact SUV. Call Now To Make Your Appointment!

Benefit Auto Enterprise Pte Ltd

Posted: 22-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

PREMIUM AD



Honda Vezel 1.5A X

\$76,000

\$8,780 /yr

08-Apr-2016

1,496 cc

34,000 km

SUV

Available

Posted: 22-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

BEST OF COMBAT



Honda Vezel 1.5A X

\$82,000

\$9,000 /yr

16-Aug-2016

1,496 cc

22,278 km

SUV

Available

One Owner Only, Beautiful White Unbelievable Selling At Lowest Depreciation, Genuine Lowest Mileage Invoices Shown Proof With 100% Guaranteed Just Inspected Vezel 1.5 x In The Market. Fully Maintained...

Posted: 22-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

PREMIUM AD



Honda Vezel 1.5A X

\$79,999

\$8,910 /yr

08-Aug-2016

1,496 cc

13,242 km

SUV

Available

Brand New Condition, Low Mileage, Fuel Economical Car, 1 Year Warranty/2 Free Servicing. Buy With A Peace Of Mind With Accredited Company For More Than 20 Years, High Trade In Price, In House Loan Ava...

Posted: 22-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

PREMIUM AD

Car Buying

Car Selling

Car Ownership

Car Aftermarket

On The Move

Lifestyle



Honda Vezel 1.5A X

\$79,800

\$9,170 /yr

20-May-2016

1,496 cc

18,500 km

SUV

Available

Popular And Beautiful Black On Black SUV With It's Spacious Cabin, Quality Interior (Changed To Leather), Smooth Ride, With Excellent Generous Space. Reliability Is Absolute Without Doubt And Offers H...

Posted: 22-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X

\$81,500

\$9,020 /yr

18-Aug-2016

1,496 cc

18,500 km

SUV

Available

This Is NOT A UBER Car! Like A Virgin! Premium DVD Player With Built-In 8" GPS/Bluetooth Interface Worth \$1.5K. V-kool Titanium 99.9% Solar Firm Worth \$1400. Free 3 Times Premium Servicing! Always Par...

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

PREMIUM AD



Honda Vezel 1.5A S

\$80,800

\$9,400 /yr

07-Jan-2016

1,496 cc

35,000 km

SUV

Available

1 Owner Only, Selling Due To Upgrade! Road Tax Till July! High Specs "S" Model! Lowest Depreciation, Good Fuel Efficiency, Servicing Maintenance Done Promptly, 100% Non Private Hire Vehicle, Condition...

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

CONFIDENTIAL



Honda Vezel 1.5A X Honda Sensing

\$84,800

\$9,160 /yr

12-Oct-2016

1,496 cc

18,000 km

SUV

Available

Up To 90% Loan, Low Downpayment, Flexi Bank/In House Loan, New Facelifted Honda Vezel 1.5A x With Honda Sensing Model, 100% Accident Free, Welcome Trade In, Please Call Us Now!

Autotruster Traders Pte Ltd

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

PREMIUM AD



Honda Vezel 1.5A X \$79,800 \$9,140 /yr 18-May-2016 1,496 cc 12,000 km SUV Available

New Arrival! Cheapest In The Market! \$3000 Drive Away! Look Like New Car Seldom Use! High Trade In Welcome! Call Me Now To View The Car Before It's Sold!

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$80,800 \$9,170 /yr 13-Jun-2016 1,496 cc 22,000 km SUV Available

1 Owner, This Is Not An UBER Car, Very Low Mileage Done, Well Groomed And Taken Care Off By Careful Owner, Trade In Welcomed, In House And Bank Loan Available With Flexible Interest Rates, Kindly Cont...

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



That Special Number In Your Heart

Want to remember the good times? Need to earn some brownie points? Got a lucky number or a special date you want embedded on your car plate? Find out if they are on sale and it could just be yours!

Find out more!



Honda Vezel 1.5A S \$87,888 \$9,570 /yr 15-Jul-2016 1,496 cc 16,000 km SUV Available

1 Owner, High Specs "S" Model Up For Grab! Depreciation Same As Normal Vezel, Extremely Low Mileage, Good Fuel Efficiency, High ARF \$16K, Servicing Maintenance Done Promptly, 100% Non Private Hire Ve...

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$83,800 \$9,230 /yr 07-Sep-2016 1,496 cc - SUV Available

Free Choice Of Colour, Brand New Leather Interior + Choice Of Colour Carpet + Brand New Pioneer DVD With Reverse Camera! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premi...

88 Motor Trading

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A S \$93,888 \$10,510 /yr 13-May-2016 1,496 cc - SUV Available

10% Down Payment, 10 Years Loan Available!

Posted: 21-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$82,800 \$9,220 /yr 29-Aug-2016 1,496 cc - SUV Available

Free Choice Of Colour, Brand New Leather Interior Plus Choice Of Colour Carpet, Brand New Pioneer DVD With Reverse Camera! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premi...

88 Motor Trading

Posted: 20-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$79,800 \$9,140 /yr 18-May-2016 1,496 cc 13,202 km SUV Available

Very Low Mileage Done, Well Groomed And Taken Care Off By Careful Owner, Trade In Welcomed, In House/Bank Loan Available With Flexible Interest Rates, Kindly Contact Our Sales Advisor For An Appointment...

Benefit Auto Enterprise Pte Ltd

Posted: 20-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel Hybrid 1.5A X \$86,888 \$10,130 /yr 20-Jul-2016 1,496 cc 38,000 km SUV Available

Fuel Type: Petrol-Electric

Equipped With Honda Sensing Safety Feature, As Good As New! Extremely Well Maintained By Owner Who Pays Attention To Detail! 100% Accident Free!

Posted: 20-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$79,800 \$9,170 /yr 19-May-2016 1,496 cc - SUV Available

Free Choice Of Colour, New Leather Interior, Choice Of Colour Carpet, New Pioneer DVD With Reverse Camera! \$0 Down Payment Available! Fast And Easy Loan Approval! Buy With Confidence! No Hidden Cost! ...

88 Motor Trading

Posted: 20-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$79,800 \$9,170 /yr 09-May-2016 1,496 cc - SUV Available

Brand New Leather Interior Plus Choice Of Colour Carpet Plus Brand New Pioneer DVD With Reverse Camera! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premium Dealer 2015-201...

88 Motor Trading

Posted: 20-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda



Honda Vezel 1.5A X \$85,800 \$9,810 /yr 30-May-2016 1,496 cc 32,963 km SUV Available

Popular Honda Vezel With 1.5L Engine Providing Adequate Power For Your Daily Drive! Compact Exterior Give You The Ability To Squeeze Through Tight Urban Confines, Yet Giving You The Sense Of Roominess...

Select By Performance Premium Selection

Posted: 20-Mar-2018 Tags: 2016 Honda Vezel, Honda Vezel, Honda, Vezel, Used Honda

Honda Vezel 1.5A X \$78,000 \$9,340 /yr 29-Jan-2016 1,496 cc 25,400 km SUV Available

LEONG AUTO PTE LTD

160 Sin Ming Drive, Sin Ming AutoCity, #02-13, Singapore 575722

Tel: 62666448 Fax: 62666358 Email: Sales@leongauto.com.sg

Business Registration No. 201312846W

GST Registration No. 201312846W

*Not Authorised
L1 Per 8?
Recovery After Rain*

ESTIMATE

Date: 19/3/2018

DOA: 19/3/2018

Vehicle No: SDE1666Z

Make & Model: Honda Vezel

S/N	Qty	Item Description	Parts Price	Surveyor
1	1	Front Bonnet	\$ 1,313.90	✓
2	1	Front Bonnet Lock Mechanism	\$ 256.60	✓
3	2	Front Bonnet Side WeatherStrip (Middle)	\$ 54.80	X
4	2	Front Bonnet Side WeatherStrip (Long)	\$ 68.30	X
5	2	Front Bonnet Side WeatherStrip (Short)	\$ 62.10	?
6	1	Front Support Panel	\$ 809.60	?
7	1	Front Support Panel Top Garnish	\$ 262.60	X
8	1	Front Support Panel Bracket	\$ 120.70	?
9	2	Front Horns	\$ 147.30	X
10	1	Front Air-Con Condenser Assy	\$ 966.00	?
11	1	Front Radiator Assy	\$ 1,439.70	?
12	1	Front Radiator Fan With Motor	\$ 354.80	X
13	1	Front Radiator Fan Cowling	\$ 128.90	X
14	2	Front Radiator Mountings	\$ 54.50	X
15	1	Front Radiator Spare Tank	\$ 67.40	✓
16	2	Front Radiator Air Guide	\$ 189.30	?
17	1	Front Air Duct	\$ 152.30	X
18	1	Front Grille	\$ 408.30	✓
19	2	Front Grille Outer Chrome	\$ 412.60	✓
21	1	Front Grille Inner Base	\$ 539.10	?
22	2	Front Head Lamp	\$ 3,655.60	?
23	2	Front Head Lamp Bracket (Big)	\$ 123.10	X
24	2	Front Head Lamp Bracket (Small)	\$ 106.00	X
25	1	Front Bumper Assy	\$ 778.50	✓
26	1	Front Bumper Reinforcement	\$ 543.50	✓
27	2	Front Bumper Reinforcement Garnish	\$ 160.00	?
28	2	Front Bumper Side Retainer	\$ 108.00	✓
29	1	Front Bumper Tow Cover	\$ 56.80	X
30	2	Front Bumper Fog Lamp	\$ 650.20	X
31	2	Front Bumper Fog Lamp Outer Garnish	\$ 60.00	✓
32	2	Front Bumper Fog Lamp Bracket	\$ 139.10	X
33	1	Front Bumper Lower Lip	\$ 367.50	?
34	1	Front Bumper Lower Grille	\$ 204.70	X
35	1	Front Engine Lower Cover	\$ 196.60	X
36	2	Front Fender	\$ 901.40	X
37	2	Front Fender Inner Shield	\$ 277.80	X
38	2	Front Fender Garnish (Protector)	\$ 175.30	X
39	1	Front Object Braking System	\$ 3,580.50	?
40	1	Front Outer Temperature Sensor	\$ 161.40	X
41	1	Front Outer Temperature Sensor Bracket	\$ 85.70	X
			\$ 20,140.50	
		Less 20%	\$ 4,028.10	
			\$ 16,112.40	

Special Nett Items				
1		Sundries	\$	50.00
2	1 set	Front Support Panel Top Garnish Clips	na \$	80.00
3	1	Front Radiator Coolant	\$	160.00
4	1 set	Front Air Duct Clips	na \$	50.00
5	1 set	Front Grille Clips	na \$	80.00
6	1	Front Grille Centre Logo	na \$	150.00
7	2 set	Front Head Lamp Clips	na \$	80.00
8	1 set	Front Bumper Assy Clips	na \$	50.00
9	2 set	Front Bumper Fog Lamp Clips	na \$	80.00
10	2 set	Front Bumper Fog Lamp Outer Garnish Clips	na \$	80.00
11	2	Front Bumper Day Light	\$	580.00
12	1 set	Front Bumper Lower Lip Clips	na \$	120.00
13	1 set	Front Bumper Lower Grille Clips	na \$	80.00
14	1 set	Front Engine Lower Cover Clips	na \$	120.00
15	2 set	Front Fender Garnish (Protector) Clips	na \$	80.00
16	1 set	Front No. Plate with Garnish	cm \$	80.00
			\$	1,920.00
Total parts			\$	18,032.40

S/N	Qty	Item Description	Parts Price	Surveyor
1	1	Rear Tail Gate	B \$ 1,646.60	✓
2	1	Rear Tail Gate Spoiler	sm \$ 720.00	X
3	1	Rear Tail Gate WeatherStrip	D/S / \$ 145.00	✓
4	1	Rear Tail Gate Inner Trim Board	\$ 583.00	?
5	2	Rear Tail Gate Inner Top Side Garnish	sm \$ 183.70	X
6	1	Rear Tail Gate Inner Top Garnish	sm \$ 79.00	X
7	2	Rear Tail Gate Side Damper	sm \$ 380.00	X
8	1	Rear Tail Gate Outer Handle Switch	sm \$ 295.30	X
9	1	Rear Tail Gate Lock Mechanism	na \$ 290.00	✓
10	1	Rear Tail Gate Lock Catch	na \$ 38.00	X
11	2	Rear Tail Gate Hinges	na \$ 90.00	X
12	1	Rear Tail Gate Inner Handle	sm \$ 27.50	X
13	1	Rear Tail Gate Trim Cover	sm \$ 26.00	X
14	1	Rear Tail Gate Outer Moulding	D/S \$ 340.00	✓
15	2	Rear Tail Gate Outer Moulding No. Plate Lamp	sm \$ 75.80	X
16	1	Rear Tail Gate Windscreen Moulding	na \$ 85.00	✓
17	2	Rear Tail Gate Stopper	sm \$ 30.00	X
18	1	Rear Tail Gate 3rd Brake Light	sm \$ 350.00	X
19	2	Rear Tail Gate Reflector Lamp	cm \$ 839.90	✓
20	1	Rear Tail Gate "Vezel" Emblem	sm \$ 67.10	X
21	1	Rear Tail Gate Outer Moulding Reverse Camera	sm \$ 1,211.90	X
22	1	Rear Bumper	Bu \$ 850.00	✓
23	2	Rear Bumper Side Retainer	ols D/S \$ 76.00	✓
24	2	Rear Corner Bumper	ols Bu \$ 536.20	✓
25	2	Rear Corner Bumper Retainer	ols D/S \$ 80.80	✓
26	2	Rear Bumper Reflector	cm \$ 323.40	✓
27	2	Rear Tail Lamp	na / cm \$ 960.00	✓
28	2	Rear Tail Lamp Panel	na \$ 290.00	X
29	1	Rear End Panel	\$ 560.00	?
30	1	Rear End Panel Top Garnish	\$ 184.00	?
31	1	Rear Sound Beep	sm \$ 250.00	X
32	1	Rear Spare Tyre Panel	na \$ 1,230.00	X
33	2	Rear Spare Tyre Side Panel	na \$ 650.00	X
34	1	Rear Spare Tyre Panel Bottom Bracket	na \$ 160.00	✓
35	1	Rear Spare Tyre Panel Sensor	\$ 191.90	?
36	1	Rear Spare Tyre Panel Side ELDC Sensor	sm \$ 1,285.40	X

37	1	Rear Cross Beam (Horizontal)	N	\$	204.00	X
38	1	Rear Cross Beam (Vertical)	N	\$	521.70	X
39	1	Rear Tow Bracket	N	\$	75.00	X
40	1	Rear Spare Tyre Panel Lower Cover	Sm	\$	219.20	X
41	2	Rear Air Duct Ventilator	Sm	\$	132.40	X
42	2	Rear Fender Protector	cl / Bn	\$	330.00	✓
43	2	Rear Fender Inner Shield	Sm	\$	320.00	X
44	2	Rear Fender Inner Trim Board Bottom	Sm	\$	520.00	✓
45	2	Rear Fender Inner Trim Board Top	Sm	\$	320.00	X
46	1	Rear Spare Tyre Tools Sponge	Sm	\$	260.90	X
47	1	Rear Spare Tyre Top Board	Sm	\$	300.00	✓
48	1	Rear Exhaust Muffler	N	\$	920.00	X
49	1	Rear Exhaust Centre Pipe	N	\$	850.00	X
50	2	Rear Exhaust Mounting	Sm	\$	254.10	✓
51	1	Rear Exhaust Heat Shield	N	\$	64.50	X
52	2	Rear Strut Bar	N	\$	285.00	X
53	2	Rear Axle Bushing	S.	\$	292.40	?
54	2	Rear Knuckle Bearing		\$	761.70	?
55	2	Rear Knuckle Bearing Hub		\$	473.80	?
56	2	Rear Suspension		\$	522.90	?
57	1	Rear Axle		\$	1,942.60	?
58	2	Rear Axle Lower Cover		\$	58.50	?
				\$	24,760.20	
		Less 20%		\$	4,952.04	
				\$	19,808.16	
		<u>Special Nett Items</u>				
1		Sundries		\$	50.00	?
2	1	Rear Tail Gate Windscreen Moulding Sealant	N	\$	120.00	400m
3	1	Rear Tail Gate Windscreen Moulding Damping Seal	N	\$	120.00	300m
4	2 set	Rear Tail Gate Reflector Lamp Clips	N	\$	80.00	X
5	1 set	Rear Tail Gate Outer Moulding Clips	..	\$	80.00	?
6	1 set	Rear Tail Gate Inner Trim Board Clips		\$	80.00	?
7	1	Rear Tail Gate Centre Logo	N	\$	150.00	✓
8	1	Rear End Panel Sealant		\$	120.00	?
9	1 set	Rear End Panel Top Garnish Clips		\$	50.00	?
10	1	Rear Spare Tyre Panel Sealant	N	\$	120.00	X
11	1 set	Rear Spare Tyre Panel Lower Cover Clips	N	\$	80.00	X
12	2	Rear Tail Lamp Sealant	N	\$	80.00	X
13	2 set	Rear Tail Lamp Clips	N	\$	50.00	X
14	2 set	Rear Fender Inner Trim Board Clips	N	\$	120.00	X
15	2 set	Rear Fender Inner Shield Clips	N	\$	80.00	X
16	2 set	Rear Fender Protector Clips	N	\$	50.00	X
17	2 set	Rear Corner Bumper Clips	N	\$	80.00	X
18	1 set	Rear Bumper Clips	N	\$	50.00	✓
19	1	Rear Exhaust Gasket	N	\$	45.00	X
20	2	Rear Tyre	Sm	\$	480.00	X
21	2	Rear Rim	Sm	\$	980.00	X
22	1 set	Rear No. Plate with Garnish	Sm	\$	80.00	X
23	1 set	Rear Reverse Sensor	N	\$	300.00	200m
				\$	3,445.00	
		Total Parts		\$	23,253.16	
	S/N	Labour Description		Amount	Amount	

1	Labour for panel beating, cut, weld, straighten front fenders and replace front damaged parts.	\$ 1,400.00	6001
2	To putty and spray painting front portion.	\$ 1,400.00	8001
3	To check wiring and focus front head lamp.	\$ 80.00	201
4	To remove and install front bonnet lock mechanism.	nn \$ 120.00	X
5	To remove and install front windscreen.	nn \$ 120.00	X
6	To remove and install air con system to facilitate the repair and refill gas.	\$ 120.00	?
7	To remove and install cooling system to facilitate the repair and check for leakage.	nn \$ 120.00	X
8	To apply anti rust proofing to front affected area.	\$ 250.00	Rec 301
9	Labour for panel beating, cut, weld, straighten and replace rear damaged parts.	\$ 1,800.00	7001
10	To putty and spray painting rear portion.	\$ 1,600.00	8001
11	To check rear lighting and wiring.	\$ 80.00	201
12	To remove and install rear tail gate lock mechanism.	\$ 120.00	601
13	To remove and install inner garnish and trim to facilitate the repair.	\$ 380.00	601
14	To apply anti rust proofing to rear affected area.	\$ 250.00	601
15	To remove and install rear reverse camera.	\$ 150.00	} 801
16	To remove and install rear reverse sensor.	\$ 150.00	
17	To remove and install rear windscreen.	\$ 120.00	✓
18	To adjust chassis alignment.	\$ 380.00	?
19	To perform 4 wheel alignment and balancing.	\$ 150.00	801
20	To remove rear undercarriage to facilitate repairs	\$ 500.00	?
21	To remove and install exhaust muffler and rear exhaust centre pipe	\$ 150.00	601
22	To conduct computer diagnostic test and reset vehicle to specifications.	\$ 300.00	?
23	To remove & refit tail gate component to replace tail gate, check & re-adjust the close gap and alignment and water seepage	\$ nn 120.00	X
	Total labour :	\$ 9,860.00	
	Total parts :	\$ 41,285.56	
	Total labour :	\$ 9,860.00	
	Total repair cost : (Before GST)	\$ 51,145.56	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

LEONG AUTO PTE LTD

160 Sin Ming Drive, Sin Ming AutoCity, #02-13, Singapore 575722

Tel: 62666448 Fax: 62666358 Email: Sales@leongauto.com.sg

Business Registration No. 201312846W

GST Registration No. 201312846W

ESTIMATE

Date: 19/3/2018

DOA: 19/3/2018

Vehicle No: SDE1666Z

Make & Model: Honda Vezel

S/N	Qty	Item Description	Parts Price	Surveyor
1	1	Front Bonnet	\$ 1,313.90	✓
2	1	Front Bonnet Lock Mechanism	\$ 256.60	✓
3	2	Front Bonnet Side WeatherStrip (Middle)	\$ 54.80	X
4	2	Front Bonnet Side WeatherStrip (Long)	\$ 68.30	X
5	2	Front Bonnet Side WeatherStrip (Short)	\$ 62.10	X
6	1	Front Support Panel	\$ 809.60	✓
7	1	Front Support Panel Top Garnish	\$ 262.60	✓
8	1	Front Support Panel Bracket	\$ 120.70	✓
9	2	Front Horns	\$ 147.30	✓
10	1	Front Air-Con Condenser Assy	\$ 966.00	✓
11	1	Front Radiator Assy	\$ 1,439.70	X
12	1	Front Radiator Fan With Motor	\$ 354.80	X
13	1	Front Radiator Fan Cowling	\$ 128.90	X
14	2	Front Radiator Mountings	\$ 54.50	X
15	1	Front Radiator Spare Tank	\$ 67.40	✓
16	2	Front Radiator Air Guide	\$ 189.30	X
17	1	Front Air Duct	\$ 152.30	X
18	1	Front Grille	\$ 408.30	✓
19	2	Front Grille Outer Chrome	\$ 412.60	✓
21	1	Front Grille Inner Base	\$ 539.10	✓
22	2	Front Head Lamp	\$ 3,655.60	✓
23	2	Front Head Lamp Bracket (Big)	\$ 123.10	✓
24	2	Front Head Lamp Bracket (Small)	\$ 106.00	✓
25	1	Front Bumper Assy	\$ 778.50	✓
26	1	Front Bumper Reinforcement	\$ 543.50	✓
27	2	Front Bumper Reinforcement Garnish	\$ 160.00	✓
28	2	Front Bumper Side Retainer	\$ 108.00	✓
29	1	Front Bumper Tow Cover	\$ 56.80	X
30	2	Front Bumper Fog Lamp	\$ 650.20	X
31	2	Front Bumper Fog Lamp Outer Garnish	\$ 60.00	X
32	2	Front Bumper Fog Lamp Bracket	\$ 139.10	X
33	1	Front Bumper Lower Lip	\$ 367.50	✓
34	1	Front Bumper Lower Grille	\$ 204.70	✓
35	1	Front Engine Lower Cover	\$ 196.60	X
36	2	Front Fender	\$ 901.40	X
37	2	Front Fender Inner Shield	\$ 277.80	X
38	2	Front Fender Garnish (Protector)	\$ 175.30	X
39	1	Front Object Braking System	\$ 3,580.50	X
40	1	Front Outer Temperature Sensor	\$ 161.40	✓
41	1	Front Outer Temperature Sensor Bracket	\$ 85.70	X
			\$ 20,140.50	
		Less 20%	\$ 4,028.10	
			\$ 16,112.40	

Special Nett Items

1		Sundries	nn	\$	50.00	X
2	1 set	Front Support Panel Top Garnish Clips	nn	\$	80.00	X
3	1	Front Radiator Coolant	nn	\$	160.00	205m
4	1 set	Front Air Duct Clips	nn	\$	50.00	X
5	1 set	Front Grille Clips	nn	\$	80.00	—
6	1	Front Grille Centre Logo	nn	\$	150.00	—
7	2 set	Front Head Lamp Clips	nn	\$	80.00	X
8	1 set	Front Bumper Assy Clips	nn	\$	50.00	—
9	2 set	Front Bumper Fog Lamp Clips	nn	\$	80.00	X
10	2 set	Front Bumper Fog Lamp Outer Garnish Clips	nn	\$	80.00	X
11	2	Front Bumper Day Light	cm	\$	580.00	2
12	1 set	Front Bumper Lower Lip Clips	nn	\$	120.00	X
13	1 set	Front Bumper Lower Grille Clips	nn	\$	80.00	X
14	1 set	Front Engine Lower Cover Clips	nn	\$	120.00	X
15	2 set	Front Fender Garnish (Protector) Clips	nn	\$	80.00	X
16	1 set	Front No. Plate with Garnish	cm	\$	80.00	455m
				\$	1,920.00	
Total parts				\$	18,032.40	

S/N	Qty	Item Description		Parts Price	Surveyor
1	1	Rear Tail Gate 1100-P0	Bz	\$ 1,646.60	✓
2	1	Rear Tail Gate Spoiler	nn	\$ 720.00	X
3	1	Rear Tail Gate WeatherStrip	diy / \$2	\$ 145.00	✓
4	1	Rear Tail Gate Inner Trim Board 265.00	mg/cm	\$ 583.00	2
5	2	Rear Tail Gate Inner Top Side Garnish	nn	\$ 183.70	X
6	1	Rear Tail Gate Inner Top Garnish	nn	\$ 79.00	X
7	2	Rear Tail Gate Side Damper	nn	\$ 380.00	X
8	1	Rear Tail Gate Outer Handle Switch	nn	\$ 295.30	X
9	1	Rear Tail Gate Lock Mechanism 180.00	nn	\$ 290.00	✓
10	1	Rear Tail Gate Lock Catch	nn	\$ 38.00	X
11	2	Rear Tail Gate Hinges	nn	\$ 90.00	X
12	1	Rear Tail Gate Inner Handle	nn	\$ 27.50	X
13	1	Rear Tail Gate Trim Cover	nn	\$ 26.00	X
14	1	Rear Tail Gate Outer Moulding 220.30	nn	\$ 340.00	—
15	2	Rear Tail Gate Outer Moulding No. Plate Lamp	nn	\$ 75.80	X
16	1	Rear Tail Gate Windscreen Moulding	nn	\$ 85.00	—
17	2	Rear Tail Gate Stopper	nn	\$ 30.00	X
18	1	Rear Tail Gate 3rd Brake Light	nn	\$ 350.00	X
19	2	Rear Tail Gate Reflector Lamp C350.80 cm	nn	\$ 839.90	✓
20	1	Rear Tail Gate "Vezel" Emblem	nn	\$ 67.10	X
21	1	Rear Tail Gate Outer Moulding Reverse Camera	nn	\$ 1,211.90	X
22	1	Rear Bumper	Bz	\$ 850.00	✓
23	2	Rear Bumper Side Retainer	cls diy	\$ 76.00	4
24	2	Rear Corner Bumper	cls Bz	\$ 536.20	4
25	2	Rear Corner Bumper Retainer	cls diy	\$ 80.80	4
26	2	Rear Bumper Reflector @ 8135.00	cm	\$ 323.40	✓
27	2	Rear Tail Lamp C 460.60	diy cm	\$ 960.00	4
28	2	Rear Tail Lamp Panel	nn	\$ 290.00	X
29	1	Rear End Panel 45.60	Bz	\$ 560.00	2
30	1	Rear End Panel Top Garnish 98.20	mg diy	\$ 184.00	2
31	1	Rear Sound Beep	nn	\$ 250.00	X
32	1	Rear Spare Tyre Panel	nn	\$ 1,230.00	X
33	2	Rear Spare Tyre Side Panel	nn	\$ 650.00	X
34	1	Rear Spare Tyre Panel Bottom Bracket	nn	\$ 160.00	X
35	1	Rear Spare Tyre Panel Sensor	nn	\$ 191.90	X
36	1	Rear Spare Tyre Panel Side ELDC Sensor	nn	\$ 1,285.40	X

37	1	Rear Cross Beam (Horizontal)	12	\$	204.00	X
38	1	Rear Cross Beam (Vertical)	12	\$	521.70	X
39	1	Rear Tow Bracket	12	\$	75.00	X
40	1	Rear Spare Tyre Panel Lower Cover	12	\$	219.20	✓
41	2	Rear Air Duct Ventilator	12	\$	132.40	X
42	2	Rear Fender Protector	cl 1 Bn	\$	330.00	✓
43	2	Rear Fender Inner Shield	12	\$	320.00	✓
44	2	Rear Fender Inner Trim Board Bottom	12	\$	520.00	✓
45	2	Rear Fender Inner Trim Board Top	12	\$	320.00	X
46	1	Rear Spare Tyre Tools Sponge	12	\$	260.90	✓
47	1	Rear Spare Tyre Top Board	12	\$	300.00	✓
48	1	Rear Exhaust Muffler	12	\$	920.00	X
49	1	Rear Exhaust Centre Pipe	12	\$	850.00	✓
50	2	Rear Exhaust Mounting	12	\$	254.10	✓
51	1	Rear Exhaust Heat Shield	12	\$	64.50	X
52	2	Rear Strut Bar	12	\$	285.00	X
53	2	Rear Axle Bushing	12	\$	292.40	✓
54	2	Rear Knuckle Bearing	12	\$	761.70	✓
55	2	Rear Knuckle Bearing Hub	12	\$	473.80	✓
56	2	Rear Suspension	12	\$	522.90	X
57	1	Rear Axle	12	\$	1,942.60	✓
58	2	Rear Axle Lower Cover	12	\$	58.50	X
					\$ 24,760.20	
Less 20%					\$ 4,952.04	
					\$ 19,808.16	

<u>Special Nett Items</u>						
1		Sundries	12	\$	50.00	X
2	1	Rear Tail Gate Windscreen Moulding Sealant	12	\$	120.00	✓
3	1	Rear Tail Gate Windscreen Moulding Damping Seal	12	\$	120.00	✓
4	2 set	Rear Tail Gate Reflector Lamp Clips	12	\$	80.00	X
5	1 set	Rear Tail Gate Outer Moulding Clips	12	\$	80.00	✓ 50
6	1 set	Rear Tail Gate Inner Trim Board Clips	12	\$	80.00	✓ 50
7	1	Rear Tail Gate Centre Logo	12	\$	150.00	✓
8	1	Rear End Panel Sealant	12	\$	120.00	✓
9	1 set	Rear End Panel Top Garnish Clips	12	\$	50.00	✓
10	1	Rear Spare Tyre Panel Sealant	12	\$	120.00	X
11	1 set	Rear Spare Tyre Panel Lower Cover Clips	12	\$	80.00	X
12	2	Rear Tail Lamp Sealant	12	\$	80.00	X
13	2 set	Rear Tail Lamp Clips	12	\$	50.00	X
14	2 set	Rear Fender Inner Trim Board Clips	12	\$	120.00	X
15	2 set	Rear Fender Inner Shield Clips	12	\$	80.00	X
16	2 set	Rear Fender Protector Clips	12	\$	50.00	X
17	2 set	Rear Corner Bumper Clips	12	\$	80.00	X
18	1 set	Rear Bumper Clips	12	\$	50.00	✓
19	1	Rear Exhaust Gasket	12	\$	45.00	X
20	2	Rear Tyre	12	\$	480.00	X
21	2	Rear Rim	12	\$	980.00	X
22	1 set	Rear No. Plate with Garnish	12	\$	80.00	X
23	1 set	Rear Reverse Sensor	12	\$	300.00	✓
					\$ 3,445.00	
Total Parts					\$ 23,253.16	

S/N	Labour Description	Amount	Amount
-----	--------------------	--------	--------

1	Labour for panel beating, cut, weld, straighten front fenders and replace front damaged parts.	\$ 1,400.00	6001
2	To putty and spray painting front portion.	\$ 1,400.00	8001
3	To check wiring and focus front head lamp.	\$ 80.00	201
4	To remove and install front bonnet lock mechanism.	na \$ 120.00	X
5	To remove and install front windscreen.	na \$ 120.00	X
6	To remove and install air con system to facilitate the repair and refill gas.	\$ 120.00	7001
7	To remove and install cooling system to facilitate the repair and check for leakage.	na \$ 120.00	X
8	To apply anti rust proofing to front affected area.	\$ 250.00	801 301
9	Labour for panel beating, cut, weld, straighten and replace rear damaged parts.	\$ 1,800.00	7001
10	To putty and spray painting rear portion.	\$ 1,600.00	8001
11	To check rear lighting and wiring.	\$ 80.00	201
12	To remove and install rear tail gate lock mechanism.	\$ 120.00	601
13	To remove and install inner garnish and trim to facilitate the repair.	\$ 380.00	601
14	To apply anti rust proofing to rear affected area.	\$ 250.00	601
15	To remove and install rear reverse camera.	\$ 150.00	} 801
16	To remove and install rear reverse sensor.	\$ 150.00	
17	To remove and install rear windscreen.	\$ 120.00	✓
18	To adjust chassis alignment.	\$ 380.00	X
19	To perform 4 wheel alignment and balancing.	\$ 150.00	801
20	To remove rear undercarriage to facilitate repairs	\$ 500.00	7 740
21	To remove and install exhaust muffler and rear exhaust centre pipe	\$ 150.00	601
22	To conduct computer diagnostic test and reset vehicle to specifications.	na \$ 300.00	X
23	To remove & refit tail gate component to replace tail gate, check & re-adjust the close gap and alignment and water seepage	\$ na 120.00	X
	Total labour :	\$ 9,860.00	
	Total parts :	\$ 41,285.56	
	Total labour :	\$ 9,860.00	
	Total repair cost :(Before GST)	\$ 51,145.56	

515
53175.56

LEONG AUTO PTE LTD

160 Sin Ming Drive, Sin Ming AutoCity, #02-13, Singapore 575722
Tel: 62666448 Fax: 62666358 Email: Sales@leongauto.com.sg
Business Registration No. 201312846W
GST Registration No. 201312846W

ESTIMATE

Date: 19/3/2018

DOA: 19/3/2018

Vehicle No: SDE1666Z

Make & Model: Honda Vezel

S/N	Qty	Item Description	Parts Price	Surveyor
		<u>Supplementary Items</u>		
		<u>Special Nett Items</u>		
1	1	Front Bumper Lower Lip <i>Request</i>	\$ 450.00	<i>is</i> X
2	1	Rear Bumper Lower Lip <i>Nil</i>	\$ 550.00	—
3	1	Rear Bumper Reflector Light <i>Nil</i>	\$ 650.00	✓
4	2	Rear Tail Gate Inner Trim Board Lamp <i>Nil</i>	\$ 380.00	X
			\$ 2,030.00	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION Ref : CS/SPF18005320/Kqbs2

ACCIDENT CLAIM SECTION SINGAPORE POLICE
FORCE) 1 MOUNT PLEASANT ROAD BLK 8 OLD
POLICE ACADEMY SINGAPORE 298333

Date : 12-06-2018



ATTN: ABDUL RAHMAN

Code : SPF

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	QX 319D	Veh. Inspected	SDE 1666Z
Policy No.		Coverage (\$)	0.00
Claim No.	AEMD/105/009/2018/027	Excess (\$)	0.00
Assign From	ABDUL RAHMAN	Assign Date	21/03/2018

2. Vehicle Particulars & Condition

Make & Model	HONDA VEZEL (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	RU11117133	Colour	METALLIC PEARL WHITE
Odometer	037312	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/45R17	MICHELIN	6 mm
L/H Front Tyre	225/45R17	MICHELIN	6 mm
R/H Rear Tyre	225/45R17	MICHELIN	6 mm
L/H Rear Tyre	225/45R17	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	19/03/2018	Inspection Date	21/03/2018
Survey held at	LEONG AUTO PTE LTD 160 SIN MING DRIVE #02-13 SIN MING AUTOCITY SINGAPORE 575722		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	14 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SDE 1666Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BONNET	BENT	1,313.90	892.30
1	FRONT BONNET LOCK MECHANISM	DISTORTED	256.60	187.70
2	FRONT BONNET SIDE WEATHERSTRIP (MIDDLE)	SERVICEABLE	54.80	-
2	FRONT BONNET SIDE WEATHERSTRIP (LONG)	SERVICEABLE	68.30	-
2	FRONT BONNET SIDE WEATHERSTRIP (SHORT)	SERVICEABLE	62.10	-
1	FRONT SUPPORT PANEL	BUCKLED	809.60	404.80
1	FRONT SUPPORT PANEL TOP GARNISH	CRACKED	262.60	262.60
1	FRONT SUPPORT PANEL BRACKET	DISTORTED	120.70	120.70
2	FRONT HORNS	DENTED	147.30	73.65
1	FRONT AIR-CON CONDENSER ASSY	PUNCTURE	966.00	966.00
1	FRONT RADIATOR ASSY	SERVICEABLE	1,439.70	-
1	FRONT RADIATOR FAN WITH MOTOR	SERVICEABLE	354.80	-
1	FRONT RADIATOR FAN COWLING	TO REPAIR SEE LABOUR	128.90	-
2	FRONT RADIATOR MOUNTINGS	SERVICEABLE	54.50	-
1	FRONT RADIATOR SPARE TANK	SERVICEABLE	67.40	-
2	FRONT RADIATOR AIR GUIDE	SERVICEABLE	189.30	-
1	FRONT AIR DUCT	SERVICEABLE	152.30	-
1	FRONT GRILLE	CRACKED	408.30	389.50
2	FRONT GRILLE OUTER CHROME	NECESSARY	412.60	142.80
1	FRONT GRILLE INNER BASE	CRACKED	539.10	539.10
2	FRONT HEAD LAMP	MTG CRACKED	3,655.60	3,655.60
2	FRONT HEAD LAMP BRACKET (BIG)	DISTORTED	123.10	123.10
2	FRONT HEAD LAMP BRACKET (SMALL)	DISTORTED	106.00	106.00
1	FRONT BUMPER ASSY	BUCKLED	778.50	778.50
1	FRONT BUMPER REINFORCEMENT	BENT	543.50	351.00
2	FRONT BUMPER REINFORCEMENT GARNISH	CRACKED	160.00	160.00
2	FRONT BUMPER SIDE RETAINER	DISTORTED	108.00	108.00
1	FRONT BUMPER TOW COVER	SERVICEABLE	56.80	-
2	FRONT BUMPER FOG LAMP	SERVICEABLE	650.20	-
2	FRONT BUMPER FOG LAMP OUTER GARNISH	O/S SERVICEABLE / N/S CRACKED	60.00	30.00
2	FRONT BUMPER FOG LAMP BRACKET	TO REPAIR SEE LABOUR	139.10	-
1	FRONT BUMPER LOWER LIP	BUCKLED	367.50	367.50

Report Ref No. CS/SPF18005320/Kqbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER LOWER GRILLE	BUCKLED	204.70	204.70
1	FRONT ENGINE LOWER COVER	SERVICEABLE	196.80	-
2	FRONT FENDER	TO REPAIR SEE LABOUR	901.40	-
2	FRONT FENDER INNER SHIELD	SERVICEABLE	277.80	-
2	FRONT FENDER GARNISH (PROTECTOR)	SERVICEABLE	175.30	-
1	FRONT OBJECT BRAKING SYSTEM	SERVICEABLE	3,580.50	-
1	FRONT OUTER TEMPERATURE SENSOR	SERVICEABLE	161.40	-
1	FRONT OUTER TEMPERATURE SENSOR BRACKET	TO REPAIR SEE LABOUR	85.70	-
1	REAR TAIL GATE	BENT	1,646.60	1,100.90
1	REAR TAIL GATE SPOILER	SERVICEABLE	720.00	-
1	REAR TAIL GATE WEATHERSTRIP	DISTORTED / DENTED	145.00	145.00
1	REAR TAIL GATE INNER TRIM BOARD	MTG CRACKED	583.00	265.00
2	REAR TAIL GATE INNER TOP SIDE GARNISH	SERVICEABLE	183.70	-
1	REAR TAIL GATE INNER TOP GARNISH	SERVICEABLE	79.00	-
2	REAR TAIL GATE SIDE DAMPER	SERVICEABLE	380.00	-
1	REAR TAIL GATE OUTER HANDLE SWITCH	SERVICEABLE	295.30	-
1	REAR TAIL GATE LOCK MECHANISM	DENTED	290.00	180.00
1	REAR TAIL GATE LOCK CATCH	TO REPAIR SEE LABOUR	38.00	-
2	REAR TAIL GATE HINGES	TO REPAIR SEE LABOUR	90.00	-
1	REAR TAIL GATE INNER HANDLE	SERVICEABLE	27.50	-
1	REAR TAIL GATE TRIM COVER	SERVICEABLE	26.00	-
1	REAR TAIL GATE OUTER MOULDING	DENTED	340.00	220.30
2	REAR TAIL GATE OUTER MOULDING NO. PLATE LAMP	SERVICEABLE	75.80	-
1	REAR TAIL GATE WINDSCREE MOULDING	NECESSARY	85.00	85.00
2	REAR TAIL GATE STOPPER	SERVICEABLE	30.00	-
1	REAR TAIL GATE 3RD BRAKE LIGHT	SERVICEABLE	350.00	-
2	REAR TAIL GATE REFLECTOR LAMP	CRACKED	839.90	701.60
1	REAR TAIL GATE "VEZEL" EMBLEM	SERVICEABLE	67.10	-
1	REAR TAIL GATE OUTER MOULDING REVERSE CAMERA	SERVICEABLE	1,211.90	-
1	REAR BUMPER	BUCKLED	850.00	850.00
2	REAR BUMPER SIDE RETAINER	O/S DISTORTED	76.00	38.00
2	REAR CORNER BUMPER	O/S BUCKLED	536.20	268.10
2	REAR CORNER BUMPER RETAINER	O/S DISTORTED	80.80	40.40

Report Ref No. CS/SPF18005320/Kqbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR BUMPER REFLECTOR	CRACKED	323.40	270.00
2	REAR TAIL LAMP	N/S CRACKED	960.00	460.60
2	REAR TAIL LAMP PANEL	TO REPAIR SEE LABOUR	290.00	-
1	REAR END PANEL	BENT	560.00	45.60
1	REAR END PANEL TOP GARNISH	MTG DISTORTED	184.00	98.20
1	REAR SOUND BEEP	SERVICEABLE	250.00	-
1	REAR SPARE TYRE PANEL	TO REPAIR SEE LABOUR	1,230.00	-
2	REAR SPARE TYRE SIDE PANEL	TO REPAIR SEE LABOUR	650.00	-
1	REAR SPARE TYRE PANEL BOTTOM BRACKET	TO REPAIR SEE LABOUR	160.00	-
1	REAR SPARE TYRE PANEL SENSOR	SERVICEABLE	191.90	-
1	REAR SPARE TYRE PANEL SIDE ELDC SENSOR	SERVICEABLE	1,285.40	-
1	REAR CROSS BEAM (HORIZONTAL)	TO REPAIR SEE LABOUR	204.00	-
1	REAR CROSS BEAM (VERTICAL)	TO REPAIR SEE LABOUR	521.70	-
1	REAR TOW BRACKET	TO REPAIR SEE LABOUR	75.00	-
1	REAR SPARE TYRE PANEL LOWER COVER	SERVICEABLE	219.20	-
2	REAR AIR DUCT VENTILATOR	SERVICEABLE	132.40	-
2	REAR FENDER PROTECTOR	O/S BUCKLED	330.00	165.00
2	REAR FENDER INNER SHIELD	SERVICEABLE	320.00	-
2	REAR FENDER INNER TRIM BOARD BOTTOM	SERVICEABLE	520.00	-
2	REAR FENDER INNER TRIM BOARD TOP	SERVICEABLE	320.00	-
1	REAR SPARE TYRE TOOLS SPONGE	SERVICEABLE	260.90	-
1	REAR SPARE TYRE TOP BOARD	SERVICEABLE	300.00	-
1	REAR EXHAUST MUFFLER	TO REPAIR SEE LABOUR	920.00	-
1	REAR EXHAUST CENTRE PIPE	TO REPAIR SEE LABOUR	850.00	-
2	REAR EXHAUST MOUNTING	SERVICEABLE	254.10	-
1	REAR EXHAUST HEAT SHIELD	TO REPAIR SEE LABOUR	64.50	-
2	REAR STRUT BAR	TO REPAIR SEE LABOUR	285.00	-
2	REAR AXLE BUSHING	NECESSARY	292.40	292.40
2	REAR KNUCKLE BEARING }	NECESSARY	761.70	1,082.40

Report Ref No. CS/SPF18005320/Kqbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR KNUCKLE BEARING HUB }	BENT	473.80	-
2	REAR SUSPENSION	SERVICEABLE	522.90	-
1	REAR AXLE	BENT	1,942.60	1,513.60
2	REAR AXLE LOWER COVER	SERVICEABLE	58.50	-
	LESS 20% DISCOUNT		-8,980.14	-3,537.13
			35,920.56	14,148.52
	<u>SPECIAL NETT ITEMS</u>			
1	SUNDRIES (SN)	NOT NECESSARY	100.00	-
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	80.00	-
1	FRONT RADIATOR COOLANT (SN)	NECESSARY	160.00	20.00
1	SET FRONT AIR DUCT CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT GRILLE CLIPS (SN)	NECESSARY	80.00	80.00
1	FRONT GRILLE CENTRE LOGO (SN)	NECESSARY	150.00	150.00
2	SET FRONT HEAD LAMP CLIPS (SN)	NOT NECESSARY	80.00	-
1	SET FRONT BUMPER ASSY CLIPS (SN)	NECESSARY	50.00	50.00
2	SET FRONT BUMPER FOG LAMP CLIPS (SN)	NOT NECESSARY	80.00	-
2	SET FRONT BUMPER FOG LAMP OUTER GARNISH CLIPS (SN)	NOT NECESSARY	80.00	-
2	FRONT BUMPER DAY LIGHT (SN)	CRACKED	580.00	580.00
1	SET FRONT BUMPER LOWER LIP CLIPS (SN)	NOT NECESSARY	120.00	-
1	SET FRONT BUMPER LOWER GRILLE CLIPS (SN)	NOT NECESSARY	80.00	-
1	SET FRONT ENGINE LOWER COVER CLIPS (SN)	NOT NECESSARY	120.00	-
2	SET FRONT FENDER GARNISH (PROTECTOR) CLIPS (SN)	NOT NECESSARY	80.00	-
1	SET FRONT NO. PLATE WITH GARNISH (SN)	CRACKED	80.00	45.00
1	REAR TAIL GATE WINDSCREEN MOULDING SEALANT (SN)	NECESSARY	120.00	40.00
1	REAR TAIL GATE WINDSCREEN MOULDING DAMPER SEAL (SN)	NECESSARY	120.00	30.00
2	SET REAR TAIL GATE REFLECTOR LAMP CLIPS (SN)	NOT NECESSARY	80.00	-
1	SET REAR TAIL GATE OUTER MOULDING CLIPS (SN)	NECESSARY	80.00	50.00
1	SET REAR TAIL GATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	80.00	50.00
1	REAR TAIL GATE CENTRE LOGO (SN)	NECESSARY	150.00	150.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	120.00	30.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	50.00	30.00
1	REAR SPARE TYRE PANEL SEALANT (SN)	NOT NECESSARY	120.00	-

Report Ref No. CS/SPF18005320/Kqbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR SPARE TYRE PANEL LOWER COVER CLIPS (SN)	NOT NECESSARY	80.00	-
2	REAR TAIL LAMP SEALANT (SN)	NOT NECESSARY	80.00	-
2	SET REAR TAIL LAMP CLIPS (SN)	NOT NECESSARY	50.00	-
2	SET REAR FENDER INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	120.00	-
2	SET REAR FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	80.00	-
2	SET REAR FENDER PROTECTOR CLIPS (SN)	NOT NECESSARY	50.00	-
2	SET REAR CORNER BUMPER CLIPS (SN)	NOT NECESSARY	80.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	REAR EXHAUST GASKET (SN)	NOT NECESSARY	45.00	-
2	REAR TYRE (SN)	SERVICEABLE	480.00	-
2	REAR RIM (SN)	SERVICEABLE	980.00	-
1	SET REAR NO. PLATE WITH GARNISH (SN)	SERVICEABLE	80.00	-
1	SET REAR REVERSE SENSOR (SN)	DENTED	300.00	200.00
1	FRONT BUMPER LOWER LIP (SN)(ADDITIONAL)	REPEATED	450.00	-
1	REAR BUMPER LOWER LIP (SN)(ADDITIONAL)	MISSING	550.00	550.00
1	REAR BUMPER REFLECTOR LIGHT (SN)(ADDITIONAL)	NECESSARY	650.00	650.00
2	REAR TAIL GATE INNER TRIM BOARD LAMP (SN) (ADDITIONAL)	SERVICEABLE	380.00	-
			7,395.00	2,755.00
	LABOUR			
	LABOUR FOR PANEL BEATING, CUT, WELD, STRAIGHTEN FRONT FENDERS AND REPLACE FRONT DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF FRONT RADIATOR FAN COWLING, FRONT BUMPER FOG LAMP BRACKET, FRONT FENDER AND FRONT OUTER TEMPERATURE SENSOR BRACKET.		1,400.00	600.00
	TO PUTTY AND SPRAY PAINTING FRONT PORTION.		1,400.00	800.00
	TO CHECK WIRING AND FOCUS FRONT HEAD LAMP.		80.00	20.00
	TO REMOVE AND INSTALL FRONT BONNET LOCK MECHANISM.	NOT NECESSARY	120.00	-
	TO REMOVE AND INSTALL FRONT WINDSCREEN.	NOT NECESSARY	120.00	-
	TO REMOVE AND INSTALL AIR CON SYSTEM TO FACILITATE THE REPAIR AND REFILL GAS.		120.00	100.00
	TO REMOVE AND INSTALL COOLING SYSTEM TO FACILITATE THE REPAIR AND CHECK FOR LEAKAGE.	NOT NECESSARY	120.00	-
	TO APPLY ANTI RUST PROOFING TO FRONT AFFECTED AREA.		250.00	30.00

Report Ref No. CS/SPF18005320/Kqbs2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR FOR PANEL BEATING, CUT, WELD, STRAIGHTEN AND REPLACE REAR DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF REAR TAIL GATE LOCK CATCH, REAR TAIL GATE HINGES, REAR TAIL LAMP PANEL, REAR SPARE TYRE PANEL, REAR SPARE TYRE SIDE PANEL, REAR SPARE TYRE PANEL BOTTOM BRACKET, REAR CROSS BEAM (HORIZONTAL), REAR CROSS BEAM (VERTICAL), REAR TOW BRACKET, REAR EXHAUST MUFFLER, REAR EXHAUST CENTRE PIPE, REAR EXHAUST HEAT SHIELD AND REAR STRUT BAR.		1,800.00	700.00
	TO PUTTY AND SPRAY PAINTING REAR PORTION.		1,600.00	800.00
	TO CHECK REAR LIGHTING AND WIRING.		80.00	20.00
	TO REMOVE AND INSTALL REAR TAIL GATE LOCK MECHANISM.		120.00	60.00
	TO REMOVE AND INSTALL INNER GARNISH AND TRIM TO FACILITATE THE REPAIR.		380.00	60.00
	TO APPLY ANTI RUST PROOFING TO REAR FFECTED AREA.		250.00	60.00
	TO REMOVE AND INSTALL REAR REVERSE CAMERA. }		150.00	80.00
	TO REMOVE AND INSTALL REAR SENSOR. }		150.00	-
	TO REMOVE AND INSTALL REAR WINDSCREEN.		120.00	120.00
	TO ADJUST CHASSIS ALIGNMENT.	NOT NECESSARY	380.00	-
	TO PERFORM 4 WHEEL ALIGNMENT AND BALANCING.		150.00	80.00
	TO REMOVE REAR UNDERCARRIAGE TO FACILITATE REPAIRS.		500.00	240.00
	TO REMOVE AND INSTALL EXHAUST MUFFLER AND REAR EXHAUST CENTRE PIPE.		150.00	60.00
	TO CONDUCT COMPUTER DIAGNOSTIC TEST AND RESET VEHICLE TO SPACIFICATIONS.	NOT NECESSARY	300.00	-
	TO REMOVE & REFIT TAIL GATE COMPONENT TO REPLACE TAIL GATE, CHECK & RE-ADJUST THE CLOSE GAP AND ALIGNMENT AND WATER SEEPAGE.	NOT NECESSARY	120.00	-
			9,860.00	3,830.00
GRAND TOTAL			53,175.56	20,733.52
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				15,600.00

Report Ref No. CS/SPF18005320/Kqbs2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.