

REF:

NS/WC18005513 / SV022

Surveyor

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

(Claim's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAG Accident Report:

GIA / PR Seen:

Est. Repairs:

Lump Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time / Action / Instruction

SUB 575B - NIM/INCD15001/Zu

SVH 215K - X

4/5/18 @ 1149am Poh Suan said vehicle still under repair

14/6/18 final fig \$19,511.52 (Reel 28,564.66, 5979 confirmed by email)

RECEIVED 14 JUN 2018

Date/Time, File Pass to?

Date/Time, File Return to?

14/6 - typist

Report Format:

Lump Sum / I.B.I. (\$

☐

Prel. Report

☐

Final Report

Days Of Repair:

Resurvey No. of Trip:

Add Foo:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Insp (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS \$1

Plucka

Giant

TOTAL

Veh No:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: N / S / Rim / STD A / Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Rear

R/Bal.

L/Bal.

D.O.I.

20/3/15

5MRS

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision

The U/C / Chassis frame / Body Structure affected due to collision



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18005513/Svb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 24-03-2018



189556

Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SGH 245K	Veh. Inspected	SHB 5795B
Policy No.	5050613007-06	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	20/03/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	18/03/2018	Inspection Date	20/03/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

Veron Chen (LKKAUTO)

From: mtreg <mtreg@income.com.sg>
Sent: Tuesday, 12 June 2018 12:22 PM
To: Veron Chen (LKKAUTO)
Subject: FW: REQUEST FOR CLAIM NUMBER

Hi,

All claims created

With Regards

Samsia
Senior Admin Assistant, Motor Insurance
www.income.com.sg



From: Veron Chen (LKKAUTO) [mailto:veronchen@lkkauto.com]
Sent: Tuesday, June 12, 2018 12:10 PM
To: mtreg <mtreg@income.com.sg>
Subject: FW: REQUEST FOR CLAIM NUMBER

Dear Sir/Madam,

Re-forward.

Best Regards,
Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 12 June 2018 9:40 AM
To: mtreg <mtreg@income.com.sg>
Subject: REQUEST FOR CLAIM NUMBER

Dear Sir/Madam,

Please provides us the claim number.

S/NO	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle
1	MT/0986885-004	SMRT TAXIS PTE LTD	SHB 5795B	SGH 245K
2	MT/0995719-002	SMRT TAXIS PTE LTD	SHB 108T	GBD 4497I

D.O.A	Time of Accident	Estimate	Tentative repair cost
18/3/2018	0:30	\$48,076.18	\$19,511.52
24/5/2018	0.45	\$15,256.07	\$3,350.00

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

eBaoTech

GeneralClaim

Hello, NAC_PAYA_UBT_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.		Date of Accident	18/03/2018 17:41						
Vehicle No. (For Motor)	SGH245K								
Search									
Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
☒	S050613007-06	SEAH LYE WOO	S00548168	GPC	Third Party	SGH245K	SGH245K	29/05/2017	28/05/2018
Continue									

Enquire Transfer Fee

Vehicle Details																				
Vehicle No. :	SHB5795B																			
Vehicle Type :	H10 - Public Transport Taxi (Motor Car)																			
Vehicle Attachment 1 :	Air-Con (Taxi)																			
Vehicle Scheme :	Taxi (Company)																			
Vehicle Make :	TOYOTA																			
Vehicle Model :	PRIUS HYBRID 1.8 CVT																			
Chassis No. :	JTDKB3FU003575910																			
Propellant :	Petrol-Electric																			
Engine No. :	22R8253580																			
Motor No. :	1NM8253580																			
Engine Capacity :	1798 cc																			
Power Rating :	53.0 kW																			
Maximum Power Output :	90.0 kW (120 bhp)																			
Maximum Laden Weight :	1790 kg																			
Unladen Weight :	1375 kg																			
Year Of Manufacture :	2017																			
Original Registration Date :	12 Dec 2017																			
Lifespan Expiry Date :	11 Dec 2025																			
COE Category :	A - Car up to 1600cc & 97kW (130bhp)																			
PQP Paid :	\$34,159.00																			
COE Expiry Date :	11 Dec 2025																			
Road Tax Expiry Date :	11 Jun 2018																			
PARF Eligibility Expiry Date :	11 Dec 2025																			
Inspection Due Date :	11 Jun 2018																			
Intended Transfer Date :	21 Mar 2018																			
CO2 Emission :	87.00 (g/km)																			
CEV/VES Rebate Utilised Amount :	\$27,610.00																			
CO Emission :	-																			
HC Emission :	-																			
NOx Emission :	-																			
PM Emission :	-																			
The current road tax expiry is 11 Jun 2018. You may renew the road tax from 12 Mar 2018 with all pre-requisite(s) fulfilled. If the road tax is renewed after 11 Jun 2018, late renewal fee(s) will be imposed. Please use Enquire Road Tax Payable to check on the late fee(s) payable.																				
Road tax, including Over Payment (if any), of a vehicle will follow the vehicle to the new registered owner when its ownership is being transferred.																				
Amount Payable (From 12 Jun 2018 to 11 Dec 2018)																				
	<table><tr><th>Amount Before GST (S\$)</th><th>GST Amount (S\$)</th><th>Amount After GST (S\$)</th></tr><tr><td>Transfer Fee :</td><td>25.00</td><td>-</td><td>25.00</td></tr><tr><td>Sub Total :</td><td></td><td></td><td>25.00</td></tr><tr><td>Nett Road Tax Amount (After Offsetting Over Payment) :</td><td>510.00</td><td>-</td><td>510.00</td></tr><tr><td>Total Amount Payable :</td><td></td><td></td><td>535.00</td></tr></table>	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)	Transfer Fee :	25.00	-	25.00	Sub Total :			25.00	Nett Road Tax Amount (After Offsetting Over Payment) :	510.00	-	510.00	Total Amount Payable :			535.00
Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)																		
Transfer Fee :	25.00	-	25.00																	
Sub Total :			25.00																	
Nett Road Tax Amount (After Offsetting Over Payment) :	510.00	-	510.00																	
Total Amount Payable :			535.00																	
Message																				
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.																				

You may print this page for reference.

OK Print

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	19/03/2018 11:31
Date Of Accident	18/03/2018 00:30
Exact Location Of Accident	PIONEER ROAD NORTH
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB5795B
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD

Are you claiming under your own insurance policy for repair to your vehicle?

NO

If No, Please state action to be taken

THIRD PARTY

Vehicle Category

TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-17087562MFSH
Cover Note Number	

Driver

Name of Driver	ISMAIL BIN ALI
NRIC No	S1326388D
Date Of Birth	16/09/1958
Occupation	OUTDOOR
Date Of Driving Pass	11/08/1981
Driving Experience	36 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
EMail Address	NOEMAIL

Address 187
 Postcode
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OTHER - RELIEF
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? YES
 Was any injured conveyed to hospital by ambulance? YES
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 6
 Passenger 1
 NAME: : UNKNOWN
 GENDER: : MALE
 Passenger 2
 NAME: : UNKNOWN
 GENDER: : FEMALE
 Passenger 3
 NAME: : UNKNOWN
 GENDER: : FEMALE
 Passenger 4
 NAME: : UNKNOWN
 GENDER: : MALE
 Passenger 5
 NAME: : UNKNOWN
 GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name TRAFFIC POLICE DIVISION HQ
 Police Station Address ROAD: 10 UBI AVENUE 3 , POSTCODE: 408865 , COUNTRY: SINGAPORE
 Police Station Contact TEL NO: 65470000 - FAX NO:
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

REFER TO POLICE REPORT - T/20180319/2095 WHILE DRIVING ALONG PIONEER ROAD NORTH AT JUNCTION OF INTERNATIONAL ROAD HEADING TOWARDS JURONG WETS AVENUE 5 WITH PASSENGERS. THE LIGHT CHANGED TO RED SO I HAD TO STOP AT THE TRAFFIC LIGHT. AFTER A FEW SECONDS SUDDENLY I FELT AN IMPACT AT THE BACK OF MY CAR.

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? YES
Remarks/ Reasons: FILE TOO LARGE
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SGH245K
Vehicle Make/Model/Colour
Details Of Properties
Vehicle Category PRIVATE CAR
Name of Driver LIEW XIAN FENG (LIU XIANFENG)
NRIC/Passport Number S9124216H
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name UNKNOWN PASSENGERS
Approximate Age
Injuries Sustain
Injured person in which vehicle? SHB5795B
Were seat belts worn?
Was this injured conveyed to hospital by ambulance? YES
Address
Postcode

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

19/3/2018

SKETCH PLAN

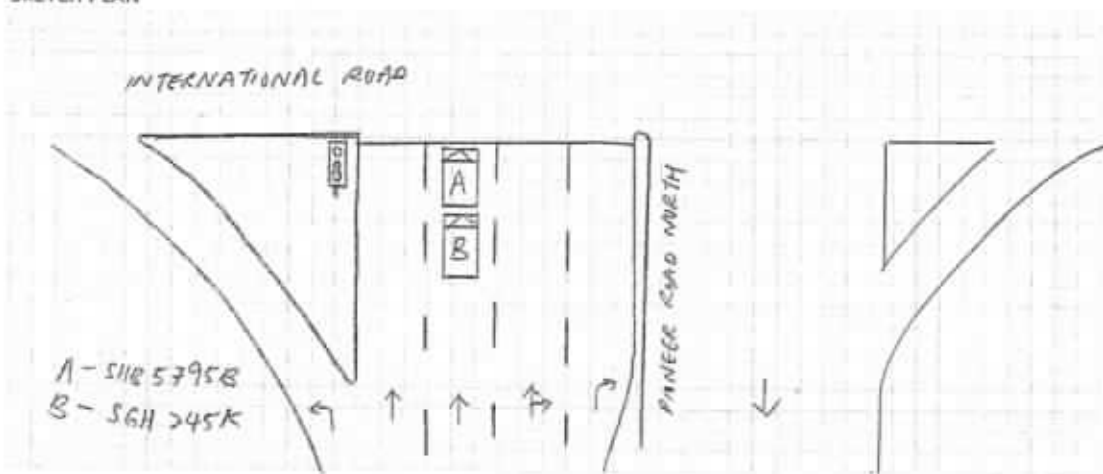

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO POLICE REPORT - 7/21/8119/2095

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature

Date & Time:

Driver's Signature _____

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name: _____

NRIC/FIN No.:



**SINGAPORE
POLICE FORCE**



T/20180319/2095

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

1 of 3

Report No. T/20180319/2095

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 19/03/2018 15:10		Vide Report No.:		Station Diary No.:	
Informant's Particulars					
Name of Informant: ISMAIL BIN ALI			Address: APT BLK 187 BOON LAY AVE #09-78 HDB JURONG WEST SINGAPORE 640187		
ID Type / ID No.: NRIC NO / S1326388D			Contact No.: Home/Office: Mobile: 98822463		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 59	Date of Birth: 16/09/1958	Type of Informant: Driver		
Race: Malay			Language:		Institution / School Name:
Occupation: Taxi driver			Driving Licence Information: Class: Date of Expiry:		

General Information of the Accident

Type of Accident:	Injury Conveyed By Ambulance	Drink Drive: No	Date/Time of Accident: 18/03/2018 00:30	Type of Location:
Location: Along Road 1 PIONEER ROAD NORTH AT JUNCTION OF PIONEER NORTH ROAD AND INTERNATIONAL ROAD HEADING TOWARDS JURONG WEST AVENUE 5				
Weather:		Road Surface:	Road Speed Limit:	
Traffic Flow:		Traffic Control:	Traffic Volume:	
Type of Collision:				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SGH245K	Car	NISSAN	SUNNY 1.6EXA		Seriously Damaged	0
SHB5795B	Car	TOYOTA	PRIUS HYBRID 1.8 CVT		Seriously Damaged	5



**SINGAPORE
POLICE FORCE**



T/20180319/2095

2 of 3

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

Report No. T/20180319/2095

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	ISMAIL BIN ALI	ID No.	S1326388D
Related Vehicle	SHB5795B (Car)	Contact No.	98822463
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	LIEW XIAN FENG	ID No.	S9124216H
Related Vehicle	NIL	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

ON 18/3/18 AT ABOUT 0030HRS

WHILE DRIVING ALONG PIONEER ROAD NORTH AT JUNCTION OF INTERNATIONAL ROAD
HEADING TOWARDS JURONG WEST AVENUE 5 WITH A PASSENGER. THE LIGHT CHANGED TO
RED SO I HAD TO STOP AT THE TRAFFIC LIGHT. AFTER A FEW SECONDS SUDDENLY I FELT AN
IMPACT AT THE BACK OF MY CAR.



**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000



T/20180319/2095

3 of 3


Report No. T/20180319/2095

CONTINUATION OF REPORT


Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the **report number** as reference.

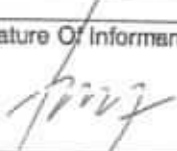Signature Of Officer Recording The Report: TP / LEE KWANG HONG KENDRICK	Signature Of Informant: 
Signature Of Interpreter: Not applicable	Date/Time: 19/03/2018 15:10
Officer In Charge Of Case: TP / GIT / SSI TAN CHIN YONG Contact No.: 65476178	 SINGAPORE POLICE FORCE Classification Of Case: <i>2D</i>
Authentication Stamp NP168	Signature: _____

SMRT Accident Vehicle Repair Estimates



Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5795B
 Ref. No : TAX/03/18/2095
 Reg. Date : 12/12/2017
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS4
 Name of Driver : ISMAIL BIN ALI
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 18/03/2018 12:30:00 AM
 Accident Reported Date / Time : 19/03/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : No
 Towed Back Date/Time : 18/03/2018
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024095106
 Special Instruction to ARC, if any :
 TOWED \$90 / SGH245K
 Prepared Date : 19/03/2018 12:08:01 PM



Sebastian
 20/3/18

- Part by part repair
- Question Mark Item Photo
- Photo Before Paint


 26/3/18

LKK Auto Consultants hence notify
 the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU003575910

Mileage :

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 2,179.00	0.00
Total Spray Painting Charges	: 5,886.00	0.00
Total Material Charges	: 26,887.34	27,821.24
Other Charges	: 2,911.00	0.00
TOTAL	: 37,863.34	0.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 15.00	0.00
Prepared / Adjusted By	:	11 days
Arc / Surveyor Sign Off Date	: 20/03/2018 11:21:06 AM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 20/03/2018 11:02:18 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	2,179.00	0.00 1400
Total Labour	2,179.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY REAR PANEL	180.00	0.00 100
TO RESPRAY TAIL GATE	378.00	0.00 200
TO RESPRAY REAR SPOILER	180.00 ?	0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	0.00 100
TO RESPRAY FILLER RR BUMPER LH	180.00	0.00 50
TO RESPRAY FILLER RR BUMPER RH	180.00	0.00 50
TO RESPRAY ROOF TOP PANEL	378.00 ?	0.00
TO RESPRAY RH RAIL ROOF SIDE	180.00	0.00 100
TO RESPRAY LH RAIL ROOF SIDE	180.00	0.00 100
TO RESPRAY REAR SPARE TYRE PANEL	180.00 ?	0.00
TO RESPRAY REAR FLOOR SIDE PANEL LH	180.00 ?	0.00
TO RESPRAY REAR FLOOR SIDE PANEL RH	180.00 ?	0.00
TO RESPRAY REAR CHASSIS LH	180.00	0.00 50
TO RESPRAY REAR CHASSIS RH	180.00	0.00 50
TO RESPRAY REAR LH WHEEL HOUSE	180.00 ?	0.00
TO RESPRAY RH REAR WHEEL HOUSE	180.00 ?	0.00
TO RESPRAY TROUGH BACK DOOR LH	180.00 ?	0.00
TO RESPRAY TROUGH BACK DOOR RH	180.00 ?	0.00
TO RESPRAY REAR FENDER RH	378.00	0.00 200
TO RESPRAY REAR FENDER LH	378.00	0.00 200
TO RESPRAY REAR DOOR LH	378.00	0.00 200
TO RESPRAY REAR DOOR RH	378.00	0.00 200
TO RESPRAY MEMBER SUB-ASSY, CENTER FLOOR CROSS , NO.2	180.00 ?	0.00
TO RESPRAY MEMBER, REAR FLOOR CROSS , NO.3	180.00 ?	0.00
Total Spray Painting & Panel Beating	5,886.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Out Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
OWING CHARGE	126.00	0.00 X
O CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
O APPLY RUST-PROOFING ON AFFECTED AREA	200.00	0.00 60
O REMOVE / REFIT SEAT	120.00	0.00 X
O ALIGN CHASSIS	350.00	0.00 200
O REMOVE & REFIT EXHAUST	120.00	0.00 50
O REMOVE & REFIT FUEL TANK	120.00 ?	0.00 1
O CHECK & RESET SYSTEM FUNCTION	350.00	0.00 200
O TRANSFER DOOR MECHANISM	240.00	0.00 X
O REMOVE AND REFIX REAR WINDSCREEN	240.00	0.00 150
O TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 50
O PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	0.00 ✓
O REMOVE AND REFIT WIRE HARDESS	200.00	0.00 30
O TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 30
O REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00 50
O INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00 50
O REPLACE SUNDRY PARTS	100.00	0.00 X
O WASH AND VACUUM	60.00	0.00 X
otal Other Costs	2,911.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5215947913			COVER, RR BUMPER ASSY	1	423.90	25.00	317.92	Replace	Replace ✓ CUB	No
5216116010			CLIPS PIECE, FRT & RR BUMPER	10	1.50	25.00	11.25	Replace	Replace ✓ NCC	No
5246247030			PAD, RR BUMPER, RH & LH , 1	2	3.80	25.00	5.70	Replace	Replace ✓ NCC	No
5246247020			PAD, RR BUMPER, RH & LH , 2	2	3.80	25.00	5.70	Replace	Replace ✓ NCC	No
5246247010			PAD, RR BUMPER, RH & LH , 3	2	3.80	25.00	5.70	Replace	Replace ✓ NCC	No
5219147030			SEAL, RR BUMPER ARM, RH & LH	2	11.00	25.00	16.50	Replace	Replace ✓ NCC	No
5256647900			FILLER, RR BUMPER , LH	1	119.90	25.00	89.92	Replace	Replace ✓ MS	No
5256547900			FILLER, RR BUMPER , RH	1	119.90	25.00	89.92	Replace	Replace ✓ CUB	No
5202347030			REAR BUMPER REINFORCEMENT	1	318.80	25.00	239.10	Replace	Replace ✓ ST	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace ✓ DCC	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace ✓ NCC	No
5257647010			RETAINER, RR BUMPER, LH	1	111.50	25.00	83.62	Replace	Replace ✓ NCC	No
5257547010			RETAINER, RR BUMPER, RH	1	112.70	25.00	84.52	Replace	Replace ✓ NCC	No
5259968010			STOPPER, RR BUMPER, RH & LH	2	4.30	25.00	6.45	Replace	Replace ✓ NCC	No
5259247010			SEAL, RR BUMPER , LH	1	85.20	25.00	63.90	Replace	Replace ?	No
5259147010			SEAL, RR BUMPER , RH	1	85.20	25.00	63.90	Replace	Replace ?	No
524534700			GUARD, RR BUMPER, LOWER	1	558.30	25.00	418.72	Replace	Replace ✓ DCC	No
5216947010			COVER, GUARD RR BUMPER LOWER	1	14.80	25.00	11.10	Replace	Replace ✓ MS	No
524614700			PAD, RR BUMPER, CTR	3	2.20	25.00	4.95	Replace	Replace ✓ NCC	No
515814700			LENS & BODY ASSY , RR BUMPER , RH	1	486.80	10.00	438.12	Replace	Replace ✓ SCR	No
515914700			LENS & BODY ASSY , RR BUMPER , LH	1	486.80	10.00	438.12	Replace	Replace ✓ CUB	No
501890609			REAR BUMPER GROMMET SCREW	2	2.20	25.00	3.30	Replace	Replace ✓ NCC	No
521834700			WIRE, LUGGAGE ROOM	1	143.50	10.00	129.15	Replace	Replace ✓ CUB	No
583994700			COVER, REAR FLOOR UNDER , LH	1	234.30	25.00	175.72	Replace	Replace ?	No
583984700			COVER, REAR FLOOR UNDER , RH	1	169.50	25.00	127.12	Replace	Replace ?	No
562594700			COVER, REAR FLOOR UNDER CENTER	1	222.60	25.00	166.95	Replace	Replace ?	No
504671706A0			CLIP , FLOOR UNDER COVER , NO.1	10	2.60	25.00	19.50	Replace	Replace ✓ NCC	No
504671707C0			CLIP , FLOOR UNDER COVER , NO.2	10	3.20	25.00	24.00	Replace	Replace ✓ NCC	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	Recommen d	Approved	Attached
58327470 40			EXHAUST HEAT SHIELD INSULATOR, MAIN MUFFLER REAR	1	137.00	25.00	102.75	Replace	Replace ✓ DT	No
17430377 30			PIPE ASSY, EXHAUST, TAIL	1	1,173.90	25.00	880.42	Replace	Replace ✓ DT	No
17565220 40			SUPPORT, EXHAUST PIPE NO.5	2	41.10	25.00	61.65	Replace	Replace ✓	No
17565280 10			SUPPORT, EXHAUST PIPE NO.4	1	41.10	25.00	30.82	Replace	Replace ✓	No
67005474 40			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	929.60	25.00	697.20	Replace	Replace ✓ DT	No
76801471 10A1			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	891.20	25.00	668.40	Replace	Replace ✓ NS	No
68810470 61			TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2	59.10	25.00	88.65	Replace	Replace ✓	No
68961470 10			TAIL GATE BOLT, BACK DOOR STAY , RH & LH	2	11.80	25.00	17.70	Replace	Replace ✓ NS	No
69350470 50			TAIL GATE LOCK ASSY, BACK DOOR	1	452.10	10.00	406.89	Replace	Replace ✓ DT	No
69321470 10			TAIL GATE LOCK COVER , BACK DOOR	1	25.30	25.00	18.97	Replace	Replace ✓	No
689600W 860			TAIL GATE STAY ASSY , BACK DOOR , LH	1	235.00	25.00	176.25	Replace	Replace ✓	No
689500W 860			TAIL GATE STAY ASSY , BACK DOOR , RH	1	235.00	25.00	176.25	Replace	Replace ✓	No
69430520 50			TAIL GATE STRIKER ASSY, BACK DOOR	1	24.90	25.00	18.67	Replace	Replace ✓ DT	No
56117501 40			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	2	27.90	25.00	41.85	Replace	Replace ✓ NSC	No
64801470 31			TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	1	725.90	25.00	544.42	Replace	Replace ✓ CRW	No
75571470 10			TAIL GATE MOULDING GLASS, BACK DOOR	1	29.70	25.00	22.27	Replace	Replace ✓ NSC	No
75575470 51			TAIL GATE MOULDING LOWER GLASS , BACK DOOR	1	19.70	25.00	14.77	Replace	Replace ✓ NSC	No
75574470 40			TAIL GATE MOULDING LOWER GLASS , BACK DOOR , LH	1	29.90	25.00	22.42	Replace	Replace ✓ NSC	No
75573471 10			TAIL GATE MOULDING LOWER GLASS , BACK DOOR , RH	1	29.90	25.00	22.42	Replace	Replace ✓ NSC	No
64819470 80			TAIL GATE SPACER, BACK DOOR GLASS , LH	1	6.90	25.00	5.17	Replace	Replace ✓ NSC	No
64818470 80			TAIL GATE SPACER, BACK DOOR GLASS , RH	1	6.90	25.00	5.17	Replace	Replace ✓ NSC	No
62785470 10			TAIL GATE SPACER, QUARTER BACK DOOR GLASS	1	5.50	25.00	4.12	Replace	Replace ✓ NSC	No

Part Number	Portion	Stock NO	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
	COMMON		SEALANT W/SCREEN	3	37.00	0.00	111.00	Replace	Replace ✓	No NEC
78814700			TAIL GATE WEATHERSTRIP, BACK DOOR	1	360.70	25.00	270.52	Replace	Replace ✓	No Defect
89455210			TAIL GATE STAY BRACKET, BACK DOOR, RH & LH	2	11.80	25.00	17.70	Replace	Replace	No
47214700C0			TAILGATE BOARD, COVER	1	24.10	25.00	18.07	Replace	Replace ✓	No NEC
48114700C0			TAILGATE BOARD, HANDLE PULL	1	19.50	25.00	14.62	Replace	Replace ✓	No NS
77504700C0			TAILGATE BOARD ASSY	1	251.50	25.00	188.62	Replace	Replace	No
79384700C0			TAILGATE TRIM, LH	1	92.10	25.00	69.07	Replace	Replace	No
77514710C0			TAILGATE TRIM, LOWER	1	218.50	25.00	163.87	Replace	Replace	No
79374700C0			TAILGATE TRIM, RH	1	92.10	25.00	69.07	Replace	Replace	No
47904700C0			TAILGATE TRIM, UPPER	1	50.50	25.00	37.87	Replace	Replace	No
51291300			TAIL GATE CUSHION, REAR LICENCE PLATE	2	2.10	25.00	3.15	Replace	Replace	No
			NUMBER PLATE	1	35.00	0.00	35.00	Replace	Replace ✓	No NS
			NUMBER PLATE FRAME	1	25.00	0.00	25.00	Replace	Replace ✓	No NS
12703310			LAMP ASSY, LICENSE PLATE	2	63.70	10.00	114.66	Replace	Replace	No
57804710			CAMERA REAR ASSY, TELEVISION	1	1,103.80	10.00	993.42	Replace	Replace	No
48404700			SWITCH ASSY, BACK DOOR OPENER	1	149.40	10.00	134.46	Replace	Replace	No
99973010			ANTENNA, ELECTRICAL KEY	1	60.30	10.00	54.27	Replace	Replace ✓	No NEC
21844740			WIRE, TAIL GATE BACK DOOR,	1	246.80	10.00	222.12	Replace	Replace	No
21854710			WIRE, TAIL GATE BACK DOOR, NO.2	1	246.80	10.00	222.12	Replace	Replace	No
30854793			SPOILER SUB-ASSY, REAR	1	1,322.10	25.00	991.57	Replace	Replace	No
10064700			LAMP SET, STOP CENTER	1	186.50	10.00	167.85	Replace	Replace	No
34414700			NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace	No NEC
34424710			NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace ✓	No NEC
34034801			EMBLEM SUB-ASSY REAR	1	46.30	25.00	34.72	Replace	Replace ✓	No NEC
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace ✓	No NEC
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace ✓	No NEC
11114701			PANEL, ROOF	1	1,245.20	25.00	933.90	Repair	Replace ?	No

Part Number	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	Recommended	Approved	Attached
56074700	MOULDING SUB-ASSY, ROOF TOP	1	637.40	25.00	478.05	Replace	Replace	No
50564700	MOULDING SUB-ASSY, ROOF DRIP SIDE FINISH, REAR LH	1	52.70	25.00	39.52	Replace	Replace	No
50554700	MOULDING SUB-ASSY, ROOF DRIP SIDE FINISH, REAR RH	1	52.70	25.00	39.52	Replace	Replace	No
10184700	MEMBER SUB-ASSY, RAIL ROOT SIDE REAR LH	1	279.20	25.00	209.40	Replace	Replace	No
10174700	MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH	1	279.20	25.00	209.40	Replace	Replace	No
83074700	END PANEL SUB-ASSY, BODY LOWER BACK	1	629.80	25.00	472.35	Replace	Replace	No
47184700C0	END PANEL , COVER, DECK TRIM SERVICE HOLE	1	47.00	25.00	35.25	Replace	Replace	No
47164710C0	END PANEL , COVER, DECK TRIM, REAR	1	122.80	25.00	92.10	Replace	Replace	No
83504700	REINFORCEMENT ASSY, REAR FLOOR END PANEL , RH & LH	2	56.70	25.00	85.05	Replace	Replace	No
COMMO N	4006314 SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No
83114710	SPARE TYRE PANEL , PAN, REAR FLOOR	1	564.80	25.00	423.60	Replace	Replace	No
83164700	EXTENSION, REAR FLOOR SIDE PANEL , LH	1	76.20	25.00	57.15	Replace	Replace	No
83154700	EXTENSION, REAR FLOOR SIDE PANEL , RH	1	76.20	25.00	57.15	Replace	Replace	No
76034700	MEMBER SUB-ASSY, REAR FLOOR SIDE , REAR RH	1	268.60	25.00	201.45	Replace	Replace	No
76044700	MEMBER SUB-ASSY, REAR FLOOR SIDE , REAR LH	1	268.60	25.00	201.45	Replace	Replace	No
76534700	MEMBER, REAR FLOOR CROSS , NO. 3	1	219.00	25.00	164.25	Replace	Replace	No
74054700	MEMBER SUB-ASSY, CENTER FLOOR CROSS , NO.2	1	500.50	25.00	375.37	Replace	Replace	No
16084790	PANEL QUARTER WHEEL HOUSE , INNER LH	1	527.00	25.00	395.25	Replace	Replace	No
16074790	PANEL QUARTER WHEEL HOUSE , INNER RH	1	527.00	25.00	395.25	Replace	Replace	No
14154710C2	BOARD, REAR FLOOR, NO.1	1	502.20	25.00	376.65	Replace	Replace	No
9934710	BOX, DECK FLOOR, REAR	1	102.20	25.00	76.65	Replace	Replace	No
9974700	BOX, DECK FLOOR, LH	1	303.40	25.00	227.55	Replace	Replace	No
9954700	BOX, DECK FLOOR, RH	1	304.00	25.00	228.00	Replace	Replace	No

Number	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	Recommen d	Approved	Attached
34740471 30C2	PANEL ASSY, DECK TRIM SIDE, LH	1	344.70	25.00	258.52	Replace	Replace	No Defect
34730472 40C2	PANEL ASSY, DECK TRIM SIDE, RH	1	344.70	25.00	258.52	Replace	Replace	No Defect
34910470 30C0	COVER ASSY, TONNEAU	1	944.20	25.00	708.15	Replace	Replace	No
3216147 V40	WIRE, FLOOR	1	3,860.00	10.00	3,474.00	Replace	Replace	No
58351120 30	BRACKET, SPARE WHEEL CLAMP	1	21.30	25.00	15.97	Replace	Replace	No
31561471 31	LENS & BODY, REAR COMBINATION LAMP , LH	1	438.10	10.00	394.29	Replace	Replace	No ✓ Cak
31622470 30	TROUGH, BACK DOOR, LH	1	99.80	25.00	74.85	Replace	Replace	No
31602471 30	PANEL SUB-ASSY, FENDER REAR LH	1	824.80	25.00	618.60	Replace	Replace	No
32940470 10	DUCT ASSY, QUARTER VENT, RH & LH	1	65.00	25.00	48.75	Replace	Replace	No ✓ Defect
35638470 30	LINER, REAR FENDER, LH	1	135.80	25.00	101.85	Replace	Replace	No
37004472 0	PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	25.00	932.92	Replace	Replace	No
39060522 10	DOOR LOCK REAR, LH	1	544.70	10.00	490.23	Replace	Replace	No
39410201 0	DOOR LOCK STRIKER	1	38.00	25.00	28.50	Replace	Replace	No
38780520 1	HINGE ASSY, REAR DOOR, LOWER LH	1	73.30	25.00	54.97	Replace	Replace	No
38760201 2	HINGE ASSY, REAR DOOR, UPPER LH	1	83.30	25.00	62.47	Replace	Replace	No
38630470 0	CHECK ASSY, REAR DOOR	1	153.50	25.00	115.12	Replace	Replace	No
3551472 1	LENS & BODY, REAR COMBINATION LAMP , RH	1	438.10	10.00	394.29	Replace	Replace	No ✓ Defect
3621470 0	TROUGH, BACK DOOR, RH	1	99.80	25.00	74.85	Replace	Replace	No
3601471 0	PANEL SUB-ASSY, FENDER REAR RH	1	824.80	25.00	618.60	Replace	Replace	No
32940470 0	DUCT ASSY, QUARTER VENT, RH & LH	1	65.00	25.00	48.75	Replace	Replace	No
35637470 0	LINER, REAR FENDER, RH	1	135.80	25.00	101.85	Replace	Replace	No
37003472 3	PANEL SUB-ASSY, REAR DOOR, RH	1	1,243.90	25.00	932.92	Replace	Replace	No
3050522 3	DOOR LOCK REAR, RH	1	544.70	10.00	490.23	Replace	Replace	No
3410201 3	DOOR LOCK STRIKER	1	38.00	25.00	28.50	Replace	Replace	No
3770520 1	HINGE ASSY, REAR DOOR, LOWER RH	1	73.30	25.00	54.97	Replace	Replace	No
3750201 2	HINGE ASSY, REAR DOOR, UPPER RH	1	83.30	25.00	62.47	Replace	Replace	No
3630470 3	CHECK ASSY, REAR DOOR	1	153.50	25.00	115.12	Replace	Replace	No
3931470 3	CARRIER, SPARE WHEEL	1	20.00	25.00	15.00	Replace	Replace	No
TOTAL MATERIALS					26,887.57	27,821.24		

TOTAL MATERIALS(Discounted)

20,001.34 21,041.47

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

SMRT Accident Vehicle Repair Estimates

3-4-18 / 13:00

4-4-18 / 08:00

21-3-18 / 08:00

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5795B
 Ref. No : TAX/03/18/2095
 Reg. Date : 12/12/2017
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS4
 Name of Driver : ISMAIL BIN ALI
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 18/03/2018 12:30:00 AM
 Accident Reported Date / Time : 19/03/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by : Sebastian
 Vehicle is Towed Back? : No (Yes)
 Towed Back Date/Time : 18/03/2018
 Replacement Vehicle Issued? : No
 Accident Repair Job Card No : 000024095106
 Special Instruction to ARC, if any :
 TOWED \$90 / SGH245K NTUC R/P
 BEFORE PAINT PHOTO AND AFTER PAINT PHOTO, FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL
 SURVEYOR SEBASTIAN (LKK) & Email : sebastianyeang@lkkauto.com HP: 90036121
 Prepared Date : 19/03/2018 12:08:01 PM



18:25

16-18

pass

37767

37733

Recording Camera

☐
☒

Radio Antenna

☐
☒

1st witness

Date

20-3-18

2nd witness

Date

1-6-18

(R) rear camera not in the car. Supplementing

+ Refer to the Supplementing part 1/18

LEE SHENG AUTO PTE LTD

Vehicle Return Date:

1/6/18

Vehicle Return Time:

14:37

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU003575910

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	2,179.00	1,800.00
Total Spray Painting Charges :	5,886.00	1,800.00
Total Material Charges :	24,436.02	14,936.52
Other Charges :	2,785.00	975.00
TOTAL :	35,286.02 48,076.18	19,511.52
Lump Sum Total :	0.00	0.00
No. of Repair Days :	16.00	15.00
Prepared / Adjusted By :		SEBASTIAN (LKK)
Arc / Surveyor Sing Off Date :	20/03/2018 11:21:06 AM	20/03/2018 04:11:26 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 20/03/2018 11:02:18 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : 2N-1806-0125

Invoice No :

Quotation Date : 6/6

Invoice Date :

Invoice Amount :

Prepared Date :

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	60.00
TO REMOVE / REFIT SEAT	120.00	0.00
TO ALIGN CHASSIS	350.00	200.00
TO REMOVE & REFIT EXHAUST	120.00	50.00
TO REMOVE & REFIT FUEL TANK	120.00	0.00
TO CHECK & RESET SYSTEM FUNCTION	350.00	200.00
TO TRANSFER DOOR MECHANISM	240.00	0.00
TO REMOVE AND REFIX REAR WINDSCREEN	240.00	120.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	50.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	125.00
TO REMOVE AND REFIT WIRE HARDESS	200.00	30.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	50.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	2,785.00	975.00

58096 12

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	2,179.00	1,800.00
Total Labour	2,179.00	1,800.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00
TO RESPRAY REAR PANEL	180.00	100.00
TO RESPRAY TAIL GATE	378.00	200.00
TO RESPRAY REAR SPOILER	180.00	0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100.00
TO RESPRAY FILLER RR BUMPER LH	180.00	50.00
TO RESPRAY FILLER RR BUMPER RH	180.00	50.00
TO RESPRAY ROOF TOP PANEL	378.00	0.00
TO RESPRAY RH RAIL ROOF SIDE	180.00	100.00
TO RESPRAY LH RAIL ROOF SIDE	180.00	100.00
TO RESPRAY REAR SPARE TYRE PANEL	180.00	0.00
TO RESPRAY REAR FLOOR SIDE PANEL LH	180.00	0.00
TO RESPRAY REAR FLOOR SIDE PANEL RH	180.00	0.00
TO RESPRAY REAR CHASSIS LH	180.00	50.00
TO RESPRAY REAR CHASSIS RH	180.00	50.00
TO RESPRAY REAR LH WHEEL HOUSE	180.00	0.00
TO RESPRAY RH REAR WHEEL HOUSE	180.00	0.00
TO RESPRAY TROUGH BACK DOOR LH	180.00	0.00
TO RESPRAY TROUGH BACK DOOR RH	180.00	0.00
TO RESPRAY REAR FENDER RH	378.00	200.00
TO RESPRAY REAR FENDER LH	378.00	200.00
TO RESPRAY REAR DOOR LH	378.00	200.00
TO RESPRAY REAR DOOR RH	378.00	200.00
TO RESPRAY MEMBER SUB-ASSY, CENTER FLOOR CROSS , NO.2	180.00	0.00
TO RESPRAY MEMBER, REAR FLOOR CROSS , NO.3	180.00	0.00
Total Spray Painting & Panel Beating	5,886.00	1,800.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
5215947913			COVER, RR BUMPER ASSY	1	423.90	25.00	317.92	Replace	Replace	No	CRK
5218116010			CLIPS PIECE, FRT & RR BUMPER	10	1.50 15	25.00	11.25	Replace	Replace	No	NEC
5246247030			PAD, RR BUMPER, RH & LH, 1	2	3.80 7.60	25.00	5.70	Replace	Replace	No	NEC
5246247020			PAD, RR BUMPER, RH & LH, 2	2	3.80 7.60	25.00	5.70	Replace	Replace	No	NEC
5246247010			PAD, RR BUMPER, RH & LH, 3	2	3.80 7.60	25.00	5.70	Replace	Replace	No	NEC
5219147030			SEAL, RR BUMPER ARM, RH & LH	2	11.00 22	25.00	16.50	Replace	Replace	No	NEC
5256647900			FILLER, RR BUMPER, LH	1	119.90	25.00	89.92	Replace	Replace	No	MS
5256647900			FILLER, RR BUMPER, RH	1	119.90	25.00	89.92	Replace	Replace	No	CRK
5202347030			REAR BUMPER REINFORCEMENT	1	318.80	25.00	239.10	Replace	Replace	No	BT
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No	DM
			PIXEL STICKER	2	60.00 120	0.00	120.00	Replace	Replace	No	NEC
5257647040			RETAINER, RR BUMPER, LH	1	111.50	25.00	83.62	Replace	Replace	No	NEC
5257547040			RETAINER, RR BUMPER, RH	1	112.70	25.00	84.52	Replace	Replace	No	NEC
5259968030			STOPPER, RR BUMPER, RH & LH	2	4.30 8.60	25.00	6.45	Replace	Replace	No	NEC
5259247040			SEAL, RR BUMPER, LH	1	85.20	25.00	63.90	Replace	Replace	No	CRK
5259147050			SEAL, RR BUMPER, RH	1	85.20	25.00	63.90	Replace	Check	No	SVC
5245347010			GUARD, RR BUMPER, LOWER	1	558.30	25.00	418.72	Replace	Replace	No	Def
5216947020			COVER, GUARD RR BUMPER LOWER	1	14.80	25.00	11.10	Replace	Replace	No	MS
5246147010			PAD, RR BUMPER, CTR	3	2.20 6.60	25.00	4.95	Replace	Replace	No	NEC
8158147010			LENS & BODY ASSY, RR BUMPER, RH	1	486.80	10.00	438.12	Replace	Replace	No	SCR
8159147010			LENS & BODY ASSY, RR BUMPER, LH	1	486.80	10.00	438.12	Replace	Replace	No	CRK
9018906029			REAR BUMPER GROMMET SCREW	2	2.20 4.40	25.00	3.30	Replace	Replace	No	NEC
8218347020			WIRE, LUGGAGE ROOM	1	143.50	10.00	129.15	Replace	Replace	No	cut
5839947030			COVER, REAR FLOOR UNDER, LH	1	234.30	25.00	175.73 175.72	Replace	Replace	No	cut
5839847050			COVER, REAR FLOOR UNDER, RH	1	169.50	25.00	127.13	Replace	Check	No	NIN
6625947010			COVER, REAR FLOOR UNDER CENTER	1	222.60	25.00	166.95	Replace	Replace	No	cut
9046717026A0			CLIP, FLOOR UNDER COVER, NO.1	10	2.60 26	25.00	19.50	Replace	Replace	No	NEC
9046717027C0			CLIP, FLOOR UNDER COVER, NO.2	10	3.20 32	25.00	24.00	Replace	Replace	No	NEC
5832747040			EXHAUST HEAT SHIELD INSULATOR, MAIN MUFFLER REAR	1	137.00	25.00	102.75	Replace	Replace	No	BT

4268.10

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
1743037730			PIPE ASSY, EXHAUST TAIL	1	1,173.90	25.00	880.42	Replace	Replace	No /	BT
1756522040			SUPPORT, EXHAUST PIPE NO.5	2	41.10 82.20	25.00	61.65	Replace	Check	No X	SVC
1756528010			SUPPORT, EXHAUST PIPE NO.4	1	41.10	25.00	30.83	Replace	Check	No X	
6700547440			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	929.60	25.00	897.20	Replace	Replace	No /	DT
7680147110A1			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	891.20	25.00	668.40	Replace	Replace	No /	MS
6881047061			TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2	59.10 118.20	25.00	88.65	Replace	Check	No X	NN
6896147010			TAIL GATE BOLT, BACK DOOR STAY, RH & LH	2	11.80 23.60	25.00	17.70	Replace	Replace	No /	HEC
6935047050			TAIL GATE LOCK ASSY, BACK DOOR	1	452.10	10.00	406.89	Replace	Replace	No /	DM
6932147010			TAIL GATE LOCK COVER, BACK DOOR	0	25.30	25.00	0.00	Replace	Not given	No X	NN
689600W860			TAIL GATE STAY ASSY, BACK DOOR, LH	1	235.00	25.00	176.25	Replace	Check	No X	NN
689500W860			TAIL GATE STAY ASSY, BACK DOOR, RH	1	235.00	25.00	176.25	Replace	Check	No X	NN
6943052050			TAIL GATE STRIKER ASSY, BACK DOOR	1	24.90	25.00	18.87	Replace	Replace	No /	BT
5611750140			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	2	27.90 55.80	25.00	41.85	Replace	Replace	No /	HEC
6480147031			TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	1	225.90	25.00	544.42	Replace	Replace	No /	URK
7557147010			TAIL GATE MOULDING GLASS, BACK DOOR	1	29.70	25.00	22.27	Replace	Replace	No /	HEC
7557547051			TAIL GATE MOULDING LOWER GLASS, BACK DOOR	1	19.70	25.00	14.77	Replace	Replace	No /	HEC
7557447040			TAIL GATE MOULDING LOWER GLASS, BACK DOOR, LH	1	29.90	25.00	22.42	Replace	Replace	No /	HEC
7557347110			TAIL GATE MOULDING LOWER GLASS, BACK DOOR, RH	1	29.90	25.00	22.42	Replace	Replace	No /	HEC
6481947080			TAIL GATE SPACER, BACK DOOR GLASS, LH	1	5.90	25.00	5.17	Replace	Replace	No /	HEC
6481847080			TAIL GATE SPACER, BACK DOOR GLASS, RH	1	5.90	25.00	5.17	Replace	Replace	No /	HEC
6278547010			TAIL GATE SPACER, QUARTER BACK DOOR GLASS	1	5.50	25.00	4.12	Replace	Replace	No /	HEC
	COMMON		SEALANT W/SCREEN	3	37.00 111	0.00	111.00	Replace	Replace	No /	HEC
6788147050			TAIL GATE WEATHERSTRIP, BACK DOOR	1	360.70	25.00	270.52	Replace	Replace	No /	Def
6894552110			TAIL GATE STAY BRACKET, BACK DOOR, RH & LH	2	11.80 23.60	25.00	17.70	Replace	Check	No X	NN

5637.60

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
64721470 50C0			TAILGATE BOARD , COVER	1	24.10	25.00	18.07	Replace	Replace	No	CRG
74811470 20C0			TAILGATE BOARD , HANDLE PULL	1	19.50	25.00	14.62	Replace	Replace	No	MS
67750470 80C0			TAILGATE BOARD ASSY	1	251.50	25.00	188.63 188.62	Replace	Replace	No	WJ
67938470 80C0			TAILGATE TRIM , LH	1	92.10	25.00	69.08	Replace	Check	No	X
67751471 10C0			TAILGATE TRIM , LOWER	1	218.50	25.00	163.88	Replace	Check	No	X
67937470 80C0			TAILGATE TRIM , RH	1	92.10	25.00	69.08	Replace	Check	No	X
64790470 60C0			TAILGATE TRIM , UPPER	1	50.50	25.00	37.88	Replace	Check	No	X
75129130 20			TAIL GATE CUSHION, REAR LICENCE PLATE	2	2.10 4.20	25.00	3.15	Replace	Check	No	X
			NUMBER PLATE	1	35.00	0.00	35.00	Replace	Replace	No	MS
			NUMBER PLATE FRAME	1	25.00	0.00	25.00	Replace	Replace	No	MS
81270331 10			LAMP ASSY, LICENSE PLATE	2	63.70 127.40	10.00	114.66	Replace	Check	No	X
867B047 010			CAMERA REAR ASSY, TELEVISION	1	1,103.80	10.00	993.42	Replace	Check	No	X
84840470 40			SWITCH ASSY, BACK DOOR OPENER	1	149.40	10.00	134.46	Replace	Check	No	X
89997301 00			ANTENNA, ELECTRICAL KEY	1	60.30	10.00	54.27	Replace	Replace	No	DM
82184474 90			WIRE, TAIL GATE BACK DOOR	1	246.80	10.00	222.12	Replace	Check	No	X
82185471 50			WIRE, TAIL GATE BACK DOOR , NO.2	1	246.80	10.00	222.12	Replace	Check	No	X
76085479 16			SPOILER SUB-ASSY, REAR	1	1,322.10	25.00	991.58 991.57	Replace	Replace	No	MS
81008470 30			LAMP SET, STOP CENTER	1	186.50	10.00	167.85	Replace	Replace	No	CRG
75441470 90			NAME PLATE (HYBRID) , LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace	No	HEC
75442471 30			NAME PLATE (PRIUS) , LUGGAGE COMPARTMENT DOOR	1	52.30	25.00	39.22	Replace	Replace	No	HEC
75403480 10			EMBLEM SUB-ASSY REAR	1	46.30	25.00	34.72	Replace	Replace	No	HEC
	COMMO N		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No	HEC
			STICKER DECAL 6555 B888	1	21.60	0.00	21.60	Replace	Replace	No	HEC
63111470 60			PANEL, ROOF	1	1,245.20	25.00	933.90	Repair	Check	No	X
75607470 10			MOULDING SUB- ASSY, ROOF TOP	1	637.40	25.00	478.05	Replace	Check	No	X
75056470 10			MOULDING SUB- ASSY, ROOF DRIP SIDE FINISH, REAR LH	1	52.70	25.00	39.53	Replace	Check	No	X
75055470 10			MOULDING SUB- ASSY, ROOF DRIP SIDE FINISH, REAR RH	1	52.70	25.00	39.53	Replace	Check	No	X

6423.90

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
6101847010			MEMBER SUB-ASSY, RAIL ROOT SIDE REAR LH	1	279.20	100.00	0.00	Replace	Repair	No <i>R</i>
6101747010			MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH	1	279.20	100.00	0.00	Replace	Repair	No <i>R</i>
5830747090			END PANEL SUB-ASSY, BODY LOWER BACK	1	629.80	25.00	472.35	Replace	Replace	No <i>/</i> <i>DT</i>
6471847080C0			END PANEL, COVER, DECK TRIM SERVICE HOLE	1	47.00	25.00	35.25	Replace	Replace	No <i>/</i> <i>DEF</i>
6471647130C0			END PANEL, COVER, DECK TRIM, REAR	1	122.80	25.00	92.10	Replace	Replace	No <i>/</i> <i>DEF</i>
5835047010			REINFORCEMENT ASSY, REAR FLOOR END PANEL, RH & LH	2	56.70 <i>113.40</i>	25.00	85.05	Replace	Check	No <i>X</i> <i>R</i>
	COMMO N	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No <i>/</i> <i>NEC</i>
5831147130			SPARE TYRE PANEL, PAN, REAR FLOOR	1	564.80	25.00	423.60	Replace	Replace <i>S</i>	No <i>/</i> <i>NEC</i>
5831647010			EXTENSION, REAR FLOOR SIDE PANEL, LH	1	76.20	25.00	57.15	Replace	Check	No <i>X</i> <i>R</i>
5831547020			EXTENSION, REAR FLOOR SIDE PANEL, RH	1	76.20	25.00	57.15	Replace	Check	No <i>X</i> <i>R</i>
5760347060			MEMBER SUB-ASSY, REAR FLOOR SIDE, REAR RH	1	268.60	25.00	201.45	Replace	Check	No <i>X</i> <i>R</i>
5760447060			MEMBER SUB-ASSY, REAR FLOOR SIDE, REAR LH	1	268.60	25.00	201.45	Replace	Replace <i>S</i>	No <i>/</i> <i>BT</i>
5765347040			MEMBER, REAR FLOOR CROSS, NO. 3	1	219.00	25.00	164.25	Replace	Check	No <i>X</i> <i>R</i>
5740547010			MEMBER SUB-ASSY, CENTER FLOOR CROSS, NO. 2	1	500.50	25.00	375.38	Replace	Check	No <i>X</i> <i>R</i>
6160847900			PANEL, QUARTER WHEEL HOUSE, INNER LH	1	527.00	25.00	395.25	Replace	Replace	No <i>/</i> <i>DT</i>
6160747900			PANEL, QUARTER WHEEL HOUSE, INNER RH	1	527.00	100.00	0.00	Replace	Repair	No <i>R</i>
5841547110C2			BOARD, REAR FLOOR, NO. 1	1	502.20	25.00	376.65	Replace	Replace <i>S</i>	No <i>/</i> <i>CPA</i>
6499347110			BOX, DECK FLOOR, REAR	1	103.20	25.00	78.65	Replace	Check	No <i>X</i> <i>AN</i>
6499747060			BOX, DECK FLOOR, LH	1	303.40	25.00	227.55	Replace	Replace <i>S</i>	No <i>/</i> <i>CPA</i>
6499547050			BOX, DECK FLOOR, RH	1	304.00	25.00	228.00	Replace	Replace <i>S</i>	No <i>/</i> <i>CPA</i>
6474047190C2			PANEL ASSY, DECK TRIM SIDE, LH	1	344.70	25.00	258.52	Replace	Replace	No <i>/</i> <i>DEF</i>
6473047240C2			PANEL ASSY, DECK TRIM SIDE, RH	1	344.70	25.00	258.52	Replace	Replace	No <i>/</i> <i>DEF</i>
6491047060C0			COVER ASSY, TONNEAU	1	944.20	25.00	708.15	Replace	Check	No <i>X</i> <i>NN</i>
8216147N40			WIRE, FLOOR	1	3,660.00	10.00	3,474.00	Replace	Check	No <i>X</i> <i>NN</i>
5835112060			BRACKET, SPARE WHEEL CLAMP	1	21.30	25.00	15.98	Replace	Check	No <i>X</i> <i>NN</i>

11,263

81 11/25/2018

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
8156147151			LENS & BODY, REAR COMBINATION LAMP, LH	1	438.10	10.00	394.29	Replace	Replace	No
6162247060			TROUGH, BACK DOOR, LH	1	99.80	25.00	74.85	Replace	Replace S	No
6160247160			PANEL SUB-ASSY, FENDER REAR LH	1	824.80	25.00	618.60	Replace	Replace S	No
6294047010			DUCT ASSY, QUARTER VENT, RH & LH	1	65.00	25.00	48.75	Replace	Replace	No
6563847060			LINER, REAR FENDER, LH	1	135.80	25.00	101.85	Replace	Check	No X
6700447210			PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	100.00	0.00	Replace	Repair	No R
6906052280			DOOR LOCK REAR, LH	1	544.70	10.00	490.23	Replace	Check	No X
6941020110			DOOR LOCK STRIKER	1	38.00	25.00	28.50	Replace	Check	No X
6878052031			HINGE ASSY, REAR DOOR, LOWER LH	1	73.30	25.00	54.98	Replace	Check	No X
6876020122			HINGE ASSY, REAR DOOR, UPPER LH	1	83.30	25.00	62.48	Replace	Check	No X
6863047050			CHECK ASSY, REAR DOOR	1	153.50	25.00	115.13	Replace	Check	No X
8155147281			LENS & BODY, REAR COMBINATION LAMP, RH	1	438.10	10.00	394.29	Replace	Replace	No
6162147050			TROUGH, BACK DOOR, RH	1	99.80	25.00	74.85	Replace	Replace S	No
6160147150			PANEL SUB-ASSY, FENDER REAR RH	1	824.80	100.00	0.00	Replace	Repair	No R
6294047010			DUCT ASSY, QUARTER VENT, RH & LH	0	65.00	25.00	0.00	Replace	Not given	No X
6563747060			LINER, REAR FENDER, RH	1	135.80	25.00	101.85	Replace	Check	No X
6700347210			PANEL SUB-ASSY, REAR DOOR, RH	1	1,243.90	100.00	0.00	Replace	Repair	No R
6905052250			DOOR LOCK REAR, RH	0	544.70	10.00	0.00	Replace	Not given	No X
6941020110			DOOR LOCK STRIKER	0	38.00	25.00	0.00	Replace	Not given	No X
6877052031			HINGE ASSY, REAR DOOR, LOWER RH	0	73.30	25.00	0.00	Replace	Not given	No X
6875020122			HINGE ASSY, REAR DOOR, UPPER RH	0	83.30	25.00	0.00	Replace	Not given	No X
6863047050			CHECK ASSY, REAR DOOR	0	153.50	25.00	0.00	Replace	Not given	No X
5193147030			CARRIER, SPARE WHEEL	1	20.00	25.00	15.00	Replace	Replace S	No
5120647012			REAR MEMBER SUB-ASSY, RR	1	2,171.70	25.00	1,628.77	Replace	Replace S	No
			INSULATOR SHEET	1	41.48	10.00	37.33	Replace	Replace S	No
TOTAL MATERIALS					9633.58		24,436.15	14,936.54		
TOTAL MATERIALS(Discounted)							24,436.02	14,936.52		

Added Spare Parts / Material Usage After Surveyor Signed off

14,936.52
+ 20.00
+ 20.00
= 15,176.52

14,936.52

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Thursday, 14 June 2018 10:26 AM
To: 'Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)'
Cc: SUR; CS A Team
Subject: RE: SHB5795B

Dear Poh Suan,

WITHOUT PREJUDICE

Confirmed amount of \$19,511.52 @ 15 working days.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)
Sent: Wednesday, 13 June 2018 3:07 PM
To: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC) <YeoPohsuan@smrt.com.sg>
Cc: SUR <sur@lkkauto.com>; CS A Team <cs-a@lkkauto.com>
Subject: RE: SHB5795B

Dear Poh Suan,

Confirmed amount of \$19,511.52

No of days :13 working days ,please confirmed.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC) [<mailto:YeoPohsuan@smrt.com.sg>]
Sent: Sunday, 10 June 2018 11:47 AM
To: Sebastian Yeang (LKK Auto) <SebastianYeang@lkkauto.com>
Cc: SUR <sur@lkkauto.com>; CS A Team <cs-a@lkkauto.com>
Subject: SHB5795B

Hi Sebastian,

Attached herewith the repair estimate of SHB 5795B having Case No: TAX/03/18/2095.

There is no change to the approved amount of \$19,511.52 @ 15 working days under part by part repair.

Cost of Repair invoice will be generated as approved.

Please finalize with me within 7 working day, thanks.

Thanks & Regards
Poh Suan

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)

Sent: Sunday, 10 June 2018 11:45 AM

To: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC)

Subject: Scan Data from FX-D421D6

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham describe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18005513/Svbe2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 25-06-2018	
			Code: INC4	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SGH 245K	Veh. Inspected	SHB 5795B	
Policy No.	5050613007-06	Coverage (\$)	0.00	
Claim No.	MT/0986885-004	Excess (\$)	0.00	
Assign From		Assign Date	20/03/2018	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS 4	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTDKB3FU003575910	Colour	MAROON	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm	
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	18/03/2018	Inspection Date	20/03/2018	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		15 Working Days		

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5795B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR MEMBER SUB-ASSY, RR (DISC 25%)	BUCKLED	2,171.70	1,628.77
1	COVER, RR BUMPER ASSY (DISC 25%)	CRACKED	423.90	317.92
10	CLIPS PIECE, FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
2	PAD, RR BUMPER, RH & LH, 1 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD, RR BUMPER, RH & LH, 2 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD, RR BUMPER, RH & LH, 3 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	SEAL, RR BUMPER ARM, RH & LH @\$11.00 (DISC 25%)	NECESSARY	22.00	16.50
1	FILLER, RR BUMPER, LH (DISC 25%)	MISSING	119.90	89.92
1	FILLER, RR BUMPER, RH (DISC 25%)	CRACKED	119.90	89.92
1	REAR BUMPER REINFORCEMENT (DISC 25%)	BENT	318.80	239.10
1	RETAINER, RR BUMPER, LH (DISC 25%)	NECESSARY	111.50	83.62
1	RETAINER, RR BUMPER, RH (DISC 25%)	NECESSARY	112.70	84.52
2	STOPPER, RR BUMPER, RH & LH @\$4.30 (DISC 25%)	NECESSARY	8.60	6.45
1	SEAL, RR BUMPER, LH (DISC 25%)	CUT	85.20	63.90
1	GUARD, RR BUMPER, LOWER (DISC 25%)	DEFORMED	558.30	418.72
1	COVER, GUARD RR BUMPER LOWER (DISC 25%)	MISSING	14.80	11.10
3	PAD, RR BUMPER, CTR @\$2.20 (DISC 25%)	NECESSARY	6.60	4.95
2	REAR BUMPER GROMMET SCREW @\$2.20 (DISC 25%)	NECESSARY	4.40	3.30
1	COVER, REAR FLOOR UNDER, LH (DISC 25%)	CUT	234.30	175.72
1	COVER, REAR FLOOR UNDER CENTER (DISC 25%)	CUT	222.60	166.95
10	CLIP, FLOOR UNDER COVER, NO.1 @\$2.60 (DISC 25%)	NECESSARY	26.00	19.50
10	CLIP, FLOOR UNDER COVER, NO.2 @\$3.20 (DISC 25%)	NECESSARY	32.00	24.00
1	EXHAUST HEAT SHIELD INSULATOR, MAIN MUFFLER REAR (DISC 25%)	BENT	137.00	102.75
1	PIPE ASSY, EXHAUST TAIL (DISC 25%)	BENT	1,173.90	880.42
1	TAIL GATE PANEL SUB-ASSY, BACK DOOR (DISC 25%)	DENTED	929.60	697.20
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY (DISC 25%)	MISSING	891.20	668.40
2	TAIL GATE BOLT, BACK DOOR STAY, RH & LH @\$11.80 (DISC 25%)	NECESSARY	23.60	17.70
1	TAIL GATE STRIKER ASSY, BACK DOOR (DISC 25%)	BENT	24.90	18.67

Report Ref No. NS/INC18005513/Svbe2

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE @\$27.90 (DISC 25%)	NECESSARY	55.80	41.85
1	TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR (DISC 25%)	CRACKED	725.90	544.42
1	TAIL GATE MOULDING GLASS, BACK DOOR (DISC 25%)	NECESSARY	29.70	22.27
1	TAIL GATE MOULDING LOWER GLASS, BACK DOOR (DISC 25%)	NECESSARY	19.70	14.77
1	TAIL GATE MOULING LOWER GLASS, BACK DOOR LH (DISC 25%)	NECESSARY	29.90	22.42
1	TAIL GATE MOULDING LOWER GLASS, BACK DOOR, RH (DISC 25%)	NECESSARY	29.90	22.42
1	TAIL GATE SPACER, BACK DOOR GLASS, LH (DISC 25%)	NECESSARY	6.90	5.17
1	TAIL GATE SPACER, BACK DOOR GLASS, RH (DISC 25%)	NECESSARY	6.90	5.17
1	TAIL GATE SPACER, QUARTER BACK DOOR GLASS (DISC 25%)	NECESSARY	5.50	4.12
1	TAIL GATE WEATHERSTRIP, BACK DOOR (DISC 25%)	DEFORMED	360.70	270.52
1	TAILGATE BOARD, COVER (DISC 25%)	CRACKED	24.10	18.07
1	TAILGATE BOARD, HANDLE PULL (DISC 25%)	MISSING	19.50	14.62
1	TAILGATE BOARD ASSY (DISC 25%)	CUT	251.50	188.62
1	SPOILER SUB-ASSY, REAR (DISC 25%)	DISTORTED	1,322.10	991.57
1	NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR (DISC 25%)	NECESSARY	52.30	39.22
1	NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR (DISC 25%)	NECESSARY	52.30	39.22
1	EMBLEM SUB-ASSY REAR (DISC 25%)	NECESSARY	46.30	34.72
1	END PANEL SUB-ASSY, BODY LOWER BACK (DISC 25%)	DENTED	629.80	472.35
1	END PANEL, COVER, DECK TRM SERVICE HOSE (DISC 25%)	DEFORMED	47.00	35.25
1	END PANEL, COVER, DECK TRIM, REAR (DISC 25%)	DEFORMED	122.80	92.10
1	SPARE TYRE PANEL, PAN, REAR FLOOR (DISC 25%)	NECESSARY	564.80	423.60
1	MEMBER SUB-ASSY, REAR FLOOR SIDE, REAR LH (DISC 25%)	BENT	268.60	201.45
1	PANEL QUARTER WHEEL HOUSE, INNER LH (DISC 25%)	DENTED	527.00	395.25
1	BOARD, REAR FLOOR, NO.1 (DISC 25%)	CRACKED	502.20	376.65
1	BOX, DECK FLOOR, LH (DISC 25%)	CRACKED	303.40	227.55
1	BOX, DECK FLOOR, RH (DISC 25%)	CRACKED	304.00	228.00

Report Ref No. NS/INC18005513/Svbe2

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983358E GST Reg. No. 20-0405911-H



Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PANEL ASSY, DECK TRIM SIDE, LH (DISC 25%)	DEFORMED	344.70	258.52
1	PANEL ASSY, DECK TRIM SIDE, RH (DISC 25%)	DEFORMED	344.70	258.52
1	TROUGH, BACK DOOR, LH (DISC 25%)	NECESSARY	99.80	74.85
1	PANEL SUB-ASSY, FENDER REAR LH (DISC 25%)	BUCKLED	824.80	618.60
1	DUCT ASSY, QUARTER VENT, RH & LH (DISC 25%)	DEFORMED	65.00	48.75
1	TROUGH, BACK DOOR, RH (DISC 25%)	NECESSARY	99.80	74.85
1	CARRIER, SPARE WHEEL (DISC 25%)	BENT	20.00	15.00
1	LENS & BODY ASSY, RR BUMPER, RH (DISC 10%)	SCRATCHED	486.80	438.12
1	LENS & BODY ASSY, RR BUMPER, LH (DISC 10%)	CRACKED	486.80	438.12
1	WIRE, LUGGAGE ROOM (DISC 10%)	CUT	143.50	129.15
1	TAIL GATE LOCK ASSY, BACK DOOR (DISC 10%)	DAMAGED	452.10	406.89
1	ANTENNA, ELECTRICAL KEY (DISC 10%)	DAMAGED	60.30	54.27
1	LAMP SET, STOP CENTER (DISC 10%)	CRACKED	186.50	167.85
1	LENS & BODY, REAR COMBINATION LAMP, LH (DISC 10%)	CRACKED	438.10	394.29
1	LENS & BODY, REAR COMBINATION LAMP, RH (DISC 10%)	DEFORMED	438.10	394.29
1	INSULATOR SHEET (DISC 10%)	NECESSARY	41.48	37.33
1	SENSOR REVERSE (SN)	DAMAGED	180.00	180.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
3	SEALANT W/SCREEN @\$37.00 (SN)	NECESSARY	111.00	111.00
1	NUMBER PLATE (SN)	MISSING	35.00	35.00
1	NUMBER PLATE FRAME (SN)	MISSING	25.00	25.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT SILAFLEX (SN)	NECESSARY	37.00	37.00
1	SEAL, RR BUMPER	SERVICEABLE	85.20	-
2	SUPPORT, EXHAUST PIPE NO.5 @\$41.10	SERVICEABLE	82.20	-
1	SUPPORT, EXHAUST, PIPE NO. 4	SERVICEABLE	41.10	-
1	COVER, REAR FLOOR UNDER, RH	NOT NECESSARY	169.50	-
2	TAIL GATE BACK DOOR HINGE ASSY, RH & LH @\$59.10	NOT NECESSARY	118.20	-
1	TAIL GATE LOCK COVER, BACK DOOR	NOT NECESSARY	25.30	-
1	TAIL GATE STAY ASSY, BACK DOOR, LH	NOT NECESSARY	235.00	-

Report Ref No. NS/INC18005513/Svbe2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52963356E GST Reg. No. 20-0405911-H



Page No. 4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL GATE STAY ASSY, BACK DOOR, RH	NOT NECESSARY	235.00	-
2	TAIL GATE STAY BRACKET, BACK DOOR, RH & LH @ \$11.80	NOT NECESSARY	23.60	-
1	TAIL GATE TRIM, LH	NOT NECESSARY	92.10	-
1	TAILGATE TRIM, LOWER	NOT NECESSARY	218.50	-
1	TAILGATE TRIM, RH	NOT NECESSARY	92.10	-
1	TAILGATE TRIM, UPPER	NOT NECESSARY	50.50	-
2	TAIL GATE CUSHION, REAR LICENCE PLATE @ \$2.10	NOT NECESSARY	4.20	-
2	LAMP ASSY, LICENSE PLATE @ \$63.70	NOT NECESSARY	127.40	-
1	CAMERA REAR ASSY, TELEVISION	NOT NECESSARY	1,103.80	-
1	SWITCH ASSY, BACK DOOR OPENER	NOT NECESSARY	149.40	-
1	WIRE, TAILGATE BACK DOOR	NOT NECESSARY	246.80	-
1	WIRE, TAILGATE BACK DOOR, NO. 2	NOT NECESSARY	246.80	-
1	MOULDING SUB-ASSY, ROOF TOP	NOT NECESSARY	637.40	-
1	MOULDING SUB-ASSY, ROOF DRIP SIDE FINISH, REAR LH	NOT NECESSARY	52.70	-
1	MOULDING SUB-ASSY, ROOF DRIP SIDE FINISH, REAR RH	NOT NECESSARY	52.70	-
1	BOX, DECK FLOOR, REAR	NOT NECESSARY	102.20	-
1	COVER ASSY, TONNEAU	NOT NECESSARY	944.20	-
1	WIRE, FLOOR	NOT NECESSARY	3,860.00	-
1	BRACKET, SPARE WHEEL CLAMP	NOT NECESSARY	21.30	-
1	LINER, REAR FENDER, LH	NOT NECESSARY	135.80	-
1	DOOR LOCK REAR, LH	NOT NECESSARY	544.70	-
1	DOOR LOCK STRIKER	NOT NECESSARY	38.00	-
1	HINGE ASSY, REAR DOOR, LOWER LH	NOT NECESSARY	73.30	-
1	HINGE ASSY, REAR DOOR, UPPER LH	NOT NECESSARY	83.30	-
1	CHECK ASSY, REAR DOOR	NOT NECESSARY	153.50	-
1	DUCT ASSY, QUARTER VENT, RH & LH	NOT NECESSARY	65.00	-
1	LINER, REAR FENDER, RH	NOT NECESSARY	135.80	-
1	DOOR LOCK REAR, RH	NOT NECESSARY	544.70	-
1	DOOR LOCK STRIKER	NOT NECESSARY	38.00	-
1	HINGE ASSY, REAR DOOR, LOWER RH	NOT NECESSARY	73.30	-
1	HINGE ASSY, REAR DOOR, UPPER RH	NOT NECESSARY	83.30	-

Report Ref No. NS/INC18005513/Svbe2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	CHECK ASSY, REAR DOOR	NOT NECESSARY	153.50	-
1	PANEL, ROOF	TO REPAIR	1,245.20	-
1	MEMBER SUB-ASSY, RAIL ROOT SIDE REAR LH	TO REPAIR	279.20	-
1	MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH	TO REPAIR	279.20	-
2	REINFORCEMENT ASSY, REAR FLOOR END PANEL, RH & LH @\$56.70	TO REPAIR	113.40	-
1	EXTENSION, REAR FLOOR SIDE PANEL, LH	TO REPAIR	76.20	-
1	EXTENSION, REAR FLOOR SIDE PANEL, RH	TO REPAIR	76.20	-
1	MEMBER SUB-ASSY, REAR FLOOR SIDE, REAR RH	TO REPAIR	268.60	-
1	MEMBER, REAR FLOOR CROSS, NO. 3	TO REPAIR	219.00	-
1	MEMBER SUB-ASSY, CENTER FLOOR CROSS, NO.2	TO REPAIR	500.50	-
1	PANEL QUARTER WHEEL HOUSE, INNER RH	TO REPAIR	527.00	-
1	PANEL SUB-ASSY, REAR DOOR, LH	TO REPAIR	1,243.90	-
1	PANEL SUB-ASSY, FENDER REAR RH	TO REPAIR	824.80	-
1	PANEL SUB-ASSY, REAR DOOR, RH	TO REPAIR	1,243.90	-
			37,226.18	14,936.52
	LABOUR			
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		4,604.00	2,715.00
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		6,086.00	1,860.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			10,850.00	4,575.00
GRAND TOTAL			48,076.18	19,511.52
RECOMMENDED COST OF REPAIRS (CONFIRMED)				19,511.52

Report Ref No. NS/INC18005513/Svbe2

YEANG WAI KEEN

Automotive Assessor

K.K. LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MinstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report in whole or in part, does so at his or her own risk.