


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB509U
Ref. No : TAX/04/18/2007
Reg. Date : 07/10/2014
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : RYAN FOO CHEE BOON
Type of Accident : HEAD TO SIDE
Date / Time of Accident : 02/04/2018 11:00:00 AM
Accident Reported Date / Time : 02/04/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 02/04/2018
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024095326
Special Instruction to ARC,if any :
TOWED \$40/ SHB4335C(COMFORT) - III
Prepared Date : 02/04/2018 02:33:58 PM

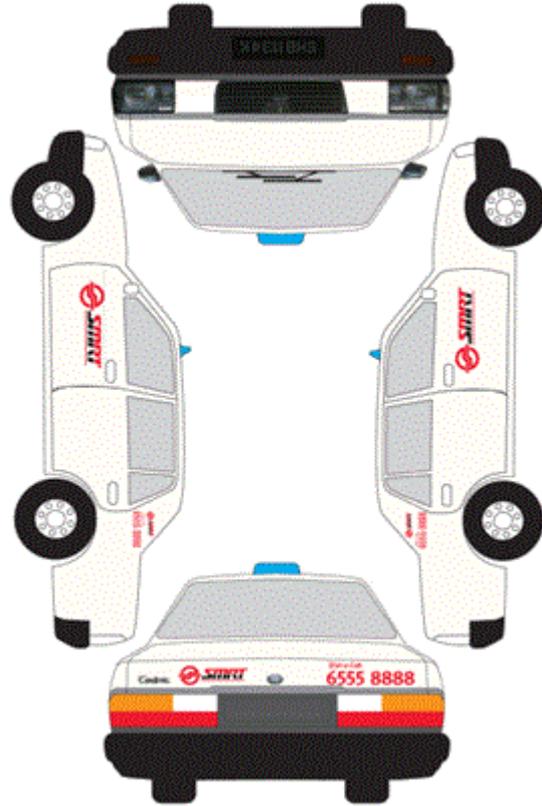

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U505752141 Mileage : 0

Work Shop : Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,014.00	0.00
Total Spray Painting Charges :	1,674.00	0.00
Total Material Charges :	10,549.90	10,549.90
Other Charges :	1,528.44	0.00
TOTAL :	14,766.34	0.00
Lum Sum Total :	14,750.00	0.00
No. of Repair Days :	6.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sing Off Date :	02/04/2018 05:17:31 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 02/04/2018 05:16:07 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : Invoice No :

Quotation Date : Invoice Date :

Invoice Amount : Prepared Date :

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH FRONT PORTION	1,014.00	0.00
Total Labour	1,014.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00
TO RESPRAY FRONT BUMPER LOWER GRILLE	180.00	0.00
TO REPSRAY FRONT HOOD	378.00	0.00
TO RESPRAY FRONT SUPPORT PANEL	180.00	0.00
TO RESPRAY FRONT FENDER RH	378.00	0.00
TO RESPRAY RIM	180.00	0.00
Total Spray Painting & Panel Beating	1,674.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO TOP UP A/C GAS	120.00	0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
TO CHECK & RESET SYSTEM FUNCTION	350.00	0.00
TO REMOVE AND REFIT WIRE HARDESS	250.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	148.44	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,528.44	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
52119-47930		6505517	BUMPER FRT	1	482.00	25.00	361.50	Replace	Replace	No
52127-47903			COVER, FR BUMPER HOLE RH	1	18.50	25.00	13.87	Replace	Replace	No
52115-47040		6505515	BUMPER SUPPORT F/RH	1	76.40	25.00	57.30	Replace	Replace	No
52611-47080		6505518	BUMPER ENERGY ABSORBER FRT	1	78.80	25.00	59.10	Replace	Replace	No
52021-47023		6505539	BUMPER REINFORCEMENT FRT	1	498.40	25.00	373.80	Replace	Replace	No
57013-47030			ARM SUB-ASSY, FR BUMPER RH	1	250.40	25.00	187.80	Replace	Replace	No
52114-47140			BRACKET, FR BUMPER	1	110.40	25.00	82.80	Replace	Replace	No
			NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace	No
			NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace	No
53102-47020		6505541	BUMPER GRILLE SUB-ASSY, LOWER	1	311.10	25.00	233.32	Replace	Replace	No
81210-12230		6505439	FOG LAMP RH	1	295.20	10.00	265.68	Replace	Replace	No
81519-47050			BRACKET, FR TURN LOWER RH	1	26.00	25.00	19.50	Replace	Replace	No
81519-47060			BRACKET, FR TURN UPPER RH	1	24.40	25.00	18.30	Replace	Replace	No
81511-47050			LENS & BODY, FR TURN RH	1	511.80	10.00	460.62	Replace	Replace	No
52618-47050		6505540	BUMPER FRT ABSORBER LOWER	1	127.70	25.00	95.77	Replace	Replace	No
82113-47180			WIRE, ENGINE ROOM, NO.3	1	242.00	10.00	217.80	Replace	Replace	No
53301-47060		6505555	HOOD PANEL	1	748.10	25.00	561.07	Replace	Replace	No
53395-47020			HOOD END PANEL SEAL	1	35.50	25.00	26.62	Replace	Replace	No
53201-47902			SUPPORT SUB-ASSY	1	1,460.40	25.00	1,095.30	Replace	Replace	No
81130-47500		6505437	HEAD LAMP RH	1	945.20	10.00	850.68	Replace	Replace	No
82111-47772			WIRE, ENGINE ROOM	1	5,567.10	10.00	5,010.39	Replace	Replace	No
85315-47140			WIPER WASHER JAR	1	180.10	25.00	135.07	Replace	Replace	No
85330 47010			MOTOR NO:1, WIPER WASHER JAR	1	239.00	10.00	215.10	Replace	Replace	No
85330 60180			MOTOR NO:2, WIPER WASHER JAR	1	240.00	10.00	216.00	Replace	Replace	No
85371 / 90099-62091			HOSE, WINDSHIELD WASHER (FROM MOTOR TO JOINT)	1	17.60	25.00	13.20	Replace	Replace	No
88710-47150			TUBE & ACCESSORY	1	631.90	25.00	473.92	Replace	Replace	No
53876-47030		6505554	FENDER LINER FRT/LH	1	171.70	25.00	128.77	Replace	Replace	No
53801-47050		6505557	FENDER FRT/RH	1	723.40	25.00	542.55	Replace	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
53875-47030		6505553	FENDER LINER FRT/RH	1	171.70	25.00	128.77	Replace	Replace	No
53852-47020			FENDER LINER PAD, FR WHEEL. LH	1	49.30	25.00	36.97	Replace	Replace	No
		6503707	TYRE	1	126.74	0.00	126.74	Replace	Replace	No
42611--47140 (Frt)		6505658	WHEEL DISC. FRONT	1	1,484.20	25.00	1,113.15	Replace	Replace	No
TOTAL MATERIALS							13,187.44	13,187.38		
TOTAL MATERIALS(Discounted)							10,549.90	10,549.90		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									