

ASS. REC. BY:

REF:

TMI /

CC3/TMI/8006155/Klonz

Kenneth

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

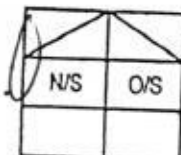

Bal. or Market Value:

IDAC Accident Report:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

03

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S11C 5375A

Yr Regn:

10, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Perant Latitude c.c.

1995

Colour

M. White / R

A/C: Insured / Std / NI / NA

Sp. Reading

283791

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15AUC 279848

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: M / S / Rim / STD A / Rim or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or

Giti

Front

Rear

R/Bal.

9

mm

R/Bal.

7

mm

L/Bal.

9

mm

L/Bal.

7

mm

D.O.A.

30/3/18

D.O.I.

3/4/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Fr body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

4/4

File pass to Corbett

7

11 By 8 1400 (Red)

33,741.10, 969

S11C 5375A - CC3/AT1/11023353/K10352

GY 7563G - CC3/CT1/6017718/11022

4/4/18

Email GIA to Shirley

RECEIVED 05 APR 2019

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

5/4 - typist

Days Of Repair:

3

Resurvey No. of Trip:

-

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S - RS, SI

Photos

Others

TOTAL

250

10

260

Report Format:

merimen

Lump Sum / I.B.I. (\$

1400p



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

TOKIO MARINE INSURANCE SINGAPORE LTD

Ref : CC3/TMI18006155/Kvb

20 MCCALLUM STREET #09-01

TOKIO MARINE CENTRESINGAPORE 069046

Date : 04-04-2018



Code : TMI

## 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GY 7563G	Veh. Inspected	SHC 5375A
Policy No.		Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	03/04/2018

## 2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

## 4. Description of Damages

--	--

## 5. General Information

Accident Date	30/03/2018	Inspection Date	03/04/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

## 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

## ...CLAIM SUBFOLDER...(Pending for Survey Report)

### CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	04 Apr 2018		04 Apr 2018 15:18 <a href="#">Edit Adj Rpt</a>				<b>Pending for Survey Report</b> <a href="#">Cancel Case</a>

Main	Reference	Claim Details	Documents	<a href="#">Show All</a>
------	-----------	---------------	-----------	--------------------------

#### CLAIM SUBFOLDER DETAILS [Created by insurer]

Insured:	SUPERIORTEC PRIVATE LIMITED, Co. Reg. No.: 200401881W		
Main Claimant:	TRANS-CAB SERVICES PTE LTD, Co. Reg. No.: 200303878K		
Vehicle Reg. No.:	SHC5375A	Date of Loss:	30/03/2018 20:00 - :59
Claim Type:	TP / M1801749	Policy/Cover Note No.:	MV005868 (TP, Fire & Theft) Coverage: 28/07/2017 - 27/07/2018
Vehicle Reg. No. (Insured):	GY7563G	Policy No. (Claimant):	
		Excess:	S\$0.00
Repairer:	Trans-cab Auto Services Pte Ltd (Ang Mo Kio) 2, Ang Mo Kio Street 63, 569111 Ang Mo Kio - Tel: 62876666		
Handling Insurer:	Tokio Marine Insurance Singapore Ltd (HQ) - Tel: 6221 6111 ... [Handled by <b>Telma Gomez</b> - 65926402]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by <b>KENNETH KONG</b> ] ... <b>[Final Rpt due 13/04/2018]</b>		
Adj Asg. Remarks:	PLS. CHECK CONSISTENCY OF THE DAMAGE.		

[View All](#)   [Compose Case Mail](#)

#### ASSOCIATED MAIL RECEIVED

There are no mail for this case.

#### ALL ASSOCIATED TASKS ▢

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

[View All](#)   [Search Tasks](#)   [Create New Task](#)   [Complete](#)

## Veron Chen (LKKAUTO)

---

**From:** Veron Chen (LKKAUTO)  
**Sent:** Wednesday, 4 April 2018 12:41 PM  
**To:** 'Too Joon Hwa'; motorclaims@tokiomarine.com.sg  
**Cc:** priscilla@tokiomarine.com.sg; SUR  
**Subject:** DIRECT SURVEY INSPECTION ON WORKSHOP - TRANS-CAB AUTO SERVICES PTE LTD, DOA: 30/3/2018, SHC 5375A (TP VEHICLE), GY 7563G (OI VEHICLE)  
**Attachments:** EST.pdf; GIA.pdf

Dear Shirley,

Please be informed that we had inspected the vehicle SHC 5375A M/s: TRANS-CAB AUTO SERVICES PTE LTD, NO.2 ANG MO KIO ST 63, SINGAPORE 569111 on 3/4/2018.

Enclosed herewith a copy of TP's GIA report and estimated cost of repair.

Meanwhile, kindly create claim in merimen for our necessary action.

Best Regards,

**Veron Chen** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	3878K

### Vehicle Details

Vehicle No.:	SHC5375A
Vehicle to be Exported:	Yes
Intended De-registration Date:	02 Apr 2018
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2014
Engine No.:	M9R8839C002083
Chassis No.:	VF1ABL15AUC279848
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	21 Oct 2014
First Registration Date:	21 Oct 2014
Transfer Count:	0
Actual ARF Paid:	\$12,498.00

### Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	20 Oct 2022
PARF Rebate Amount:	\$9,373.00

### Intended COE Rebate Details

COE Expiry Date:	20 Oct 2022
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$50,938.00
COE Rebate Amount:	\$28,960.00
<b>Total Rebate Amount:</b>	<b>\$38,333.00</b>

### Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 02 Apr 2018

OK

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	02/04/2018 09:36
Date Of Accident	30/03/2018 20:20
Exact Location Of Accident	GEYLANG LORONG 14
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC5375A
<b>Insured/Policyholder</b>	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62866666

### Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 L (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

### Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

### Driver

Name of Driver	SIM SANG HEE
NRIC No	S2043386H
Date Of Birth	17/11/1951
Occupation	OUTDOOR
Date Of Driving Pass	31/07/1972
Driving Experience	45 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97955472
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 619 ANG MO KIO AVENUE 4 #05-1069
Postcode	560619
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	COLLISION - MAJOR/MINOR RD
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	5
Passenger 1	NAME: : UNKNOWN GENDER: : MALE
Passenger 2	NAME: : UNKNOWN GENDER: : MALE
Passenger 3	NAME: : UNKNOWN GENDER: : FEMALE
Passenger 4	NAME: : UNKNOWN GENDER: : FEMALE

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

On 30.03.2018 at about 2020 hours, I was travelling straight along Lorong 14 Geylang after picking up my passenger. Suddenly I felt an impact. Vehicle B (GY7563G) which was stationary on my left along NO 3 Lorong 14 Geylang suddenly move forward hit onto my taxi left side front portion. After the accidents, Vehicle B's driver told me, his vehicle has no brake and moved forward hit onto my taxi.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GY7563G
Vehicle Make/Model/Colour	

Details Of Properties

Vehicle Category

GOODS VEHICLE

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)



**SKETCH PLAN**

**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My Insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

# Sketch Plan #2 Pg. 1

## SKETCH PLAN

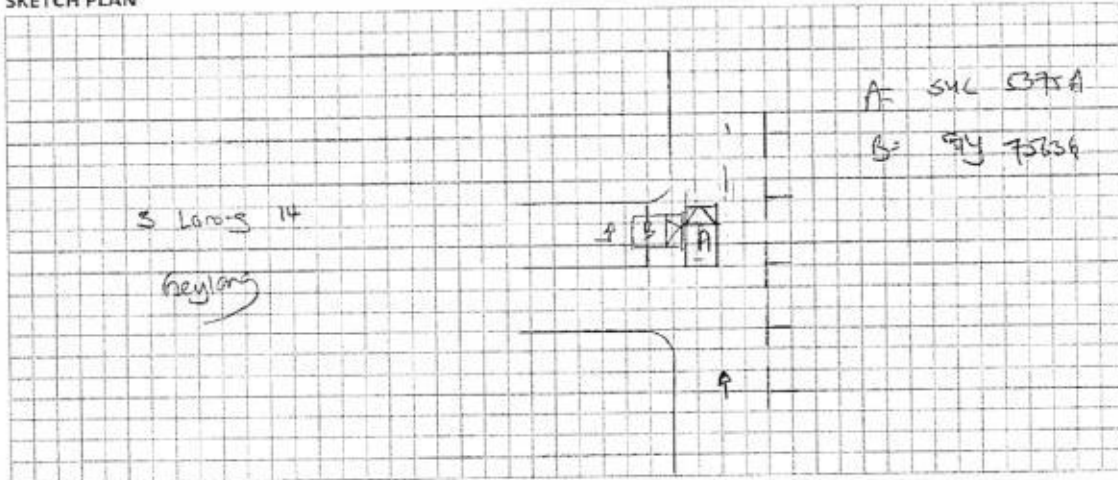

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

plu see attach G.A Report

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time:

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5375A****AAD1804-004***Not Authored  
L1 Rep @ 1400*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

**SHC 5375A**

VF1ABL15AUC279848

RENAULT

LATITUDE

30.3.2018

*Accio***PART****LIST**

1	HEADLAMP LH	\$	<i>Sn</i> 1,184.43 X
1	HEADLAMP PANEL FRT LH	\$	<i>R</i> 152.15 X
1	FENDER PANEL FRT LH	\$	<i>R</i> 783.83 ✓
1	WHEELARCH FRT LH	\$	<i>Sn</i> 278.84
1	FENDER BRACKET LOWER LH	\$	<i>Bc</i> 15.79
1	FENDER INSULATOR LH	\$	<i>Sn</i> 130.84
1	DOOR PANEL FRT LH	\$	<i>R</i> 2,844.66
1	DOOR HINGE UPPER LH L70Y	\$	<i>R</i> 261.28
1	DOOR HINGE LOWER LH	\$	<i>R</i> 300.55
1	DOOR CHECK FRT LH	\$	<i>Sn</i> 194.77
1	DOOR CHECK BOLT	\$	<i>Sn</i> 22.69
1	DOOR LOCK FRT LH	\$	<i>R</i> 908.75
1	DOOR CATCH FRT LH	\$	<i>Sn</i> 131.23
1	DOOR HANDLE OUTER FRT LH	\$	<i>Sn</i> 477.76
1	DOOR HANDLE COVER FRT LH	\$	<i>Sn</i> 13.22
1	DOOR HANDLE MODULE FRT LH	\$	<i>Sn</i> 133.60
1	DOOR REGULATOR FRT LH	\$	<i>Sn</i> 505.19
1	DOOR REGULATOR MOTOR FRT LH	\$	<i>Sn</i> 796.46
1	DOOR REGULATOR GUIDE FRT LH	\$	<i>Sn</i> 120.97
1	DOOR PANEL REAR LH L70Y	\$	<i>R</i> 2,844.66
1	DOOR GUIDE REAR LH L70Y	\$	<i>Sn</i> 176.82
1	DOOR GUIDE SCREW	\$	<i>Sn</i> 10.85
1	DOOR HINGE UPPER LH L70Y	\$	<i>R</i> 274.50
1	DOOR HINGE LOWER L70Y	\$	<i>R</i> 300.55
1	DOOR HINGE BOLT	\$	<i>Sn</i> 10.85
1	DOOR HINGE NUT L70Y	\$	<i>Sn</i> 14.60
1	DOOR CHECK REAR LH/RH L70Y	\$	<i>Sn</i> 203.06
1	DOOR CHECK BOLT	\$	<i>Sn</i> 22.69
1	DOOR CHECK NUT	\$	<i>Sn</i> 3.75

*13119.34*

**Trans-cab Auto Services Pte Ltd****AAD1804-004**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5375A**

1	DOOR LOCK REAR LH L70Y	\$	908.75
1	DOOR LOCK SCREW L70Y	\$	6.12
1	DOOR CATCH SCREW L70Y	\$	10.06
1	DOOR HANDLE OUTER REAR LH L70Y	\$	126.49
1	DOOR HANDLE CAP REAR LH L70Y	\$	35.52
1	DOOR HANDLE SEAL REAR LH L70Y	\$	7.89
1	DOOR HANDLE COVER REAR LH L70Y	\$	13.22
1	DOOR HANDLE MODULE REAR LH L70Y	\$	133.60
1	DOOR REGULATOR REAR LH L70Y	\$	1,135.10
1	DOOR REGULATOR MOTOR REAR LH L70Y	\$	893.75
1	DOOR REGULATOR NUT REAR L70Y	\$	12.43
1	DOOR REGULATOR MOTOR SCREW REAR L70Y	\$	6.31
1	DOOR FINISHER REAR LH L70Y	\$	423.10
1	DOOR MOULDING REAR LH L70Y	\$	176.82
1	DOOR MOULDING CLIP L70Y	\$	5.92
1	DOOR MOULDING SCREW L70Y	\$	6.91
1	DOOR CASING REAR LH L70Y	\$	1,509.06
1	DOOR WATER SHIELD REAR LH L70Y	\$	30.39
1	DOOR CASING CLIP	\$	12.63
1	DOOR CASING LIGHT L70Y	\$	48.74
1	DOOR FINISHER INNER REAR LH L70Y	\$	323.44
1	DOOR FINISHER BRACKET INNER REAR LH L70Y	\$	46.97
1	DOOR FINISHER BRACKET INNER REAR LH L70Y	\$	20.33
1	DOOR FINISHER BRACKET INNER REAR LH L70Y	\$	20.33
1	DOOR FINISHER BRACKET INNER REAR LH L70Y	\$	20.33
1	DOOR GRAB HANDLE REAR LH L70Y	\$	210.96
1	DOOR BLIND REAR LH L70Y	\$	741.80
1	DOOR WHEATHESTRIIP REAR LH L70Y	\$	410.66
1	DOOR SEAL REAR LH L70Y	\$	162.02
1	DOOR GLASS RUNNER SEAL REAR LH L70Y	\$	229.31
1	DOOR WAIST SEAL OUTER REAR LH L70Y	\$	334.69
1	DOOR WAIST SEAL INNER REAR LH L70Y	\$	115.64
1	FENDER PANEL REAR LH	\$	3,299.13
1	FENDER PANEL INNER TRIM REAR	\$	671.45
1	WHEELARCH REAR LH	\$	543.47
1	BUMPER COVER REAR	\$	1,108.46
1	BUMPER LOWER REAR	\$	768.84
1	BUMPER BRACKET CTR REAR	\$	113.47

14644.11

**Trans-cab Auto Services Pte Ltd**

AAD1804-004

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5375A

1	BUMEPR RETAINER LH REAR	\$	SH 44.99	} X
1	BUMPER BEAM REAR	\$	R 777.52	
1	BUMPER BEAM BRACKET LH REAR	\$	R 225.95	
1	DOOR MIRROR ASSY LH	\$	SH 1,483.40	
1	TAILLAMP LH	\$	SH 552.55	

	\$	30,847.89	86
10%	\$	3,084.79	
	\$	27,763.10	

**Specical Nett**

1SET	BUMPER CLIP FRT	\$	SH 66.00	} X
1	BUMPER BRACKET CLIP FRT LH	\$	SH 12.00	
1	BUMPER SUPPORT CLIP FRT LH	\$	SH 10.50	
1SET	BUMPER GRILLE LOWER CLIP	\$	SH 69.00	
1SET	FRAME FULL SUPPORT PANEL CLIP	\$	SH 70.00	
2	FRAME FULL SUPPORT PANEL NUT	\$	SH 20.00	
2	FRAME FULL SUPPORT PANEL STUD	\$	SH 30.00	
1SET	WHEELARCH CLIP FRT LH	\$	SH 30.50	
1	FRONT DOOR STICKER 'Trans-cab'	\$	SH 80.00	60SN
1	FRONT DOOR STICKER 'Chassis'	\$	SH 50.00	15SN
1	REAR DOOR STICKER '6555 3333'	\$	SH 80.00	X

<b>TOTAL</b>	\$	<b>518.00</b>
--------------	----	---------------

<b>TOTAL PARTS</b>	\$	<b>28,281.10</b>
--------------------	----	------------------

**LABOUR**

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same

\$	2,450.00	400L
----	----------	------

Putty and spray painting of the affected portion.

\$	2,200.00	440L
----	----------	------

To rust-proofing of the affected areas.

\$	170.00	30L
----	--------	-----

**Trans-cab Auto Services Pte Ltd**

AAD1804-004

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5375A

To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	nn 380.00 X
To check steering geometry and computer wheel alignment	\$	220.00 601
To transfer of tire, rim and on wheel balancing.	\$	nn 170.00 X
To Check Electrical Lighting Concerned.	\$	170.00 201
To transfer of front fender fittings, attachment and perform water seepage test.	\$	nn 380.00 X
To vacuum, replace, refix and recharge air condenser	\$	nn 380.00 X
To replace, refix and top up coolant for radiator	\$	nn 170.00 X
To vacuum, replace, refix and recharge Air Intercooler	\$	nn 170.00 X

**TOTAL \$ 6,860.00****Over All Total \$ 35,141.10**

07

**PART BY PART (REPAIR DAY)**

7 DAYS

3 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI18006155/KVBN2

Date: 10/04/2018

## REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MV005868
Claimant Vehicle No :	SHC5375A	Insured Vehicle No :	GY7563G
Date of Loss:	30/03/2018	Nature of Claim:	TP
		Claim No:	M1801749

## DESCRIPTION &amp; IDENTIFICATION OF VEHICLE

Reg No:	SHC5375A	Engine No:	M9R8839C002083
Make & Model:	RENAULT LATITUDE, 2.0 L (A)	Chassis No:	VF1ABL15AUC279848
Reg. Date:	21/10/2014 (Man. Year: 2014)	Odometer:	283791 km
Colour:	Metallic White/Red		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

## CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

## CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Giti 9 mm	Rear Left Side:	Giti 7 mm
Front Right Side:	Giti 9 mm	Rear Right Side:	Giti 7 mm

The above values represent the remaining tyre treads depth

## COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	28,281.07	780.45	27,500.62	97.24
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,860.00	950.00	5,910.00	86.15
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>35,141.07</b>	<b>1,730.45</b>	<b>33,410.62</b>	<b>95.08</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>1,400.00</b>		
<b>(S\$)</b>	35,141.07	1,400.00	33,741.07	96.02
<b>+ GST 7.00/7.00% (S\$)</b>	2,459.87	98.00	2,361.87	96.02
<b>Nett Amount (S\$)</b>	<b>37,600.94</b>	<b>1,498.00</b>	<b>36,102.94</b>	<b>96.02</b>

## INSPECTION

Date of Assignment:	04/04/2018	
Date Inspected:	03/04/2018	Inspected At: Trans-cab Auto Services Pte Ltd (Ang Mo Kio) 2, Ang Mo Kio Street 63 Singapore 569111
Estimated Period of Repair:	3.0 days	

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our

*knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*



## REPAIR DETAILS

<b>Reference</b>	
<b>Part Source:</b> MRM-SG	Version: 1.0 (Last Synchronised: 10 Apr 2018)
<b>Parts:</b> 143	RENAULT LATITUDE 2.0 L (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b> Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SHC5375A)
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page.
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.

## Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*HEADLAMP LH	Serviceable	1,184.43 FL	*- FL
2	1	*HEADLAMP PANEL FRT LH	Repair	152.15 FL	*- FL
3	1	*FENDER PANEL FRT LH	Bent	783.83 FL	*783.83 FL
4	1	*WHEELARCH FRT LH	Serviceable	278.84 FL	*- FL
5	1	*FENDER BRACKET LOWER LH	Serviceable	15.79 FL	*- FL
6	1	*FENDER INSULATOR LH	Serviceable	130.84 FL	*- FL
7	1	*DOOR PANEL FRT LH	Repair	2,844.66 FL	*- FL
8	1	*DOOR HINGE UPPER LH L70Y	Repair	261.28 FL	*- FL
9	1	*DOOR HINGE LOWER LH	Repair	300.55 FL	*- FL
10	1	*DOOR CHECK FRT LH	Serviceable	194.77 FL	*- FL
11	1	*DOOR CHECK BOLT	Serviceable	22.69 FL	*- FL
12	1	*DOOR LOCK FRT LH	Repair	908.75 FL	*- FL
13	1	*DOOR CATCH FRT LH	Serviceable	131.23 FL	*- FL
14	1	*DOOR HANDLE OUTER FRT LH	Serviceable	477.76 FL	*- FL
15	1	*DOOR HANDLE COVER FRT LH	Serviceable	13.22 FL	*- FL
16	1	*DOOR HANDLE MODULE FRT LH	Serviceable	133.60 FL	*- FL
17	1	*DOOR REGULATOR FRT LH	Serviceable	505.19 FL	*- FL
18	1	*DOOR REGULATOR MOTOR FRT LH	Serviceable	796.46 FL	*- FL
19	1	*DOOR REGULATOR GUIDE FRT LH	Serviceable	120.97 FL	*- FL
20	1	*DOOR PANEL REAR LH L70Y	Repair	2,844.66 FL	*- FL
21	1	*DOOR GUIDE REAR LH L70Y	Serviceable	176.82 FL	*- FL
22	1	*DOOR GUIDE SCREW	Serviceable	10.85 FL	*- FL
23	1	*DOOR HINGE UPPER LH L70Y	Repair	274.50 FL	*- FL
24	1	*DOOR HINGE LOWER L70Y	Repair	300.55 FL	*- FL
25	1	*DOOR HINGE BOLT	Serviceable	10.85 FL	*- FL
26	1	*DOOR HINGE NUT L70Y	Serviceable	14.60 FL	*- FL
27	1	*DOOR CHECK REAR LH/RH L70Y	Serviceable	203.06 FL	*- FL
28	1	*DOOR CHECK BOLT	Serviceable	22.69 FL	*- FL
29	1	*DOOR CHECK NUT	Serviceable	3.75 FL	*- FL
30	1	*DOOR LOCK REAR LH L70Y	Serviceable	908.75 FL	*- FL
31	1	*DOOR LOCK SCREW L70Y	Serviceable	6.12 FL	*- FL
32	1	*DOOR CATCH SCREW L70Y	Serviceable	10.06 FL	*- FL
33	1	*DOOR HANDLE OUTER REAR LH L70Y	Serviceable	126.49 FL	*- FL
34	1	*DOOR HANDLE CAP REAR LH L70Y	Serviceable	35.52 FL	*- FL
35	1	*DOOR HANDLE SEAL REAR LH L70Y	Serviceable	7.89 FL	*- FL
36	1	*DOOR HANDLE COVER REAR LH L70Y	Serviceable	13.22 FL	*- FL
37	1	*DOOR HANDLE MODULE REAR LH L70Y	Serviceable	133.60 FL	*- FL
38	1	*DOOR REGULATOR REAR LH L70Y	Serviceable	1,135.10 FL	*- FL
39	1	*DOOR REGULATOR MOTOR REAR LH L70Y	Serviceable	893.75 FL	*- FL
40	1	*DOOR REGULATOR NUT REAR L70Y	Serviceable	12.43 FL	*- FL
41	1	*DOOR REGULATOR MOTOR SCREW REAR L70Y	Serviceable	6.31 FL	*- FL
42	1	*DOOR FINISHER REAR LH L70Y	Serviceable	423.10 FL	*- FL
43	1	*DOOR MOULDING REAR LH L70Y	Serviceable	176.82 FL	*- FL
44	1	*DOOR MOULDING CLIP L70Y	Serviceable	5.92 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
45	1	*DOOR MOULDING SCREW L70Y	Serviceable	6.91 FL	*- FL
46	1	*DOOR CASING REAR LH L70Y	Serviceable	1,509.06 FL	*- FL
47	1	*DOOR WATER SHIELD REAR LH L70Y	Serviceable	30.39 FL	*- FL
48	1	*DOOR CASING CLIP	Serviceable	12.63 FL	*- FL
49	1	*DOOR CASING LIGHT L70Y	Serviceable	48.74 FL	*- FL
50	1	*DOOR FINISHER INNER REAR LH L70Y	Serviceable	323.44 FL	*- FL
51	1	*DOOR FINISHER BRACKET INNER REAR LH L70Y	Serviceable	46.97 FL	*- FL
52	1	*DOOR FINISHER BRACKET INNER REAR LH L70Y	Serviceable	20.33 FL	*- FL
53	1	*DOOR FINISHER BRACKET INNER REAR LH L70Y	Serviceable	20.33 FL	*- FL
54	1	*DOOR FINISHER BRACKET INNER REAR LH L70Y	Serviceable	20.33 FL	*- FL
55	1	*DOOR GRAB HANDLE REAR LH L70Y	Serviceable	210.96 FL	*- FL
56	1	*DOOR BLIND REAR LH L70Y	Serviceable	741.80 FL	*- FL
57	1	*DOOR WEATHERSTRIP REAR LH L70Y	Serviceable	410.66 FL	*- FL
58	1	*DOOR SEAL REAR LH L70Y	Serviceable	162.02 FL	*- FL
59	1	*DOOR GLASS RUNNER SEAL REAR LH L70Y	Serviceable	229.31 FL	*- FL
60	1	*DOOR WAIST SEAL OUTER REAR LH L70Y	Serviceable	334.69 FL	*- FL
61	1	*DOOR WAIST SEAL INNER REAR LH L70Y	Serviceable	115.64 FL	*- FL
62	1	*FENDER PANEL REAR LH	Serviceable	3,299.13 FL	*- FL
63	1	*FENDER PANEL INNER TRIM REAR	Serviceable	671.45 FL	*- FL
64	1	*WHEELARCH REAR LH	Serviceable	543.47 FL	*- FL
65	1	*BUMPER COVER REAR	Serviceable	1,108.46 FL	*- FL
66	1	*BUMPER LOWER REAR	Serviceable	768.84 FL	*- FL
67	1	*BUMPER BRACKET CTR REAR	Serviceable	113.47 FL	*- FL
68	1	*BUMPER RETAINER LH REAR	Serviceable	44.99 FL	*- FL
69	1	*BUMPER BEAM REAR	Repair	777.52 FL	*- FL
70	1	*BUMPER BEAM BRACKET LH rREAR	Repair	225.95 FL	*- FL
71	1	*DOOR MIRROR ASSY LH	Serviceable	1,483.40 FL	*- FL
72	1	*TAILLAMP LH	Serviceable	552.55 FL	*- FL
73	1	*SET BUMPER CLIP FRT	Not Necessary	66.00 FS	*- FS
74	1	*BUMPER BRACKET CLIP FRT LH	Not Necessary	12.00 FS	*- FS
75	1	*BUMPER SUPPORT CLIP FRT LH	Not Necessary	10.50 FS	*- FS
76	1	*SET BUMPER GRILLE LOWER CLIP	Not Necessary	69.00 FS	*- FS
77	1	*SET FRAME FULL SUPPORT PANEL CLIP	Not Necessary	70.00 FS	*- FS
78	2	*FRAME FULL SUPPORT PANEL NUT	Serviceable	20.00 FS	*- FS
79	2	*FRAME FULL SUPPORT PANEL STUD	Serviceable	30.00 FS	*- FS
80	1	*SET WHEELARCH CLIP FRT LH	Not Necessary	30.50 FS	*- FS
81	1	*FRONT DOOR STICKER TRANS-CAB	Necessary	80.00 FS	*60.00 FS
82	1	*FRONT DOOR STICKER CLASSIC	Necessary	50.00 FS	*15.00 FS
83	1	*REAR DOOR STICKER 6555-3333	Not Necessary	80.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$\$)</b>	<b>31,365.86</b>	<b>858.83</b>
- List Item Discount on L Items 10.00/10.00% (\$\$)	3,084.79	78.38
<b>Total Parts (\$\$)</b>	<b>28,281.07</b>	<b>780.45</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	2,450.00	400.00
2	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	2,200.00	440.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	30.00
4	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER,TO ENABLE REPAIR	New	380.00	-
5	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	60.00
6	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING	New	170.00	-
7	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
8	TO TRANSFER OF FRONT FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	380.00	-
9	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR CONDENSER	New	380.00	-
10	TO REPLACE,REFIX AND TOP UP COOLANT FOR RADIATOR	New	170.00	-
11	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR INTERCOOLER	New	170.00	-
Gross Labour Cost (S\$)			6,860.00	950.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >