

ASS. REC. BY: Adrian King

REF:

CC3 / ALH 18006737 / Afb / V

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. 425110793386Sum Insured: _____ Excess: \$800

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 130K

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 038/8 days Res.: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SKS7261L Yr Regn: 2015 AprilType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A6 c.c. 1798Colour: Black A/C: Insured / Std / NI / NASp. Reading: 74643 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAU222467FN062674Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 245/45R18R: 245/45R18BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 06 mm R/Bal. 06 mmL/Bal. 06 mm L/Bal. 06 mmD.O.A. _____ D.O.I. 1/04/18Survey held at PremiumDes. of Damages: Fr / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>OD AIG.</u>
	<u>SKS 7261L - CS/ALH18006737 / Kfb</u>
	<u>DA: 060418</u>
	<u>12/4 Report via menmen</u>
	<u>13/4 14:33pm authorise repair by Victor Koh</u>
	<u>13/4 2:51pm inform premium authorise repair excess \$800</u>
	<u>Part by Part \$6430.76 (Red: 3472.24 : 35%)</u>

RECEIVED 2 11 AUG 2018

Date/Time, File Pass to?

☐ : Preli. ReportDays Of Repair: 31) 2018 Typist☒ : Final ReportResurvey No. of Trip: 1

Survey Fee:

Transportation:

Date/Time, File Return to?

S + RS. SI

2)

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Photos:

Others:

Report Format: TPLump Sum / (B): (\$ 6,430.76)

TOTAL



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AIG ASIA PACIFIC INSURANCE PTE LTD

Ref : CC3/AIG18006737/Atb

78 SHENTON WAY #08-16
CHARTIS BUILDING
SINGAPORE 079120

Date : 11-04-2018



Code : AIG

1. Policy Particulars :- OWN DAMAGE

Insured Veh.	Veh. Inspected	SKS 7261L
Policy No. 2100420491	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	11/04/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No. HIDDEN	Year of Reg.	
Chassis No.	Colour	
Odometer -	Steering	
Brakes	Modification	
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date 06/04/2018	Inspection Date 11/04/2018
Survey held at PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1 . SINGAPORE 408699	

5a. Remarks

A)THE MARKET VALUE IS S\$------(EST. AVERAGE)
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

Denise Tay (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Friday, 13 April 2018 2:51 PM
To: 'Claims Dept'; SUR
Subject: RE: SKS 7261 L Own Damage Claims

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SKS 7261L (Excess \$800/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Need damage photos of Front bumper top cover

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Denise Tay (LKKAUTO)
Sent: Thursday, 12 April 2018 2:31 PM
To: 'Claims Dept' <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SKS 7261 L Own Damage Claims

Dear Jeffery,

Excess \$800

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims Dept [<mailto:claims@premiumauto.com.sg>]
Sent: Thursday, 12 April 2018 8:36 AM
To: SUR <sur@lkkauto.com>

View Received Message

This mail is associated with :

***SKS7261L (4251107933SG)**

OD

Apr 6 2018 8:00PM

[CHAN KHENG MENG]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 13/04/2018 14:33 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$6882.00) - SKS7261L - Claim Handler: Dally Amri, Mimi Zarina

Approved:6882.00:Re-inspect and upload damage photos of Front bumper top cover, Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	4424Z
Vehicle Details	
Vehicle No.:	SK57261L
Vehicle to be Exported:	No
Intended De-registration Date:	12 Apr 2018
Vehicle Make:	AUDI
Vehicle Model:	A6 1.8 TFSI S TRONIC
Primary Colour:	Black
Manufacturing Year:	2015
Engine No.:	CYG003371
Chassis No.:	WAUZZZ4G7FN062674
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$39,742.00
Original Registration Date:	30 Apr 2015
First Registration Date:	30 Apr 2015
Transfer Count:	1
Actual ARF Paid:	\$37,639.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Apr 2025
PARF Rebate Amount:	\$28,229.00
Intended COE Rebate Details	
COE Expiry Date:	29 Apr 2025
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$79,500.00
COE Rebate Amount:	\$54,969.00
Total Rebate Amount:	\$83,198.00

The information contained herein is correct as at 12 Apr 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	07/04/2018 11:12
Date Of Accident	06/04/2018 20:00
Exact Location Of Accident	LORONG 2 TOA PAYOH EXITING TO PIE CHANGI
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKS7261L
Insured/Policyholder	
Name Of Registered Owner	CHAN KHENG MENG
NRIC No	S2754424Z
Email Address	KHENG MENGCHAN@YAHOO.COM
Mobile Phone No	(LOCAL) +65-92998873
Alternative Phone No	OFFICE-92998873

Vehicle Particulars

Manufacturer	AUDI
Model	AUDI A6 1.8 TFSI
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company


Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100420491-02000
Cover Note Number	

Driver

Name of Driver	CHAN KHENG MENG
NRIC No	S2754424Z
Date Of Birth	10/09/1967
Occupation	INDOOR
Date Of Driving Pass	07/07/2008
Driving Experience	9 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-92998873
Fax Number	
Contact Number	OFFICE-92998873
Email Address	KHENG MENGCHAN@YAHOO.COM

No. Of Passenger (Including Driver)

SKETCH PLAN

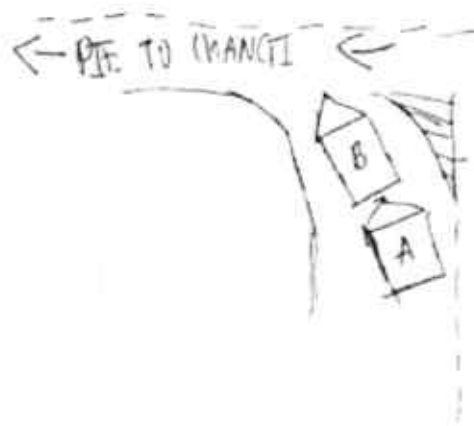

A: SKS 7261L
B: SGM 7400G

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

As I was coming out of Lorong 2 Tan
Pagar to turn into PIE Changi
I stopped behind SGM 7400G
to wait for traffic to clear.
When traffic clear, SGM 7400G
started to move and then
stopped suddenly. My car
SKS 7261L bump into the
rear of SGM 7400G as it
stopped.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time

Driver's Signature
(if driver is not the policyholder)
Date & Time

Reporting Centre Personnel's Signature
Name: Lina Rose Simay
NRIC/ID No: 6552964M



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



AUDI AG



Audi

WAUZZZ4G7FN062674

2150kg

3830kg

1 - 1130kg

2 - 1140kg

Typ 4G

03
CYGA7183
022015



CERTIFICATE OF INSURANCE

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT(CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

M.X.1

AUDI AUTO PROTECTOR

CERTIFICATE NO. 2100420491-02000

OWN DAMAGE EXCESS S\$800.00 (1)
WINDSCREEN EXCESS S\$100.00

(for policies with effect from 1st November 2002)

SUM INSURED Market Value
INSURING WITH COE/PARF Yes
SKS7261L

1) VEHICLE REGISTRATION NO.

2) NAME OF INSURED

CHAN KHENG MENG

3) EFFECTIVE DATE OF THE COMMENCEMENT
OF INSURANCE FOR THE PURPOSES OF THE ACT

30 Apr 2017

4) DATE OF EXPIRY OF INSURANCE

29 Apr 2018

5) PERSON OR CLASSES OF PERSONS ENTITLED TO DRIVE *
SUBJECT TO AGE CONDITION :All Age Condition

a) The Insured.

b) Any other person who is driving on the Insured's order or with his permission.

This policy will indemnify the insured or any authorised driver only if he/she meets the age conditions.

A Young and/or Inexperienced Driver Excess ("YIDR") of S\$3,000.00, in addition to the Policy Excess, applies to You and any Authorised Driver (named or unnamed) if You are or the said Authorised Driver is below the age of 23 and/or has less than 2 years' driving experience.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6) LIMITATION AS TO USE *

Use only for social, domestic and pleasure purposes and for the Insured's business.

The Policy does not cover use for hire or rewards, tuition, driving test, racing, pace-making, reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

APPROVED REPORTING CENTRES / AUDI AUTHORISED REPAIRERS

1. Audi Customer Service Center - 55 Ubi Road 1 (Tel: 63662323)

APPROVED REPORTING CENTRES / AIG AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

2. ComfortDelgro Engrg - 205 Braddell Rd (Tel: 63837118) 3. DPS Body & Paint Workshop - 209 Pandan Gardens (Tel: 65684501)

4. Ethoz - 30 Bukit Batok Cres(Tel:66547777) 5. Glass-Fix - 52 Ubi Ave 3 (Tel: 62780887) - For windscreen only

6. Kan Fook Sing Motor - 61 Defu Lane 12 (Tel: 67479560) 7. Lai Huat (Meng Kee) Motor - 21 Sin Ming Ind (Tel: 64538110)

8. Mova Automotive - 1008 Bukit Merah Lane 3 (Tel: 62723892) 9. Progressive Automotive - 3022A Ubi Rd 1 (Tel: 67415336)

10. SME Motor - 1 Kaki Bukit Ave 6 Blk D (Tel: 67476106)

LOSS OF USE Loss Of Use 15 days Replacement Car only for repairs at Audi Customer Service Centre

NAMED DRIVER NA

HIRE PURCHASE COMPANY DBS BANK LTD
/ EMPLOYER'S LOAN

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

I / We hereby Certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Issued At Singapore 28 Mar 2017

AIG Asia Pacific Insurance Pte. Ltd.

504125-207
PREMIUM LEASING - SLEE
281 ALEXANDRA ROAD
AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

AUTHORISED REPRESENTATIVE

ORIGINAL

SSCGUK

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S2754424Z



Name

CHAN KHENG MENG

曾庆明

Race

CHINESE

Date of birth

10-09-1967

Country of birth

MALAYSIA

Sex

M

S2754424Z

REPUBLIC OF SINGAPORE DRIVING LICENCE



Licence Number S2754424Z

Name

CHAN KHENG MENG

Birth Date 10 Sep 1967

Issue Date 07 Jul 2008



4822218

NRIC No: S2754424Z



Date of issue

07-02-2012

65 INGGU ROAD
SINGAPORE 757171

NRIC No: S2754424Z

Date: 11/04/2013

No: 7462054

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

PASS DATE

Class 3 Motor Cars $\leq$ 3000kg with $\leq$ 7 passengers, exclusive of the driver; and other motor vehicles $\leq$ 2500kg 07 Jul 2008



NP 428A

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0431/2018/NK
Date	:	10-Apr-18

Vehicle NOT IN workshop. Kindly assist to arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr. Chan Kheng Meng
Address	:	65 Ingg Road Singapore 757171
Telephone	:	HP +65 992998873
Type of Claim	:	Own Damage Claims
Policy No.	:	2100420491-02000
Vehicle No	:	SKS 7261 L
Model Code	:	Audi A6 1.8 TFSI
Model / Year	:	Apr-15
Engine No	:	CYG003371
Chassis No	:	WAUZZZ4G7FN062674
Mileage	:	
Date In	:	
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	06-Apr-18
Place of Accident	:	Lorong 2 Toa Payoh Exiting To Pie Changi

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKS 7261 L

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy nad front parking aid.	S/N \$ 480.00 ✓	✓
2	To dismantle and renew front bumper assy. Re-organise front crash management components.Reinstall all parts removed.	\$ 1,050.00 500 ✓	✓
3	To respray front bumper and bonnet. ✓ x	\$ 900.00 550 ✓	✓
4	To carry out diagnostic checks.	S/N \$ 192.00 ✓	✓
TOTAL LABOUR CHARGES		: \$ <u>2,622.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKS 7261 L

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Delud</i>	\$ 3,321.00 ✓	2657.76
2	FRONT BUMPER FIXING SETS <i>new</i>	\$ 43.00 ✗	
3	RADIATOR GRILLE <i>cond</i>	\$ 1,697.00 ✓	1357.60
4	RADIATOR GRILLE COVER <i>part new</i>	\$ 32.00 ?	
5	AIR GUIDE GRILLE LH / RH <i>part new</i>	2 \$ 614.00 ?	
6	FRONT BUMPER COVER LH / RH <i>part new</i>	2 \$ 88.00 ?	
7	FRONT BUMPER FOAM <i>part new</i>	\$ 203.00 ?	
8	FRONT BUMPER REINFORCEMENT <i>part</i>	\$ 702.00 ?	561.60
9	FRONT BUMPER SUPPORT <i>new</i>	2 \$ 21.00 ✗	
10	FRONT BUMPER TOP COVER <i>cond</i>	\$ 105.00 ✓	84
11	SIGN " CAUTION" <i>new</i>	\$ 12.00 ✓	928
12	RADIATOR GRILLE SUPPORT FRONT LH / RH <i>new</i>	2 \$ 118.00 ?	X
13	FRONT NO PLATE <i>part</i>	S/N \$ 25.00 ✓	23
14	SUNDRIES <i>new</i>	\$ 300.00 ?	1552
TOTAL SPARE PARTS		: \$ 7,281.00	
TOTAL LABOUR CHARGES		: \$ 2,622.00	
GRAND TOTAL		: \$ 9,903.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim
Surveyed Date : 11/04/18
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 04 Days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0431/2018/NK
Date : 10-Apr-18

Vehicle NOT IN workshop. Kindly assist to arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Adrian

3 days - ok - jb - 24 May 18

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Chan Kheng Meng
Address : 65 Ingg Road
Singapore 757171
Telephone : HP +65 992998873
Type of Claim : Own Damage Claims
Policy No. : 2100420491-02000
Vehicle No : **SKS 7261 L**
Model Code : Audi A6 1.8 TFSI
Model / Year : Apr-15
Engine No : CYG003371
Chassis No : WAUZZZ4G7FN062674
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 6-Apr-18
Place of Accident : Lorong 2 Toa Payoh Exiting To Pie Changi

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKS 7261 L

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy nad front parking aid.	S/N \$ 480.00	\$ 480.00
2	To dismantle and renew front bumper assy. Re-organise front crash management components.Reinstall all parts removed.	\$ 1,050.00	\$ 500.00
3	To respray front bumper and bonnet.	\$ 900.00	\$ 550.00
4	To carry out diagnostic checks.	S/N \$ 192.00	\$ 192.00
TOTAL LABOUR CHARGES		: \$ 2,622.00	\$ 1,722.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKS 7261 L

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 3,321.00	\$ 2,655.76
2	FRONT BUMPER FIXING SETS	\$ 43.00	
3	RADIATOR GRILLE	\$ 1,697.00	\$ 1,357.60
4	RADIATOR GRILLE COVER	\$ 32.00	
5	AIR GUIDE GRILLE LH / RH	2 \$ 614.00	
6	FRONT BUMPER COVER LH / RH	2 \$ 88.00	
7	FRONT BUMPER FOAM	\$ 203.00	
8	FRONT BUMPER REINFORCEMENT	\$ 702.00	\$ 561.60
9	FRONT BUMPER SUPPORT	2 \$ 21.00	
10	FRONT BUMPER TOP COVER	\$ 105.00	\$ 84.00
11	SIGN " CAUTION"	\$ 12.00	\$ 9.28
12	RADIATOR GRILLE SUPPORT FRONT LH / RH	2 \$ 118.00	
13	FRONT NO PLATE	S/N \$ 25.00	\$ 25.00
14	SUNDRIES	\$ 300.00	\$ 15.52
TOTAL SPARE PARTS		\$ 7,281.00	\$ 4,708.76
TOTAL LABOUR CHARGES		\$ 2,622.00	\$ 1,722.00
GRAND TOTAL		\$ 9,903.00	\$ 6,430.76

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SKS 7261 L

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0431/2018/MAS

14 Aug 2018

Dear Sir,

RE: INSURANCE CLAIM FOR SKS 7261 L, Audi A6 1.8 TFSI Ultra S-Tro

With reference to the above-mentioned vehicle, no **SKS 7261 L**, claimant, **Mr. Chan Keng Meng**, please find the related document per attached.

1. A copy of the Original invoice no. 85012799 – S\$6,024.91
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encls

AIG – SKS 7261 L

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S2754424Z



Name

CHAN KHENG MENG

曾庆明

Race

CHINESE

Date of birth

10-09-1967

Sex

M

Country of birth

MALAYSIA

S2754424Z

REPUBLIC OF SINGAPORE DRIVING LICENCE




Licence Number S2754424Z

Name

CHAN KHENG MENG

Birth Date 10 Sep 1967

Issue Date 07 Jul 2008



001623359H



482238

NRIC No. S2754424Z



Date of issue

07-02-2012

65 INGGU ROAD
SINGAPORE 757171

NRIC No: S2754424Z

Date: 11/04/2013

No: 7452054

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

PASS DATE

Class 3 Motor Cars <= 3000kg with <= 7 passengers, exclusive of the driver; and other motor vehicles <= 2500kg 07 Jul 2008



Licence No: S2754424Z

NP 428A



HOTLINE TEL: (65) 6419 3000
FAX: (65) 6415-3723

CERTIFICATE OF INSURANCE

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

M.X.1

AUDI AUTO PROTECTOR

CERTIFICATE NO. 2100420491-02000

OWN DAMAGE EXCESS \$800.00 (1)

WINDSCREEN EXCESS \$5100.00

(for policies with effect from 1st November 2002)

SUM INSURED Market Value
INSURING WITH COE/PAF Yes

SKS7261L

CHAN KHENG MENG

30 Apr 2017

29 Apr 2018

1) VEHICLE REGISTRATION NO.

2) NAME OF INSURED

3) EFFECTIVE DATE OF THE COMMENCEMENT
OF INSURANCE FOR THE PURPOSES OF THE ACT

4) DATE OF EXPIRY OF INSURANCE

5) PERSON OR CLASSES OF PERSONS ENTITLED TO DRIVE *
SUBJECT TO AGE CONDITION :All Age Condition

a) The Insured.

b) Any other person who is driving on the Insured's order or with his permission.

This policy will indemnify the insured or any authorised driver only if he/she meets the age conditions.

A Young and/or Inexperienced Driver Excess ("YIDR") of \$53,000.00, in addition to the

Policy Excess, applies to You and any Authorised Driver (named or unnamed) if You are or the said

Authorised Driver is below the age of 23 and/or has less than 2 years' driving experience.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6) LIMITATION AS TO USE *

Use only for social, domestic and pleasure purposes and for the Insured's business.

The Policy does not cover use for hire or rewards, tuition, driving test, racing, pace-making, reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

APPROVED REPORTING CENTRES / AUDI AUTHORISED REPAIRERS

1. Audi Customer Service Center - 55 Ubi Road 1 (Tel: 63662323)

APPROVED REPORTING CENTRES / AIG AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

2. ComfortDelgro Engrg - 205 Braddell Rd (Tel: 63837118) 3. DPS Body & Paint Workshop - 209 Pandan Gardens (Tel: 65684501)

4. Ethoz - 30 Bukit Batok Cres (Tel: 66547777) 5. Glass-Fix - 52 Ubi Ave 3 (Tel: 62780887) - For windscreen only

6. Kan Fook Sing Motor - 61 Defu Lane 12 (Tel: 67479560) 7. Lai Huat (Meng Kee) Motor - 21 Sin Ming Ind (Tel: 64538110)

8. Mova Automotive - 1008 Bukit Merah Lane 3 (Tel: 62723892) 9. Progressive Automotive - 3022A Ubi Rd 1 (Tel: 67415336)

10. SME Motor - 1 Kaki Bukit Ave 6 Blk D (Tel: 67476106)

LOSS OF USE Loss Of Use 15 days Replacement Car only for repairs at Audi Customer Service Centre

NAMED DRIVER NA

HIRE PURCHASE COMPANY DBS BANK LTD
/ EMPLOYER'S LOAN

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

I / We hereby Certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Issued At Singapore 28 Mar 2017

AIG Asia Pacific Insurance Pte. Ltd.

304125-207
PREMIUM LEASING - SLEE
281 ALEXANDRA ROAD
AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

AUTHORISED REPRESENTATIVE

ORIGINAL

SSCGUK



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone: 6386 2223
Main Telefax: 6471 3233

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Telephone: 6386 2223
Telefax: 6471 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408075
Telephone: 6388 0331
Telefax: 6388 0331

Customer Service
Service Appointment
24-hour Breakdown Service
Email: customer.care@premiumauto.com.sg
6386 2323
9628 1233

INS TAX INVOICE
Company Reg. No. 199902271W
GST Reg. No. 199902271W

Page 1 13:58

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012739 Date : 02/08/2018 Order : SKS7261L Term : 30	Account: 0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	---

Regn No.: SKS7261L (V 26108) Regn Date: 30/04/2015 Mileage: 79504 WIP No.: 61502
Model: A6 1.8 TFSI ULTRA S tronic 4GC Chassis: WAUZZZ467FN062674 Engine: CYG 003371 Dept: U
VSB No.:
You have been assisted by :- UB-Jiayee (33)

		Details	Qty	Unit Price	Amount
S	SUBLET	M: TO SUPPLY VEHICLE NUMBER PLATE.	25.00	1.00	25.00
Q	EXC	M: 5888 Insurance Excess/Liability	-800.00	1.00	-800.00
S	BODYWORK	M: TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY AND FRONT PARKING AID	480.00	1.00	480.00
S	BODYWORK	M: TO DISMANTLE AND RENEW FRONT BUMPER ASSY. REORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	500.00	1.00	500.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER	550.00	1.00	550.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
X	A400853651AET94	GRILLE Less 020%	1.00	1697.00	1,357.60
Sub-Total					
7% GST					
Grand Total					



Premium Automobiles Pte Ltd

Audi Centre Singapore
201 Alexandra Road
Singapore 159538
Main Telephone 6386 2223
Main Telefax 6471 3233

Alexandra Service Centre
201 Alexandra Road
Singapore 159538
Telephone 6386 2223
Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408821
Telephone 6388 2223
Telefax 6388 2223

Customer Service
Service Appointment
Hour Breakdown Service
Email customer.care@premiumauto.com.sg
6386 2223
6388 1233

Page 2 13:58

INS TAX INVOICE
Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012799 Date : 02/08/2016 Order : SK57261L Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SK57261L (V 26100) Regn Date: 30/04/2015 Mileage: 79504 WIP No.: 61502
Model: A6 1.8 TFSI ULTRA S tronic 4GC Chassis: WAUZZZ4G7FN062674 Engine: CY6 003371 Dept: U
VSB No.:
You have been assisted by :- UB-Jiayee (33)

		Details	Qty	Unit Price	Amount
X	A460007081D	COVER	1.00	105.00	84.00
X	A460007113A	BEAM	1.00	702.00	561.60
X	A460007065ADGRU	COVER (A)	1.00	2425.00	1,940.00
X	A7L5018097A	CLIP	18.00	3.40	48.96
X	A460007683B T34	GRILLE (A)	1.00	573.50	458.80
X	A4600020536B	BRACKET	1.00	19.40	15.52
X	A8K0010520A	PLATE	1.00	11.60	9.28
X	A46000757B 222	MOLDING	1.00	208.00	208.00

Parts 4,683.75
Labour 0.00
Sublet 1,747.00
Menus 0.00
Lubricant 0.00

Sub-Total 5,630.76
7% GST 394.15
Grand Total 6,024.91



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Customer

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SKS 7261 L

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0431/2018/GW
20 April 2018

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE : CLAIM – OWNER’S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A6 1.8 TFSI
Vehicle Chassis No. : WAUZZZ4G7FN062674
Vehicle Regn No. : **SKS 7261 L**
Vehicle Mileage : 98225 km
Vehicle Owner : Mr. Chan Keng Meng
Certificate No : 2100420491-02000
Policy Excess : **S\$856.00**(inclusive 7% GST)
Accident Date : 06/04/2018
Place : Lorong 2 Toa Payoh Exiting To PIE Changi
Repair Cost : \$ 6,024.91
WIP No. : **61502**
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :

Time :

Date :


20/4/18

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	12 Apr 2018		11 Apr 2018 19:29 Edit Adj Rpt	S\$6,430.76 Edit Estimates	S\$6,430.76 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
[Created by insurer]									
Insured:	CHAN KHENG MENG, ID: S2754424Z, Tel: +6592998873, Email: khengmengchan@yahoo.com								
Vehicle Reg. No.:	SKS7261L	Date of Loss:	06/04/2018 20:00 - :59 [35 Months and 7 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 4251107933SG	Policy/Cover Note No.:	2100420491 (Comprehensive)						
		Excess:	S\$800.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Dally Amri, Mimi Zarina] MimiZarina.DallyAmri@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 20/04/2018]								
Driver/Custodian:	CHAN KHENG MENG (50 / Male), NRIC: S2754424Z, Tel: +6592998873								
ASSOCIATED MAIL RECEIVED									
View All Compose Case Mail									
- AIG_SG (13/04/2018): Alert - Adj Mandate Approved (S\$6882.00) - SKS7261L - Claim Handler: Dally Amri,... - AIG_SG (12/04/2018): SKS7261L / OD / 06/04/2018 / Coverage & Excess update									
ALL ASSOCIATED TASKS									
View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SKS7261L (4251107933SG)
 OD
 Apr 6 2018 8:00PM
 [CHAN KHENG MENG]
 Premium Automobiles Pte Ltd

Upload Documents			Upload Photos		Compose New Letter		Upload Video		Upload Audio		View View in Browser	
Assessment Reports											1 per page ☒	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)									Thumbnail	Print
1	12/04/18 16:30	Adjuster Immediate Advice									 Load HTM	
Photos/Images											3 per page ☒	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)									Thumbnail	Print
1	12/04/18 16:21	General View									 Load JPG	☒
2	12/04/18 16:21	General View									 Load JPG	☒
3	12/04/18 16:21	General View									 Load JPG	☒
4	12/04/18 16:21	General View									 Load JPG	☒
5	12/04/18 16:21	General View									 Load JPG	☒
6	12/04/18 16:21	General View									 Load JPG	☒
7	12/04/18 16:21	General View									 Load JPG	☒
8	12/04/18 16:21	General View									 Load JPG	☒
9	12/04/18 16:21	General View									 Load JPG	☒
10	12/04/18 16:21	General View									 Load JPG	☒
11	12/04/18 16:21	General View									 Load JPG	☒
12	12/04/18 16:21	General View									 Load JPG	☒
13	12/04/18 16:21	General View									 Load JPG	☒
14	12/04/18 16:21	General View									 Load JPG	☒
15	12/04/18 16:21	General View									 Load JPG	☒
16	12/04/18 16:21	General View									 Load JPG	☒
17	12/04/18 16:21	General View									 Load JPG	☒
18	12/04/18 16:21	General View									 Load JPG	☒
19	12/04/18 16:21	General View									 Load JPG	☒
20	12/04/18 16:21	General View									 Load JPG	☒
21	12/04/18 16:21	General View									 Load JPG	☒
22	12/04/18 16:21	General View									 Load JPG	☒
23	12/04/18 16:21	General View									 Load JPG	☒
24	12/04/18 16:21	General View									 Load JPG	☒
25	12/04/18 16:21	General View									 Load JPG	☒
26	12/04/18 16:21	General View									 Load JPG	☒
27	12/04/18 16:22	General View									 Load JPG	☒
28	12/04/18 16:22	General View									 Load JPG	☒
29	12/04/18 16:22	General View									 Load JPG	☒
30	12/04/18 16:22	General View									 Load JPG	☒
31	12/04/18 16:22	General View									 Load JPG	☒
32	12/04/18 16:22	General View									 Load JPG	☒
33	12/04/18 16:22	General View									 Load JPG	☒
34	19/07/18 10:31	Reinspection Photo									Load JPG	☒
35	19/07/18 10:31	Reinspection Photo									Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
36	19/07/18 10:31	Reinspection Photo	 Load JPG	☒
37	19/07/18 10:31	Reinspection Photo	 Load JPG	☒
38	19/07/18 10:31	Reinspection Photo	 Load JPG	☒
39	19/07/18 10:31	Reinspection Photo	 Load JPG	☒
40	19/07/18 10:31	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	12/04/18 16:22	Certificate of Insurance	 Load PDF	
2	12/04/18 16:22	Driver's Driving License	 Load PDF	
3	12/04/18 16:22	estimate	 Load PDF	
4	12/04/18 16:22	Singapore Accident Statement	 Load PDF	
5	24/08/18 11:12	WORKSHOP INVOICE	 Load PDF	
6	24/08/18 11:12	DISCHARGE VOUCHER	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	07/04/18 12:59	Accident Statement	 Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	07/04/18 12:50	Accident Photo	 Load JPG	☒
2	07/04/18 12:50	Accident Photo	 Load JPG	☒
3	07/04/18 12:50	Accident Photo	 Load JPG	☒
4	07/04/18 12:50	Accident Photo	 Load JPG	☒
5	07/04/18 12:50	Accident Photo	 Load JPG	☒
6	07/04/18 12:50	Accident Photo	 Load JPG	☒
7	07/04/18 12:51	Accident Photo	 Load JPG	☒
8	07/04/18 12:51	Accident Photo	 Load JPG	☒
9	07/04/18 12:51	Accident Photo	 Load JPG	☒
10	07/04/18 12:51	Accident Photo	 Load JPG	☒
11	07/04/18 12:51	Accident Photo	 Load JPG	☒
12	07/04/18 12:51	Accident Photo	 Load JPG	☒
13	07/04/18 12:51	Accident Photo	 Load JPG	☒
14	07/04/18 12:51	Accident Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	07/04/18 12:57	Sketch Plan	 Load JPG	☒
2	07/04/18 12:57	Sketch Plan #2	 Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST Reset Save Print
There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**Show Remarks To:** ☐ Handling InsurerNote: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CC/AIG18006737/ATBQ2

Date: 24/08/2018

REFERENCE

Insured/Claimant: CHAN KHENG MENG Policy No: 2100420491
Date of Loss: 06/04/2018 Nature of Claim: OD Claim No: 4251107933SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKS7261L**
Make & Model: AUDI A6, 1.8 TFSI S-tronic (A) Engine No: CYG003371
Reg. Date: 30/04/2015 (Man. Year: 2015) Chassis No: WAUZZZ4G7FN062674
Colour: Black Odometer: 74643 km
Engine Capacity: 1798 cc
Market Value/New Car Price: S\$130,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/45 R18 Rear Tyre Size: 245/45 R18
Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm
Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	7,281.00	4,708.76	2,572.24	35.33
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,622.00	1,722.00	900.00	34.32
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	9,903.00	6,430.76	3,472.24	35.06
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	9,103.00	5,630.76	3,472.24	38.14
+ GST 7.00/7.00% (S\$)	637.21	394.15	243.06	38.14
Nett Amount (S\$)	9,740.21	6,024.91	3,715.30	38.14

INSPECTION

Date of Assignment: 11/04/2018
Date Inspected: 11/04/2018 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 3.0 days

Adjuster: ADRIAN LING

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	3,321.00 FS	*2,655.76 FS
2	1		*FRONT BUMPER FIXING SETS	Not Necessary	43.00 FS	*- FS
3	1		*RADIATOR GRILLE	Cracked	1,697.00 FS	*1,357.60 FS
4	1		*RADIATOR GRILLE COVER	Not Necessary	32.00 FS	*- FS
5	2		*AIR GUIDE LH/RH	Not Necessary	614.00 FS	*- FS
6	2		*FRONT BUMPER COVER LH/RH	Not Necessary	88.00 FS	*- FS
7	1		*FRONT BUMPER FOAM	Not Necessary	203.00 FS	*- FS
8	1		*FRONT BUMPER REINFORCEMENT	Bent	702.00 FS	*561.60 FS
9	2		*FRONT BUMPER SUPPORT	Not Necessary	21.00 FS	*- FS
10	1		*FRONT BUMPER TOP COVER	Cracked	105.00 FS	*84.00 FS
11	1		*SIGN CAUTION	Necessary	12.00 FS	*9.28 FS
12	2		*RADIATOR GRILLE SUPPORT FRONT LH/RH	Not Necessary	118.00 FS	*- FS
13	1		*FRONT NO PLATE	Bent	25.00 FS	*25.00 FS
14	1		*SUNDRIES	Necessary	300.00 FS	*15.52 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$)	7,281.00	4,708.76
--------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS ,HORNS ,OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY NAD FRONT PARKING AID	New	480.00	480.00
2	TO DISMANTLE AND RENEW FRONT BUMPER ASSY .RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS .REINSTALL ALL PARTS REMOVED	New	1,050.00	500.00
3	TO RESPRAY FRONT BUMPER AND BONNET	New	900.00	550.00
4	TO CARRY OUT DIAGNOSTIC CHECKS	New	192.00	192.00
Gross Labour Cost (S\$)			2,622.00	1,722.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >