



Car Times Autolution Pte Ltd (Co.Reg.No:20165716G)  
160 Sin Ming Drive,  
#02--04  
AutoCity  
Singapore 575722

Tel: 6471 5111 Email: claims@cartimes.com.sg

**INSURER: AXA**

**PARTICULARS OF CLAIM**

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	GA239841/1	Date of Accident:	15/4/2018
Vehicle Reg. No.:	SKH 9798 A	Driveable?	YES
Driver Age/Info:	48/MALE	Party At Fault:	DRIVER
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	KELVIN TAN CHEOW CHONG	Contact No:	+65 9764 2764
Driver:	KELVIN TAN CHEOW CHONG		
Make/Model:	MERCEDES GLC 250	Vehicle Reg. Date:	7 JUL 2017
Vehicle Colour:	WHITE	Chassis No:	WDC2533462F190633
Engine No:	27492030906357		
Total Loss?			
Est. Duration of Repair (day)	5 days		
Description of Accident/Loss	PLEASE SEE ATTACHED SKETCH		
Present Location:	CAR TIMES AUTOLUTION PTE LTD		

# CARTIMES

autolution

VEHICLE NO: SKH 9798 A MERC.GLC 250

CLASSIC : WDC2533462F190633


QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)	SURVEYORS ADJUSTMENT
<b>PARTS (LIST ITEMS)</b> <i>COM</i>				
1	FRONT BONNET	Damaged	<i>By</i> \$982.00	✓
1	FRONT BONNET 'MERCEDES' LOGO	Damaged	<i>mis</i> \$33.00	✓
1	FRONT BONNET LOCK	Damaged	\$35.00	?
1	FRONT BONNET INSULATOR	Damaged	<i>su</i> \$160.00	X
2	FRONT LHS & RHS HEADLAMP <i>o/s ?</i>	Damaged <i>NIS mgum</i>	\$2,900.00	✓
2	FRONT RHS & LHS HEADLAMP BRACKET	Damaged	\$470.00	?
1	FRONT BUMPER TOW COVER	Damaged	<i>nd</i> \$33.00	✓
1	FRONT UPPER GRILL	Damaged	<i>nd</i> \$133.00	✓
1	FRONT GRILL "STAR" LOGO	Damaged	<i>cm</i> \$28.00	✓
1	FRONT GRILL "STAR" ASSY	Damaged	<i>cm</i> \$36.00	✓
1	FRONT TOP PANEL	Damaged	\$235.00	?
1	FRONT LOWER GRILL	Damaged	\$110.00	?
2	FRONT UPPER GRILL CHROME	Damaged	<i>nd</i> \$64.00	✓
1	FRONT BUMPER	Damaged	<i>cm</i> \$775.00	✓
1	FRONT BUMPER BRACKET	Damaged	\$105.00	?
1	FRONT REINFORCEMENT BAR	Damaged	\$230.00	?
2	FRONT BUMPER LHS & RHS STRUT	Damaged	\$54.00	?
1	FRONT BUMPER SPONGE	Damaged	\$75.00	?
1	FRONT BUMPER NUMBER PLATE GARNISH	Damaged	<i>nd</i> \$60.00	✓
1	FRONT BUMPER LOWER LID	Damaged	<i>nd/su</i> \$260.00	✓
2	FRONT BUMPER RHS & LHS SIDE FOGLAMP COVER@	Damaged	<i>su</i> \$80.00	X
2	FRONT BUMPER RHS & LHS SIDE RETAINER	Damaged	<i>su</i> \$80.00	X
1	CONDENSER	Damaged	\$696.00	?
1	RADIATOR	Damaged	\$540.00	?
1	FRONT COWLING	Damaged	\$1,080.00	?
1	FRONT LH FENDER	Damaged	<i>r</i> \$490.00	X
			\$9,744.00	
<b>SPECIAL NETT ITEMS</b>				
1 set	FRONT BUMPER CLIPS	Necessary	<i>nd</i> \$40.00	✓
6 pcs	FRONT SENSOR(FRONT BUMPER,FRONT GRILLE,FRONT BUMPER GARNISH)	Damaged	\$510.00	?
1	RADIATOR COOLANT	Necessary	\$80.00	?
1	Front number plate w/holder	Damaged	<i>cm</i> \$45.00	✓
<b>TOTAL PARTS</b>			<b>\$675.00</b>	

*For*  
*18*

*Not Authorised*  
*L.B.I.*  
*Recovery B4 pain*

*Ex @ 500%*

*Fax: 62564313*

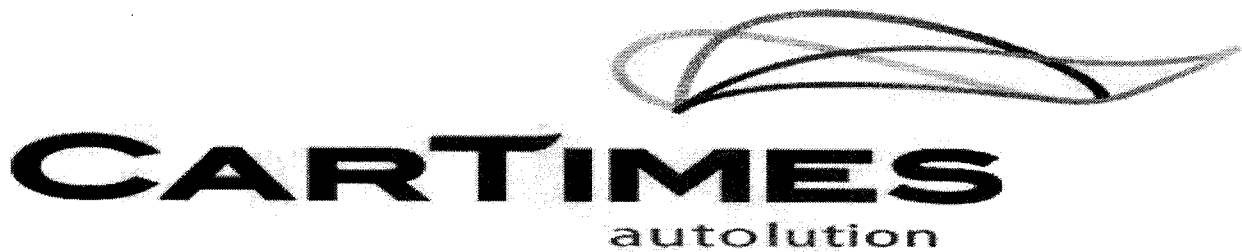

VEHICLE NO: SKH 9798 A MERC.GLC 250

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (\$\$)	SURVEYORS ADJUSTMENT
	<b><u>LABOUR</u></b>		
1	To remove the affected parts & fittings to commence repairs; replace damaged parts and components	1000.00	500
2	To supply paint materials, expandable items & putty, respray paint on parts replaced & repaired	1200.00	600
3	To remove and re-fix wiring and check all electrical components at damaged areas for proper functions	150.00	20
4	To remove and replace front bumper sensor and check for proper function.	150.00	60
5	Perfrom diagnois on vehicle	150.00	?
6	Remove and replace condenser and top up gas	150.00	?
7	Remove and replace radiator and top up coolant and perfrom pressure test check for leakage	150.00	?
	Labour Total :	2950.00	
	<b>TOTAL (PARTS &amp; LABOUR):</b>	<b>13369.00</b>	

**LKK Auto Consultants** hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: