



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2003284
INV Date 20/04/2020
Reference CC4/EQI18007513/R1ps3q2
Code EQI



PROFESSIONAL SERVICE FEE

Vehicle No. YP 6747J
Insured Veh. GY 7499J
Claim No. DM18HO00699/SG
Policy No. DMCPHQ17-003933
Accident Date 16/03/2018
Inspection Date 15/11/2018

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD		Ref : CC4/EQI18007513/R1ps3q2		
5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Date : 20-04-2020		
		Code : EQI		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GY 7499J	Veh. Inspected	YP 6747J	
Policy No.	DMCPHQ17-003933	Coverage (\$)	0.00	
Claim No.	DM18HO00699/SG	Excess (\$)	0.00	
Assign From	JANET	Assign Date	15/11/2018	
2. Vehicle Particulars & Condition				
Make & Model	MITSUBISHI CANTER FEB21	c.c	2998	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	FEB21EA21315	Colour	GREEN	
Odometer	48256	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/55 R15	YOKOHAMA	7 mm	
L/H Front Tyre	195/55 R15	YOKOHAMA	7 mm	
R/H Rear Tyre	195/55 R15 (D)	YOKOHAMA	7/7 mm	
L/H Rear Tyre	195/55 R15 (D)	YOKOHAMA	7/7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/03/2018	Inspection Date	15/11/2018	
Survey held at	GOLDBELL ENGINEERING PTE LTD 10 TUAS AVE 18 SINGAPORE 638894			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		12 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YP 6747J

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT WINDSCREEN WEATHERSTRIP	NECESSARY	477.20	477.20
1	FRONT PANEL	BENT	2,320.79	2,320.79
1	FRONT PANEL GARNISH	DEFORMED	365.77	365.77
1	'FUSO' MARK	NECESSARY	147.63	147.63
1	RADIATOR GRILLE	CRACKED	1,053.14	1,053.14
1	'CANTER' MARK	NECESSARY	74.70	74.70
1	'THREE-DIA' MARK	SERVICEABLE	78.66	-
1	RADIATOR GRILLE BRACKET	SERVICEABLE	24.96	-
1	FRONT BUMPER	BENT	929.76	929.76
1	FRONT BUMPER STAY LHS	SERVICEABLE	186.95	-
1	FRONT BUMPER STAY RHS	BENT	186.95	186.95
1	FRONT BUMPER COVER LHS	MISSING	325.54	325.54
1	FRONT BUMPER COVER RHS	DEFORMED	325.54	325.54
1	HEADLAMP LHS	SERVICEABLE	461.45	-
1	HEADLAMP RHS	CRACKED	461.45	461.45
1	TURN SIGNAL LAMP LHS	CRACKED	245.15	245.15
1	TURN SIGNAL LAMP RHS	BROKEN	245.15	245.15
1	HEATER ASSY	SERVICEABLE	2,337.68	-
1	AIR INTAKE DUCT ASSY	SERVICEABLE	829.06	-
1	HORN	SERVICEABLE	124.36	-
1	HORN COVER	SERVICEABLE	108.32	-
1	REAR VIEW MIRROR LHS	BENT	93.59	93.59
1	REAR VIEW MIRROR STAY LHS	SCRATCHED	437.17	437.17
1	FRONT UNDER VIEW MIRROR LHS	MISSING	54.09	54.09
	LESS 25% DISCOUNT		-2,973.77	-1,935.91
			8,921.29	5,807.71
<u>SPECIAL NETT ITEMS</u>				
1	FRONT NUMBER PLATE (SN)	BENT	20.00	20.00
1	SEALANT (SN)	SERVICEABLE	40.00	-
2	CARGOBOX REAR DOOR LHS/RHS (SN)	BENT	3,600.00	3,600.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	CARGOBOX REAR DOOR LOCK LHS/RHS (SN)	SERVICEABLE	2,600.00	-
1	CARGOBOX WOODEN LOWER RAIL (SN)	CRACKED	450.00	450.00
1	CARGOBOX WOODEN STEP (SN)	SERVICEABLE	400.00	-
1	CARGOBOX METAL STEP (SN)	BENT	500.00	500.00
1	CARGOBOX METAL STEP STAY (SN)	BENT	150.00	150.00
6	U-BOLT (SN)	SERVICEABLE	1,080.00	-
4	SET BOLT & NUT (SN)	SERVICEABLE	140.00	-
1	REAR BUMPER (SN)	BENT	850.00	850.00
1	REAR BUMPER BRACKET RHS (SN)	SERVICEABLE	180.00	-
1	COMPANY LOGO ON CARGOBOX (SN)	NECESSARY	750.00	750.00
1	'60KM/H' STICKER (SN)	NECESSARY	20.00	20.00
1	SUNDRIES (SN)	NECESSARY	80.00	50.00
			10,860.00	6,390.00
	LABOUR			
	TO REMOVE & REFIT DAMAGED PARTS ,CUT ,WELD ,PANEL BEAT ,STRAIGHTEN & REALIGN ,ETC.		3,000.00	2,400.00
	TO CHECK FOR & RECTIFY WIRING FAULTS ,ETC .TO CARRY OUT DIAGNOSTICS CHECK.		150.00	150.00
	TO REMOVE & REFIX FRONT WINDSCREEN.		180.00	180.00
	TO REMOVE & REFIX DASHBOARD ASSY .		700.00	600.00
	TO REMOVE & REFIX AIRCOND SYSTEM AND TOP UP GAS.TO CHECK FUNCTION.		700.00	600.00
	TO REMOVE,REFIX & REALIGN REAR CARGOBOX .TO REPLACE ALL DAMAGED PARTS.		3,600.00	3,000.00
	TO PUTTY,CLEAN ,SPRAY PAINT & POLISH ,ETC.		2,800.00	2,450.00
			11,130.00	9,380.00
GRAND TOTAL			30,911.29	21,577.71
RECOMMENDED COST OF REPAIRS				21,577.71

Report Ref No. CC4/EQ18007513/R1ps3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YP 6747J

INSPECTION





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YP 6747J

RE-INSPECTION

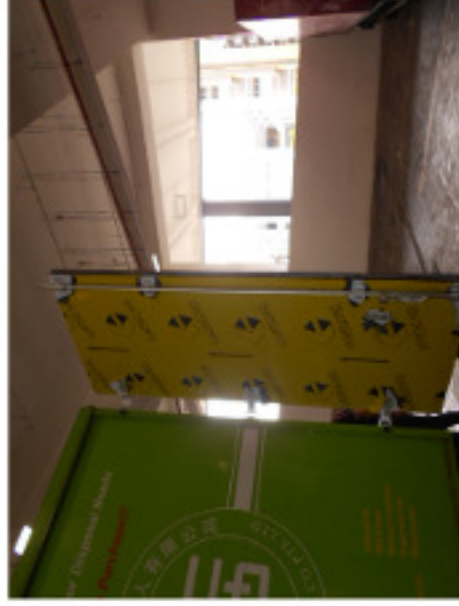




LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

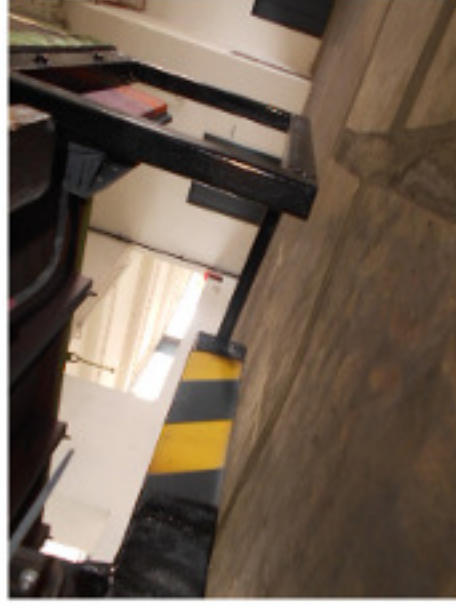



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

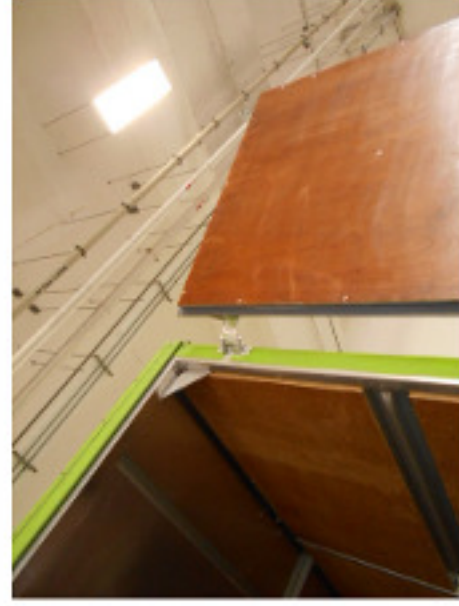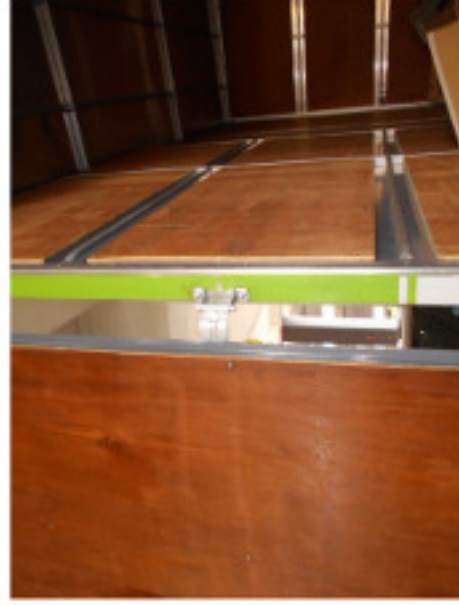



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

