

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0506/2018/CCS
Date : 30-Apr-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Ms Lee Siew Mun
Address : 13 Jalan Sedap
Singapore 438269
Telephone : HP +65 96624154
Type of Claim : Own Damage Claims
Policy No. :
Vehicle No : **SLC 4958 C**
Model Code : Audi A4 SEDAN 1.4 TFSI
Model / Year : May-16
Engine No : CVN 009011
Chassis No : WAUZZZF40GA071745
Mileage :
Date In : 30-Apr-18
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 28-Apr-18
Place of Accident : Along Victoria Street

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLC 4958 C.

S/n	Nature of Jobs	Estimated Charges	Remarks
1	To remove and transfer front wiring harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 360.00 /	
2	To remove and transfer radiator, additional radiator and a/c condenser. Check radiator fans. To pressurise cooling system, vacuum and regas air cond system.	S/N \$ 1,000.00 ?	
3	To dismantle front bumper, bonnet, both headlights and both front fenders. Remove and renew front lock carrier, align to position. Renew all damaged panel and headlights. Re-organise front crash management components. Reinstall all parts removed.	\$ 5,600.00 2250 if change lock carrier - 4000?	
4	To respray front bumper, bonnet and both front fenders.	\$ 3,000.00 2200	
5	To carry out diagnostic check.	S/N \$ 192.00 /	
TOTAL LABOUR CHARGES		: \$ 10,152.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLC 4958 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	\$ 1,849.00	DE ✓
2	FRONT BUMPER GRILLE - CENTER	\$ 171.00	CRA ✓
3	FRONT BUMPER AIR GUIDE - LH/RH	2 \$ 146.00	?
4	RADIATOR GRILLE	\$ 972.00	CRA ✓
5	FRONT BUMPER FOAM	\$ 107.00	?
6	FRONT REINFORCEMENT BEAM	\$ 702.00	BI ✓
7	FRONT REINFORCEMENT BEAM BOLT SET	\$ 47.00	ne ✓
8	FRONT BUMPER SUPPORT - LH/RH	2 \$ 48.00	?
9	FRONT LOCK CARRIER BRACKET	\$ 118.00	CRA ✓
10	FRONT BUMPER TOP COVER	\$ 109.00	DE ✓
11	BONNET RELEASE LEVER	\$ 12.00	X
12	BONNET BOWDEN CABLE	\$ 50.00	BI ✓
13	SIGN ' CAUTION ' STICKER	\$ 12.00	ne ✓
14	STICKER FOR AIR CONDITIONER	\$ 7.00	ne ✓
15	FRONT BUMPER GRILLE - LH/RH	2 \$ 236.00	X
16	FRONT FENDER - LH/RH	2 \$ 1,330.00	BI ✓
17	FRONT FENDER ATTACHMENT PARTS	2 \$ 90.00	?
18	FRONT FENDER CLOSING ELEMENT - LH/RH	2 \$ 88.00	ne ✓
19	FRONT FENDER BRACKET - FRONT LH/RH	2 \$ 62.00	ne ✓
20	FRONT FENDER BRACKET - CENTER LH/RH	2 \$ 86.00	?
SUB-TOTAL SPARE PARTS CHARGES		: \$ 6,242.00	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLC 4958 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT FENDER RIVET SET	\$ 24.00	new ✓
22	FRONT FENDER BRACE - LH/RH	2 \$ 206.00	?
23	HEADLIGHT TRIM - LH/RH	2 \$ 40.00	new ✓
24	FRONT FENDER TRIM - OUTER LH/RH	2 \$ 54.00	new ✓
25	BONNET	\$ 2,163.00	PT ✓
26	BONNET ATTACHMENT PARTS	\$ 105.00	?
27	BONNET HINGE - LH/RH	2 \$ 532.00	X
28	BONNET IMPACT PROTECTION - LH/RH	2 \$ 48.00	new ✓
29	BONNET IMPACT PROTECTION - CENTER	\$ 24.00	new ✓
30	BONNET LOCK STRIKER - LH/RH	2 \$ 88.00	?
31	BONNET LOCK	2 \$ 376.00	?
32	LED HEADLIGHT - LH/RH	2 \$ 13,946.00	OK ✓
33	HEADLIGHT WASHER CYLINDER - LH/RH	2 \$ 368.00	X
34	HEADLIGHT CYLINDER BRACKET - LH/RH	2 \$ 11.00	X
35	HEADLIGHT WASHER PIPE	\$ 79.00	X
36	FRONT LOCK CARRIER	\$ 891.00	?
37	FRONT LOCK CARRIER AIR GUIDE - INNER LH/RH	2 \$ 46.00	?
38	FRONT LOCK CARRIER AIR GUIDE - UPPER LH/RH	2 \$ 20.00	?
39	ADDITIONAL RADIATOR	\$ 455.00	?
40	A/C CONDENSER	\$ 540.00	PT ✓
SUB-TOTAL SPARE PARTS CHARGES		:	\$ 20,016.00

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLC 4958 C.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	A/C PRESSURE SENSOR	\$ 170.00	X
42	A/C HIGH PRESSURE VALVE	\$ 46.00	X
43	RADIATOR	\$ 585.00	?
44	RADIATOR RUBBER BUSH	\$ 38.00	?
45	COOLANT	\$ 133.00	?
46	FRONT NO. PLATE	S/N \$ 25.00	Bf ✓
47	SUNDRIES	\$ 400.00	?
TOTAL SPARE PARTS CHARGES		: \$ 27,655.00	
TOTAL LABOUR CHARGES		\$ 10,152.00	
GRAND TOTAL		\$ 37,807.00	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Name : Rasu
Surveyed Date : 02/05/18 @ 1130
Authorised Date :
Excess Cost : 7 days
Liability : Hp 90560068
Remarks :
Excess : TBA
Revert
Resurvey by paint

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer


Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel: 6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

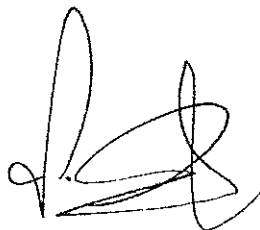

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant