

**S & H Motor Pte Ltd**  
**Blk 106 Sin Ming Drive**  
**#07-02**  
**Sin Ming Autocity**  
**Singapore 575722**

**Claim Reference:**  
**Assessment Number: SH000219**  
**Version: S&HMOTOR/1**  
**Date Calculated: 03/05/2018 04:49**

**Full Report - V1**  
**Registration: SKA1849B**  
**Printed: 03/05/2018 11:49**

**Summary Information**

**Claim**

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SH Motor	Date of Incident:	28/04/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	DMPCSN3000211801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

**Vehicle**

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 CGI BE
Model Sheet Number:	304 26
Registration:	SKA1849B
Registration Month:	
Registration Year:	
VIN Number:	WDD2040482A473956
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

**Model Specs**

FR A395./F500./R131.	MODEL 2011
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

**Vehicle Condition**

**Vehicle Status**

Pre-Accident Condition:  
Steering: **LKK Auto Consultants** hence notify the Repairer of the following:  
• To resurvey before/after spray painting  
• To display damaged part(s) during resurvey  
• Parts prices are subject to confirmation  
• Third party survey is on a "Without Prejudice" basis  
• No illegal modification(s) is allowed  
• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Brakes Pedal Travel:  
Place of Inspection:  
Pre-Accident Damage:  
Tyres Condition:  
Tread Depth RHF:  
Tread Depth LHR:  
Damage Areas: Acknowledged by Repairer

Severity of Impact:  
Vehicle Status on Inspection:  
Date of Inspection: 03/05/2018

Tread Depth RHF:  
Tread Depth RHR:  
Direction of Impact:

Signature:  
Date:

*Not Authorised*  
*Resurvey B4 paint*  
*Ex 812501*  
*5 days*  
*Per m/s*  
*Fax: 62564313*

Claim Reference:

Assessment Number: SH000219



Version: S&amp;HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

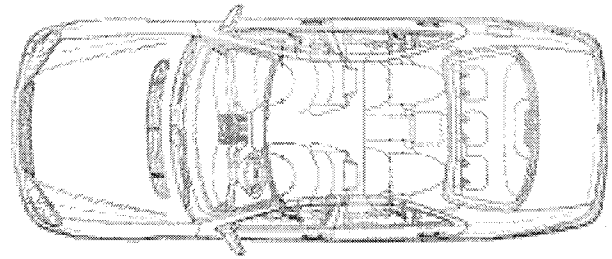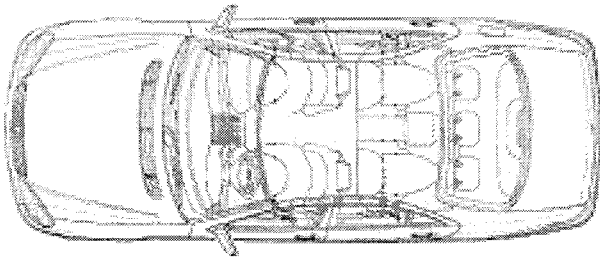

## Addresses

## Cost Summary

Total Labour	\$1,476.60
Total Paint/Material	\$232.30
Total Parts	\$6,980.00
Total of Additional Costs	\$285.00
Excess:	TBA
Grand Total Exc GST:	\$8,973.90
7 % GST:	\$628.17
Grand Total Inc GST:	\$9,602.07

## Repair Information

### LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR

Price/Dent = \$46.00/HR

### Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
40-6500 01	VEHICLE FRONT AND REAR ALIGNMENT WITHOUT ADJUSTMENT	7.0	32.20
40-6710 01	ADD/WORK FOR VEHICLE WITH BOARDING-/EXITING SUPPORT	1.0	4.60
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
88-2506 01	RENEW BONNET INCLUDES: R + R BONNET, CONVERT ALL PARTS	11.0	50.60
82-4790 01)	RENEW L/F LAMP UNIT (DET/REFIT BUMPER)	3.0	13.80
88-9663 01	R + R L/F WING MOULDING	3.0	13.80
88-3814 01	R + R L/F WING (FRONT BUMPER REMOVED)	7.0	32.20
88-3816 01)	RENEW L/F WING (REMOVED)	2.0	9.20

# S & H Motor Pte Ltd

Claim Reference:

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

88-3511 01	FIT L/WING BADGE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE	12.0	55.20
	INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION		
62-1301 01	R + R L/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
40-1580 01	R + R FRONT WHEEL (WHEELS)	3.0	13.80
42-2706 01)	R + R L/F BRAKE PADS	3.0	13.80
42-2731 01)	R + R LEFT FRONT BRAKE DISC (BRAKE PADS REMOVED)	3.0	13.80
33-2380 01)	R + R FRONT WHEEL HUB ADD/WORK	3.0	13.80
33-2280 01)	R + R LEFT FRONT WHEEL HUB	3.0	13.80
33-2995 02	R + R LEFT FRONT WHEEL BEARING	6.0	27.60
33-5156 02)	R + R LEFT FRONT STEERING KNUCKLE (FRONT WHEEL HUB REMOVED)	9.0	41.40
33-1421 02)	R + R L/F AXLE TENSION ROD (WHEEL REM)	12.0	55.20
33-1405 01	R + R LEFT FRONT CONTROL ARM	5.0	23.00
0258	REMOVE AND REFIT FRT NO PLATE REINF	1.0*	4.60 X
0305	REMOVE AND REFIT FRONT BUMPER GRILLE	2.0*	9.20
0481	REMOVE AND REFIT BONNET INSULATION	2.0*	9.20 ✓
0638	REMOVE AND REFIT R/F FOG LAMP	2.0*	9.20 X
9973	KN TEST DRIVE	5.0*	23.00 ?
0930	REPAIR CTR FRT REINF	10.0*	46.00 ?
1111	REPAIR L/F WHEELHOUSE ASSY	20.0*	92.00 ?
1155	REPAIR L/UPP W-HOUSE S-MEMB	30.0*	138.00 ?
1283	REPAIR L/F C-MEMBER BRACKET	10.0*	46.00 ?

## LABOUR COST

Total Work Units	219.0	
Panel / Mechanical Labour	21.1HRS	\$970.60
Visual Alignment Labour	0.8HRS	\$36.80
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	21.9HRS	\$1,007.40
Paint Labour	10.2HRS	\$469.20
Total Labour	32.1HRS	\$1,476.60

## PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
741	L/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
361	L/F OUTER SENSOR NEW PART PAINT K1R	3.0	
365	L/F INNER SENSOR NEW PART PAINT K1R	3.0	
742	R/F WING SURFACE PAINT	5.0	
1111	L/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
1481	LEFT FRONT DOOR SURFACE PAINT	7.0	

## LABOUR COST - PAINT

# S & H Motor Pte Ltd

Claim Reference:

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

TIME(PAINT)	72.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	102.0	
Total Paintwork Labour	10.2HRS	\$469.20
<b>MATERIAL COST - PAINT</b>		<b>Cost Price</b>
New Part Painting		\$108.36
New Part Painting - Plastic K1R		\$45.26
Material-Constant Main Work Metal		\$28.60
Surface-/Blend Paint		\$41.08
Material-Const Main Work Plastic		\$9.00
Total Excluding Pearlescent Uplift		\$232.30
Pearlescent Uplift @ 0.0%		\$0.00
<b>Total Paint Material Cost</b>		<b>\$232.30</b>

## PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)	
283	1	FRONT BUMPER COVER	204 880 0940 9999	CM	0%		950.00*	✓
303	1	L/F BUMPER COVER	204 885 2223		0%	DI	80.00*	✓
311	1	L/F BUMPER MOULDING	204 885 0721		0%	ME	80.00*	✓
312	1	R/F BUMPER MOULDING	204 885 0821		0%	ME	80.00*	✓
349	1	FRT/CTR IMPACT DAMP	204 885 0037		0%		115.00*	✓
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	ME	35.00*	✓
361	1	L/F OUTER SENSOR	000 905 2402		0%	SEN	180.00*	✓
365	1	L/F INNER SENSOR	000 905 2402		0%		180.00*	?
405	1	FRONT GRILLE	204 880 0023 9744		0%		430.00*	✓
431	1	BADGE	204 817 0616		0%		80.00*	?
471	1	BONNET	204 880 1057 64		0%	B	1,080.00*	✓
507	1	L/SPRING ELEMENT	204 880 0227		0%	SP	10.00*	X
508	1	R/SPRING ELEMENT	204 880 0227		0%	SP	10.00*	✓
561	1	LEFT HEADLAMP ASSY	204 906 5303		0%	CM	650.00*	✓
577	1	L/HEADLAMP COVER	204 826 1324		0%		165.00*	?
637	1	L/F FOG LAMP	251 820 0756		0%		190.00*	?
741	1	L/F WING	204 880 1318		0%	ME	580.00*	✓
765	1	L/F RAIL	204 881 0106		0%		30.00*	?
785	1	L/F WING MOULDING	204 690 3162		0%	ME	40.00*	✓
789	1	L/F WING CLAMP KIT	USE SINGLE PARTS		0%	ME	25.00*	✓
811	1	L/F WING BADGE	204 817 7220		0%	ME	55.00*	✓
839	1	L/F W-HOUSE CVR FRT	204 690 5730		0%		135.00*	?
1001	1	FRT LWR CROSSMEMBER	207 620 1600		0%		280.00*	?
1179	1	L/F UPP REINF	204 620 0991		0%		190.00*	?
7047	1	L/F UPP CONTROL ARM	204 330 4311		0%	SP	270.00*	X
7071	1	L/F STRUT	204 330 6711		0%	SP	290.00*	X
7081	1	L/F STEERING KNUCKLE	204 332 0101		0%	SP	480.00*	X
7121	1	L/F WHEEL BRG SET	203 330 0051		0%	ME	290.00*	X

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Sub Total

\$6,980.00

Total Parts

\$6,980.00

## NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

### Extras

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Audatex System Using Manufacturer Times

**S & H Motor Pte Ltd****Claim Reference:****Assessment Number: SH000219****Version: S&HMOTOR/1****Date Calculated: 03/05/2018 04:49****Full Report - V1****Registration: SKA1849B****Printed: 03/05/2018 11:49**

<b>Description</b>		<b>Betterment</b>	<b>Price</b>
WHEEL ALIGNMENT	SPECIALIST	0%	\$65.00
ELECTRICAL WORK	SPECIALIST		\$40.00
ECU DIAGNOSTIC	SPECIALIST	0%	\$180.00
		<b>Total Extras</b>	<b>\$285.00</b>

**Final Calculation****Total Parts** **\$6,980.00****Labour**

Total Panel/Mechanical	\$970.60
Total Paintwork	\$469.20
Total Visual Alignment work	\$36.80

**Total Labour** **\$1,476.60****Additional Costs**

Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$285.00

**Total of Additional Costs** **\$285.00****Total Paint/Material Costs** **\$232.30****Grand Total Excludes GST** **\$8,973.90**GST @ 7 % **\$628.17****Grand Total Includes GST** **\$9,602.07****Assessment Notes**