

12/05/2018

ASS. REC. BY:

REF: CS/CTL18008111/Kyber

Special Instruction:

SURVIVOR:

Kenneth

ASSIGNMENT (Office)

Merimen

From (Person):

Chong Soon Sen

of

CTL

Date/Time:

03052018 213pm

Estimated Cost:

Bill to:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SKA 18498

Insured:

at Workshop m/s

S & H Motor

Tel:

6453 430

of

160 Sin Ming Dr 407-02

Policy No:

DMPCE3000211801

Claim No:

SNM18D02196C01

Sum Insured:

Excess:

\$1250.00

Make of Veh:

D.O.A.

28042188

(Client's Record)

CA / REV / REP. / REV 24 HRS

04052018

H.O.D. Endorsement:

Date/Time:

03052018 259pm

Person Contacted:

Gynthia

Vehicle IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SKA 18498 - X

7/5/18

Revert by merimen

8/5/18

Rece approved \$ 7362.50 from Alfred by merimen

8/5/18

Informed Doris CIA on part by part & \$1250 by email

28/7/18

LS \$5300 confirmed by email (Reel 3673.90, 1401)

REF: CTL

Merimen

ASSIGNMENT

From: Date: 04052018

Estimated Cost:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SKA 1849B

at Workshop n/s: S & H Motor

of: 160 Sin Ming Drive #07-02

Insured

Policy No.

Claims No.

Sum insured: Excess: \$ 1250.00

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: \$62k

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 05 days Res: Yes or No

Lump Sum: % 3 Val: Yes or No

CA / ☒ REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SKA 1849B Yr Regn: 01 11

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: M. C200 C6i 1796

Colour: M. Gray A/C: Insured / Std / NI / NA

Sp. Reading: 1151 P0 T/Radio: Insured / Std / NI / NA

Eng. No:

O/Nr: WOB 2040482A 473956

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size F:

R:

225/40R17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front:

Rear:

R/Bal: 6 mm

R/Bal: 5 mm

L/Bal: 6 mm

L/Bal: 5 mm

D.O.A: 28/4/18

D.O.I: 4/5/18

Survey held at: ✓

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

FR N/S

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

7/5 File pass to Catherine

RECEIVED 30 JUL 2018

Case/Time: File Pass to: ☐ Prel. ReportII ☐ Final Report

Case/Time: File Return to:

30/7 - typist

Report Format: merimen

Lump Sum / I.B. n/s: 5300/-

Days Of Repair: 5

Resurvey No. of Trip: 1

Add Fee: ☐ Site Insp (\$)☐ Interview (\$)☐ Tech. Insp (\$)☐ Workshop (\$)

Survey Fee

Transportation

3 - 5 - 10 - 20

1 - 2 - 3 - 4

1 - 2 - 3 - 4

1 - 2 - 3 - 4

Survey

220

220

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	03 May 2018 Sendback Est	03 May 2018 12:15 S\$8,973.90	03 May 2018 14:13 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

Show All

CLAIM SUBFOLDER DETAILS

Insured:	LEE MUI HIANG, ID: 57248875Z		
Vehicle Reg. No.:	SKA1849B	Date of Loss:	28/04/2018 08:00 - :59 [87 Months and 2 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD / SNM18D02196C01	Policy/Cover Note No.:	DMPCSN3000211801 (Comprehensive)
		Excess:	S\$1,250.00
Repairer:	S & H Motor Pte Ltd (Sin Ming) 160 Sin Ming Drive #07-02, Sin Ming AutoCity, 575722 Sin Ming - Tel: 6453 4730		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 14/05/2018]		
Driver/Custodian:	CHO CHONG HUA (45 / Male), NRIC: 57219621Z, Tel: +6592378446		
Adj Asg. Remarks:	SURVEY REVERT		

ASSOCIATED MAIL RECEIVED

View All

Compose Case Mail

There are no mail for this case.



ALL ASSOCIATED TASKS

View All

Search Tasks

Create New Task

Complete

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 8 May 2018 1:43 PM
To: SUR; enquiry@sh-motor.com
Subject: SKA 1849B-DOA: 28/4/2018 (CHINA TAIPING OD)

Dear Doris,

As instructed by our client , please proceed to repair the insured vehicle **SKA 1849B on part by part (Excess \$1250/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

SKA1849B (SNM18D02196C01)

OD

Apr 28 2018 8:00AM

[LEE MUI HIANG]

S & H Motor Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on 08/05/2018 11:29 AM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$7362.50) - SKA1849B - Claim Handler: Chong Boon Sen

Approved:7362.50:PLEASE PROCEED TO AUTHORIZE REPAIRS AT \$7,362.50 BEFORE EXCESS OF \$1,250.00

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To:	China Taiping Insurance (Singapore) Pte. Ltd. 3 Anson Road #16-00 Springleaf Tower Singapore 079909	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn:	Chong Boon Sen	Date:	07 May 2018

Preliminary Advice

Vehicle No	: SKA1849B	Accident Date	: 28/04/2018
Make	: MERCEDES-BENZ C200	Policy No.	: DMPCSN3000211801
Assignment Date	: 03/05/2018	Excess	: S\$1,250.00
Date of Inspection	: 04/05/2018	Est. Duration of Repair	: 5.00
Inspection At	: S & H MOTOR PTE LTD (SIN MING) 160 SIN MING DRIVE #07-02, SIN MING AUTOCITY SINGAPORE 575722		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front r/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	8,973.90
Revised Amount	:S\$	5,567.50
Check Items (Estimated)	:S\$	1,795.00
Total	:S\$	7,362.50
Lump Sum Repair	:S\$	
Total Loss Consideration		
New for Old Value	:S\$	
Pre-Accident Value	:S\$	62,000.00
COE / PARF Rebate	:S\$	39,528.00
Salvage Value	:S\$	
Margin for Repair	:S\$	22,472.00

Brake System : In Order
Steering System : In Order
Tyre Condition (Front) : 6/6 mm
Tyre Condition (Rear) : 5/5 mm

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	8875Z
Vehicle Details	
Vehicle No.:	SKA1B49B
Vehicle to be Exported:	No
Intended De-registration Date:	07 May 2018
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	C 200 CGI
Primary Colour:	Grey
Manufacturing Year:	2010
Engine No.:	27186030161525
Chassis No.:	WDD2040482A473956
Maximum Power Output:	135.0 kW (181 bhp)
Open Market Value:	\$45,292.00
Original Registration Date:	26 Jan 2011
First Registration Date:	26 Jan 2011
Transfer Count:	1
Actual ARF Paid:	\$45,292.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	25 Jan 2021
PARF Rebate Amount:	\$27,175.00
Intended COE Rebate Details	
COE Expiry Date:	25 Jan 2021
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$46,001.00
COE Rebate Amount:	\$12,353.00
Total Rebate Amount:	\$39,528.00

The information contained herein is correct as at 07 May 2018

OK

Enquire Transfer Fee

Vehicle Details

Vehicle No.:	5KA1849B
Vehicle Type:	P10 - Passenger Motor Car
Vehicle Attachment 1:	No Attachment
Vehicle Scheme:	Normal
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	C 200 CGI
Chassis No.:	WDD2040482A473956
Propellant:	Petrol
Engine No.:	27186030161525
Engine Capacity:	1796 cc
Maximum Power Output:	135.0 kW (181 bhp)
Maximum Laden Weight:	2010 kg
Unladen Weight:	1505 kg
Year Of Manufacture:	2010
Original Registration Date:	26 Jan 2011
Lifespan Expiry Date:	-
COE Category:	E - Open Category
Quota Premium:	\$46,001.00
COE Expiry Date:	25 Jan 2021
Road Tax Expiry Date:	25 Jan 2019
PARF Eligibility Expiry Date:	25 Jan 2021
Inspection Due Date:	25 Jan 2020
Intended Transfer Date:	30 Apr 2018
CO2 Emission:	-
CO Emission:	-
HC Emission:	-
NOx Emission:	-
PM Emission:	-

Late renewal fee(s) will be imposed if road tax / lay up has expired. Please use Enquire Road Tax Payable for fee(s) payable.

Road tax, including Over Payment (if any), of a vehicle will follow the vehicle to the new registered owner when its ownership is being transferred.

Amount Payable

	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Transfer Fee:	25.00	-	25.00
Total Amount Payable:			25.00

You may print this page for reference.

OK

Print

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	28/04/2018 16:02
Date Of Accident	28/04/2018 08:20
Exact Location Of Accident	T-JUNCTION OF MARYMOUNT LANE TO UPP THOMSON RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKA1849B
Insured/Policyholder	
Name Of Registered Owner	LEE MUI HIANG
NRIC No	S7248875Z
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-92378446
Alternative Phone No	OFFICE-92378446

Vehicle Particulars

Manufacturer	MERCEDES-BENZ
Model	-

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN3000211801
Cover Note Number	

Driver

Name of Driver	CHO CHONG HUA
NRIC No	S7219621Z
Date Of Birth	09/06/1972
Occupation	INDOOR
Date Of Driving Pass	29/04/1998
Driving Experience	19 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-92378446
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address -
 Postcode -
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured SPOUSE
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

refer attached report.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SJW5765D
 Vehicle Make/Model/Colour
 Details Of Properties
 Vehicle Category PRIVATE CAR
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all Insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or Agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

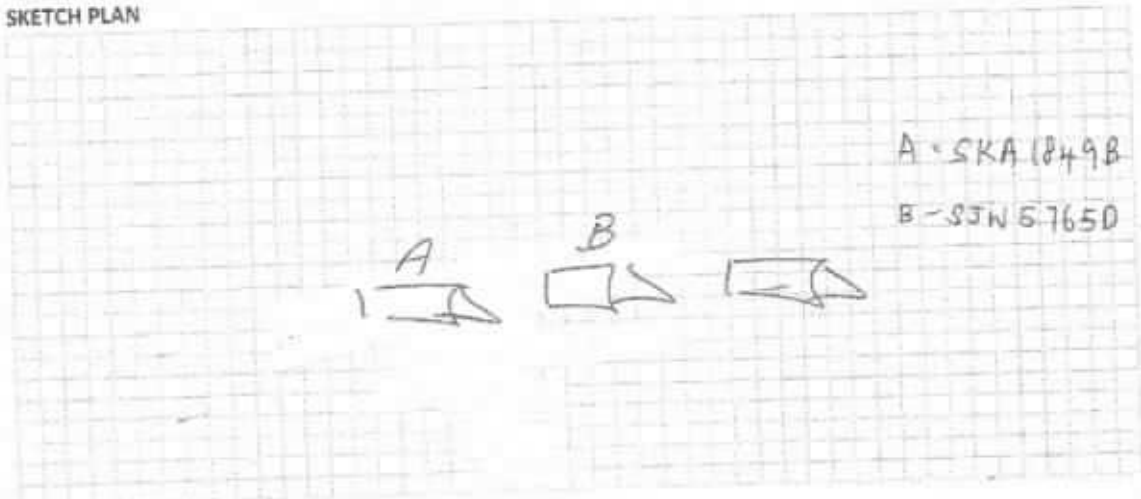

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was driving along T junction of Marymount Lane heading towards Upper Thomson Rd. The front vehicle B stopped abruptly but I could not stop in time and accidentally hit onto his car's rear portion. Fortunately no injury to both parties.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

S & H Motor Pte Ltd
Blk 106 Sin Ming Drive
#07-02
Sin Ming Autocity
Singapore 575722

Claim Reference:
Assessment Number: SH000219
Version: S&HMOTOR/1
Date Calculated: 03/05/2018 04:49

Full Report - V1
Registration: SKA1849B
Printed: 03/05/2018 11:49

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SH Motor	Date of Incident:	28/04/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	DMPCSN3000211801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 CGI BE
Model Sheet Number:	304 26
Registration:	SKA1849B
Registration Month:	
Registration Year:	
VIN Number:	WDD2040482A473956
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FR A395./F500./R131.	MODEL 2011
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:

Steering: LKK Auto Consultants hence notify the Repairer of the following:
Brakes Pedal Travel: To resurvey before/after spray painting
Place of Inspection: To display damaged part(s) during resurvey
Pre-Accident Damage: Parts prices are subject to confirmation
Tyres Condition: * Third party survey is on a "Without Prejudice" basis
Tread Depth LHF: * No illegal modification(s) is allowed
Tread Depth LHR: * Supplementary item(s) must be resurveyed and related to final approval from Insurance Company
Damage Areas: Acknowledged by Repairer

Signature:

Date:

Severity of Impact:

Vehicle Status on

Inspection:

Date of Inspection: 03/05/2018

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

Not Authorised
Resurvey by pain
Ex 812501
5 days
Fax: 62564315

Claim Reference:

Assessment Number: SH000219



Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

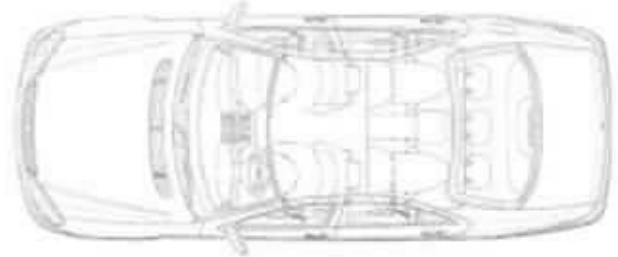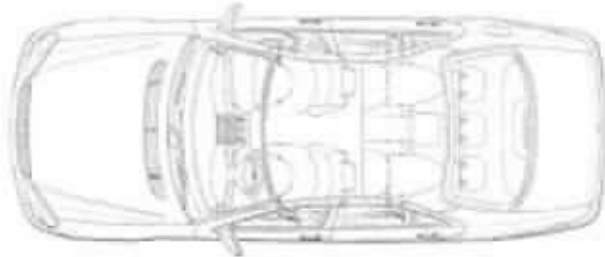

Addresses

Cost Summary

Total Labour	\$1,476.60
Total Paint/Material	\$232.30
Total Parts	\$6,980.00
Total of Additional Costs	\$285.00
Excess:	TBA
Grand Total Exc GST:	\$8,973.90
7 % GST:	\$628.17
Grand Total Inc GST:	\$9,602.07

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR

Price/Dent = \$46.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
40-6500 01	VEHICLE FRONT AND REAR ALIGNMENT WITHOUT ADJUSTMENT	7.0	32.20
40-6710 01	ADD/WORK FOR VEHICLE WITH BOARDING-/EXITING SUPPORT	1.0	4.60
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL,	9.0	41.40
88-1105 02	ADJUST FRONT FOG LAMPS DIS + ASS FRONT BUMPER (BUMPER REMOVED)	6.0	27.60
88-1358 01	AFTER CHECK: RENEW PARTS IF NECESSARY ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED)	3.0	13.80
88-2506 01	(VEHICLE WITH LUXURY EQUIPMENT) RENEW BONNET INCLUDES: R + R BONNET, CONVERT ALL PARTS	11.0	50.60
82-4790 01)	RENEW L/F LAMP UNIT (DET/REFIT BUMPER)	3.0	13.80
88-9663 01	R + R L/F WING MOULDING	3.0	13.80
88-3814 01	R + R L/F WING (FRONT BUMPER REMOVED)	7.0	32.20
88-3816 01)	RENEW L/F WING (REMOVED)	2.0	9.20

S & H Motor Pte Ltd

Claim Reference:

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

88-3511 01	FIT L/WING BADGE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE	12.0	55.20
	INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION		
62-1301 01	R + R L/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
40-1580 01	R + R FRONT WHEEL (WHEELS)	3.0	13.80
42-2706 01)	R + R L/F BRAKE PADS	3.0	13.80
42-2731 01)	R + R LEFT FRONT BRAKE DISC (BRAKE PADS REMOVED)	3.0	13.80
33-2380 01)	R + R FRONT WHEEL HUB ADD/WORK	3.0	13.80
33-2280 01)	R + R LEFT FRONT WHEEL HUB	3.0	13.80
33-2995 02	R + R LEFT FRONT WHEEL BEARING	6.0	27.60
33-5156 02)	R + R LEFT FRONT STEERING KNUCKLE (FRONT WHEEL HUB REMOVED)	9.0	41.40
33-1421 02)	R + R L/F AXLE TENSION ROD (WHEEL REM)	12.0	55.20
33-1405 01	R + R LEFT FRONT CONTROL ARM	5.0	23.00
0258	REMOVE AND REFIT FRT NO PLATE REINF	1.0*	4.60 X
0305	REMOVE AND REFIT FRONT BUMPER GRILLE	2.0*	9.20
0481	REMOVE AND REFIT BONNET INSULATION	2.0*	9.20 ✓
0638	REMOVE AND REFIT R/F FOG LAMP	2.0*	9.20 X
9973	KN TEST DRIVE	5.0*	23.00 7
0930	REPAIR CTR FRT REINF	10.0*	46.00 7
1111	REPAIR L/F WHEELHOUSE ASSY	20.0*	92.00 7
1155	REPAIR L/UPP W-HOUSE S-MEMB	30.0*	138.00 7
1283	REPAIR L/F C-MEMBER BRACKET	10.0*	46.00 7

LABOUR COST

Total Work Units	219.0	
Panel / Mechanical Labour	21.1HRS	\$970.60
Visual Alignment Labour	0.8HRS	\$36.80
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	21.9HRS	\$1,007.40
Paint Labour	10.2HRS	\$469.20
Total Labour	32.1HRS	\$1,476.60

PAINT WORK

Guide Number	Description	Time Basis 10 WU = 1 HR. Price = \$46.00/HR	WU	Cost Price (\$)
	- TWO COAT METALLIC			
	- PREPARE OFF VEHICLE			
471	BONNET NEW PART PAINTING		28.0	
741	L/F WING NEW PART PAINTING		9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R		10.0	
361	L/F OUTER SENSOR NEW PART PAINT K1R		3.0	
365	L/F INNER SENSOR NEW PART PAINT K1R		3.0	
742	R/F WING SURFACE PAINT		5.0	
1111	L/F WHEELHOUSE ASSY SURFACE PAINT		7.0	
1481	LEFT FRONT DOOR SURFACE PAINT		7.0	

LABOUR COST - PAINT

S & H Motor Pte Ltd

Claim Reference:

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

TIME(PAINT)	72.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	102.0	
Total Paintwork Labour	10.2HRS	\$469.20
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$108.36
New Part Painting - Plastic K1R		\$45.26
Material-Constant Main Work Metal		\$28.60
Surface-/Blend Paint		\$41.08
Material-Const Main Work Plastic		\$9.00
Total Excluding Pearlescent Uplift		\$232.30
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$232.30

PARTS

				Price Valid: 01/06/2015		
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER COVER 3	204 880 0940 9999	CM	0%	950.00*
303	1	L/F BUMPER COVER 7	204 885 2223		0%	80.00*
311	1	L/F BUMPER MOULDING 8	204 885 0721		0%	80.00*
312	1	R/F BUMPER MOULDING 26	204 885 0821		0%	80.00*
349	1	FRT/CTR IMPACT DAMP 6	204 885 0037		0%	115.00*
350	1	FRT BUMPER CLAMP KIT 5	USE SINGLE PARTS		0%	35.00*
361	1	L/F OUTER SENSOR 11	000 905 2402		0%	180.00*
365	1	L/F INNER SENSOR 10	000 905 2402		0%	180.00*
405	1	FRONT GRILLE 5	204 880 0023 9744		0%	430.00*
431	1	BADGE 1	204 817 0616		0%	80.00*
471	1	BONNET 2	204 880 1057 64		0%	1,080.00*
507	1	L/SPRING ELEMENT 20	204 880 0227		0%	10.00*
508	1	R/SPRING ELEMENT 27	204 880 0227		0%	10.00*
561	1	LEFT HEADLAMP ASSY 25	204 906 5303		0%	650.00*
577	1	L/HEADLAMP COVER 23	204 826 1324		0%	165.00*
637	1	L/F FOG LAMP 1	251 820 0756		0%	190.00*
741	1	L/F WING 19	204 880 1318		0%	580.00*
765	1	L/F RAIL 12	204 881 0106		0%	30.00*
785	1	L/F WING MOULDING 21	204 690 3162		0%	40.00*
789	1	L/F WING CLAMP KIT 21	USE SINGLE PARTS		0%	25.00*
811	1	L/F WING BADGE 20	204 817 7220		0%	55.00*
839	1	L/F W-HOUSE CVR FRT 18	204 690 5730		0%	135.00*
1001	1	FRT LWR CROSSMEMBER 6	207 620 1600		0%	280.00*
1179	1	L/F UPP REINF 16	204 620 0991		0%	190.00*
7047	1	L/F UPP CONTROL ARM 16	204 330 4311		0%	270.00*
7071	1	L/F STRUT 16	204 330 6711		0%	290.00*
7081	1	L/F STEERING KNUCKLE 13	204 332 0101		0%	480.00*
7121	1	L/F WHEEL BRG SET 17	203 330 0051		0%	290.00*
f: OEM Parts			Sub Total			\$6,980.00
g: Original			Total Parts			\$6,980.00
h: Secondhand			KK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey			
p: Parallel						
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

S & H Motor Pte Ltd

Claim Reference:

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V1

Registration: SKA1849B

Printed: 03/05/2018 11:49

Description	Betterment	Price
WHEEL ALIGNMENT SPECIALIST	0%	\$65.00
ELECTRICAL WORK SPECIALIST		\$40.00
ECU DIAGNOSTIC SPECIALIST	0%	\$180.00
Total Extras		\$285.00

Final Calculation

Total Parts **\$6,980.00**

Labour

Total Panel/Mechanical	\$970.60	736	391
Total Paintwork	\$469.20	✓	455.40
Total Visual Alignment work	\$36.80	✓	

Total Labour

\$1,476.60

Additional Costs

Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$285.00

Total of Additional Costs

\$285.00

Total Paint/Material Costs

\$232.30

Grand Total Excludes GST

\$8,973.90

GST @ 7 %

\$628.17

Grand Total Includes GST

\$9,602.07

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore

408933

Revert

Claim Reference: SNM18D02196C01
Assessment Number: SH000219
Version: CHINATAI/2
Date Calculated: 07/05/2018 04:44

Full Report - V1
Registration: SKA1849B
Printed: 07/05/2018 11:44

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	28/04/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM18D02196C01	Estimated Repair Time:	
Policy Number:	DMPCSN3000211801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 CGI BE
Model Sheet Number:	304 26
Registration:	SKA1849B
Registration Month:	
Registration Year:	
VIN Number:	WDD2040482A473956
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%



Model Specs

FR A395./F500./R131.	MODEL 2011
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
	Date of Inspection:
Brakes Pedal Travel:	03/05/2018
Place of Inspection:	
Pre-Accident Damage:	
Tyres Condition:	Tread Depth RHF:
Tread Depth LHF:	Tread Depth RHR:
Tread Depth LHR:	Direction of Impact:
Damage Areas:	

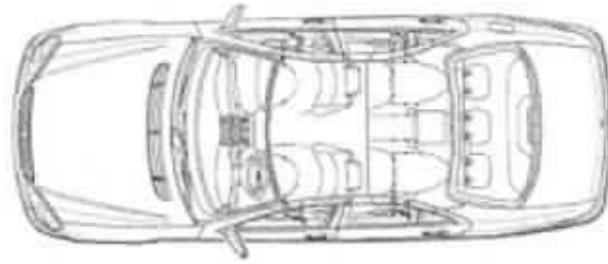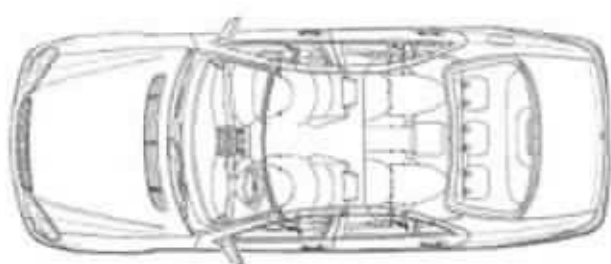

Addresses

Cost Summary

Total Labour	\$1,205.20
Total Paint/Material	\$232.30
Total Parts	\$5,640.00
Total of Additional Costs	\$285.00
Repair Cost Exc GST:	\$7,362.50
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,250.00
After Deduction -	
Grand Total Exc GST:	\$6,112.50
7 % GST:	\$427.88
Grand Total Inc GST:	\$6,540.38

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
 Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED)	6.0	27.60
88-1358 01	AFTER CHECK: RENEW PARTS IF NECESSARY ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
88-2506 01	RENEW BONNET INCLUDES: R + R BONNET, CONVERT ALL PARTS	11.0	50.60
82-4790 01)	RENEW L/F LAMP UNIT (DET/REFIT BUMPER)	3.0	13.80
88-9663 01	R + R L/F WING MOULDING	3.0	13.80
88-3814 01	R + R L/F WING (FRONT BUMPER REMOVED)	7.0	32.20
88-3816 01)	RENEW L/F WING (REMOVED)	2.0	9.20
88-3511 01	FIT L/WING BADGE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN	12.0	55.20

	THE REPAIR SECTION		
62-1301 01	R + R L/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
0305	REMOVE AND REFIT FRONT BUMPER GRILLE	1.0*	4.60
0481	REMOVE AND REFIT BONNET INSULATION	2.0*	9.20
9973	KN TEST DRIVE	5.0*	23.00
0930	REPAIR CTR FRT REINF	10.0*	46.00
1111	REPAIR L/F WHEELHOUSE ASSY	20.0*	92.00
1155	REPAIR L/UPP W-HOUSE S-MEMB	30.0*	138.00
1283	REPAIR L/F C-MEMBER BRACKET	10.0*	46.00
LABOUR COST			
	Total Work Units	160.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	16.0HRS	\$736.00
	Paint Labour	10.2HRS	\$469.20
	Total Labour	26.2HRS	\$1,205.20

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
741	L/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
361	L/F OUTER SENSOR NEW PART PAINT K1R	3.0	
365	L/F INNER SENSOR NEW PART PAINT K1R	3.0	
742	R/F WING SURFACE PAINT	5.0	
1111	L/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
1481	LEFT FRONT DOOR SURFACE PAINT	7.0	
LABOUR COST - PAINT			
	TIME(PAINT)	72.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	102.0	
	Total Paintwork Labour	10.2HRS	\$469.20
MATERIAL COST - PAINT			
	New Part Painting		\$108.36
	New Part Painting - Plastic K1R		\$45.26
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$41.08
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$232.30
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$232.30

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
431	1	BADGE	204 817 0616			0%	80.00*

471	1	BONNET	204 880 1057 64	0%	1,080.00*
283	1	FRONT BUMPER COVER	204 880 0940 9999	0%	950.00*
405	1	FRONT GRILLE	204 880 0023 9744	0%	430.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS	0%	35.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600	0%	280.00*
349	1	FRT/CTR IMPACT DAMP	204 885 0037	0%	115.00*
303	1	L/F BUMPER COVER	204 885 2223	0%	80.00*
311	1	L/F BUMPER MOULDING	204 885 0721	0%	80.00*
637	1	L/F FOG LAMP	251 820 0756	0%	190.00*
365	1	L/F INNER SENSOR	000 905 2402	0%	180.00*
361	1	L/F OUTER SENSOR	000 905 2402	0%	180.00*
765	1	L/F RAIL	204 881 0106	0%	30.00*
1179	1	L/F UPP REINF	204 620 0991	0%	190.00*
839	1	L/F W-HOUSE CVR FRT	204 690 5730	0%	135.00*
741	1	L/F WING	204 880 1318	0%	580.00*
811	1	L/F WING BADGE	204 817 7220	0%	55.00*
789	1	L/F WING CLAMP KIT	USE SINGLE PARTS	0%	25.00*
785	1	L/F WING MOULDING	204 690 3162	0%	40.00*
577	1	L/HEADLAMP COVER	204 826 1324	0%	165.00*
561	1	LEFT HEADLAMP ASSY	204 906 5303	0%	650.00*
312	1	R/F BUMPER MOULDING	204 885 0821	0%	80.00*
508	1	R/SPRING ELEMENT	204 880 0227	0%	10.00*
f: OEM Parts				Sub Total	\$5,640.00
g: Original				Total Parts	\$5,640.00
h: Secondhand					
p: Parallel					
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
WHEEL ALIGNMENT SPECIALIST	0%	\$65.00
ELECTRICAL WORK SPECIALIST		\$40.00
ECU DIAGNOSTIC SPECIALIST	0%	\$180.00
Total Extras		\$285.00

Final Calculation

Total Parts	\$5,640.00
Labour	
Total Panel/Mechanical	\$736.00
Total Paintwork	\$469.20
Total Labour	\$1,205.20
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$285.00
Total of Additional Costs	\$285.00
Total Paint/Material Costs	\$232.30
Repair Costs Excludes GST	\$7,362.50
Deductions	
Deduction for Excess (Fixed)	-\$1,250.00
Total Deductions	-\$1,250.00
Grand Total Excludes GST (After Deduction)	\$6,112.50

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D02196C01

Full Report - V1

Assessment Number: SH000219

Registration: SKA1849B

Version: CHINATAI/2

Printed: 07/05/2018 11:44

Date Calculated: 07/05/2018 04:44

GST @ 7 %

\$427.88

Grand Total Includes GST (After Deduction)

\$6,540.38

Assessment Notes

S & H Motor Pte Ltd
Blk 106 Sin Ming Drive
#07-02

Sin Ming Autocity
Singapore 575722

Repairer

Claim Reference:
Assessment Number: SH000219
Version: S&HMOTOR/1
Date Calculated: 03/05/2018 04:49

Full Report - V1
Registration: SKA1849B
Printed: 03/05/2018 11:49

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SH Motor	Date of Incident:	28/04/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	DMPCSN3000211801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 CGI BE
Model Sheet Number:	304 26
Registration:	SKA1849B
Registration Month:	
Registration Year:	
VIN Number:	WDD2040482A473956
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FR A395./F500./R131.	MODEL 2011
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
	Date of Inspection: 03/05/2018
Brakes Pedal Travel:	
Place of Inspection:	
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

Not Withheld

Running B4 point

Ex 812501

5 days

5/5/18 Fax: 62564313

Claim Reference:

Assessment Number: SH000219



Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V:

Registration: SKA18491

Printed: 03/05/2018 11:49

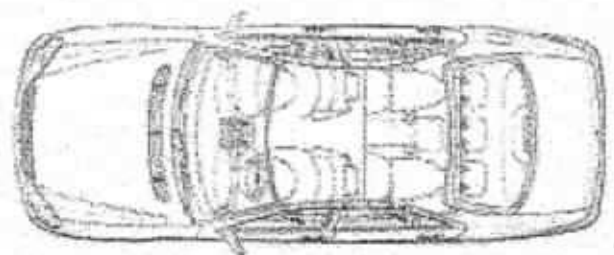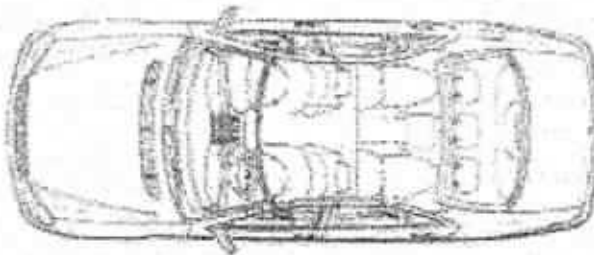

Addresses

Cost Summary

Total Labour	\$1,476.60
Total Paint/Material	\$232.30
Total Parts	\$6,980.00
Total of Additional Costs	\$285.00
Excess:	TBA
Grand Total Exc GST:	\$8,973.90
7 % GST:	\$628.17
Grand Total Inc GST:	\$9,602.07

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
40-6500 01	VEHICLE FRONT AND REAR ALIGNMENT WITHOUT ADJUSTMENT	7.0	32.20
40-6710 01	ADD/WORK FOR VEHICLE WITH BOARDING-/ EXITING SUPPORT	1.0	4.60
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
88-2506 01	RENEW BONNET INCLUDES: R + R BONNET, CONVERT ALL PARTS	11.0	50.60
82-4790 01)	RENEW L/F LAMP UNIT (DET/REFIT BUMPER)	3.0	13.80
88-9663 01	R + R L/F WING MOULDING	3.0	13.80
88-3814 01	R + R L/F WING (FRONT BUMPER REMOVED)	7.0	32.20
88-3816 01)	RENEW L/F WING (REMOVED)	2.0	9.20

S & H Motor Pte Ltd

Claim Reference:

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V:

Registration: SKA18491

Printed: 03/05/2018 11:49

88-3511 01	FIT L/WING BADGE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	12.0	55.20
62-1301 01	R + R L/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
40-1580 01	R + R FRONT WHEEL (WHEELS)	3.0	13.80
42-2706 01)	R + R L/F BRAKE PADS	3.0	13.80
42-2731 01)	R + R LEFT FRONT BRAKE DISC (BRAKE PADS REMOVED)	3.0	13.80
33-2380 01)	R + R FRONT WHEEL HUB ADD/WORK	3.0	13.80
33-2280 01)	R + R LEFT FRONT WHEEL HUB	3.0	13.80
33-2995 02	R + R LEFT FRONT WHEEL BEARING	6.0	27.60
33-5156 02)	R + R LEFT FRONT STEERING KNUCKLE (FRONT WHEEL HUB REMOVED)	9.0	41.40
33-1421 02)	R + R L/F AXLE TENSION ROD (WHEEL REM)	12.0	55.20
33-1405 01	R + R LEFT FRONT CONTROL ARM	5.0	23.00
0258	REMOVE AND REFIT FRT NO PLATE REINF	1.0*	4.60
0305	REMOVE AND REFIT FRONT BUMPER GRILLE	2.0*	9.20
0481	REMOVE AND REFIT BONNET INSULATION	2.0*	9.20
0638	REMOVE AND REFIT R/F FOG LAMP	2.0*	9.20
9973	KN TEST DRIVE	5.0*	23.00
0930	REPAIR CTR FRT REINF	10.0*	46.00
1111	REPAIR L/F WHEELHOUSE ASSY	20.0*	92.00
1155	REPAIR L/UPP W-HOUSE S-MEMB	30.0*	138.00
1283	REPAIR L/F C-MEMBER BRACKET	10.0*	46.00

LABOUR COST

Total Work Units	219.0	
Panel / Mechanical Labour	21.1HRS	\$970.60
Visual Alignment Labour	0.8HRS	\$36.80
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	21.9HRS	\$1,007.40
Paint Labour	10.2HRS	\$469.20
Total Labour	32.1HRS	\$1,476.60

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
741	L/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
361	L/F OUTER SENSOR NEW PART PAINT K1R	3.0	
365	L/F INNER SENSOR NEW PART PAINT K1R	3.0	
742	R/F WING SURFACE PAINT	5.0	
1111	L/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
1481	LEFT FRONT DOOR SURFACE PAINT	7.0	

LABOUR COST - PAINT

Claim Reference:

S & H Motor Pte Ltd

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V:

Registration: SKA1849E

Printed: 03/05/2018 11:49

TIME(PAINT)	
Preparation Main Work Plastic	72.0
Preparation Main Work Metal	5.0
Preparation Work Multi Layer Paint	25.0
Total Work Units (10WU/HR)	0.0
Total Paintwork Labour	102.0
MATERIAL COST - PAINT	10.2HRS
New Part Painting	\$469.20
New Part Painting - Plastic K1R	Cost Price
Material-Constant Main Work Metal	\$108.36
Surface-/Blend Paint	\$45.26
Material-Const Main Work Plastic	\$28.60
Total Excluding Pearlescent Uplift	\$41.08
Pearlescent Uplift @ 0.0%	\$9.00
Total Paint Material Cost	\$232.30
	\$0.00
	\$232.30

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
283	1	FRONT BUMPER COVER	204 880 0940 9999	CM	0%		950.00*
303	1	L/F BUMPER COVER	204 885 2223		0%	011	80.00*
311	1	L/F BUMPER MOULDING	204 885 0721		0%	~	80.00*
312	1	R/F BUMPER MOULDING	204 885 0821		0%	~	80.00*
349	1	FRT/CTR IMPACT DAMP	204 885 0037		0%	~	115.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	~	35.00*
361	1	L/F OUTER SENSOR	000 905 2402		0%	Scr	180.00*
365	1	L/F INNER SENSOR	000 905 2402		0%		180.00*
405	1	FRONT GRILLE	204 880 0023 9744		0%		430.00*
431	1	BADGE	204 817 0616		0%		80.00*
471	1	BONNET	204 880 1057 64		0%	B	1,080.00*
507	1	L/SPRING ELEMENT	204 880 0227		0%	~	10.00*
508	1	R/SPRING ELEMENT	204 880 0227		0%	~	10.00*
561	1	LEFT HEADLAMP ASSY	204 906 5303		0%	CM	650.00*
577	1	L/HEADLAMP COVER	204 826 1324		0%		165.00*
637	1	L/F FOG LAMP	251 820 0756		0%		190.00*
741	1	L/F WING	204 880 1318		0%	~	580.00*
765	1	L/F RAIL	204 881 0106		0%		30.00*
785	1	L/F WING MOULDING	204 690 3162		0%	~	40.00*
789	1	L/F WING CLAMP KIT	USE SINGLE PARTS		0%	~	25.00*
811	1	L/F WING BADGE	204 817 7220		0%	~	55.00*
839	1	L/F W-HOUSE CVR FRT	204 690 5730		0%		135.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600		0%		280.00*
1179	1	L/F UPP REINF	204 620 0991		0%		190.00*
7047	1	L/F UPP CONTROL ARM	204 330 4311		0%	~	270.00*
7071	1	L/F STRUT	204 330 6711		0%	~	290.00*
7081	1	L/F STEERING KNUCKLE	204 332 0101		0%	~	480.00*
7121	1	L/F WHEEL BRG SET	203 330 0051		0%	~	290.00*
f: OEM Parts			Sub Total				\$6,980.00
g: Original			Total Parts				\$6,980.00
h: Secondhand							
p: Parallel							
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Claim Reference:

S & H Motor Pte Ltd

Assessment Number: SH000219

Version: S&HMOTOR/1

Date Calculated: 03/05/2018 04:49

Full Report - V

Registration: SKA18491

Printed: 03/05/2018 11:41

Description	Betterment	Price
WHEEL ALIGNMENT	0%	\$65.00
ELECTRICAL WORK	0%	\$40.00
ECU DIAGNOSTIC	0%	\$180.00
SPECIALIST		
SPECIALIST		
SPECIALIST		
Total Extras		\$285.00

Final Calculation

Total Parts

Labour

Total Panel/Mechanical \$6,980.00

Total Paintwork \$970.60

Total Visual Alignment work \$469.20

\$36.80

Total Labour

Additional Costs

\$1,476.60

Corr Prot Materials External

Corr Prot Materials Internal \$0.00

Cost of Specialist \$0.00

\$285.00

Total of Additional Costs

Total Paint/Material Costs

\$285.00

Grand Total Excludes GST

\$232.30

GST @ 7 %

\$8,973.90

Grand Total Includes GST

\$628.17

\$9,602.07

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

finalised

Claim Reference: SNM18D02196C01
Assessment Number: SH000219
Version: LKKAUTOC/2
Date Calculated: 27/07/2018 07:55

Full Report - V1
Registration: SKA1849B
Printed: 27/07/2018 14:55

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	28/04/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM18D02196C01	Estimated Repair Time:	
Policy Number:	DMPCSN3000211801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C Class
Sub Model:	C 200 CGI BE
Model Sheet Number:	304 26
Registration:	SKA1849B
Registration Month:	
Registration Year:	
VIN Number:	WDD2040482A473956
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%



Model Specs

FR A395./F500./R131.	MODEL 2011
RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD
LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	DRIVER SEAT MEMORY
L/F SEAT WITH MEMORY	STRG WHEEL LEATHER
LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED
PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
SPARE WHEEL	PARKTRONIC SYSTEM
RIGHT HAND DRIVE	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	03/05/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

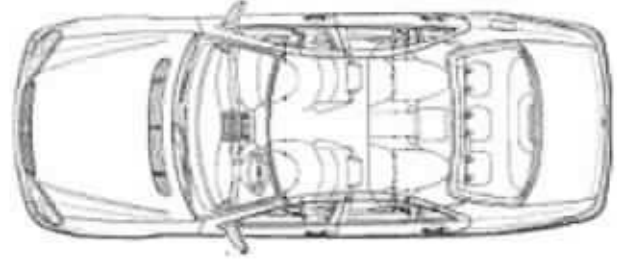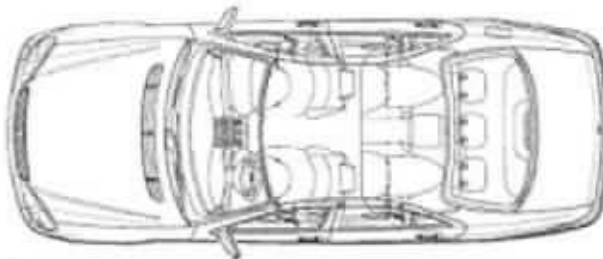

Addresses

Cost Summary

Total Labour	\$846.40
Total Paint/Material	\$231.81
Total Parts	\$5,275.00
Total of Additional Costs	\$285.00
Repair Cost Exc GST:	\$6,638.21
Overall Discount (0.0%):	- \$0.00
Excess:	-\$1,250.00
After Deduction -	
Grand Total Exc GST:	\$5,388.21
7 % GST:	\$377.17
Grand Total Inc GST:	\$5,765.38

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR

Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	41.40
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	27.60
88-1358 01	ADD TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING SYSTEM)	3.0	13.80
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	13.80
88-2506 01	RENEW BONNET INCLUDES: R + R BONNET, CONVERT ALL PARTS	11.0	50.60
82-4790 01)	RENEW L/F LAMP UNIT (DET/REFIT BUMPER)	3.0	13.80
88-9663 01	R + R L/F WING MOULDING	3.0	13.80
88-3814 01	R + R L/F WING (FRONT BUMPER REMOVED)	7.0	32.20
88-3816 01)	RENEW L/F WING (REMOVED)	2.0	9.20
88-3511 01	FIT L/WING BADGE	3.0	13.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN	12.0	55.20

THE REPAIR SECTION			
62-1301 01	R + R L/F TRUSSING BETWEEN WHEELHOUSES	7.0	32.20
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	59.80
0305	REMOVE AND REFIT FRONT BUMPER GRILLE	1.0*	4.60
0481	REMOVE AND REFIT BONNET INSULATION	2.0*	9.20
LABOUR COST			
	Total Work Units	85.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	8.5HRS	\$391.00
	Paint Labour	9.9HRS	\$455.40
	Total Labour	18.4HRS	\$846.40

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$46.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	28.0	
741	L/F WING NEW PART PAINTING	9.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
361	L/F OUTER SENSOR NEW PART PAINT K1R	3.0	
742	R/F WING SURFACE PAINT	5.0	
1111	L/F WHEELHOUSE ASSY SURFACE PAINT	7.0	
1481	LEFT FRONT DOOR SURFACE PAINT	7.0	
LABOUR COST - PAINT			
	TIME(PAINT)	69.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	99.0	
	Total Paintwork Labour	9.9HRS	\$455.40
MATERIAL COST - PAINT			
	New Part Painting		\$108.36
	New Part Painting - Plastic K1R		\$44.77
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$41.08
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$231.81
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$231.81

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Price (\$)
431	1	BADGE	204 817 0616		80.00*
471	1	BONNET	204 880 1057 64		1,080.00*
283	1	FRONT BUMPER COVER	204 880 0940 9999		950.00*
405	1	FRONT GRILLE	204 880 0023 9744		430.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		35.00*
1001	1	FRT LWR CROSSMEMBER	207 620 1600		280.00*
349	1	FRT/CTR IMPACT DAMP	204 885 0037		115.00*

303	1	L/F BUMPER COVER	204 885 2223	0%	80.00*
311	1	L/F BUMPER MOULDING	204 885 0721	0%	80.00*
637	1	L/F FOG LAMP	251 820 0756	0%	190.00*
361	1	L/F OUTER SENSOR	000 905 2402	0%	180.00*
1179	1	L/F UPP REINF	204 620 0991	0%	190.00*
839	1	L/F W-HOUSE CVR FRT	204 690 5730	0%	135.00*
741	1	L/F WING	204 880 1318	0%	580.00*
811	1	L/F WING BADGE	204 817 7220	0%	55.00*
789	1	L/F WING CLAMP KIT	USE SINGLE PARTS	0%	25.00*
785	1	L/F WING MOULDING	204 690 3162	0%	40.00*
507	1	L/SPRING ELEMENT	204 880 0227	0%	10.00*
561	1	LEFT HEADLAMP ASSY	204 906 5303	0%	650.00*
312	1	R/F BUMPER MOULDING	204 885 0821	0%	80.00*
508	1	R/SPRING ELEMENT	204 880 0227	0%	10.00*

f: OEM Parts

Sub Total

\$5,275.00

g: Original

Total Parts

\$5,275.00

h: Secondhand

p: Parallel

x: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
WHEEL ALIGNMENT SPECIALIST	0%	\$65.00
ELECTRICAL WORK SPECIALIST		\$40.00
ECU DIAGNOSTIC SPECIALIST	0%	\$180.00
Total Extras		\$285.00

Final Calculation

Total Parts	\$5,275.00
Labour	
Total Panel/Mechanical	\$391.00
Total Paintwork	\$455.40
Total Labour	\$846.40
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$285.00
Total of Additional Costs	\$285.00
Total Paint/Material Costs	\$231.81
Repair Costs Excludes GST	\$6,638.21
Deductions	
Deduction for Excess (Fixed)	-\$1,250.00
Total Deductions	-\$1,250.00
Grand Total Excludes GST (After Deduction)	\$5,388.21
GST @ 7 %	\$377.17
Grand Total Includes GST (After Deduction)	\$5,765.38

Assessment Notes

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D02196C01

Full Report - V1

Assessment Number: SH000219

Registration: SKA1849B

Version: LKKAUTOC/2

Printed: 27/07/2018 14:55

Date Calculated: 27/07/2018 07:55

Veron Chen (LKKAuto)

From: Doris <doris@sh-motor.com>
Sent: Saturday, 28 July 2018 5:33 PM
To: Veron Chen (LKKAuto)
Subject: RE: vehicle no : SKA1849B-Final

Dear Veron

Noted...Thank...lump sum repair S\$5,300.00

Please arrange in merimein

Thank

Doris

From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Friday, 27 July 2018 3:11 PM
To: Doris; SUR
Cc: Kenneth Kong (LKKAuto)
Subject: RE: vehicle no : SKA1849B-Final

Dear Doris,

Offer Lump Sum \$5300 before excess \$1250 @ 5 working days.

Kindly confirm.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Doris <doris@sh-motor.com>
Sent: Friday, 20 July 2018 12:46 PM
To: SUR <sur@lkkauto.com>
Cc: Kenneth Kong (LKKAuto) <KennethKong@lkkauto.com>
Subject: FW: vehicle no : SKA1849B-Final

Can final

From: Doris [mailto:doris@sh-motor.com]
Sent: Wednesday, 4 July 2018 10:45 AM
To: 'Kenneth Kong (LKKAuto)'
Subject: FW: vehicle no : SKA1849B-Final

Dear Kenneth

• Can final

Thank

Doris

From: Doris [<mailto:doris@sh-motor.com>]

Sent: Friday, 8 June 2018 5:45 PM

To: 'Kenneth Kong (LKKAUTO)'

Subject: vehicle no : SKA1849B-Final

Dear Kenneth

Forward vehicle no : SKA 1849 B for final lump sum cost

Thank

Doris

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	03 May 2018 Sendback Est	03 May 2018 12:15 \$48,973.90	03 May 2018 14:13 Edit Adj Rpt	\$55,300.00 Edit Estimates	\$55,300.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured: LEE MUI HIANG , ID: 572488752									
Vehicle Reg. No.: SKA1849B		Date of Loss: 28/04/2018 08:00 - :59 [87 Months and 2 Days From LTA Reg Date (Man Yr)]							
Claim Type: OD / SNM18D02196C01		Policy/Cover Note No.: DMPCSN3000211801 (Comprehensive)							
		Excess: S\$1,250.00							
Repairer: S & H Motor Pte Ltd (Sin Ming) 160 Sin Ming Drive #07-02, Sin Ming AutoCity, 575722 Sin Ming - Tel: 6453 4730									
Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 14/05/2018]									
Driver/Custodian: CHO CHONG HUA (45 / Male), NRIC: S7219621Z, Tel: +6592378446									
Adj Asg. Remarks: SURVEY REVERT									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
• CHINA_TAIPIING (08/05/2018): Alert - Adj Mandate Approved (\$7362.50) - SKA1849B - Claim Handler: Chong Boon ...									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SKA1849B (SNM18D02196C01)

OD

Apr 28 2018 8:00AM

[LEE MUI HIANG]

S & H Motor Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			View View in Browser		
Assessment Reports									1 per page		☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)							Thumbnail	Print	
1	28/04/18 16:38	Accident Statement								Load HTM	
2	03/05/18 12:15	Repairer Estimates								Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)							Thumbnail	Print	
1	07/05/18 12:02	Adjuster Immediate Advice								Load HTM	
Photos/Images									3 per page		☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)							Thumbnail	Print	
1	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
2	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
3	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
4	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
5	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
6	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
7	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
8	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
9	28/04/18 16:20	Accident Photo [Linked Accident Report Documents]								Load JPG	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)							Thumbnail	Print	
1	07/05/18 11:36	General View								Load PDF	
2	30/07/18 09:14	Reinspection Photo								Load PDF	
Documentation									1 per page		☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)							Thumbnail	Print	
1	28/04/18 16:32	Sketch Plan [Linked Accident Report Documents]								Load TIF	
2	28/04/18 16:32	Sketch Plan #2 [Linked Accident Report Documents]								Load TIF	
3	28/04/18 16:32	Sketch Plan #3 [Linked Accident Report Documents]								Load TIF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)							Thumbnail	Print	
1	07/05/18 11:36	MARK ESTIMATE								Load PDF	
2	07/05/18 12:03	AUDATEX								Load PDF	

Linked Accident Report Documents

					View View in Browser	
Assessment Reports					1 per page	☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)			Thumbnail	Print
1	28/04/18 16:38	Accident Statement			 Load HTM	
Photos/Images					3 per page	☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)			Thumbnail	Print

Assessment Reports				1 per page	☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)		Thumbnail	Print
1	28/04/18 16:20	Accident Photo		Load JPG	☒
2	28/04/18 16:20	Accident Photo		Load JPG	☒
3	28/04/18 16:20	Accident Photo		Load JPG	☒
4	28/04/18 16:20	Accident Photo		Load JPG	☒
5	28/04/18 16:20	Accident Photo		Load JPG	☒
6	28/04/18 16:20	Accident Photo		Load JPG	☒
7	28/04/18 16:20	Accident Photo		Load JPG	☒
8	28/04/18 16:20	Accident Photo		Load JPG	☒
9	28/04/18 16:20	Accident Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	S & H Motor Pte Ltd (Sin Ming)		Thumbnail	Print
1	28/04/18 16:32	Sketch Plan		Load TIF	
2	28/04/18 16:32	Sketch Plan #2		Load TIF	
3	28/04/18 16:32	Sketch Plan #3		Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CT118008111/KVBE2

Date: 10/08/2018

REFERENCE

Insured/Claimant: LEE MUI HIANG Policy No: DMPCSN3000211801
Date of Loss: 28/04/2018 Nature of Claim: OD Claim No: SNM18D02196C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKA1849B**
Make & Model: MERCEDES-BENZ C200, 1.8 (A) Engine No: 27186030161525
Reg. Date: 26/01/2011 (Man. Year: 2010) Chassis No: WDD2040482A473956
Colour: Metallic Grey Odometer: 115190 km
Engine Capacity: 1796 cc
Market Value/New Car Price: S\$62,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/45Z R17 Rear Tyre Size: 225/45Z R17
Front Left Side: Michelin 6 mm Rear Left Side: Michelin 5 mm
Front Right Side: Michelin 6 mm Rear Right Side: Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,980.00	5,275.00	1,705.00	24.43
Miscellaneous Items	285.00	285.00	0.00	0.00
Labour	1,708.90	1,078.21	630.69	36.91
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	8,973.90	6,638.21	2,335.69	26.03
Approved Total (Overridden) (S\$)		5,300.00		
- Excess (S\$)	0.00	1,250.00	-1,250.00	
(S\$)	8,973.90	4,050.00	4,923.90	54.87
+ GST 7.00/7.00% (S\$)	628.17	283.50	344.67	54.87
Nett Amount (S\$)	9,602.07	4,333.50	5,268.57	54.87

INSPECTION

Date of Assignment: 03/05/2018 Present Location: S & H Motor Pte Ltd (Sin Ming)
Date Inspected: 04/05/2018 Inspected At: 160 Sin Ming Drive #07-02, Sin Ming
AutoCity
Singapore 575722
Estimated Period of Repair: 5.0 days

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 10 Aug 2018)
Parts:	143	MERCEDES-BENZ C200 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKA1849B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BADGE	Necessary	80.00 F	*80.00 F
2	1	NA	*BONNET	Bent	1,080.00 F	*1,080.00 F
3	1	NA	*FRONT BUMPER COVER	Cracked	950.00 F	*950.00 F
4	1	NA	*FRONT GRILLE	Scratched	430.00 F	*430.00 F
5	1	NA	*FRT BUMPER CLAMP KIT	Necessary	35.00 F	*35.00 F
6	1	NA	*FRT LWR CROSSMEMBER	Bent	280.00 F	*280.00 F
7	1	NA	*FRT/CTR IMPACT DAMP	Distorted	115.00 F	*115.00 F
8	1	NA	*L/F BUMPER COVER	Distorted	80.00 F	*80.00 F
9	1	NA	*L/F BUMPER MOULDING	Necessary	80.00 F	*80.00 F
10	1	NA	*L/F FOG LAMP	MTG Cracked	190.00 F	*190.00 F
11	1	NA	*L/F INNER SENSOR	Serviceable	180.00 F	*- F
12	1	NA	*L/F OUTER SENSOR	Scratched	180.00 F	*180.00 F
13	1	NA	*L/F RAIL	Serviceable	30.00 F	*- F
14	1	NA	*L/F STEERING KNUCKLE	Serviceable	480.00 F	*- F
15	1	NA	*L/F STRUT	Serviceable	290.00 F	*- F
16	1	NA	*L/F UPP CONTROL ARM	Serviceable	270.00 F	*- F
17	1	NA	*L/F UPP REINF	Bent	190.00 F	*190.00 F
18	1	NA	*L/F WHEEL BRG SET	Not Necessary	290.00 F	*- F
19	1	NA	*L/F W-HOUSE CVR FRT	Cracked	135.00 F	*135.00 F
20	1	NA	*L/F WING	Buckled	580.00 F	*580.00 F
21	1	NA	*L/F WING BADGE	Necessary	55.00 F	*55.00 F
22	1	NA	*L/F WING CLAMP KIT	Necessary	25.00 F	*25.00 F
23	1	NA	*L/F WING MOULDING	Necessary	40.00 F	*40.00 F
24	1	NA	*L/HEADLAMP COVER	Serviceable	165.00 F	*- F
25	1	NA	*L/SPRING ELEMENT	Cracked	10.00 F	*10.00 F
26	1	NA	*LEFT HEADLAMP ASSY	Cracked	650.00 F	*650.00 F
27	1	NA	*R/F BUMPER MOULDING	Necessary	80.00 F	*80.00 F
28	1	NA	*R/SPRING ELEMENT	Missing	10.00 F	*10.00 F
29	1	NA	*SUNDRY PARTS (NPA)	Not Necessary	0.00 F	*- F

F=Franchise part

Total Parts (S\$)	6,980.00	5,275.00
--------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	ECU diagnostic	180.00	180.00
2	1	Electrical work	40.00	40.00
3	1	Wheel alignment	65.00	65.00
Sub Total (S\$)			285.00	285.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	Total Paint Labour	New	469.20	455.40
2	Total Paint Materials	New	232.30	231.81
3	Total Panel/Mechanical Labour	New	1,007.40	391.00
Gross Labour Cost (S\$)			1,708.90	1,078.21

Report was unsubmitted during this print-out.

< END OF ESTIMATES >